MINE INSPECTION REPORTS 2Q 2013

OAKTOWN FUELS #1, BLACK PANTHER

Inspection date(s): 04/04/13 Areas Inspected: Surface, belts, tunnels, shops, silos, plants 1 & 2 Findings/Law Violated:

- 1. ID for 2nd floor plant 2 start stop switch not marked. 30cfr 77.809
- 2. 3rd floor plant 2 fire extinguisher out of date. 30cfr 77.1110
- 3. Raw coal reclaim feeder #1& #3 in tunnel no ID. 30cfr 77.809
- 4. #2 raw coal silo head house needs cleaned. 30cfr 77. 202
- 5. O2 bottle in old shop/ warehouse needs a cover located at welder. 30cfr 77.208(e)
- 6. No tag on fire extinguishers one in draw off tunnel train load-out and one at train load-out control room.
- 7. Belly pan at train load out belt needs cleaned. 30cfr 77.202

Corrective action taken: All violations were noted by management and corrective action taken

RECOMMENDATIONS: Need to check on fire extinguishers near out of date at train loadout location

OAKTOWN FUELS #2, BLACK PANTHER

Inspection date(s): 04/18/13 Areas Inspected: Unit 1, belt, road Findings/Law Violated:

1. Life line at 5x cut missing a ball for door in intake 30cfr 75.380-7(vi) Corrective action taken: Violation was corrected RECOMMENDATIONS: Need for better curtain work

CARLISLE MINE, SUNRISE COAL COMPANY

Inspection date(s): 04/03/13 Areas Inspected: Surface, plant, shops, tunnels, belts Findings/Law Violated:

- 1. 1st floor of plant a guard was off a motor. 30cfr 77.400
- The start stop switch for a motor and a pump was not ID on the 1st & 2nd floor of the plant. 30cfr 77.809
- 3. Need to clean walk-way and structure for rotary breaker. 30cfr 77.202

Corrective action taken: All violations were noted by management and corrective action taken

RECOMMENDATIONS: None

Inspection date(s): 04/15/13 Areas Inspected: Unit 5, S3, S4, S5, S6, S7 Belts Findings/Law Violated:

1. No ball on life line at S7 15x cut and S2 135x cut. 30cfr 75.380-7(vi)

2. Fire extinguisher no tag at oil station. 30cfr 75.1100-3

Corrective action taken: All violations corrected

RECOMMENDATIONS: Need to work on belt at head of S6

Need to adjust roller for sprays at S7

Inspection date(s): 04/25/13

Areas Inspected: Unit 2, belt 2A, & intake

Findings/Law Violated:

1. Missing a ball on life line at 1x cut 3WA secondary escapeway. 30cfr 75.380-7(vi)

Corrective action taken: Citation was corrected

FRANCISCO MINE, BLACK BEAUTY COAL COMPANY

Inspection date(s): 04/09/13 Areas Inspected: Surface, shop, plant, belts, tunnels, train load-out Findings/Law Violated:

- 1. #7 heater on 1^{st} floor of plant has a hole in breaker box. 30cfr 77.505
- 2. Switch on 1st, 3rd, 4th, floor needs IDs, 30cfr 77.809
- 3. Belly pan for refuse collecting belt needs cleaned. 30cfr 77.202
- 4. 3rd floor of raw coal transfer has rotating shaft that needs a guard. 30cfr 77.400
- 5. No ID on switches at raw coal draw off tunnel. 30cfr 77.809
- 6. Stacker belt walk-way needs cleaned. 30cfr 77.205(b)

Corrective action taken: All violations were noted by management and corrective action taken

RECOMMENDATIONS: Replace bad rollers on silo belt

Inspection date(s): 04/23/13 Areas Inspected: Unit 1, belt 1NE Findings/Law Violated:

1. Bad roof bolt on unit 1 1xcut outby face in 00 entry. 30cfr 75.202(a) Corrective action taken: Citation was corrected

FREELANDVILLE WEST, TRIAD COAL COMPANY

Inspection date(s): 04/01/13 Areas Inspected: Unit 1, intake, & return Findings/Law Violated:

1. Unit 1 #3 miner remote box tram boot had a hole. 30cfr 1725(a) Corrective action taken: Remote box was replaced RECOMMENDATIONS: None

Inspection date(s): 04/11/13 Areas Inspected: Surface, plant, shop, belt, & equipment Findings/Law Violated: 1. No violations

Corrective action taken: None RECOMMENDATIONS: None

Inspection date(s): 04/17/13 Areas Inspected: Unit 1, belts, roads Findings/Law Violated:

- 1. 58x cut 2msw intake wall has a hole. 30cfr 75.333(h)
- 2. Unit 1 #4 entry no flag. 30cfr 75.208

Corrective action taken: All violations corrected

FREELANDVILLE MINE, TRIAD COAL COMPANY PREP PLANTS #1& #2

Inspection date(s): 04/11/13 Areas Inspected: Surface, plant, belt, shop, equipment Findings/Law Violated: 1. No violations Corrective action taken: None

GIBSON MINE, GIBSON COAL COMPANY

Inspection date(s): 04/12/13 Areas Inspected: Unit 4A belt, 4A Intake Findings/Law Violated:

1. 4A intake 5xcut hi voltage cable needs guard. 30cfr 75.807 Corrective action taken: Violation noted by management RECOMMENDATIONS: None

Inspection date(s): 04/16/13

Areas Inspected: Surface, shop, plant, breaker house, silos raw & clean coal, belts, tunnels, & train load-out

Findings/Law Violated:

- 1. Fire extinguisher in women's trailer is out of date. 30cfr 77.1110
- 2. Need to replace belly pan on the raw coal belt. 30cfr 77.203
- 3. Replace guard for the motors on top of #2 silo raw coal. 30cfr 77.203
- 4. Rotary breaker switch on 2nd floor needs ID. 30cfr 77.809
- 5. Fire extinguisher on 3rd floor of rotary breaker needs a tag. 30cfr 77.1110
- 6. 3rd floor of plant fire extinguisher out of date near screen bowl. 30cfr 77.1110
- 7. Clean coal belt from plant needs cleaned at head. 30cfr 77.202
- 8. Clean coal flop gate walk-way needs cleaned. 30cfr. 77.202
- 9. Clean head of clean coal silo #2. 30cfr 77.202

Corrective action taken: All violations noted by management and corrective action taken **RECOMMENDATIONS:** None

Inspection date(s): 04/24/13

Areas Inspected: Belts. 2A, 2nd 42 SW, 1st 42SW, 1st42 NW, 2nd Main SW, 1st Main SW Findings/Law Violated:

- 1. Need a fire riser between 3 & 7xcut on 2A belt. 30cfr 75.1100-2(b)
- 2. Loose rib at 16x cut on $1^{st} 2^{nd}$ SW belt. 30cfr 75.202(a)
- 3. 13x cut 1st Main SW no ball on life line. 30cfr 75.380-7(vi)
- 4. 11x cut to 15x cut on 1st Main SW need a fire riser. 30cfr 75.1100-2(b)

Corrective action taken: Ball installed on life line, Loose rib flagged, all violations noted and corrective action taken

PROSPERITY MINE, FIVE STAR COAL COMPANY

Inspection date(s): 04/08/13

Areas Inspected: Surface, plant, shops, tunnels, belts, warehouse, train load-out, & trucks Findings/Law Violated:

1. #33 mantrip bad fire extinguisher. 30cfr 77.1110

2. Fire extinguishers at slope belt, stacker belt, & mcc room out of date. 30cfr 77.1110 Corrective action taken: All violations corrected RECOMMENDATIONS: None

Inspection date(s): 04/22/13 Areas Inspected: Belts 3N1, 2S2, 2S1, ME Findings/Law Violated:

1. 2S2 3xcut need a guard under belt. 30cfr 75.1722

2. No ball on life line at 2S2 2xcut and Main East 6xcut. 30cfr 75.380-7(VI) Corrective action taken: Life line corrected and guard will be done on 3rds

LANDREE MINE

Inspection date(s): 04/10/13 Areas Inspected: Surface, shop, belts, plant, train load-out, tunnels Findings/Law Violated:

- 1. 8" grinder missing hood & adjustment. 30cfr 77.401
- 2. Fire extinguisher in shop missing tag and one out of date. 30cfr 77.1110
- 3. Raw coal stacker walk-way needs cleaned. 30cfr 77.205(b)
- 4. Raw coal draw off tunnel lights not working. 30cfr 77.207
- 5. Welder on 1st floor of plant positive post not protected. 30cfr 77.512
- 6. 2 holes in PLC cabinet at train load out. 30cfr 77.509(b)

Corrective action taken: All violations were noted and corrective action taken RECOMMENDATIONS: All permanent electrical installations need fire extinguishers

Inspection date(s): 04/22/13

Areas Inspected: Main south belt, Main west belt, secondary escapeway, Unit 1 Findings/Law Violated:

- 1. Drive roller at head of Main west belt needs guarded 30cfr 75.1722(b)
- 2. Unit 1 Oxygen & acetylene gauges need changed 30cfr 75.1725(a)
- 3. Breaker for #1 miner no ID tag. 30cfr 75.5112
- 4. Cat head for #2 shuttle car no ID tag(readable) 30cfr 75.512

Corrective action taken: Management was informed of all citations and corrective action taken

RECOMMENDATIONS: Flag equipment in x cuts