

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K0000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 11/07/12</p> <p>Facility Number: 000908 Provider Number: 15G394 AIM Number: 100244380</p> <p>Surveyor: Phillip Komsiski, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, Transitional Services Sub LLC was found not in compliance with Requirements for Participation in Medicaid, 42 CFR subpart 483.470(j), Life Safety from Fire, and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story facility was sprinklered. The facility has a fire alarm system with smoke detection in the corridors, common living areas and hard wired smoke detectors in all resident sleeping rooms. The facility has a capacity of eight and had a census of eight at the time of this survey.</p>	K0000		

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE \_\_\_\_\_ TITLE \_\_\_\_\_ (X6) DATE \_\_\_\_\_

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2012	
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
	<p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101 A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Slow with an E-score of 3.2.</p> <p>Quality Review by Robert Booher, Life Safety Code Specialist-Medical Surveyor on 11/14/12.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 11/07/2012	
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
KS051	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD A manual fire alarm system is provided in accordance with Section 9.6, 33.2.3.4.1.</p> <p>Exception No 1: Where there are interconnected smoke detectors meeting the requirements of 33.2.3.4.3 and there is not less than one manual fire alarm box per floor arranged to continuously sound the smoke detector alarms.</p> <p>Exception No. 2: Other manually activated continuously sounding alarms acceptable to the authority having jurisdiction.</p> <p>Based on record review and interview, the facility failed to ensure 1 of 1 fire alarm systems was maintained in accordance with the applicable requirements of NFPA 72, National Fire Alarm Code. LSC 9.6.1.4 requires fire alarm systems to be maintained in accordance with NFPA 72. NFPA 72, 7-3.2 requires testing shall be performed in accordance with the schedules in Chapter 7, or more often if required by the authority having jurisdiction. Table 7-3.2 shall apply. Table 7-3.2 "Testing Frequencies" requires alarm notification appliances, batteries, and initiating devices to be tested at least annually. This deficient practice could affect all clients, staff, and visitors in the facility.</p> <p>Findings include:</p> <p>Based on review of Fire Alarm Inspection</p>	KS051	<p>Current records of inspection for automatic fire alarm systems will be monitored and maintained in the home for review as required by NFPA 72 LSC 9.6.1.4. USAutomatic came to the home and completed an inspection on 10/5/2012. The Home Manager will monitor that an inspection has been completed at least yearly and will notify the Program Director of any concerns with timeliness of these inspections. Anytime they are found to be out of compliance or in need of maintenance, the Program Director will notify USAutomatic to ensure they remain in compliance. Documentation is attached. Persons Responsible: Home Manager, Program Director</p>	11/26/2012			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	reports on 11/07/12 at 1:20 p.m. with the House Manager, the most recent fire alarm system inspection available for review occurred on 09/15/10. Based on interview on 11/07/12 at 1:22 p.m. with the House Manager who, after consulting with facility office staff, acknowledged no other documentation was available for review.			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
KS056	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p><b>IMPRACTICAL</b> Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2012
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	<p>habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on record review and interview, the facility failed to ensure 1 of 1 sprinkler waterflow alarm devices was tested quarterly. LSC 33.2.3.5.2 refers to LSC section 9.7. LSC 9.7.5 refers to NFPA 25, Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. NFPA 25, at 2-3.3 requires waterflow alarm devices including but not limited to mechanical water motor gongs, vane-type waterflow devices and pressure switches providing audible or visual signals be tested quarterly. This deficient practice could affect all clients and staff.</p> <p>Findings include:</p> <p>Based on review of Sprinkler System records on 11/07/12 at 1:15 p.m. with the House Manager, documentation was not available for quarterly inspections of waterflow alarm devices. Documentation available for review indicated the last sprinkler inspection was done 08/15/11 and was done annually. Based on</p>	KS056	<p>Current records of inspection for automatic fire alarm systems will be monitored and maintained in the home for review as required by NFPA 72 LSC 9.6.1.4. USAutomatic came to the home and completed an inspection on 10/5/2012. The Home Manager will monitor that an inspection has been completed at least yearly and will notify the Program Director of any concerns with timeliness of these inspections. Anytime they are found to be out of compliance or in need of maintenance, the Program Director will notify USAutomatic to ensure they remain in compliance. Documentation is attached. Persons Responsible: Home Manager, Program Director</p>	11/26/2012	

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G394	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2012
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 701 RILEY BLVD BEDFORD, IN 47421
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	interview on 11/07/12 at 1:25 p.m. with the House Manager, the last sprinkler inspection was done 08/15/11, sprinkler inspections of the waterflow alarms were not tested quarterly, and no other documentation was available for review.			