

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING <u>01</u> B. WING _____	X3) DATE SURVEY COMPLETED 03/26/2015
--	---	---	---

NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
--------------------	--	---------------	---	----------------------

K 000 Bldg. 01	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 03/26/2015</p> <p>Facility Number: 003833 Provider Number: 15G707 AIM Number: 200453450</p> <p>Surveyor: Scott Wytosick, Life Safety Code Specialist and Amy Kelley, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, AWS was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story facility was fully sprinklered. The facility has a fire alarm system with smoke detection in the corridors, in resident sleeping rooms and in common living areas. The facility has a capacity of 4 and had a census of 3 at</p>	K 000		
-----------------------	--	-------	--	--

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 03/26/2015
--	---	--	---

NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K 056 Bldg. 01	<p>the time of this survey.</p> <p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Prompt with an E-Score of 1.1.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p> <p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT</p> <p>Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 03/26/2015
--	---	--	---

NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING <u>01</u> B. WING _____	X3) DATE SURVEY COMPLETED 03/26/2015
--	---	---	---

NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING <u>01</u> B. WING _____	X3) DATE SURVEY COMPLETED 03/26/2015
--	---	---	---

NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on observation and interview, the facility failed to ensure 1 of 1 sprinkler systems was continuously maintained in reliable operating condition and inspected and tested periodically. NFPA 25, 2-3.2 requires gauges shall be replaced every 5 years or tested every 5 years by comparison with a calibrated gauge. Gauges not accurate to within 3 percent of the full scale shall be recalibrated or replaced. This deficient practice affects all occupants in the facility including staff, visitors and clients.</p>	K 056	<p>A work order request to assess the water gauge was submitted to the Benchmark contractor that services the sprinkler system. The water gauge was replaced on 4/17/15. A copy of the report of inspection is being included with this plan of correction. The sprinkler system is monitored quarterly and the water gauges are to be assessed at that time. Assessment of the water gauges will be recorded on the inspection report including the replacement</p>	04/17/2015

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G707	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 03/26/2015
NAME OF PROVIDER OR SUPPLIER BENCHMARK HUMAN SERVICES			STREET ADDRESS, CITY, STATE, ZIP CODE 1105 N HILL ST SOUTH BEND, IN 46617		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	Findings include: Based on observation with the Residential Manager at 11:39 a.m. on 03/26/2015, the sprinkler system located in the sprinkler riser closet had one of two pressure gauges with a date indicating the gauge was manufactured in 2009. Based on interview at the time of observation, the Residential Manager acknowledged the gauge was manufactured in 2009.		of gauges when indicated. Inspection reports will bereviewed by the director to ensure compliance.		