

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
--------------------	--	---------------	---	----------------------

K010000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 01/28/14</p> <p>Facility Number: 001110 Provider Number: 15G596 AIM Number: 100240090</p> <p>Surveyor: Lex Brashear, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, Rehabilitation Center Developmental Services was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story facility was sprinklered. The facility has a monitored fire alarm system with hard wired smoke detectors in the corridors, in sleeping rooms, and in common living areas. The facility has a capacity of eight and had a census of</p>	K010000		
---------	---	---------	--	--

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE _____ TITLE _____ (X6) DATE _____

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>eight at the time of this survey.</p> <p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Slow with an E-Score of 1.72.</p> <p>Quality Review by Robert Booher, Life Safety Code Specialist-Medical Surveyor on 02/04/14.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K01S056	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT</p> <p>Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on observation and interview, the facility failed to ensure 2 of over 30 sprinkler heads were free of a corrosion. LSC 9.7.5 requires all sprinkler systems shall be inspected, tested, and maintained in accordance with NFPA 25, Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. NFPA 25, 2-2.1.1 requires sprinklers to be free of corrosion, foreign material, paint, and physical damage and shall be installed in the proper orientation (upright, pendent, or sidewall). Any sprinkler shall be replaced that is painted, corroded, damaged, loaded, or in the improper orientation. This deficient practice could affect any client in the home while using either shower/bathroom.</p> <p>Findings include:</p> <p>Based on observations on 01/28/14 between 12:15 p.m. and 12:45 p.m. during a tour of the facility with the Qualified Intellectual Disability</p>	K01S056	The deficiency is being resolved, as maintenance has been informed of the two sprinkler heads that need to be replaced. Maintenance will have the two sprinkler heads, one in each of the two bathrooms replaced. Preventatively, Human Right Committee will be notified to monitor sprinkler heads to be free of corrosion when completing their site visits.	02/14/2014

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/28/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES	STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K01S152	<p>Professional (QIDP), both shower/bathrooms had one sprinkler head each covered with green corrosion. This was acknowledged by the QIDP at the time of each observation.</p> <p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD (1) The facility holds evacuation drills at least quarterly for each shift of personnel and under varied conditions to - (i) Ensure that all personnel on all shifts are trained to perform assigned tasks; (ii) Ensure that all personnel on all shifts are familiar with the use of the facility's emergency and disaster plans and procedures.</p> <p>(2) The facility must - (i) Actually evacuate clients during at least one drill each year on each shift; (ii) Make special provisions for the evacuation of clients with physical disabilities: (iii) File a report and evaluation on each drill: (iv) Investigate all problems with evacuation drills, including accidents and take corrective action: and (v) During fire drills, clients may be evacuated to a safe area in facilities certified under the Health Care Occupancies Chapter of the Life Safety Code.</p> <p>(3) Facilities must meet the requirements of paragraphs (i) (1) and (2) of this section for any live-in and relief staff that they utilize. Based on record review and interview, the facility failed to ensure fire drills</p>	K01S152	All Group Home Management will be retrained on the absolute need to complete all of the quarterly	02/14/2014

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G596	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 01/28/2014
NAME OF PROVIDER OR SUPPLIER REHABILITATION CENTER DEVELOPMENTAL SERVICES			STREET ADDRESS, CITY, STATE, ZIP CODE 1426 S ALVORD LN EVANSVILLE, IN 47714		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	<p>were conducted quarterly on 2 of 3 shifts during 2 of 4 quarters. This deficient practice could affect all clients.</p> <p>Findings include:</p> <p>Based on review of the facility's fire drills in the Fire Drill folder on 01/28/14 at 11:45 a.m. with the Office Coordinator present while at the office, the facility performed thirteen fire drills during the past twelve months, however, they lacked documentation fire drills were conducted during the second shift (evening) of the second quarter (April, May, and June), and the third shift (night) of the fourth quarter (October, November, and December) of 2013. Based on interview at the time of record review, the Office Coordinator said there were no other fire drills performed during the previously mentioned shifts and quarters.</p>		<p>evacuation drills for preparedness. Systematically, the Group Home Coordinator will now be responsible to schedule and ensure that the drills are run effectively and consistently. Preventatively, the evacuation drill form has been updated to include dates of when the drills are to be completed and times when the overnight drills are to be completed.</p>		