

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
--------------------	--	---------------	---	----------------------

K010000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 11/07/14</p> <p>Facility Number: 000819 Provider Number: 15G300 AIM Number: 100249100</p> <p>Surveyor: Mark Caraher, Life Safety Code Specialist,</p> <p>At this Life Safety Code survey, Transitional Services Sub, LLC was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This two story facility with a basement was fully sprinklered. The facility has a fire alarm system with smoke detection on all levels including corridors, bedrooms, all living areas and the basement. The facility has a capacity of 8 and had a census of 8 at the time of this</p>	K010000		
---------	--	---------	--	--

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE \_\_\_\_\_ TITLE \_\_\_\_\_ (X6) DATE \_\_\_\_\_

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K01S056	<p>survey.</p> <p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Prompt with an E-Score of 0.7.</p> <p>Quality Review by Dennis Austill, Life Safety Code Specialist on 11/19/14.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p> <p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2014	
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
	<p>providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 11/07/2014	
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
	<p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED  11/07/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on observation and interview, the facility failed to keep the minimum amount and type of spare sprinklers on the premises in the spare sprinkler cabinet. LSC 9.7.5 requires automatic sprinkler systems be inspected, tested and maintained in accordance with NFPA 25, Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. NFPA 25, Section</p>	K01S056	<p>Minimum required (6) spare sprinkler heads have been placed in the facility.</p> <p>Weekly checks of facility will be completed to ensure the minimum required spare sprinkler heads are in the facility and will documented on door alarm check list. Door Alarm Checklist will be monitored weekly by the home manager and at least</p>	12/07/2014

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2014
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
K01S152	<p>2-4.1.4 states a supply of at least six spare sprinklers shall be stored in a cabinet on the premises for replacement purposes. The stock of spare sprinklers shall be proportionally representative of the types and temperature ratings of the system sprinklers. A minimum of two sprinklers of each type and temperature rating installed shall be provided. The cabinet shall be so located that it will not be exposed to moisture, dust, corrosion, or a temperature exceeding 100°F (38°C). This deficient practice could affect all clients, staff and visitors in the facility.</p> <p>Findings include:</p> <p>Based on observation with the Program Director during a tour of the facility from 1:40 p.m. to 2:00 p.m. on 11/07/14, a total of five spare sprinklers were noted on the premises in the spare sprinkler cabinet in the basement at the sprinkler system riser. Based on interview at the time of observation, the Program Director acknowledged a supply of at least six spare sprinklers was not stored in a cabinet on the premises for replacement purposes.</p> <p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD (1) The facility holds evacuation drills at least quarterly for each shift of personnel and under varied conditions to -</p>		<p>monthly by the Program Director and/or Area Director.</p> <p>Responsible Party: Home Manager, Program Director, Area Director.</p>		

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2014
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	<p>(i) Ensure that all personnel on all shifts are trained to perform assigned tasks;</p> <p>(ii) Ensure that all personnel on all shifts are familiar with the use of the facility's emergency and disaster plans and procedures.</p> <p>(2) The facility must -</p> <p>(i) Actually evacuate clients during at least one drill each year on each shift;</p> <p>(ii) Make special provisions for the evacuation of clients with physical disabilities;</p> <p>(iii) File a report and evaluation on each drill;</p> <p>(iv) Investigate all problems with evacuation drills, including accidents and take corrective action: and</p> <p>(v) During fire drills, clients may be evacuated to a safe area in facilities certified under the Health Care Occupancies Chapter of the Life Safety Code.</p> <p>(3) Facilities must meet the requirements of paragraphs (i) (1) and (2) of this section for any live-in and relief staff that they utilize.</p> <p>Based on record review and interview, the facility failed to conduct fire drills under varied conditions on the third shift for 3 of 4 quarters. This deficient practice affects all clients, staff and visitors.</p> <p>Findings include:</p> <p>Based on review of "Fire Drill Report" documentation with the Program Director during record review from 1:00 p.m. to 1:40 p.m. on 11/07/14, fire drills conducted on the third shift in the fourth</p>	K01S152	<p>All staff were retrained on 11/6/14 on completing evacuations drills according to the schedule developed by Mentor for various times on each shift. Home Manager will monitor evacuation drills each month to ensure the schedule being followed. Program and/or Area Director will monitor at least monthly as follow up.</p> <p>Responsible Party: Home Manager, Program Director, Area Director</p>	12/07/2014	

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G300	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED  11/07/2014
NAME OF PROVIDER OR SUPPLIER  TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 110 W PIKE ST MARTINSVILLE, IN 46151		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	quarter of 2013 on 12/08/13, in the second quarter of 2014 on 06/09/14 and in the third quarter of 2014 on 09/08/14 were conducted, respectively, at 3:00 a.m., 2:30 a.m. and 3:30 a.m. Based on interview at the time of record review, the Program Director stated additional fire drill documentation was not available for review and acknowledged third shift fire drills were not conducted under varied conditions.				