

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K0000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 01/18/13</p> <p>Facility Number: 005659 Provider Number: 15G742 AIM Number: 100244210</p> <p>Surveyor: Mark Caraher, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, Transitional Services Sub LLC was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 Edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story building was determined to be fully sprinklered. The facility has a fire alarm system with smoke detection in corridors, bedrooms and all living areas. The facility has a capacity of 8 and had a census of 8 at the time of this survey.</p> <p>Calculation of the Evacuation Difficulty</p>	K0000		

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Slow with an E-Score of 2.8.</p> <p>Quality Review by Robert Booher, Life Safety Code Specialist-Medical Surveyor on 01/23/13.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 01/18/2013	
NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
K0130	<p>Based on observation and interview, the facility failed to ensure 2 of 2 portable fire extinguishers which require a 12 year hydrostatic test were emptied and subjected to the applicable maintenance procedures every six years as required by NFPA 10, Section 4-4.3. LSC 4.6, General Requirements at 4.6.12.2 requires existing LSC features obvious to the public, such as fire extinguishers, to be either maintained or removed. NFPA 10, 4-4.3 requires every six years, stored pressure fire extinguishers which require a 12 year hydrostatic test shall be emptied and subjected to the applicable maintenance procedures. This deficient practice could affect all clients, staff and visitors.</p> <p>Findings include:</p> <p>Based on observations with the Home Manager during a tour of the facility from 11:45 a.m. to 12:15 p.m. on 01/18/13, each of the facility's two portable fire extinguishers located in the dining room and in the north hallway had an affixed label and collar stating the most recent six year maintenance had been performed in December 2005. Documentation of six year maintenance performed after December 2005 was not available for</p>	K0130	All needed adjustments were corrected on 1/28/2013 by USAutomatic Fire and Security. Area Director and Maintenance will review completed reports from USAutomatic and ensure all needed repairs and adjustments have been completed. Responsible Party: Area Director, Maintenance Supervisor	01/28/2013			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	review. Each portable fire extinguisher's manufacturer label indicated it is a stored pressure fire extinguisher manufactured in 1987. Based on interview at the time of the observations, the Home Manager acknowledged the two portable fire extinguishers were past due for the six year maintenance procedure.			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742		X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 01/18/2013	
NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC				STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
KS056	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 01/18/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on record review and interview, the facility failed to ensure the sprinkler system was maintained in accordance with NFPA 25, 1998 Edition, the Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. LSC 9.7.5 requires all sprinkler systems shall be inspected, tested, and maintained in accordance with NFPA 25, Standard for the Inspection, Testing, and Maintenance of Water-Based Fire Protection Systems. NFPA 25, 2-3.4 states the freezing point of solutions in antifreeze shall be tested annually and the solutions shall be in accordance with Tables 2-3.4(a) and (b). This deficient practice could affect all clients, staff and visitors.</p> <p>Findings include:</p> <p>Based on review of USAutomatic Fire & Security "Report of Inspection - Addendum: Deficiencies" documentation dated 09/19/12 during record review with the Home Manager from 11:05 a.m. to</p>	KS056	All needed adjustments were corrected on 1/28/2013 by USAutomatic Fire and Security. Area Director and Maintenance will review completed reports from USAutomatic and ensure all needed repairs and adjustments have been completed. Responsible Party: Area Director, Maintenance Supervisor	01/28/2013

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 01/18/2013
NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	11:45 a.m. on 01/18/13, the report stated "The antifreeze system tested at zero degrees. The system should be recharged so that the building is protected to a minimum of -20 degrees." Based on interview at the time of record review, the Home Manager acknowledged no documentation was available for review to verify the antifreeze system solution had been adjusted or replaced on or after 09/19/12.				