

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K020000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 05/17/13</p> <p>Facility Number: 000590 Provider Number: 15G024 AIM Number: 100248560</p> <p>Surveyor: Joe L. Brown, Jr., Life Safety Code Specialist</p> <p>At this Life Safety Code survey, ADEC Inc. was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story facility with a basement was sprinklered. The facility has a fire alarm system with smoke detection on all levels including the corridors, common living areas and battery operated detectors in resident sleeping rooms. The facility has a capacity of 8 and had a census of 8 at the time of this survey.</p>	K020000		

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE \_\_\_\_\_ TITLE \_\_\_\_\_ (X6) DATE \_\_\_\_\_

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Prompt with an E-Score of 0.98.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K02S056	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024		X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____		X3) DATE SURVEY COMPLETED  05/17/2013	
NAME OF PROVIDER OR SUPPLIER  ADEC INC				STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE			
	<p>Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p>						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p><b>IMPRACTICAL</b> Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>Based on observation and interview, the facility failed to ensure two of sixteen sprinkler heads were free of foreign materials, paint, and physical damage. LSC 33.2.3.5.2 refers to NFPA 13D. 13D 3-5.4.1 states sprinklers shall be permitted to be factory painted or enameled as ornamental finish in accordance with 3-5.4.2; otherwise, sprinklers shall not be painted, and any sprinklers that have been painted shall be replaced with new, listed sprinklers. This deficient practice had the potential to affect all clients, staff, and visitors.</p> <p>Findings include:</p> <p>Based on observation and interview on 05/17/13 at 11:10 a.m. during</p>	K02S056	The facility manager or QDDP will complete monthly inspections of all sprinkler heads, and will document that the sprinkler heads were dusted and clear of any debris. The manager and QDDP will trained on this process. All documentation of this monthly routine will be held in the group home. Person Responsible: QDDP, Res Manager	05/31/2013

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  15G024	X2) MULTIPLE CONSTRUCTION A. BUILDING 02 B. WING _____	X3) DATE SURVEY COMPLETED  05/17/2013
--	---	--	---

NAME OF PROVIDER OR SUPPLIER  ADEC INC	STREET ADDRESS, CITY, STATE, ZIP CODE 807 MOTTVILLE RD BRISTOL, IN 46507
--	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	the tour of the facility with the Qualified Developmental Disability Professional (QDDP), a sprinkler head in the utility room and a sprinkler head in the kitchen ceiling had foreign materials and spider webs on it. Based on interview on 05/17/13 at 11:10 a.m. with the QDDP acknowledged that there were foreign materials and spider webs on the sprinkler heads.			