

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K010000	<p>A Life Safety Code Recertification Survey was conducted by the Indiana State Department of Health in accordance with 42 CFR 483.470(j).</p> <p>Survey Date: 02/06/14</p> <p>Facility Number: 005659 Provider Number: 15G742 AIM Number: 100244210</p> <p>Surveyor: Mark Caraher, Life Safety Code Specialist</p> <p>At this Life Safety Code survey, Transitional Services Sub LLC was found not in compliance with Requirements for Participation in Medicaid, 42 CFR Subpart 483.470(j), Life Safety from Fire and the 2000 Edition of the National Fire Protection Association (NFPA) 101, Life Safety Code (LSC), Chapter 33, Existing Residential Board and Care Occupancies.</p> <p>This one story building was determined to be fully sprinklered. The facility has a fire alarm system with smoke detection in corridors, in bedrooms and in all living areas. The facility has a capacity of 8 and had a census of 8 at the</p>	K010000		

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (see instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>time of this survey.</p> <p>Calculation of the Evacuation Difficulty Score (E-Score) using NFPA 101A, Alternative Approaches to Life Safety, Chapter 6, rated the facility Slow with an E-Score of 1.8.</p> <p>Quality Review by Robert Booher, Life Safety Code Specialist-Medical Surveyor on 02/11/14.</p> <p>The facility was found not in compliance with the aforementioned regulatory requirements as evidenced by the following:</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K01S056	<p>483.470(j)(1)(i) LIFE SAFETY CODE STANDARD PROMPT</p> <p>Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: In prompt evacuation facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>SLOW Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p> <p>Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 3: Not Applicable.</p> <p>Exception No. 4: Not Applicable.</p> <p>Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All</p>			

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____	X3) DATE SURVEY COMPLETED 02/06/2014
--	---	--	---

NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC	STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
	<p>habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5. Based on record review, observation and interview; the facility failed to ensure 1 of 1 automatic sprinkler systems was maintained in reliable operating condition. LSC 9.7.1.1 refers to NFPA 13R, the Standard for the Installation of Sprinkler Systems in Residential Occupancies. NFPA 13R, Section 2-4.1 states where a common supply main is used to supply both domestic and sprinkler systems, a single, listed control valve shall be provided to shut off both the domestic and sprinkler systems, and a separate shutoff valve shall be provided for the domestic system only. Exception: The sprinkler system piping shall be permitted to have a separate control valve where supervised by one of the following methods:</p> <p>(a) Central station, proprietary, or remote alarm service (b) Local alarm service that causes the sounding of an audible signal at a constantly attended location (c) Valves that are locked open This deficient practice affects all clients,</p>	K01S056	The facility has secured the valves at this time as required. TSI/Indiana Mentor maintenance staff will complete follow up observations after each bi-annual check by USAutomatic to ensure that the valves continue to be secured as required. Person Responsible: Area Director, Program Director, Home Manager, Maintenance Staff	02/21/2014

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 15G742	X2) MULTIPLE CONSTRUCTION A. BUILDING 01 B. WING _____		X3) DATE SURVEY COMPLETED 02/06/2014
NAME OF PROVIDER OR SUPPLIER TRANSITIONAL SERVICES SUB LLC			STREET ADDRESS, CITY, STATE, ZIP CODE 369 W WASHINGTON ST MORGANTOWN, IN 46160		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
	<p>staff and visitors.</p> <p>Findings include:</p> <p>Based on review of USAutomatic Fire & Security "Report of Inspection" documentation dated 09/10/13 with the Program Director during record review from 11:30 a.m. to 12:10 p.m. on 02/06/14, Item 17 stated, "the control valves are not locked, sealed or monitored. They are located in a closet but the closet is not kept locked." Based on observation with the Program Director during a tour of the facility from 12:10 p.m. to 12:30 p.m. on 02/06/14, automatic sprinkler system shutoff valves were not locked, sealed or monitored. Based on interview at the time of observation, the Program Director acknowledged the automatic sprinkler system shutoff valves were not locked, sealed or monitored.</p>				