



Grant County Health Department
401 South Adams Street
Marion, 46953
Office - (765)651-2401

Swimming Pool Inspection Report

Owner

N/A
Taylor University
236 W. Reade Ave.
Upland, IN 46989

Facility

Taylor University
236 W. Reade Ave.
Upland, IN 46989
License Number :

The Taylor University Eichling Aquatics Wing was inspected on 07/22/2026 by Cassie Leech, Jeff Couch, Josh Keller (Grant Co HD & Steve Yearly, IDOH.

The pool was not actually open for use at the time of this inspection. However, these violations of 410 IAC 6-2.1 and 675 IAC 20 were observed and must be corrected by before opening for use.

1. The pool's Calcium Hypochlorite disinfectant feeder was not operable. It needs the attention of a competent service technician. Disinfectant is being hand fed. This is a violation of 410 IAC 6-2.1-30(a) and 675 IAC 20-2-24.

The pool cannot be opened for use until a disinfectant feeder is operable and being used to add the disinfectant. See 410 IAC 6-2.1-43(4).

2. The pH of the pool water was 7.0 or lower. This is out of the acceptable range of 7.2 to 7.8 (inclusive). This is a violation of 410 IAC 6-2.1-30(m).

Note that it is critical to keep the pH feeder calibrated against the actual, measured pH.

3. The alkalinity of the water was 20ppm. This is out of the acceptable range of least 80 and no more than 120 part per million (mg/l). This is a violation of 410 IAC 6-2.1-30(n). More importantly, this will interfere with the proper operation of the chemical feed system. Alkalinity increaser can be added to address this.

4. The test kit is not capable of measuring combined Chlorine or Alkalinity. It does not have adequate reagents for these tests. This is a violation of 410 IAC 6-2.1-30(i).

5. The pool water was not tested for combined chlorine at least twice a week. This is a violation of 410 IAC 6-2.1-30(p) (1).

6. The pool water was not tested for total alkalinity at least once a week. This is a violation of 410 IAC 6-2.1-30(p) (2).

7. A meter to measure the flow of water through the pool water recirculation system was not provided. This is a violation of 410 IAC 6-2.1-32(c).

8. Skimmers were all missing their floating weirs. This is a violation of 410 IAC 6-2.1-26(a) and 675 IAC 20-2-21(c) (4).

9. Several of the inlets are missing their covers. This is a violation of 410 IAC 6-2.1-26(a), 675 IAC 20-2-4(b), and 675 IAC 20-2-20.

10. A 24 unit first aid kit within the pool enclosure was not adequate. It is old and degraded. This is a violation of