

Pavement Condition Report

Lafayette-Purdue University Airport

Project 13801869

Prepared for:

Indiana Department of Transportation
 Office of Aviation
 100 N. Senate Ave.
 Indianapolis, IN 46204
 Indiana Department of Transportation

Prepared by:

Applied Research Associates, Inc.
 6314 Odana Rd.
 Madison, WI 53719
 (608) 274-6409

January 2013



Executive Summary

Background


Since 1995, airports have been required to implement a pavement maintenance-management program to receive funding for any project constructed using Federal money. To assist individual airports in meeting this requirement and help improve airport pavement conditions statewide, the Indiana Department of Transportation, Office of Aviation contracted with Applied Research Associates, Inc. to provide pavement evaluation surveys at local airports. This report documents pavement condition at Lafayette-Purdue University Airport in September 2012.

A primary objective of the pavement management program is to determine maintenance and rehabilitation needs by comparing pavement condition to a standardized benchmark called the minimum service level (MSL), defined as the minimum pavement condition acceptable in managing Indiana's airfield pavements. The benchmark MSL values used to trigger rehabilitation at Lafayette-Purdue University Airport are shown below.

Runway	Taxiway	Apron
65	60	60

Pavement Condition

The overall Pavement Condition Index (PCI) for the airfield pavements was 81. Runways had an average inspected PCI of 79 and were above the desired MSL of 65. Taxiways had an average inspected PCI of 78, and ramps had an average inspected PCI of 88.

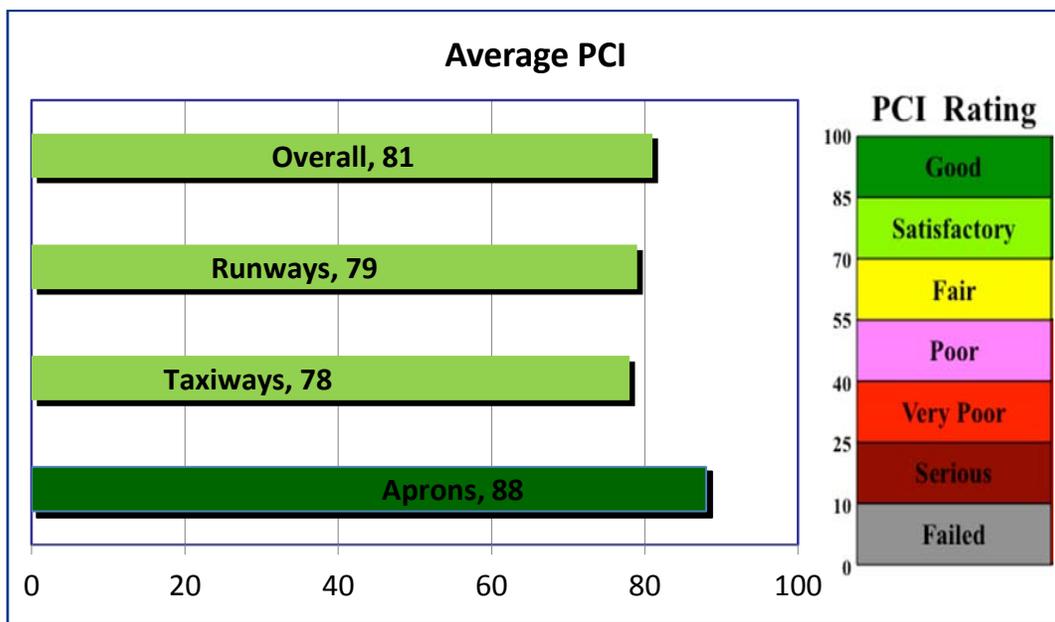

Capital Improvement Program

The table below provides a summary of the projected pavement rehabilitation needs for the next 5 years of the capital improvement program, starting in 2012. The estimated cost for the rehabilitation actions that provide the greatest increase in pavement service life is approximately \$250,000 in 2012 dollars. If no action is taken, the overall PCI is projected to drop to 75 by 2016.

Project Year	Calendar Year	Amount
Year 1	2012	107,401
Year 2	2013	16,919
Year 3	2014	100,284
Year 4	2015	-
Year 5	2016	21,149
5-Year Total		\$ 245,753

Maintenance

Analysis of potential maintenance projects identified approximately 1,900 square feet of patching needs and approximately 140,000 linear feet of crack sealing and crack repair needs, at an estimated total cost of approximately \$280,000.

Specific recommendations to help prioritize airfield maintenance are found in chapter 4 of this report. A summary of all identified maintenance needs is shown in the table below and in the figure on the following page.

Work Item	Quantity	Unit	Cost
AC PATCH	1,368	SF	\$11,643
AC RESTORATIVE CRACK REPAIR	32,883	LF	\$40,117
AC SUSTAINING CRACK REPAIR	7,261	LF	\$6,188
PCC PATCHING	559	SF	\$9,164
PCC RESTORATIVE SEAL REPAIR	96,561	LF	\$212,436
Total:			\$278,548

AC = asphalt concrete; PCC = portland cement concrete; S.F. = square feet; L.F. = linear feet

LAFAYETTE - PURDUE UNIVERSITY AIRPORT
2012 PCI Inspection

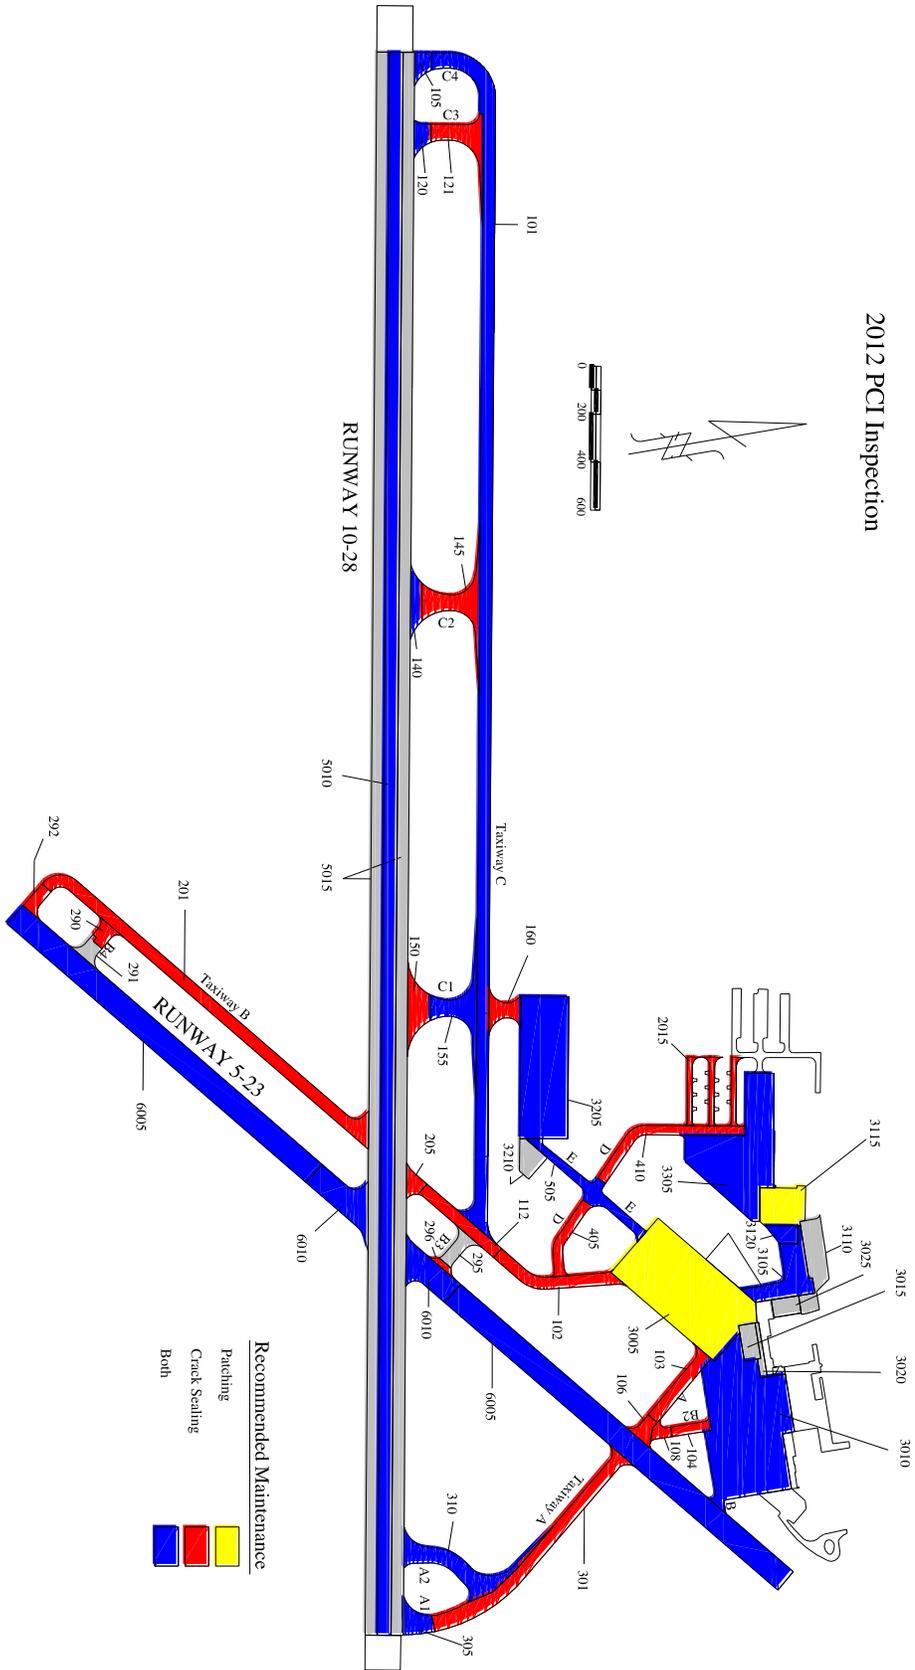


Table of Contents

1. Introduction	1
1.1 Objective and Scope	1
1.2 Description of Tasks Performed.....	1
2. Pavement Condition Evaluation	7
2.1 Overview.....	7
2.2 Distress Types and Frequency	12
2.3 PCI Summary.....	13
2.4 Analysis Commentary	14
3. Capital Improvement Program.....	17
3.1 Analysis	17
3.2 Cost Estimates	17
3.3 Capital Improvement Strategies	21
4. Maintenance Management Program.....	25
4.1 General Comments	25
4.2 Recommended Maintenance Actions.....	25
4.3 Pavement Deterioration	30
4.4 Best Practices.....	33
4.5 Pavement Repair Materials	36
4.6 Pavement Repair Equipment.....	36
Appendix A. AIRPAV Software.....	39
Appendix B. Feature Analysis.....	41
Appendix C. General Maintenance Techniques.....	137
Appendix D. PCI Summary.....	145
Appendix E. Distress Identification.....	153
Appendix F. Airport Responsibilities.....	161

Table of Figures

Figure 1-1. Pavement Numbering System	3
Figure 1-2. PCI Value and Descriptive Rating	4
Figure 2-1. Inspected Pavement Condition	8
Figure 2-2. Pavement Condition by Branch Use	9
Figure 2-3. Typical Good PCC Pavement (Feature 3020).....	9
Figure 2-4. Typical Good AC Pavement (Feature 2015)	10
Figure 2-5. Typical Satisfactory AAC Pavement (Feature 112)	10
Figure 2-6. Typical Fair AAC Pavement (Feature 6010)	11
Figure 2-7. Typical Poor AAC Pavement (Feature 140)	11
Figure 3-1. Programmed CIP	21
Figure 4-1. Recommended Maintenance	29

Table of Tables

Table 1-1. Minimum Service Levels	1
Table 1-2. Inspection Density	3
Table 2-1. Definition and Distribution of PCI Ratings	7
Table 2-2. Distress Frequency in AC Pavement	12
Table 2-3. Distress Frequency in PCC Pavement	12
Table 2-4. PCI Results	13
Table 2-5. Runway Condition Distribution	15
Table 2-6. Taxiway Condition Distribution	15
Table 2-7. Apron Condition Distribution	15
Table 3-1. Unit Costs.....	18
Table 3-2. Most Comprehensive Repair	22
Table 3-3. Lowest Annual Cost Repair	22
Table 3-4. All Viable Options	23
Table 4-1. Recommend Maintenance Actions	25
Table 4-2. Recommend AC Patching	26
Table 4-3. Recommend PCC Patching.....	26
Table 4-4. Recommend AC Restorative Crack Repair.....	27
Table 4-5. Recommend AC Sustaining Crack Repair.....	28
Table 4-6. Recommend PCC Restorative Crack Repair.....	28
Table 4-7. General Maintenance Policy (AC).....	34
Table 4-8. General Maintenance Policy (PCC).....	35

GLOSSARY OF ABBREVIATIONS

AC	- asphalt concrete
ACC	- asphalt overlay on existing asphalt
APC	- asphalt overlay on existing concrete
APMS	- airport pavement management system
ARA	- Applied Research Associates, Inc.
CADD	- computer-aided design and drafting
CIP	- capital improvement program
FAA	- Federal Aviation Administration
FOD	- foreign object damage
GIS	- geographic information system
INDOT	- Indiana Department of Transportation
L&T	- longitudinal and transverse
LTD	- longitudinal, transverse, and diagonal
M&R	- maintenance and rehabilitation
MSL	- minimum service level
PCC	- portland cement concrete
PCI	- Pavement Condition Index
PCN	- Pavement Classification Number
PDF	- portable electronic document

1. Introduction

1.1 Objective and Scope

The Indiana Department of Transportation, Office of Aviation (INDOT) retained Applied Research Associates, Inc., (ARA) to provide airfield pavement inspection, pavement evaluation, and pavement management services for Indiana’s statewide network of airfield pavements. The pavement evaluations documented in this report were performed under purchase order number 13801869.

A primary objective of INDOT’s ongoing pavement evaluation and management program is to determine maintenance and rehabilitation (M&R) needs by comparing the Pavement Condition Index (PCI) to a standardized benchmark called the minimum service level (MSL). The MSL is defined as the minimum pavement condition acceptable in managing INDOT’s airside pavement. The benchmark MSL values used to trigger rehabilitation vary by airport classification and are shown in Table 1-1.

Table 1-1. Minimum Service Levels

Facility	Primary	Commercial Service	Large GA > 3600’Rwy	Large GA < 3600’Rwy
Runway	70	65	60	55
Taxiway	65	60	55	50
Apron	65	60	55	50

Additional goals of this project were to implement a software program to manage the pavement network, develop performance curves based on historical rates of pavement deterioration, forecast future pavement conditions, identify and recommend specific M&R actions to address the root cause of the documented pavement distress, and estimate the cost and ideal timing of the recommend M&R. The following tasks were performed in support of the project goals:

- Review record documents
- Define the pavement network
- Conduct an airfield condition survey
- Update the AIRPAV database & software
- Develop a 5-year airfield M&R work plan
- Report findings to INDOT

1.2 Description of Tasks Performed

1.2.1 Records Review

A detailed records review was performed to determine the airport’s construction history and the as-built cross section for each pavement feature. Plan sets for recent projects were provided to ARA in computer-aided design and drafting (CADD) format. Older plans sets were provided as hard copies or in portable electronic document (PDF) format.

1.2.2 Define Pavement Network

Prior to the field survey, a pavement network map was developed using available aerial photography and construction plans. The map was divided into facilities, features, and sample units. A facility is defined as a complete area of the airfield that is used for a particular type of operation. Facilities are typically named for complete functional elements of pavement, such as Runway 11-29, Taxiway A, or North Terminal Apron. After facilities are defined, they are divided into features based on pavement type, construction, structure, and usage. Note that the terms branch and section may be used interchangeably with facility and feature throughout this report.

Features are divided into sample units as prescribed by ASTM D5340-11, *Standard Test Method for Airport Pavement Condition Index Surveys*. A sample unit is a subdivision of a section used exclusively to aid in the inspection process and reduce the effort needed to determine distress quantities and the PCI. The specified sample unit size for an asphalt concrete (AC) pavement is $5,000 \text{ ft}^2 \pm 2,000 \text{ ft}^2$. Sample units on portland cement concrete (PCC) pavements contain 20 ± 8 slabs.

To allow users to search, sort, and identify airport pavement quickly, a numbering system is used in conjunction with the facility, feature, and sample unit convention. The format starts with facility, then feature, and finally identifies the sample unit. The number 1605.300 is parsed as an example in Figure 1-1. Most pavement references in this report are presented in this format.

Using statistical sampling methods, the PCI procedure provides a high confidence level in evaluating overall pavement condition while sampling only a portion of the pavement surface. Table 1-2. shows the network-level inspection density used on this project. Where appropriate, “additional sample units” were identified and inspected to record pavement areas with distress patterns not representative of the overall pavement condition. The unique distress types documented in additional sample units are not extrapolated across the entire feature.

As the surveyors inspected the pavement, they were mindful to ensure that the pre-survey airfield map depicted the actual pavement, otherwise known as a “ground-truth” survey. Noticeable differences between what was present in the field and what was displayed on the maps were adjusted by a CADD technician.

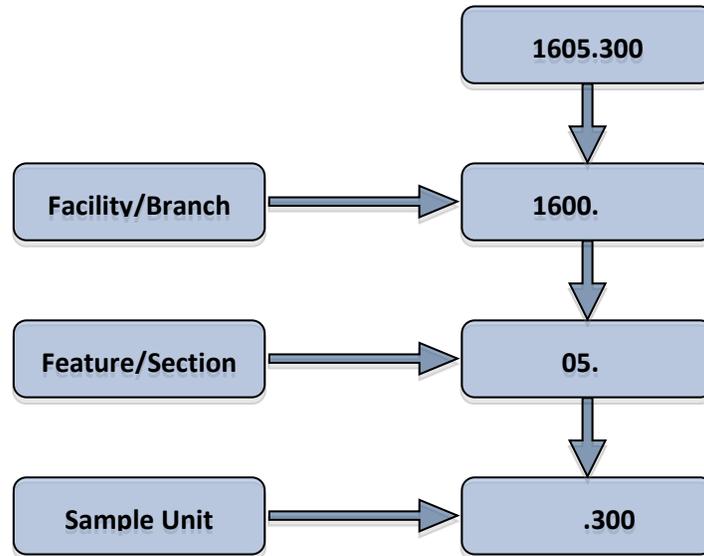


Figure 1-1. Pavement Numbering System

Table 1-2. Inspection Density

Sample Unit in Feature	Inspected Sample Units
1-2	ALL
3-4	2
5-7	3
8-10	4
11-14	5
15-19	6
20-25	7
26-30	8
31-37	9
38-45	10
46-55	11
56-80	12
> 80	15%

1.2.3 Conduct Airfield Condition Survey

The pavement condition surveys were performed in accordance with ASTM D5340-11. The procedure is based on the identification and measurement of visible distress at the pavement surface. Each PCI distress will deduct from the pavement's perfect condition of 100. Using pavement management software (or curves provided in ASTM D5340-11), a deduct value is determined for each combination of distress type, severity, and measured quantity. The PCI value is then determined from the unique combination of these variables.

A primary benefit of the PCI procedure is the ability to perform objective evaluations and compare pavement condition with an easy-to-understand numerical rating. Because the combined impact of multiple distresses is not cumulative, ASTM D5340-11 provides an additional family of curves to adjust for multiple distresses. The PCI is determined by applying the individual deduct value for each distress type along with any required correction factors to account for multiple distress types.

Figure 1-2. shows the relationship between PCI values, descriptive ratings, and typical repair actions. Generally, pavement maintenance is most cost-effective when the pavement is still in satisfactory condition. Rehabilitation, such as an asphalt mill and inlay, is typically performed for pavements with PCI values between 55 and 70. When the PCI value drops below 55, a mill and inlay may not provide the desired performance, and complete reconstruction often becomes the most cost-effective means of repairing the pavement.

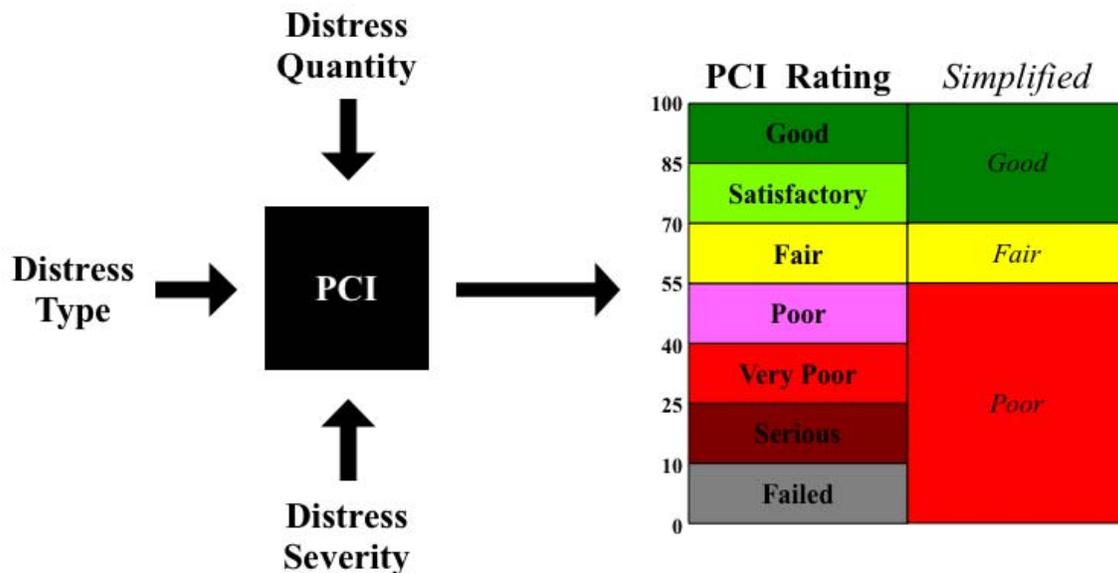


Figure 1-2. PCI Value and Descriptive Rating

1.2.4 Update AIRPAV Database & Software

The network definition, construction history, and data from the survey were entered into the AIRPAV pavement management system (APMS) software. After all data were entered, family curves were developed to model the change in pavement condition over time. These family curves are used to estimate future pavement condition. Typically, several curves are developed, with separate curves defined for different pavement surface types, such as AC, PCC, asphalt overlay on existing asphalt (ACC), and asphalt overlay on existing concrete (APC). The latest version of AIRPAV containing all survey data, deterioration curves, M&R policies, budgets, and construction history, was provided to INDOT on CD-ROM.

1.2.5 Develop 5-Year Airfield M&R Work Plans

A 5-year capital improvement program (CIP) was developed showing the year that each pavement feature was expected to fall below the MSL. The 5-year plan detailed in chapter 3 shows rehabilitation alternatives for each feature based on the PCI and the individual distress types observed during the pavement evaluation. The timing of each project is shown as the year that the PCI falls below the MSL and does not consider other important factors. Using reports like this for each airport in the State, INDOT engineers and planners develop a final 5-year statewide CIP plan that balances the sometimes conflicting priorities of pavement condition, operational constraints, construction staging considerations, and available funding.

1.2.6 Report Finding to INDOT

This report includes background information, PCI results and recommendations, and M&R budget scenarios. Photographs depicting typical pavement conditions observed during the survey are included in chapter 2. Appendix A contains general information about the AIRPAV pavement management software. Appendix B provides an analysis of each pavement section based on recorded distress. Appendix C contains a summary of general maintenance techniques and best practices. Appendix D provides a detailed summary of the airfield pavement condition. Appendix E describes common airfield distress types, and Appendix F contains exhibits to help the airport owner manage the airfield pavement system.

2. Pavement Condition Evaluation

2.1 Overview

Using statistical sampling methods, approximately one third of the total 3 million square feet of airside pavement was surveyed as part of this assessment. The average inspected PCI for all pavements was 81 (Satisfactory). The average inspected PCI for the runways, taxiways, and ramps were as follows: 79 (Satisfactory), 78 (Satisfactory), and 88 (Good). Table 2-1 provides a general description of the PCI rating categories, including a simplified rating scale of Good, Fair, and Poor. This table also shows the associated distress levels and general M&R requirements for each rating category.

Table 2-1. Definition and Distribution of PCI Ratings

Simplified PCI Rating	PCI Range	Definition	Pavement Area (ft ²)	Pavement Area (%)
Good	86-100	GOOD: Pavement has minor or no distresses and requires only routine maintenance.	749,341	25%
	71-85	SATISFACTORY: Pavement has scattered low-severity distresses that need only routine maintenance.	2,095,761	70%
Fair	56-70	FAIR: Pavement has a combination of generally low- and medium-severity distresses. M&R needs are routine to major in the near future.	112,625	4%
Poor	41-55	POOR: Pavement has low-, medium-, and high-severity distresses that probably cause some operational problems. Near-term maintenance and repair needs may range from routine up to a requirement for reconstruction.	44,900	1%
	26-40	VERY POOR: Pavement has predominantly medium- and high-severity distresses that cause considerable maintenance and operational problems. Near-term maintenance and repair needs will be intensive in nature.	-	-
	11-25	SERIOUS: Pavement has mainly high-severity distresses that cause operational restrictions; immediate repairs are needed.	-	-
	0-10	FAILED: Pavement deterioration has progressed to the point that safe operations are no longer possible; complete reconstruction is required.	-	-

Two pavement sections had simplified PCI ratings of Poor, indicating that major M&R may be needed. The pavement within each of the PCI condition categories is shown in Figure 2-1. The inspected PCI is summarized by branch use in Figure 2-2, and the photographs that follow provide examples of the condition categories.

LAFAYETTE - PURDUE UNIVERSITY AIRPORT
2012 PCI Inspection

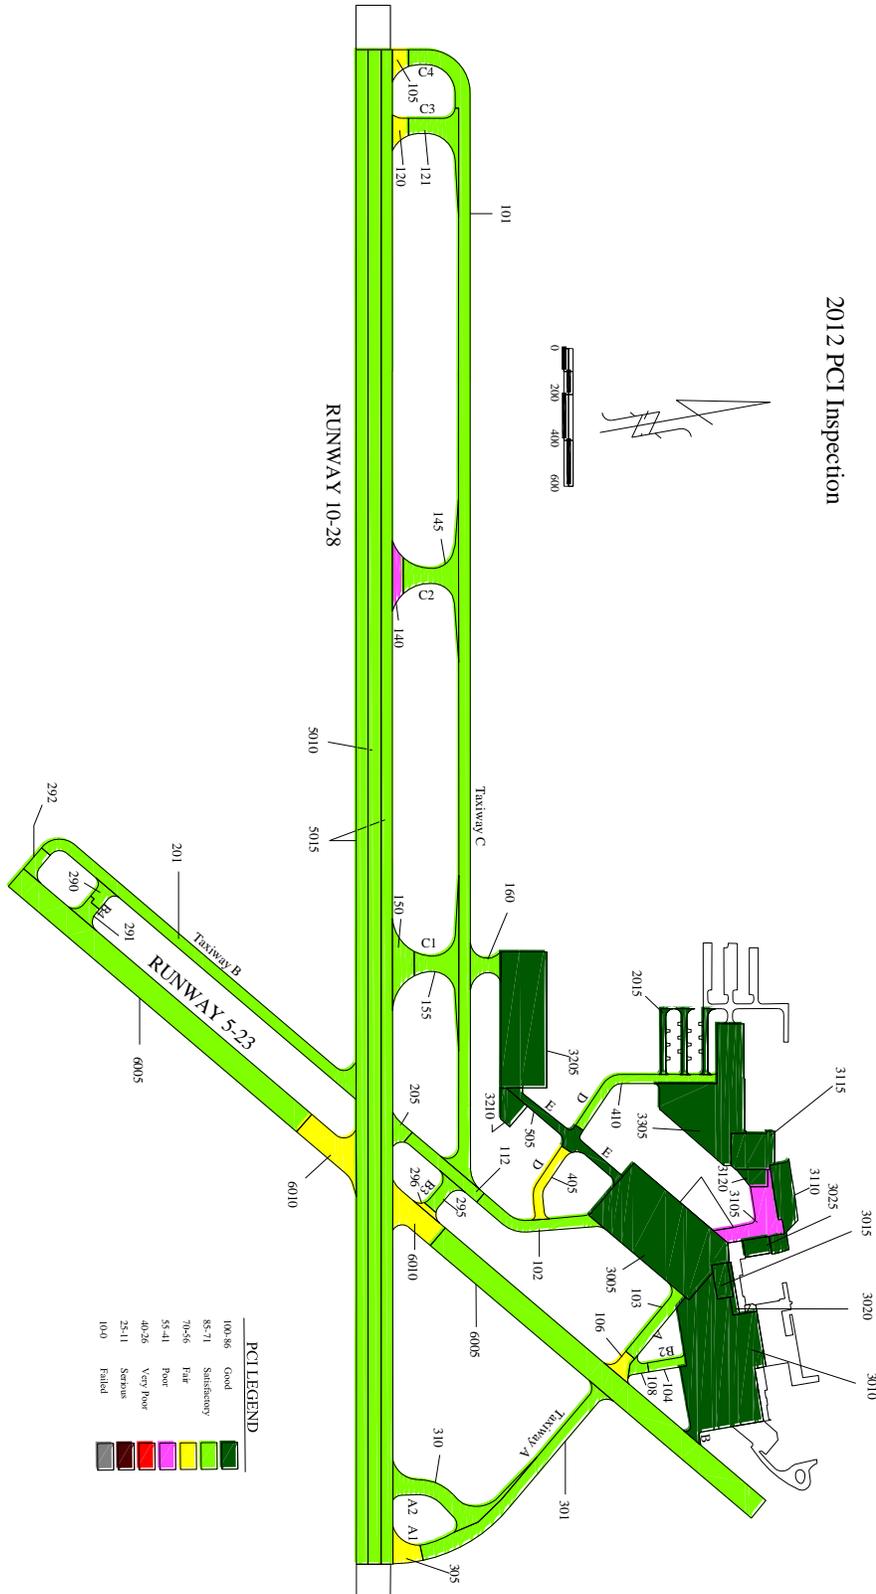


Figure 2-1. Inspected Pavement Condition

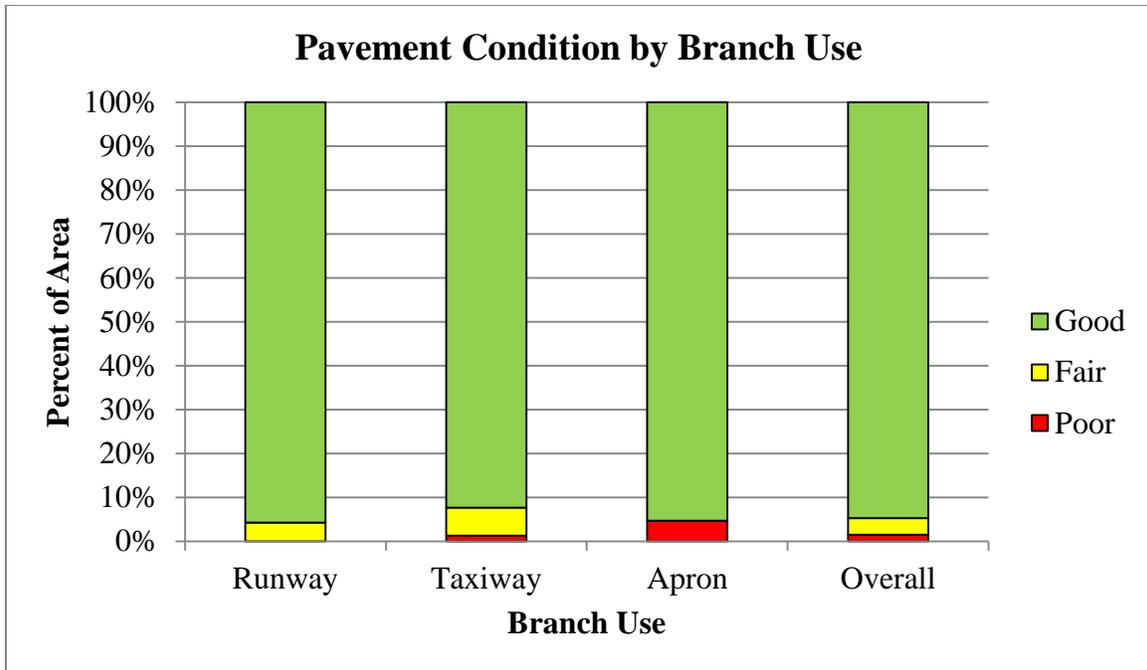


Figure 2-2. Pavement Condition by Branch Use



Figure 2-3. Typical Good PCC Pavement (Feature 3020)



Figure 2-4. Typical Good AC Pavement (Feature 2015)



Figure 2-5. Typical Satisfactory AAC Pavement (Feature 112)



Figure 2-6. Typical Fair AAC Pavement (Feature 6010)



Figure 2-7. Typical Poor AAC Pavement (Feature 140)

2.2 Distress Types and Frequency

The inspectors surveyed approximately 640,000 ft² of AC pavement. The frequency of each distress type is shown in Table 2-2. The most common distress types were longitudinal and transverse (L&T) cracking, weathering, alligator cracking and depressions. L&T cracking and weathering are climate-related distresses; alligator cracking is a load-related distress, and depressions are a construction and materials related distress.

Table 2-2. Distress Frequency in AC Pavement

Distress	Sample Units	% Inspected Sample Units
L&T CRACKING	133	99
WEATHERING	105	78
ALLIGATOR CRACKING	21	16
DEPRESSIONS	10	8
PATCHING	4	3
RAVELING	4	3
SWELL	2	2
OIL SPILLAGE	1	1

The inspectors surveyed approximately 200,000 ft² of PCC pavement. The frequency of each distress type is shown in Table 2-3. The most common rigid pavement distress types were joint seal damage and joint and corner spalls.

Table 2-3. Distress Frequency in PCC Pavement

Distress	Sample Units	% Inspected Sample Units	Slabs	% Inspected Slabs
JOINT SEAL DAMAGE	47	75.8	1,172	75.6
CORNER SPALLING	17	27.4	23	1.5
JOINT SPALLING	12	19.4	15	1
SETTLEMENT OR FAULTING	8	12.9	18	1.2
LONG/TRANS/DIAG CRACKS	3	4.8	6	0.4
SHRINKAGE CRACKS	2	3.2	5	0.3
PATCHING SMALL	1	1.6	1	0.1
PATCHING LARGE	1	1.6	2	0.1

2.3 PCI Summary

The branch and section PCI values are shown below, along with the surface type, area, and last year construction occurred.

Table 2-4. PCI Results

Branch	Branch PCI	Section	Surface	Area (sf)	Built	2009 PCI	2012 PCI
100 (Twy A)	76	101	AC/AC	263,602	2001	79	77
		102	AC	27,300	2002	91	85
		103	AC/AC	18,000	2004	90	84
		104	AC/AC	6,900	2004	84	80
		105	AC/AC	7,425	1996	66	62
		106	AC/AC	7,000	2001	77	70
		108	AC/AC	5,675	2001	80	74
		112	AC/AC	20,500	2001	80	78
		120	AC/AC	7,500	1996	66	57
		121	AC/AC	22,745	2001	71	72
		140	AC/AC	10,500	1996	65	47
		145	AC/AC	30,200	2001	72	73
		150	AC/AC	18,500	1996	70	72
		155	AC/AC	25,500	2001	83	72
200 (Twy B)	82	201	AC/AC	89,933	2005	93	85
		205	AC/AC	7,600	1996	78	74
		290	AC/AC	6,800	2005	90	84
		291	AC/AC	6,800	2001	77	73
		292	AC	6,500	2001	88	84
		295	AC/AC	8,400	2001	74	71
		296	AC/AC	2,200	2001	75	63
300 (Twy)	80	301	AC/AC	59,000	2005	88	85
		305	AC/AC	12,000	1996	57	61
		310	AC/AC	38,000	2005	85	79
400 (Twy D)	73	405	AC/AC	15,000	2002	79	68
		410	AC	28,000	2002	88	76
500 (Twy E)	93	505	PCC	25,850	1990	97	93
2000 (T-Hangars)	88	2015	AC	18,660	2001	89	88

Table2-4. PCI Results (cont.)

Branch	Branch PCI	Section	Surface	Area (sf)	Built	2009 PCI	2012 PCI
3000 (Terminal Ramp)	89	3005	PCC	170,716	1995	90	87
		3010	PCC	188,801	1990	92	90
		3015	PCC	12,750	2004	100	100
		3020	PCC	4,650	2005	100	100
		3025	PCC	8,600	2007	100	100
3100 (GA Ramp)	78	3105	AC	34,400	2001	70	51
		3110	AC	29,424	2007	100	86
		3115	PCC	29,655	2007	100	99
		3120	PCC	7,915	1980	91	90
3200 (FBO Ramp)	92	3205	PCC	120,000	1990	95	91
		3210	PCC	11,820	2009	-	100
3300 (Purdue Ramp)	89	3305	PCC	120,500	1980	92	89
5000 (Rwy 10-28)	81	5010	AC	377,781	1996	75	77
		5015	AC	665,525	1996	79	83
6000 (Rwy 5-23)	73	6005	AC/AC	350,500	2001	82	74
		6010	AC/AC	61,500	2001	75	67

2.3.1 Sections with PCI increase since last inspection

In 2010 ASTM revised the PCI procedure by adding the rigid pavement distress type Alkali-Silica Reaction (ASR), and separating the flexible pavement distress type Weathering / Raveling into two separate distress types: Weathering (loss of asphalt binder) and Raveling (loss of aggregate). These changes updated PCI distress deduct values and can cause inconsistencies when comparing PCI data collected with the current ASTM to data collected with the pre-2010 methodology.

The minor increase in PCI for sections 121, 145, 150, 160, and 305 was due to changes in the ASTM procedure described above. The increase in PCI for sections 5010 and 5015 was due to a combination of the ASTM changes as well as recent airport maintenance.

2.4 Analysis Commentary

The following pages provide a brief overview of the 2012 inspected pavement conditions for each facility. Comments are based primarily on the AIRPAV analysis but also include field notes and remarks from the pavement condition inspectors. Where appropriate, individual pavement sections are referenced within the larger facility.

2.4.1 Runways

Runway 5-23 consisted of 2 sections of AAC pavement. The runway had a total area of 412,000 ft² with an area-weighted average PCI of 73 (Satisfactory). Runway 10-28 consisted of 2 sections of AC pavement. The runway had a total area of 1,043,306 ft² with an area-weighted average PCI of 81 (Satisfactory). The most common runway distresses were L&T cracking and weathering.

Table 2-5. Runway Condition Distribution

PCI Range	Rating	Number of Sections	Pavement Area (ft ²)	Pavement Area (%)
100-71	Good	3	1,393,806	96
70-56	Fair	1	61,500	5
55-0	Poor	-	-	-

2.4.2 Taxiways

The taxiways consisted of several branches containing 29 sections of AC, AAC and PCC pavement. The total area of the taxiways was 808,900 ft². The area-weighted average PCI was 78 (Satisfactory). The distribution of taxiway pavement area and sections by PCI range is shown in Table 2-6.

Table 2-6. Taxiway Condition Distribution

PCI Range	Rating	Number of Sections	Pavement Area (ft ²)	Pavement Area (%)
100-71	Good	21	746,465	93
70-56	Fair	6	51,125	6
55-0	Poor	1	10,500	1

2.4.3 Aprons

The aprons consisted of 12 sections of AC and PCC pavement. The total area of apron pavements was 739,231 ft², and the area-weighted average PCI was 88 (Good). The distribution of pavement area and sections by PCI range are shown in Table 2-7.

Table 2-7. Apron Condition Distribution

PCI Range	Rating	Number of Sections	Pavement Area (ft ²)	Pavement Area (%)
100-71	Good	12	704,831	95
70-56	Fair	-	-	-
55-0	Poor	1	34,400	5

3. Capital Improvement Program

3.1 Analysis

The individual feature analyses shown in appendix B document viable rehabilitation projects that address the causes of each pavement section failure while restoring the pavement to a condition above the desired MSL. The recommended timing of each improvement action is defined as the year that the pavement condition is projected to reach the MSL. By establishing benchmark MSL targets, it is possible to plan objectively for future needs against a standard set of performance criteria. This section categorizes the identified viable options into CIP strategies based on cost and expected service life.

The airport may find it desirable to adjust the timing of projects detailed in the CIP to meet fiscal and operational constraints. For example, if different sections of a runway were projected to reach the MSL in various years ranging from 2013 to 2015, it is not operationally feasible to stage rehabilitation over a 3-year period. Instead, runway rehabilitation would be programmed in a manner that balanced the need to minimize the length of the runway closure while maximizing the remaining service life.

3.2 Cost Estimates

Project costs were estimated based on the pavement area and the unit costs shown in Table 3-1 for specific M&R activities. Project costs are presented so planners and managers can compare the relative magnitude of funding required for various alternatives. The two-page AIRPAV feature analysis (see appendix B) provides cost estimates for each identified project. These cost estimates are for planning purposes only and do not constitute an engineering estimate.

Furthermore, these costs estimates represent the improvement of existing pavement structures and associated incidental work only. Other potential project line items, such as lighting, navigational aids, and drainage modifications are not included, and estimates for those items must be developed separately and incorporated into an overall project cost.

Typical examples of work that might be included in alternatives evaluated by AIRPAV are outlined on the following pages. These example projects would meet the requirements for each selected option; however, the descriptions are not intended to imply required, or even preferred, design configurations. Rehabilitation decisions, such as overlay thickness design, should be made in conjunction with engineering design analysis.

Table 3-1. Unit Costs

Rigid Pavement (PCC)	
Reconstruction	\$12.65 /sf
Slab Replacement & Full Depth Patching	\$12.24 /sf
Patching (Partial Depth)	\$16.37 /sf
Slab Repair & Overlay	\$4.60 /sf + \$0.40 /sf/in > 4"
Joint Seal Replacement	\$2.20 /lf
Joint Seal Repair	\$0.85 /lf
Undersealing	\$4.08 /sf
Flexible Pavement (AC)	
Reconstruction	\$5.25 /sf
Resurfacing	\$1.41 /sf
Structural Overlay	\$2.21 /sf + \$0.40 /sf/in > 4"
Surface Treatment	\$0.38 /sf
Patching	\$9.74 /sf
Crack Repair (Restorative)	\$1.22 /lf
Crack Repair (Sustaining)	\$0.85 /lf

3.2.1 Rigid Pavement Work Descriptions

The following descriptions provide additional information about the typical work items covered by the unit costs shown in Table 3-1.

3.2.1.1 Reconstruction

Reconstruction is recommended when the pavement defects would not be corrected by less extensive measures. Unit prices assume removal of the existing pavement to the subgrade and reconstruction with 8 inches of high strength PCC pavement on 6 inches of aggregate subbase.



3.2.1.2 Repair and Overlay

This procedure usually consists of a crack and seat process, where the existing pavement is broken into segments of approximately 2 ft on a side by dropping a heavy breaker bar onto the pavement. Properly done, aggregate interlock between pavement segments is retained and reflective cracking is reduced. A flexible surface is then placed over the recycled PCC base.



3.2.1.3 Slab Replacement

Slab replacements are typically required for high-severity blow ups, scaling, and shattered slabs. Unit prices assume removal of the selected slab to the subgrade. Prepare subgrade to bearing strength equivalent to surrounding subgrade. Provide subbase support equivalent to existing and install load transfer steel as required. Place PCC pavement level with existing surface.



3.2.1.4 Patching (Partial Depth)

While partial depth patching is most commonly used to repair joint and corner spalls, it is effective for a wide variety of distress types. Saw cut and remove area of pavement to sound concrete above reinforcing steel. Treat existing concrete to ensure firm bond. Place PCC level with existing surface.



3.2.1.5 Joint Seal Replacement

Rout joints and cracks to a depth of at least 1-1/4 inches, clean joint wall surfaces to expose fresh vital concrete, install backing rope, and apply rubberized sealant meeting ASTM D3405 specification, or equivalent.



3.2.1.6 Joint Seal Repair

Press existing sealant into joint for use as backer material; apply joint sealant meeting ASTM D3405 specification, or equivalent.

3.2.1.7 Undersealing

Undersealing is used to repair faulting between slabs or when corner breaks have settled relative to the slab. High-pressure injection is used to force material into the underlying voids and continues until the settled pavement is restored to its original elevation. Several materials have been used for undersealing, including cement grout, asphalt slurries, and proprietary formulations of expansive Styrofoam.



3.2.2 Flexible Pavement Work Descriptions

3.2.2.1 Reconstruction

Reconstruction is recommended when the pavement defects would not be corrected by less extensive measures. Unit prices assume removal of existing pavement to subgrade. Scarify and compact subgrade to 6-inch depth. Construct 4 inches of P401 AC surface course on 8 inches of aggregate base course.



3.2.2.2 Resurfacing

Resurfacing assumes a nominal 2-inch asphalt mill and inlay on existing prepared pavement.



3.2.2.3 Structural Overlay

Structural overlays are used to address load related distress or to increase pavement load bearing capacity. Apply a 4-inch AC overlay on existing prepared pavement. Add additional thickness as needed to achieve required strength.

3.2.2.4 Surface Treatment

Apply a high-quality, penetrating rejuvenating sealer. Surface treatments are a cost effective way to address weathering and raveling. They perform best when applied to pavement that is still in fair to satisfactory condition.



3.2.2.5 Patching

Apply a high-quality, penetrating rejuvenating sealer.

3.2.2.6 Crack Repair (Restorative)

Apply a high-quality, penetrating rejuvenating sealer. This is typically a large project with significant prep work.

3.2.2.7 Crack Repair (Sustaining)

Apply a high-quality, penetrating rejuvenating sealer. This is typically spot repairs of existing crack sealant.



3.3 Capital Improvement Strategies

Figure 3-1 shows a projection of the overall airport pavement condition for the next 10 years based on implementing one of three capital improvement strategies:

- No Action: No capital improvement action is undertaken
- Longest Life: The most comprehensive repair and longest life rehabilitation option
- Lowest Cost: The rehabilitation option with the projected lowest annual cost

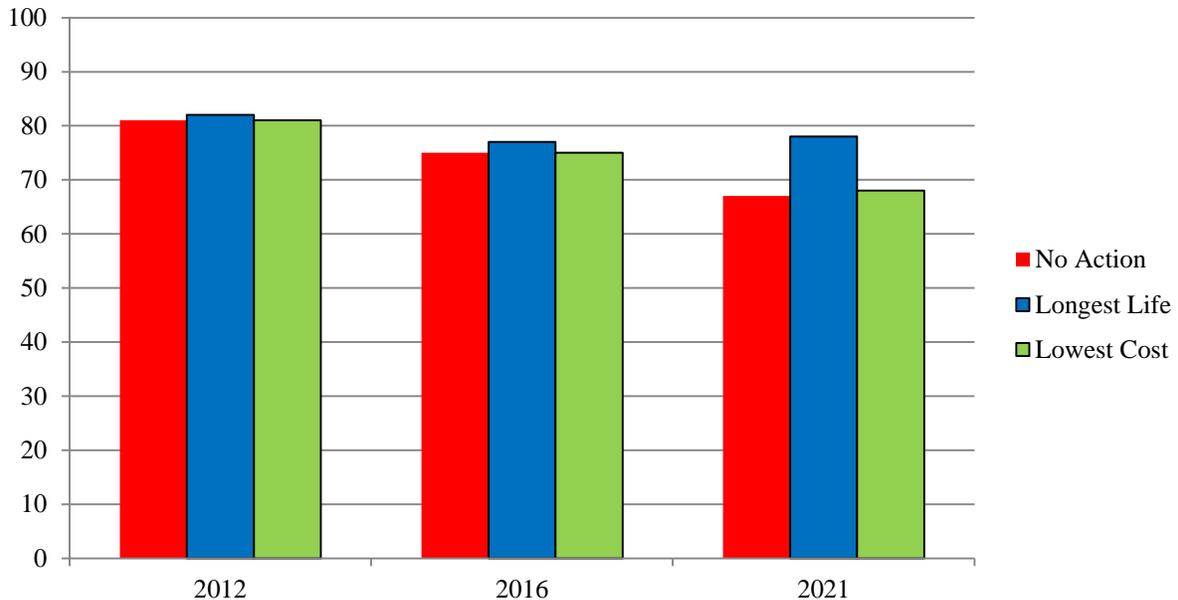


Figure 3-1. Programmed CIP

The longest life CIP scenario is projected to cost approximately **\$1.4 million** over the next 10 years. The lowest annual cost scenario is projected to cost approximately **\$430,000** over the next 10 years. Examples of each capital improvement strategy and a complete listing of all viable capital projects are presented in Table 3-2 through Table 3-4.

Table 3-2. Most Comprehensive Repair

Feature	Built	Description	Action Yr	Work Item	Cost, \$
105	1996	TAXIWAY C	2014	Resurfacing	10,469
106	2001	TAXIWAY A	2019	Resurfacing	9,869
120	1996	TAXIWAY C-3	2012	Structural Overlay	16,574
121	2001	TAXIWAY C-3	2021	Resurfacing	32,070
140	1996	TAXIWAY C-2	2012	Resurfacing	14,804
150	1996	TAXIWAY C-1	2020	Resurfacing	26,084
155	2001	TAXIWAY C-1	2021	Resurfacing	35,954
205	1996	TAXIWAY B	2021	Resurfacing	10,715
295	2001	TAXIWAY B-3	2020	Resurfacing	11,843
296	2001	TAXIWAY B-3	2014	Resurfacing	3,101
305	1996	TAXIWAY A	2013	Resurfacing	16,919
405	2002	TAXIWAY D	2016	Resurfacing	21,149
3105	2001	TAXILANE	2012	Structural Overlay	76,023
5010	1996	RUNWAY 10-28 KEEL	2021	Resurfacing	532,671
6005	2001	RUNWAY 5-23	2019	Resurfacing	494,204
6010	2001	RUNWAY 5-23	2014	Resurfacing	86,714
				Total	1,399,163

Table 3-3. Lowest Annual Cost Repair

Feature	Built	Description	Action Yr	Work Item	Cost, \$
105	1996	TAXIWAY C	2014	Crack Repair	201
106	2001	TAXIWAY A	2019	Surface Treatment	2,771
120	1996	TAXIWAY C-3	2012	Surface Treatment	3,101
121	2001	TAXIWAY C-3	2021	Surface Treatment	9,205
140	1996	TAXIWAY C-2	2012	Resurfacing	14,804
150	1996	TAXIWAY C-1	2020	Surface Treatment	7,676
155	2001	TAXIWAY C-1	2021	Crack Repair	1,393
205	1996	TAXIWAY B	2021	Surface Treatment	3,002
295	2001	TAXIWAY B-3	2020	Surface Treatment	3,217
296	2001	TAXIWAY B-3	2014	Surface Treatment	855
305	1996	TAXIWAY A	2013	Crack Repair	932
405	2002	TAXIWAY D	2016	Crack Repair	1,077
3105	2001	TAXILANE	2012	Structural Overlay	76,023
5010	1996	RUNWAY 10-28 KEEL	2021	Surface Treatment	145,706
6005	2001	RUNWAY 5-23	2019	Surface Treatment	137,479
6010	2001	RUNWAY 5-23	2014	Surface Treatment	23,369
				Total	430,811

Table 3-4. All Viable Options

Feature	Built	Description	Action Yr	Work Item	Cost, \$
105	1996	TAXIWAY C	2014	Resurfacing	10,469
105	1996	TAXIWAY C	2014	Surface Treatment	2,928
105	1996	TAXIWAY C	2014	Crack Repair	201
106	2001	TAXIWAY A	2019	Resurfacing	9,869
106	2001	TAXIWAY A	2019	Surface Treatment	2,771
106	2001	TAXIWAY A	2019	Crack Repair	625
120	1996	TAXIWAY C-3	2012	Structural Overlay	16,574
120	1996	TAXIWAY C-3	2012	Surface Treatment	3,101
121	2001	TAXIWAY C-3	2021	Resurfacing	32,070
121	2001	TAXIWAY C-3	2021	Surface Treatment	9,205
121	2001	TAXIWAY C-3	2021	Crack Repair	2,103
140	1996	TAXIWAY C-2	2012	Resurfacing	14,804
140	1996	TAXIWAY C-2	2012	Surface Treatment	4,702
150	1996	TAXIWAY C-1	2020	Resurfacing	26,084
150	1996	TAXIWAY C-1	2020	Surface Treatment	7,676
150	1996	TAXIWAY C-1	2020	Crack Repair	2,091
155	2001	TAXIWAY C-1	2021	Resurfacing	35,954
155	2001	TAXIWAY C-1	2021	Surface Treatment	10,271
155	2001	TAXIWAY C-1	2021	Crack Repair	1,393
205	1996	TAXIWAY B	2021	Resurfacing	10,715
205	1996	TAXIWAY B	2021	Surface Treatment	3,002
205	1996	TAXIWAY B	2021	Crack Repair	477
295	2001	TAXIWAY B-3	2020	Resurfacing	11,843
295	2001	TAXIWAY B-3	2020	Surface Treatment	3,217
296	2001	TAXIWAY B-3	2014	Resurfacing	3,101
296	2001	TAXIWAY B-3	2014	Surface Treatment	855
296	2001	TAXIWAY B-3	2014	Crack Repair	235
305	1996	TAXIWAY A	2013	Resurfacing	16,919
305	1996	TAXIWAY A	2013	Surface Treatment	4,927
305	1996	TAXIWAY A	2013	Crack Repair	932
405	2002	TAXIWAY D	2016	Resurfacing	21,149
405	2002	TAXIWAY D	2016	Surface Treatment	6,209
405	2002	TAXIWAY D	2016	Crack Repair	1,077
3105	2001	TAXILANE	2012	Structural Overlay	76,023
3105	2001	TAXILANE	2012	Surface Treatment	14,359
5010	1996	RUNWAY 10-28 KEEL	2021	Resurfacing	532,671
5010	1996	RUNWAY 10-28 KEEL	2021	Surface Treatment	145,706
5010	1996	RUNWAY 10-28 KEEL	2021	Crack Repair	26,054
6005	2001	RUNWAY 5-23	2019	Resurfacing	494,204
6005	2001	RUNWAY 5-23	2019	Surface Treatment	137,479
6005	2001	RUNWAY 5-23	2019	Crack Repair	27,245
6010	2001	RUNWAY 5-23	2014	Resurfacing	86,714
6010	2001	RUNWAY 5-23	2014	Surface Treatment	23,369
6010	2001	RUNWAY 5-23	2014	Crack Repair	5,719

4. Maintenance Management Program

4.1 General Comments

Most pavement distress is classified by severity (low, medium, or high). As a general rule, high-severity distresses should be patched, and medium-severity distress should be sealed. A detailed matrix of recommended maintenance policies to address various distress types is provided near the end of this section.

4.1.1 Inspected Crack Severity

Of the inspected pavement, 69 percent of the cracks were rated at low severity and require no maintenance beyond ongoing inspection and spot repair. About 27 percent of the cracks were rated at medium severity and would benefit from sealing and repair. Approximately 5 percent of the cracks were rated at high severity and warrant patching to maintain safe operations.

4.1.2 Other Distress

In asphalt pavement, area measured distresses such as rutting, depressions, fatigue cracks, and raveling were recorded at low severity levels 42 percent of the time, medium severity 56 percent of the time, and high severity 2 percent of the time.

Joint seal damage was recorded on 76 percent of the inspected PCC slabs. When identified, joint seal damage severity levels were recorded as follows: 21 percent at low severity, 79 percent at medium severity, and 0 percent at high severity.

4.2 Recommended Maintenance Actions

The following illustrations and tables show pavement areas that have maintenance and repair needs. Ongoing development of capital improvement projects may address some of these maintenance needs. To help budgeting and prevent duplication of effort, all pavement features recommended for maintenance should be compared to planned improvements prior to finalizing a maintenance program strategy.

Table 4-1. Recommend Maintenance Actions

Work Item	Quantity	Unit	Cost
AC PATCH	1,368	SF	\$11,643
AC RESTORATIVE CRACK REPAIR	32,883	LF	\$40,117
AC SUSTAINING CRACK REPAIR	7,261	LF	\$6,188
PCC PATCHING	559	SF	\$9,164
PCC RESTORATIVE SEAL REPAIR	96,561	LF	\$212,436
Total:			\$ 279,548

In the following tables, pavement features shown in **grey** text cannot be raised above MSL via maintenance alone, and need only be included in a maintenance plan to provide continued safety or serviceability until their programmed major rehabilitation is implemented.

4.2.1 Patching

Table 4-2. Recommend AC Patching

Feature	Work Item	Amount	Insp. PCI	Change	Est. PCI
101	AC PATCH	31	77	1	78
105	AC PATCH	29	62	14	76
120	AC PATCH	24	57	11	68
140	AC PATCH	60	47	15	62
155	AC PATCH	78	72	7	79
305	AC PATCH	21	61	11	72
310	AC PATCH	22	79	1	80
3105	AC PATCH	960	51	3	54
5010	AC PATCH	75	77	-	77
6005	AC PATCH	16	74	2	76
6010	AC PATCH	50	67	12	79
	TOTAL:	1,368	S.F.		
EQUIPMENT: SAW, AIR COMPRESSOR, HEATING KETTLE, HAND TOOLS					
EST. MATERIALS: 17 TONS ASPHALT PATCH					
EST. MATERIAL COST: \$1,672					
EST. CREW HOURS: 39.1					
EST. CREW COST: \$9,970					
EST. PROJECT COST: \$11,643					

Table 4-3. Recommend PCC Patching

Feature	Work Item	Amount	Insp. PCI	Change	Est. PCI
505	PCC PATCHING	17	93	-	93
3005	PCC PATCHING	45	87	-	87
3010	PCC PATCHING	206	90	2	92
3115	PCC PATCHING	5	99	-	99
3120	PCC PATCHING	2	90	-	90
3205	PCC PATCHING	149	91	2	93
3305	PCC PATCHING	132	89	2	91
	TOTAL:	559	S.F.		
EQUIPMENT: SAW, AIR COMPRESSOR, JACK HAMMER, MIXER, HAND TOOLS					
EST. MATERIALS: 11 CUBIC YARDS CONCRETE MIX					
EST. MATERIAL COST: \$1,437					
EST. CREW HOURS: 56.0					
EST. CREW COST: \$7,727					
EST. PROJECT COST: \$9,164					

4.2.2 Crack Seal

Table 4-4. Recommend AC Restorative Crack Repair

Feature	Work Item	Amount	Insp. PCI	Change	Est. PCI
101	AC RESTORATIVE CRACK REPAIR	12,802	77	4	81
103	AC RESTORATIVE CRACK REPAIR	372	84	9	93
104	AC RESTORATIVE CRACK REPAIR	177	80	9	89
105	AC RESTORATIVE CRACK REPAIR	165	62	2	64
108	AC RESTORATIVE CRACK REPAIR	443	74	2	76
120	AC RESTORATIVE CRACK REPAIR	360	57	-	57
121	AC RESTORATIVE CRACK REPAIR	1,724	72	2	74
140	AC RESTORATIVE CRACK REPAIR	1,374	47	3	50
145	AC RESTORATIVE CRACK REPAIR	2,220	73	3	76
150	AC RESTORATIVE CRACK REPAIR	1,714	72	2	74
155	AC RESTORATIVE CRACK REPAIR	1,097	72	4	76
201	AC RESTORATIVE CRACK REPAIR	1,972	85	8	93
301	AC RESTORATIVE CRACK REPAIR	1,237	85	8	93
305	AC RESTORATIVE CRACK REPAIR	764	61	6	67
310	AC RESTORATIVE CRACK REPAIR	1,057	79	11	90
405	AC RESTORATIVE CRACK REPAIR	883	68	6	74
410	AC RESTORATIVE CRACK REPAIR	1,242	76	4	80
3105	AC RESTORATIVE CRACK REPAIR	2,049	51	6	57
6010	AC RESTORATIVE CRACK REPAIR	1,231	67	2	69
	TOTAL:	32,883	L.F.		
EQUIPMENT: AIR COMPRESSOR, HEATING KETTLE, HAND TOOLS					
EST. MATERIALS: 6,577 POUNDS ASTM D3405 SEALANT OR EQUIVALENT					
EST. MATERIAL COST: \$6,576					
EST. CREW HOURS: 164.4					
EST. CREW COST: \$33,540					
EST. PROJECT COST: \$40,117					

Table 4-5. Recommend AC Sustaining Crack Repair

Feature	Work Item	Amount	Insp. PCI	Change	Est. PCI
102	AC SUSTAINING CRACK REPAIR	147	85	-	85
106	AC SUSTAINING CRACK REPAIR	76	70	-	70
112	AC SUSTAINING CRACK REPAIR	173	78	-	78
160	AC SUSTAINING CRACK REPAIR	80	78	-	78
205	AC SUSTAINING CRACK REPAIR	58	74	-	74
290	AC SUSTAINING CRACK REPAIR	39	84	-	84
292	AC SUSTAINING CRACK REPAIR	36	84	-	84
296	AC SUSTAINING CRACK REPAIR	28	63	-	63
2015	AC SUSTAINING CRACK REPAIR	75	88	-	88
5010	AC SUSTAINING CRACK REPAIR	3,195	77	-	77
6005	AC SUSTAINING CRACK REPAIR	3,348	74	-	74
	TOTAL:	7,261	L.F.		
EQUIPMENT: AIR COMPRESSOR, HEATING KETTLE, HAND TOOLS					
EST. MATERIALS: 1,452 POUNDS ASTM D3405 SEALANT OR EQUIVALENT					
EST. MATERIAL COST: \$1,452					
EST. CREW HOURS: 31.6					
EST. CREW COST: \$4,735					
EST. PROJECT COST: \$6,188					

Table 4-6. Recommend PCC Restorative Crack Repair

Feature	Work Item	Amount	Insp. PCI	Change	Est. PCI
505	PCC RESTORATIVE SEAL REPAIR	6,049	93	3	96
3010	PCC RESTORATIVE SEAL REPAIR	39,153	90	8	98
3120	PCC RESTORATIVE SEAL REPAIR	1,639	90	1	91
3205	PCC RESTORATIVE SEAL REPAIR	24,880	91	7	98
3305	PCC RESTORATIVE SEAL REPAIR	24,839	89	3	92
	TOTAL:	96,561	L.F.		
EQUIPMENT: ROUTER, SAND BLASTER, AIR COMPRESSOR, HEATING KETTLE, HAND TOOLS					
EST. MATERIALS: 19,312 POUNDS ASTM D3405 SEALANT OR EQUIVALENT					
EST. MATERIAL COST: \$48,280					
EST. CREW HOURS: 804.7					
EST. CREW COST: \$164,155					
EST. PROJECT COST: \$212,436					

4.3 Pavement Deterioration

Before attempting maintenance and repairs, it helps to understand pavement performance and pavement deterioration. The factors that contribute most to deterioration are environmental, materials, and/or load related. Brief discussions of each are presented in the following sections.

4.3.1 Environmental/Age-Related Deterioration

Seasonal and daily temperature changes cause expansion and contraction of the pavement materials. The shear stresses created by expansion and contraction can cause transverse cracking in flexible pavement and mid-slab cracking in rigid pavement. Further, expansion and contraction will cause cracks, and rigid pavement joints, to open and close with changes in temperature.

Flexible pavement oxidizes as it ages, losing its lighter, volatile, components and becoming brittle with time. Surface treatments and seal coats are designed, in part, to provide a protective barrier and prevent this type of oxidation.

Subsurface water can have the greatest impact on pavement deterioration. A wet subgrade greatly reduces the ability of a pavement to support wheel loads, and the results often show up as rutting and cracking of flexible pavement. The fine materials in a wet base can be pumped up through the cracks and eventually result in a loss of support. This loss of support can be evidenced as corner breaks and faulting in rigid pavement. Moisture inside a pavement system expands when it freezes, creating stresses that cause the pavement surface to heave. Subsequent freeze-thaw cycles leave voids in the pavement structure that enable further rutting and breaking. Repeated freeze-thaw cycles eventually cause the pavement to disintegrate. Freeze-thaw deterioration requires frost-susceptible material, sub-zero temperatures, and water. If we remove one of these factors, freeze-thaw damage will not occur. One of the best ways to ensure pavement longevity is to provide drainage and keep it dry.

4.3.2 Materials-Related Deterioration

The pavement thickness and type of subgrade play a large role in the formation and spacing of transverse cracks. If the subgrade and base materials are smooth or rounded and allow for relatively free movement of the pavement surface, transverse cracks will often be spaced far apart (>60 feet). If the subgrade and base material are rough or angular and provide greater resistance to movement of the pavement surface, transverse cracks will be spaced more closely (<40 feet). The distance between transverse cracks also depends on the pavement thickness, as a thicker pavement can resist cracking for longer lengths. At general aviation airport pavements, around 50 feet is typical transverse crack spacing.

Aggregate is the biggest component of any pavement structure, and it is the contact between the aggregate particles that actually transfers the load and provides the strength. Aggregate durability and shape are major factors affecting pavement performance. Durability is the ability of the aggregate to perform satisfactorily over time and resist deterioration. Sharp, well-angled aggregates that interlock, compact densely, and resist movement are the most desirable.

In flexible pavement, the selection of asphalt cement can have a significant impact on pavement performance. Asphalt is visco-elastic, which means it is stiff at low temperatures and flows at high temperatures. With this in mind, we expect asphalt pavement to remain stiff on hot summer days to resist plastic deformation (rutting and shoving). In addition, we expect asphalt pavement to have

sufficient cold temperature flexible on cold winter days to resist transverse cracking. The proper selection of asphalt cement grade and maintaining adequate mix volumetrics (air voids, voids in the mineral aggregate, etc.) are key factors in the performance of flexible pavement.

As water freezes, it expands and occupies a greater volume than in a liquid state. In PCC pavement, interconnected, well-distributed air voids are required to allow for expansion of moisture with the PCC. PCC mixes with insufficient air entrainment are susceptible to freeze-thaw damage, as the expansive forces have been shown to cause concrete deterioration. Small, closely spaced, interconnected air voids provide the greatest degree of protection.

Asphalt paving mixes also require air voids, but for reasons different than for PCC pavement. When a well-constructed asphalt pavement is subjected to vehicle loading, it will nevertheless experience some minor secondary consolidation. Air voids allow for the safe movement of the asphalt binder within the mix. With insufficient air voids, the asphalt binder will migrate to the surface of the pavement—it will in essence, get squeezed out of the mix. This phenomenon is called flushing. In addition, these mixes become unstable and are prone to rutting in the wheel paths.


However, if the air voids become too high, air and water can penetrate the pavement, reducing both durability and flexibility. Air infiltration will accelerate oxidization of the binder, while water penetration will increase the moisture susceptibility of the mix (i.e., stripping of the asphalt cement from the aggregate). Air voids in flexible pavement should be kept low enough to prevent water and air from penetrating the asphalt layers, but high enough to minimize the potential of plastic deformation.

Regardless of whether the pavement binder is AC or PCC, binder materials are mixed with aggregate to coat all aggregate particles with a thin binder film. Durability of flexible asphalt pavement is increased with a thicker binder film, and the pavement becomes more resistant to age hardening; however, if the film is too thick, the asphalt acts like a lubricant, promoting ruts, shoving, and bleeding. Each asphalt mix should be customized for materials available locally.

With a concrete pavement, aggregate interlock supports the wheel loads, and the hydrated cement binder further interlocks the aggregate particles to inhibit all movement. “Hydration” is the term for the chemical reaction of portland cement with water. In the hydration process, dry cement particles react with water to form gels, and then crystals, that grow and bond with the aggregate and form a rigid interlocking structure. Hydration can continue for years, but much of the ultimate strength will be reached within 28 days. Hydration is a sensitive chemical process. Typically, any admixtures used to accelerate the hydration process will reduce durability, and admixture use should be considered carefully or avoided.

4.3.3 Load-Related Deterioration

As illustrated below, rigid and flexible pavements differ in the way loads are distributed. A concrete slab resists bending and transfers loads evenly, while an asphalt pavement is designed to bend, gradually spreading loads over wider areas.

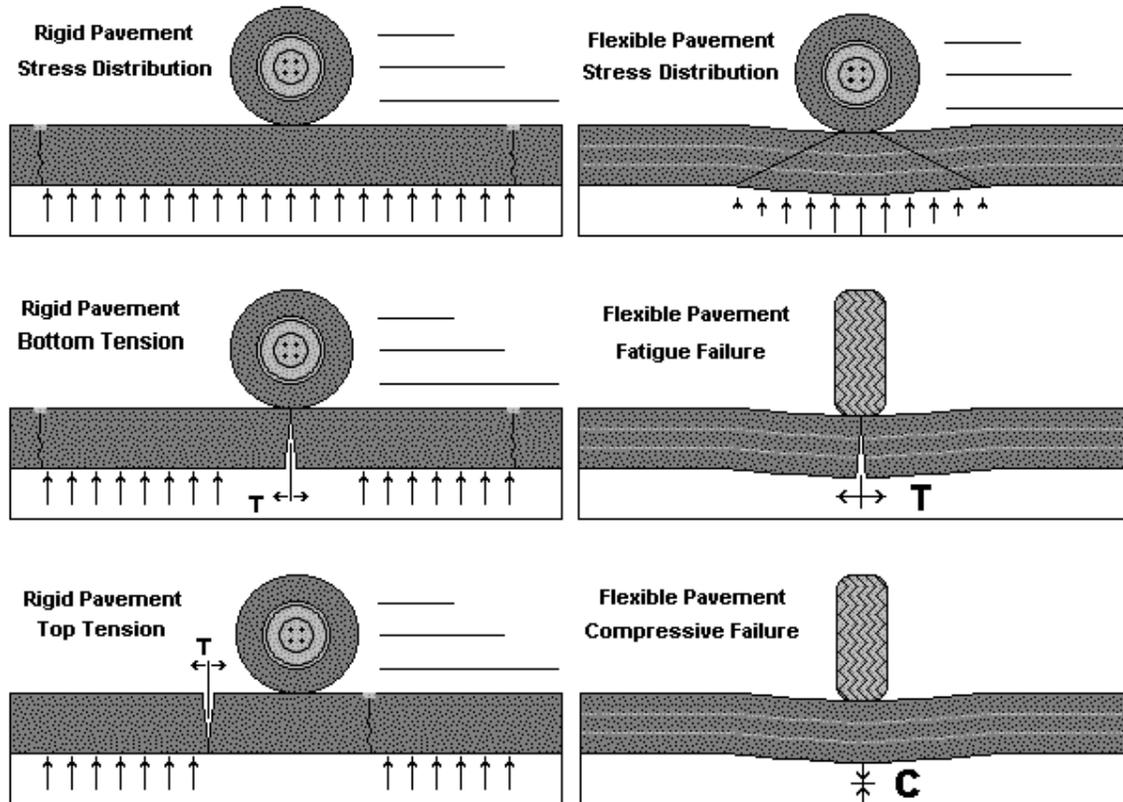

Load-related cracks can start at the top or bottom of a pavement section. In asphalt sections, load-related (fatigue) cracks start at the bottom. If a load-related crack reaches the surface, it usually indicates structural deficiency. In rigid pavement, corner breaks are caused by tensile forces at the top of the slab, and the crack propagates downward. Mid-slab LTD cracks are distress examples resulting from tensile forces at the bottom of the slab.

Both wheel loads and environmental factors can cause spalls anytime there is movement between adjacent slabs. If non-compressible material (such as a small rock) is allowed into a joint, stresses will build up between adjacent slabs and can cause a spall. Keeping joint and crack sealant intact can help to reduce the infiltration of non-compressible material and minimize spalling.

4.4 Best Practices

4.4.1 Flexible Pavement

L&T cracks at medium severity should be filled with a good quality crack sealant material. High-severity cracks normally must be patched.

Cracks rated at low severity may be narrow unsealed cracks or sealed cracks up to 3 inches wide. The PCI procedure does not distinguish between narrow unfilled cracks and wider filled cracks. Some L&T cracks at low severity are included in the estimated sealing quantities and costs in this maintenance plan. In general, when medium- or high-severity cracking constitutes less than 25 percent of the total crack quantity, sustaining maintenance usually is more cost-effective. When 25 percent or more of the total crack quantity is at medium or high severity, a restorative program typically becomes more cost-effective.

Existing patches rated as medium and high severity should be replaced with new patches. Small areas (usually less than 100 square feet per patch) of alligator cracking and rutting at medium and high severity also may be repaired cost-effectively by patching. Larger patches should be considered if equipment can be made available to accomplish the work. Patching to repair up to 10 percent of the surface of a pavement feature that is otherwise serviceable can result in significant cost savings as compared to rehabilitation of the entire feature.

An example maintenance policy treatment matrix for flexible pavement is shown in Table 4-7. Examples of various maintenance techniques are provided in appendix C.

4.4.2 Rigid Pavement

Joint seal damage rated at medium and high severity should be repaired. If medium- and high-severity damage is limited to less than about 25 percent of the total joint length, sustaining maintenance is recommended. If medium- and high-severity damage exceeds 25 percent of the total joint length, the joint sealant should be removed and replaced under a restorative repair project.

LTD cracks at low and medium severity should be considered for sealing as part of the joint sealing project. High-severity LTD cracks require sealing, patching, or slab replacement, depending on the extent of deterioration.

Small patches are typically used to repair medium- and high-severity spalls or to replace deteriorated older patches. Restorative small patches are typically partial-depth repairs, usually to a maximum depth of 1/3 of the slab thickness. Large patches and corner breaks at medium and high severity should be repaired by full-depth large patches.

High-severity LTD cracks and shattered slabs are candidates for patching and slab replacement. Low-severity shattered slabs can be left in place pending further deterioration.

An example maintenance policy treatment matrix for rigid pavement is shown in Table 4-7. Examples of various maintenance techniques are provided in appendix C.

Table 4-7. General Maintenance Policy (AC)

Distress Type	Distress Severity	Maintenance Action
Alligator Cracking	Low	Crack Sealing - AC
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Bleeding	N/A	Monitor
Depression	Low	Monitor
	Medium	Patching - AC Shallow
	High	Patching - AC Deep
Jet Blast	N/A	Patching - AC Shallow
Longitudinal, Transverse, Joint Reflective, & Block Cracking	Low	Monitor
	Medium	Crack Sealing - AC
	High	Patching - AC Deep
Oil Spill	N/A	Patching - AC Shallow
Patching	Low	Monitor
	Medium	Crack Sealing - AC
	High	Patching - AC Deep
Polished Aggregate	N/A	Monitor
Weathering / Raveling	Low	Monitor
	Medium	Surface Treatment
	High	Patching - AC Shallow
Rutting, Corrugation and Swell	Low	Monitor
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Shoving	Low	Monitor
	Medium	Patching - AC Shallow
	High	Patching - AC Deep
Slippage Cracking	N/A	Patching - AC Shallow

Table 4-8. General Maintenance Policy (PCC)

Distress Type	Distress Severity	Maintenance Action
Blow Up	Low	Patching - PCC Partial Depth
	Medium	Slab Replacement - PCC
	High	Slab Replacement - PCC
Longitudinal, Transverse & Diagonal Cracking	Low	Monitor
	Medium	Crack Sealing - PCC
	High	Patching - PCC Full Depth
Durability Cracking	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Slab Replacement - PCC
Large Patch & Corner Break	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Patching - PCC Full Depth
Popout / Shrinkage Cracks	N/A	Monitor
Scaling	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Slab Replacement - PCC
Faulting	Low	Monitor
	Medium	Grinding (Localized)
	High	Grinding (Localized)
Shattered Slab	Low	Monitor
	Medium	Crack Sealing - PCC
	High	Slab Replacement - PCC
Joint Spall, Corner Spall & Small Patch	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Patching - PCC Partial Depth

4.5 Pavement Repair Materials

New pavement repair materials are introduced and improved regularly. This section provides information on products compatible with airport needs.

4.5.1 Joint and Crack Sealer

Hot-poured, pressure-injected, polymeric rubberized asphalt sealant meeting ASTM D3405 specifications is suitable for most sealing requirements. This product is relatively inexpensive, durable, and suitable for both rigid and flexible pavements. Other, more expensive, hot-applied sealants that promise longer life are being developed for specialty applications. Twin component cold applied sealants also have been used with success. Contact your local distributor.

4.5.2 Flexible Pavement Patch

High-performance plant mixed cold patching products that can be stockpiled on-site can be used for short term repairs to maintain safety. Long-term patches should be made with high-quality plant mixed hot asphalt having a ¾-inch maximum aggregate size and meeting Federal Aviation Administration (FAA) P401, or highest quality highway specifications. Low-quality packaged materials available from local hardware type stores should be avoided.

4.5.3 Rigid Pavement Patch

Permanent patches in rigid pavement should be made with air-entrained concrete with 1-inch maximum size aggregate. If the area must be quickly opened to traffic, high early concrete should be considered. Concrete should have zero slump and a coarse texture. As with asphalt patches, low-quality packaged materials should be used only as temporary patches to maintain safety and service until a more permanent repair can be made.

4.6 Pavement Repair Equipment

Many pavement repair and sealing products are available. Specialized tools and equipment help ensure high-quality repairs. This section discusses equipment compatible with airport needs.

4.6.1 Air Compressor

Used to remove non-compressible sand and debris from prepared cracks and joints, the compressor should have a sustained capacity of 120 cubic feet per minute with a nozzle velocity of 100 psi. Trailer-mounted compressors typically have capacities in this range.

4.6.2 Concrete Saw

A saw capable of making a minimum 3-inch-deep cut is required. The saw should be capable of making cuts in both asphalt and concrete. Gasoline-powered 5- to 25-hp wheel-mounted saws typically are preferred for this type of work, but electric and pneumatic tools also are available.

4.6.3 Heating Kettle

Applying sealant is the most time-consuming operation, and a sealing machine with heating and pressure application capabilities is a critical item in a successful sealing program. The capacity of the sealing equipment dictates the rate at which a crew progresses. For large sealing projects, a minimum 100-gallons/hour sustained capacity is recommended. The unit should be a double boiler type, with mechanical agitators or continuous recirculation. Kettle temperature must be monitored to ensure that the sealant is not “burned.” Overheating the sealant will prematurely age harden the material.

4.6.4 Router

A concrete saw can be used to prepare joints, but for random cracking, a mechanical router with a vertical impact mechanism is preferred. When cracks are being routed, this activity will dictate the speed of the crew. Crack routers in the 25-hp range are commonly used and are available from a variety of manufacturers.

4.6.5 Sand Cleaner

A sand blaster helps to clean loose particles and dust from prepared cracks. The unit must have sufficient force to expose fresh, vital pavement to bond with sealant and patching materials.

4.6.6 Vibratory Roller or Plate Compactor

Required to compact plant mixed and packaged patching materials properly. Small rollers are best for pothole type applications; plate compactors are best for large areas.

4.6.7 Other Equipment

Other general use equipment that can be helpful in a maintenance program includes bucket loaders, dump trucks, water tanks, and a power sweeper unit.

Appendix A. AIRPAV Software

The Software

Data analysis was performed using the AIRPAV pavement evaluation and management software. In addition to calculating and documenting PCI values, AIRPAV evaluates the collected inspection data and recommends rehabilitation actions that address the cause of pavement distress. AIRPAV can incorporate traffic and structural capacity evaluations into the pavement evaluation matrix, and AIRPAV also performs preliminary life cycle cost analysis of the various rehabilitation alternatives, providing guidance on the lowest annual cost repair strategy.



A complete database, along with an updated version of AIRPAV, is provided on INDOT computers for ongoing management of the INDOT pavement systems.

Capital Improvements

AIRPAV creates interactive CIPs, providing the user with the ability to control unit costs, develop new projects, move projects between years, and even increase or decrease the scope and cost of individual projects.

Maintenance

AIRPAV calculates and develops maintenance work orders organized by type of work. Maintenance work orders can be printed and issued directly to maintenance crews.

Traffic

AIRPAV provides the ability to model aircraft ground movements. Traffic can be sorted by airline, aircraft type, destination gate or ramp, and runway used. The program graphically displays each taxi path, accumulates total operations, automatically determines design aircraft, and calculates structural overlay requirements for each pavement feature. The software can provide Pavement Classification Numbers (PCN) for each pavement feature or report results directly as inches of overlay required.

Maps


AIRPAV permits viewing and printing of PCI maps. Inspection layout, pavement condition, and other views are available from within the software.

Query

The AIRPAV query function is a powerful search tool that allows users to extract useful reports meeting various criteria. As examples, lists can be created for taxiway pavement, asphalt pavement, or areas below MSL at the time of inspection.

Global Information System (GIS) Integration

AIRPAV is fully GIS-enabled. A single click in AIRPAV exports all data to an MS Access database that can be linked to shape files used in an ESRI product. In this way, virtually all data in the pavement management database can be accessed in GIS format.

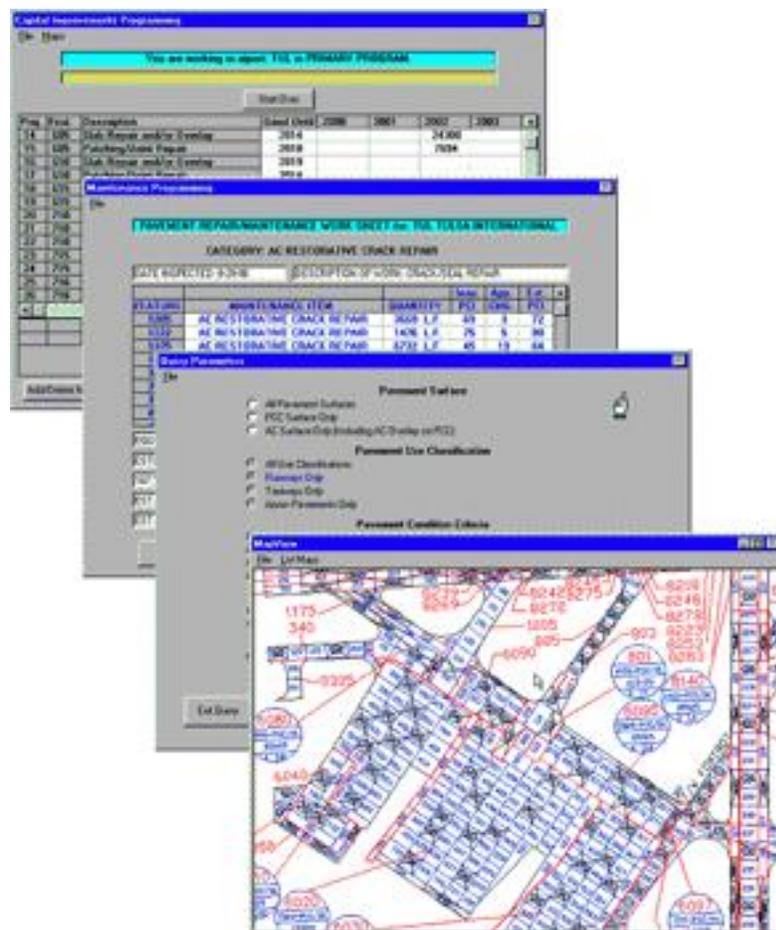

Appendix B. Feature Analysis


Pavement Performance Models

Projected performance is determined by relating current pavement condition to expected pavement condition. Projected performance varies based on pavement type. There are four pavement types in Indiana: AC, PCC, ACC, and APC. Each pavement type has a unique deterioration curve, created by plotting all data for that group as PCI vs. age and then finding a performance curve to best fit the data. These curves represent the historic performance of pavement in the group and become the baseline for future projections. The baseline curves are modeled with a third order polynomial equation as shown below.

$$PCI = X(\text{Age})^3 + Y(\text{Age})^2 + Z(\text{Age}) + C$$

Current Condition (rotating the curves)


Starting with the baseline curve for comparison, current pavement condition is plotted, and the baseline curve is rotated to meet the current condition. The rotated curve provides the starting point for projecting the future pavement condition.

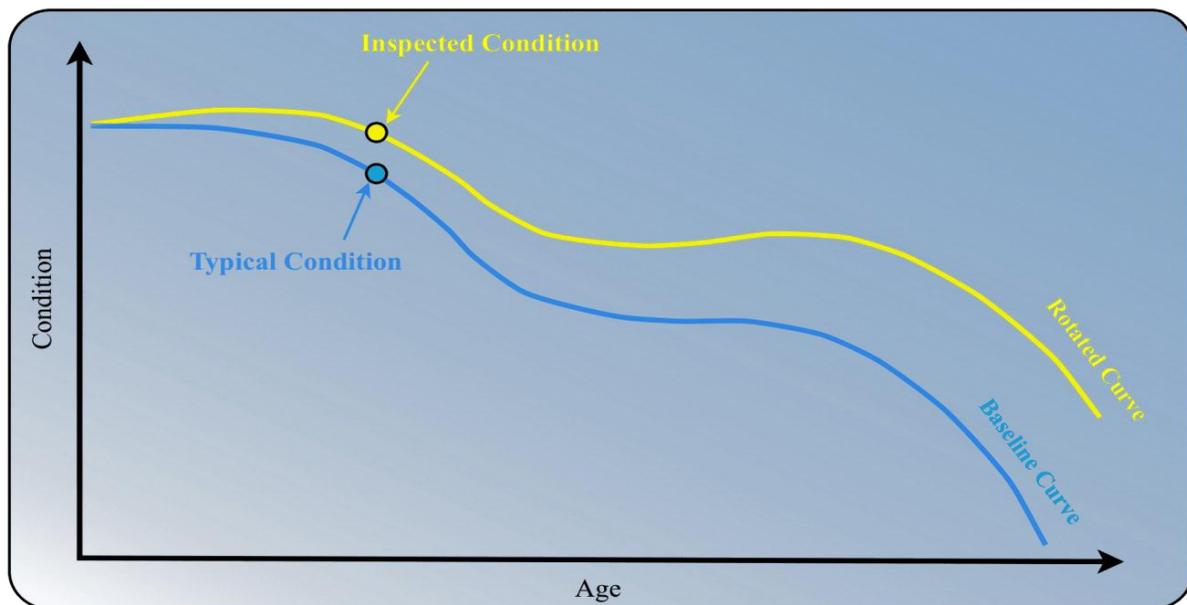

Advanced Analysis (accounting for distress)


Some types of pavement distress have a greater impact on pavement deterioration than others. Rutting and alligator (fatigue) cracking are major structural failures and can lead to rapid pavement deterioration. Other distress types, like L&T cracking, develop slowly over time and typically do not cause a significant deviation from the baseline curve.

After current condition is accounted for with the curve rotation, pavement distress is addressed in the advanced analysis by compressing or expanding the baseline curve to account for the expected rate of pavement deterioration.

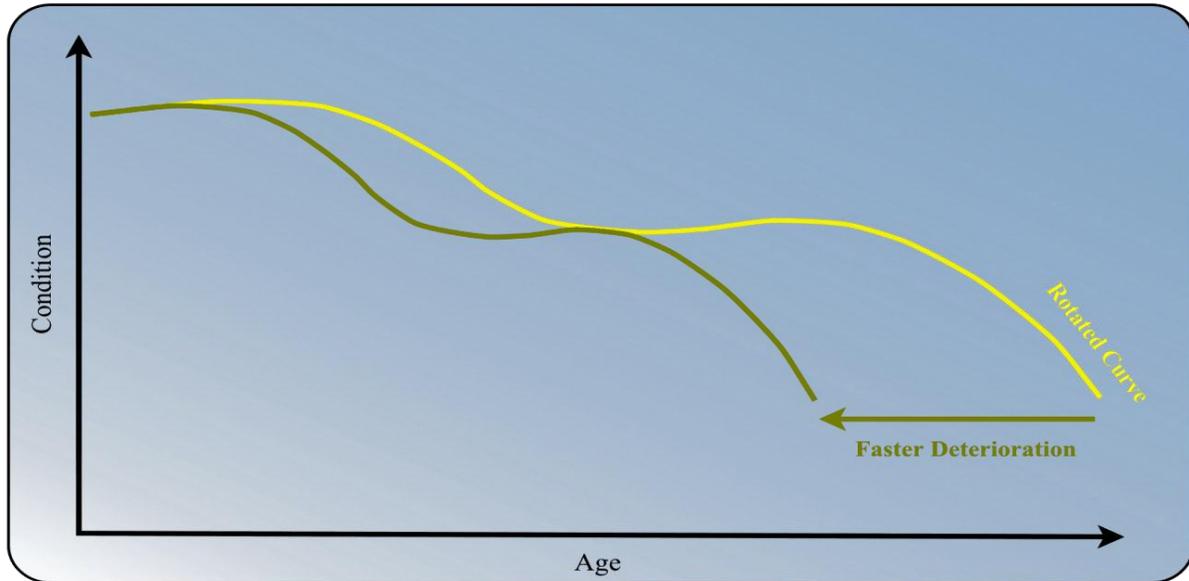

Projected PCI (near term vs. longer term)

Projecting pavement condition with advanced analysis is a combination of rotating, expanding, and contracting the baseline curves. This projection method provides good short-term results for all pavement sections and fair long-term projections on pavement sections with conditions near the baseline model. The long-term accuracy of outlier data is discussed on the following page.

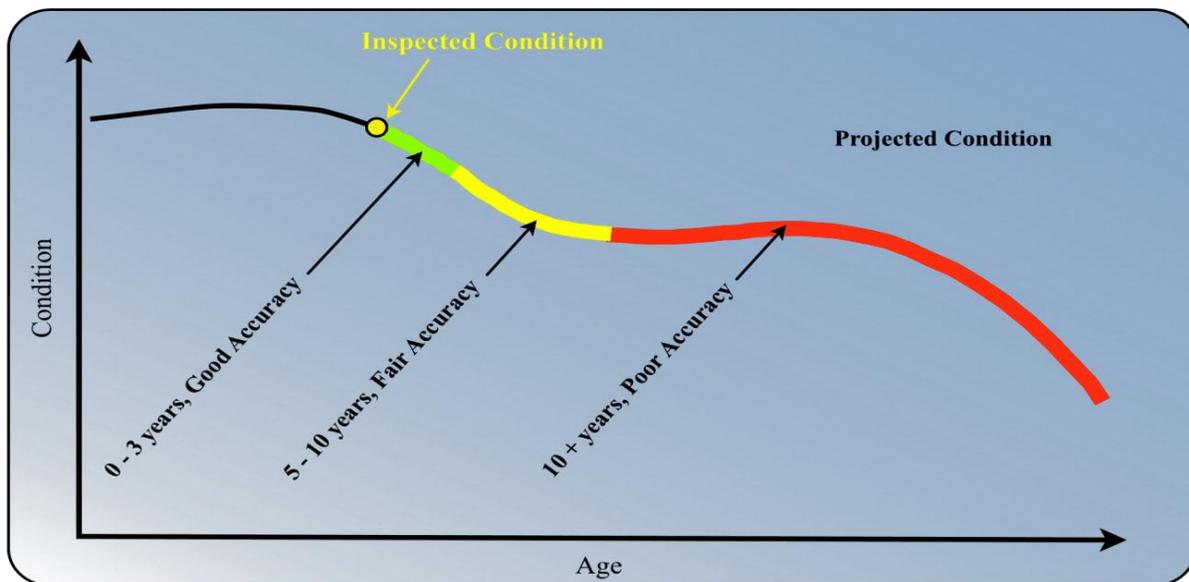


Projected PCI (why some features have unexpected projections)

Long-term PCI projections can be very useful for planning purposes. However, projections in excess of 10 years are well beyond the intended scope of the PCI procedure. FAA Advisory Circular 150/5380-6B establishes a maximum 3-year interval between detailed PCI surveys.

Curve rotation, expansion, and contraction are performed to produce the best possible accuracy of future pavement condition over the next 3 to 5 years. This methodology can overemphasize certain performance trends in the long term. This is especially true for outlier data, such as pavement features that are performing much better or worse than is typical.

The curve below shows an example of a performance trend being overemphasized in the long-term projection. Because the pavement feature is performing much better than the baseline curve, the long-term projection shows the pavement lasting an additional 30+ years before reaching the MSL. Rotation of the curve to provide the most accurate projection over 3 to 5 years has resulted in a long-term projection that is likely unrealistic.

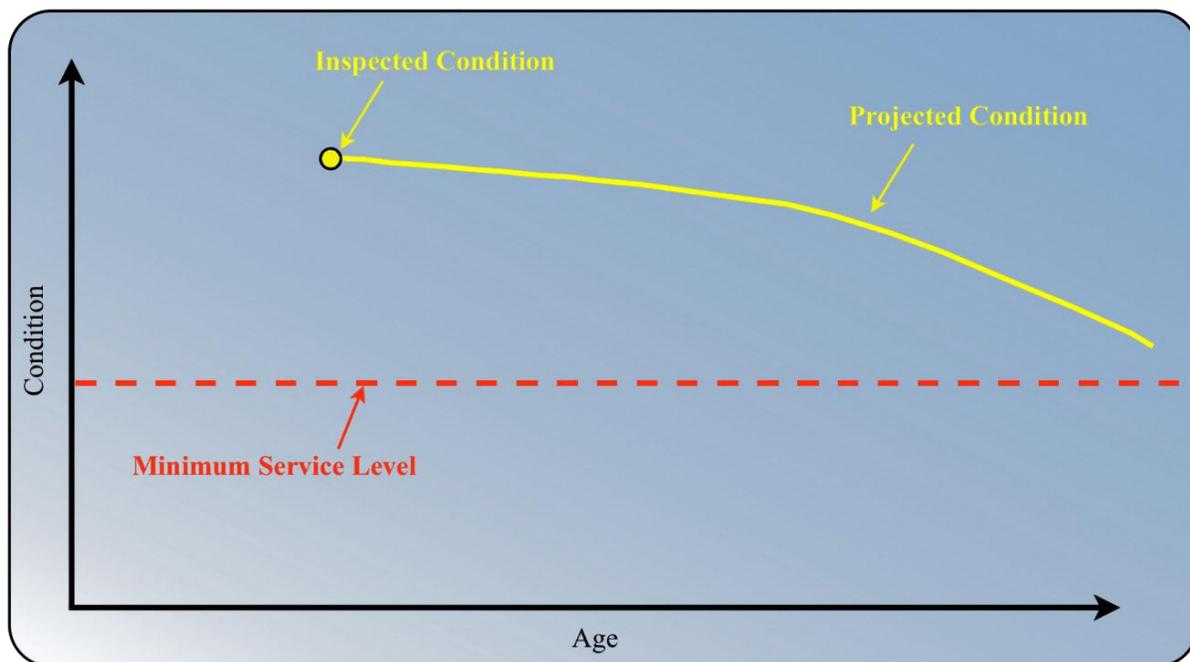

When long-term projections such as this are encountered, airport managers should not rely on projections in excess of 10 years. Managers can be confident that the pavement is performing much better than average and will not require rehabilitation within the current 5-year CIP planning window. As new distress develops over time, future PCI surveys will determine the ideal timing for rehabilitation.

Feature Analysis

As part of the PCI evaluation, a detailed analysis is presented for each airside pavement feature using the two-page format depicted below.

Page 1

The first page of the analysis is a feature summary. Located near the top left-hand corner is the feature number and pavement description. Construction history and inspector comments are listed below, along with a photo of the pavement section if available. Distress totals recorded during the PCI survey are listed next, and an approximation of the cause of the pavement deterioration is shown at the bottom. If the pavement is projected to fall below the desired MSL during the next 12 years, the analysis year will be shown along with the optimum year for pavement rehabilitation.

AIRPAV

AIRPORT: BLOOMINGTON/MONROE COUNTY
AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 5007

ANALYSIS YEAR: 2011 **OPTIMIZED FOR: 2019**

PAVEMENT TYPE: AC
FEATURE AREA: 1,278,750
INSPECTED AREA: 40,000
MINIMUM SERVICE LEVEL: 65

DESCRIPTION: RUNWAY 17-35 KEEL

INSPECTION DATE: 8-11-11
FEATURE'S HIGH PCI: 72
FEATURE'S LOW PCI: 59
AVERAGE PCI: 69 GOOD
ESTIMATED PCI IS: 65 in 2019

COMMENTS/HISTORY FOR FEATURE 5007, RUNWAY 17-35 KEEL

1989: 4" P401 / 5" P401 / 13" P209
*
*

DISTRESS QUANTITIES FOR FEATURE 5007					
DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF ALL DISTRESS
ALLIGATOR CRACKING	LOW	66	2,199	S.F.	8.3
LONG & TRANS. CRACK	MED	995	31,808	L.F.	30.4
LONG & TRANS. CRACK	LOW	2,824	90,279	L.F.	34.8
RAVELING/WEATHERING	LOW	9,450	302,104	S.F.	26.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	8 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	52 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	39 %

PAGE 1

Description & Feature # →

Optimized Rehab Year →

Construction History ←

Distress Totals ←

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 101	DESCRIPTION: TAXIWAY C
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 82
FEATURE AREA: 263,602	FEATURE'S LOW PCI: 68
INSPECTED AREA: 61,500	AVERAGE PCI: 77 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 77 in 2012

COMMENTS/HISTORY FOR FEATURE 101, TAXIWAY C

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 101

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	6	25	S.F.	5.7
LONG.& TRANS. CRACK	HIGH	1	4	L.F.	1.9
LONG.& TRANS. CRACK	MED	894	3,831	L.F.	40.5
LONG.& TRANS. CRACK	LOW	2,093	8,971	L.F.	34.4
WEATHERING	LOW	54,150	232,098	S.F.	17.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	6 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	57 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	37 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 101

DESCRIPTION: TAXIWAY C

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 77 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 77 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 72

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

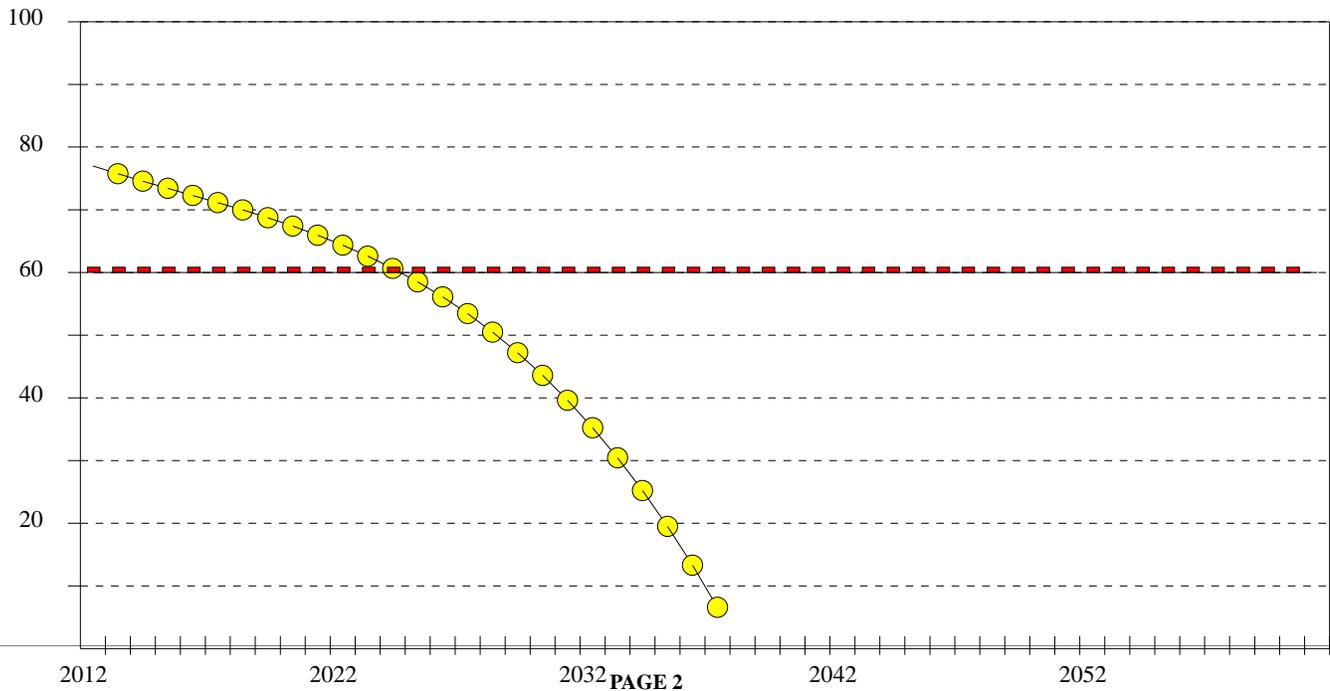

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 102	DESCRIPTION: TAXIWAY B
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 85
FEATURE AREA: 27,300	FEATURE'S LOW PCI: 84
INSPECTED AREA: 15,000	AVERAGE PCI: 85 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 85 in 2012

COMMENTS/HISTORY FOR FEATURE 102, TAXIWAY B

2002: 1.5" P401 (1/2" Agg) / P603 / 2.5" P401 (3/4" Agg)
 /Pulverized asphalt removal
 1972: 3" P401 / 3" P201
 1964: 3" P401 / 9" P208 / 7" P154

DISTRESS QUANTITIES FOR FEATURE 102

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	108	196	L.F.	51.1
LONG.& TRANS. CRACK	LOW	433	788	L.F.	48.8

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 102

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 85 SATISFACTORY

CONSTRUCTION YEAR: 2002

ESTIMATED PCI IS: 85 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 76

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

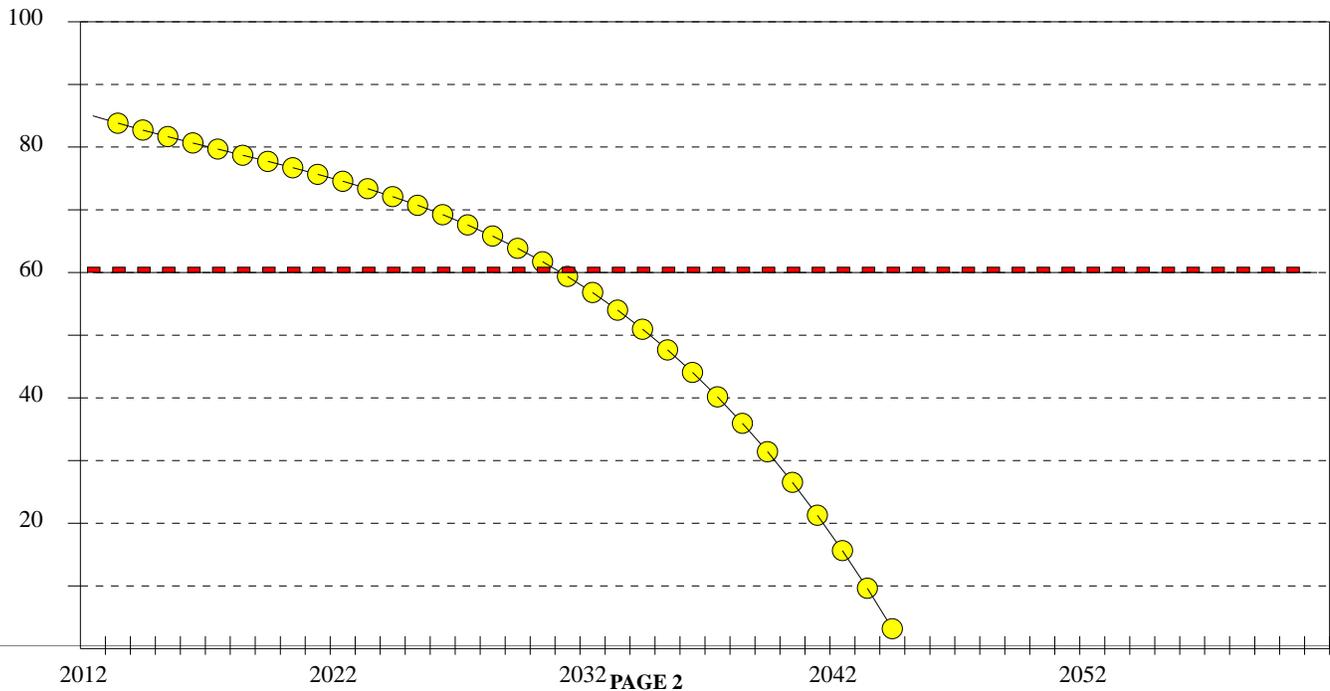

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 103	DESCRIPTION: TAXIWAY A
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 84
FEATURE AREA: 18,000	FEATURE'S LOW PCI: 84
INSPECTED AREA: 10,000	AVERAGE PCI: 84 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 84 in 2012

COMMENTS/HISTORY FOR FEATURE 103, TAXIWAY A

2004 AC Overlay est
 1972: 3" P401 / 3" P201
 1964: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 103

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	122	219	L.F.	70.6
LONG.& TRANS. CRACK	LOW	85	153	L.F.	29.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 103

DESCRIPTION: TAXIWAY A

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 84 SATISFACTORY

CONSTRUCTION YEAR: 2004

ESTIMATED PCI IS: 84 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 77

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

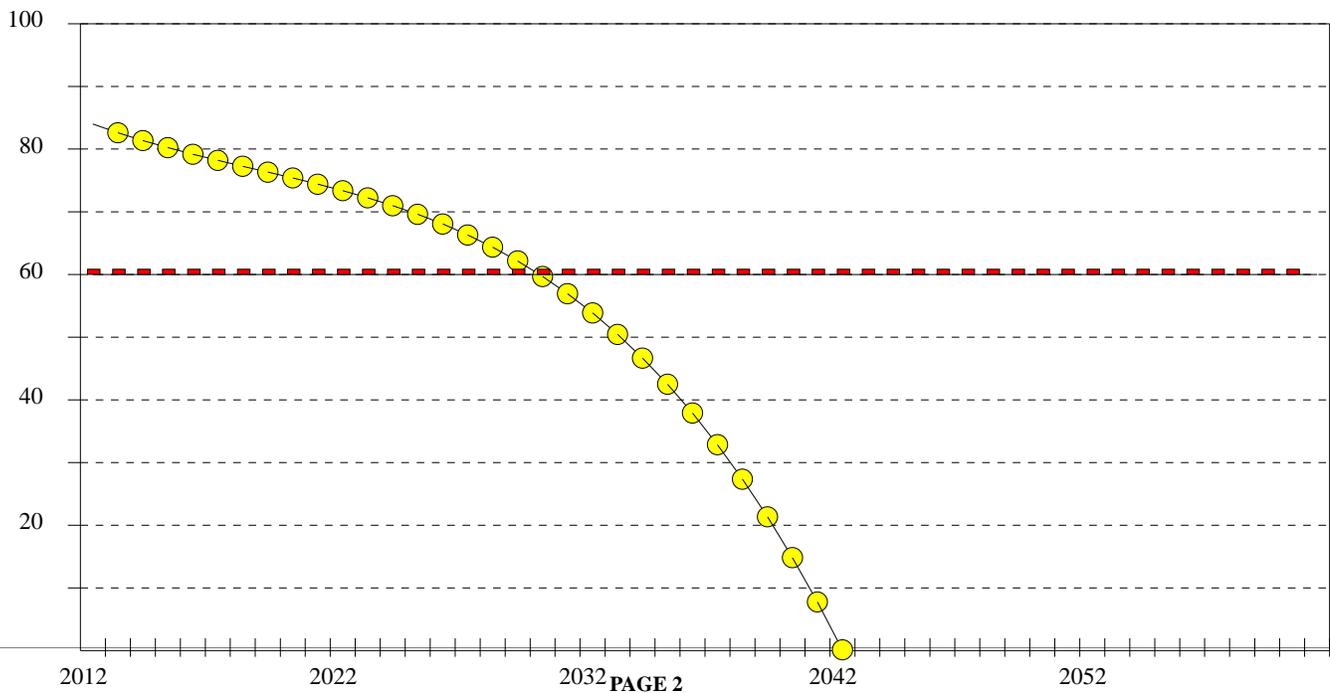

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 104	DESCRIPTION: TAXIWAY B-2
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 82
FEATURE AREA: 6,900	FEATURE'S LOW PCI: 79
INSPECTED AREA: 6,850	AVERAGE PCI: 80 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 80 in 2012

COMMENTS/HISTORY FOR FEATURE 104, TAXIWAY B-2

2004 AC Overlay est
 1964: AC OVERLAY
 1960: AC UNKNOWN SECTION
 *

DISTRESS QUANTITIES FOR FEATURE 104

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
DEPRESSION	LOW	20	20	S.F.	6.1
LONG.& TRANS. CRACK	MED	154	155	L.F.	79.1
LONG.& TRANS. CRACK	LOW	22	22	L.F.	9.4
WEATHERING	LOW	800	805	S.F.	5.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 104

DESCRIPTION: TAXIWAY B-2

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 80 SATISFACTORY

CONSTRUCTION YEAR: 2004

ESTIMATED PCI IS: 80 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 77

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

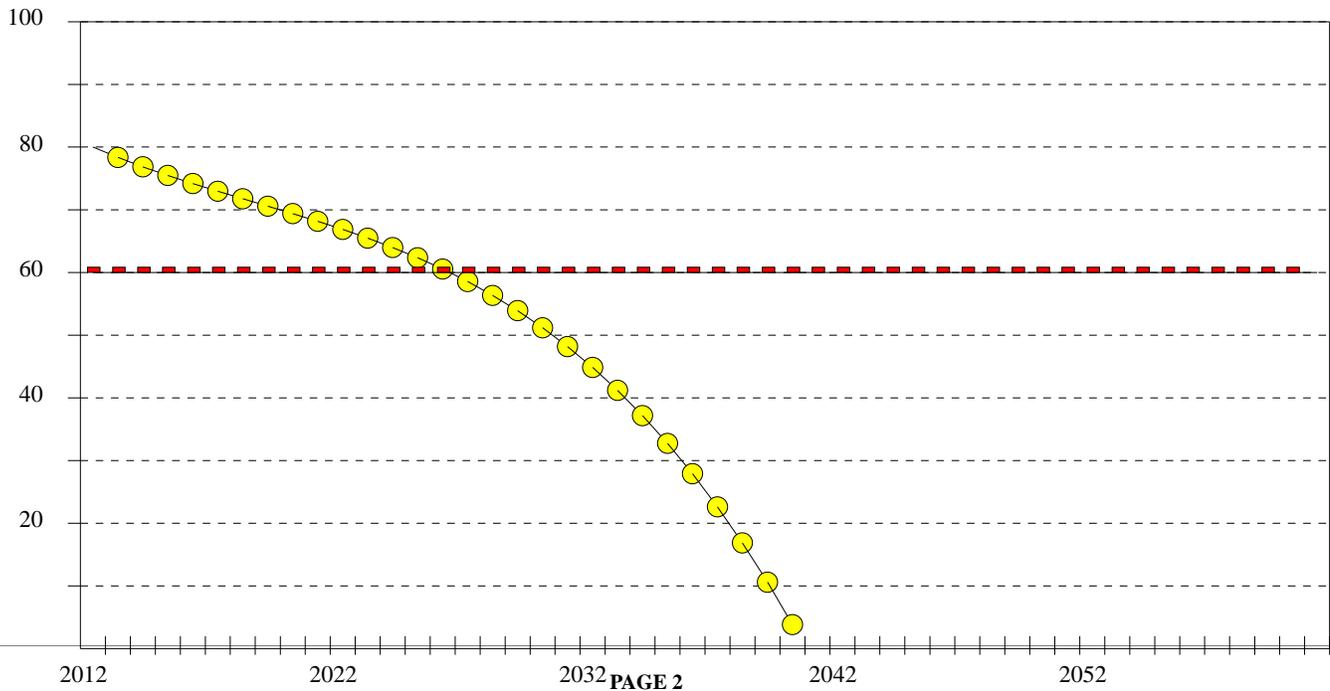

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 105	DESCRIPTION: TAXIWAY C
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 73
FEATURE AREA: 7,425	FEATURE'S LOW PCI: 50
INSPECTED AREA: 7,425	AVERAGE PCI: 62 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2014

COMMENTS/HISTORY FOR FEATURE 105, TAXIWAY C

1996 1.5" P401
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 105

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	29	29	S.F.	25.3
ALLIGATOR CRACKING	LOW	38	38	S.F.	30
LONG.& TRANS. CRACK	MED	88	88	L.F.	14.6
LONG.& TRANS. CRACK	LOW	77	77	L.F.	6
PATCH & UTILITY CUT	MED	7	7	S.F.	6.5
PATCH & UTILITY CUT	LOW	101	101	S.F.	9.1
WEATHERING	MED	58	58	S.F.	.4
WEATHERING	LOW	3,925	3,925	S.F.	7.6

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	66 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	22 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	12 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 105

DESCRIPTION: TAXIWAY C

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 62 FAIR

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 59 in 2014


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 63

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$10,469	20 YEARS
▼	SURFACE TREATMENT	\$2,928	4 YEARS
◆	CRACK REPAIR	\$201	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

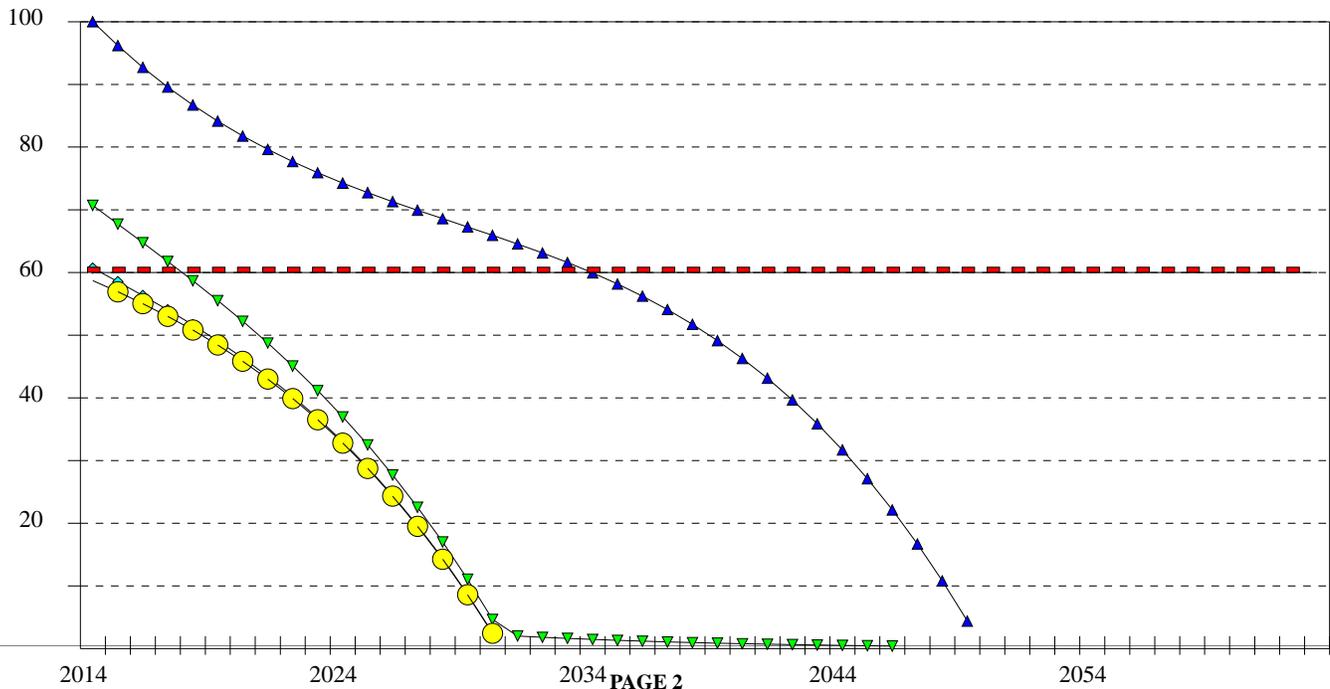

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 106	DESCRIPTION: TAXIWAY A
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2019	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 76
FEATURE AREA: 7,000	FEATURE'S LOW PCI: 64
INSPECTED AREA: 5,350	AVERAGE PCI: 70 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2019

COMMENTS/HISTORY FOR FEATURE 106, TAXIWAY A

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 3" P401 / 3" P201
 1964: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 106

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	LOW	3	3	S.F.	9.3
LONG.& TRANS. CRACK	MED	70	91	L.F.	30
LONG.& TRANS. CRACK	LOW	323	422	L.F.	41.7
WEATHERING	MED	494	646	S.F.	12.3
WEATHERING	LOW	1,300	1,700	S.F.	6.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	9 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	54 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	36 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 106

DESCRIPTION: TAXIWAY A

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2019

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 70 FAIR

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2019


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 63

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$9,869	20 YEARS
▼	SURFACE TREATMENT	\$2,771	8 YEARS
◆	CRACK REPAIR	\$625	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

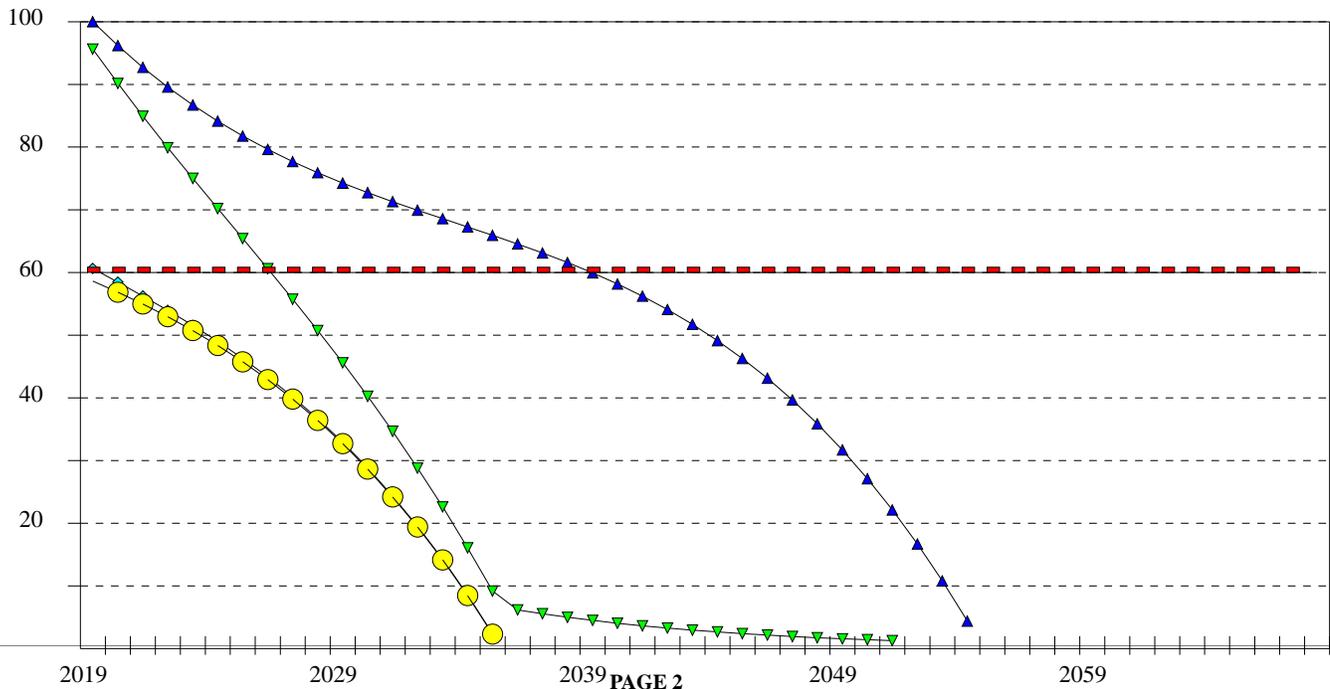

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 108	DESCRIPTION: TAXIWAY B-2
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 81
FEATURE AREA: 5,675	FEATURE'S LOW PCI: 68
INSPECTED AREA: 4,400	AVERAGE PCI: 74 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 60 in 2022

COMMENTS/HISTORY FOR FEATURE 108, TAXIWAY B-2

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1964: AC OVERLAY
 1960: AC UNKNOWN SECTION
 *

DISTRESS QUANTITIES FOR FEATURE 108

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	98	126	L.F.	46
LONG.& TRANS. CRACK	LOW	246	317	L.F.	44.7
SWELL	LOW	12	15	S.F.	4.1
WEATHERING	LOW	600	773	S.F.	4.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	66 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	34 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 108

DESCRIPTION: TAXIWAY B-2

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 74 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 60 in 2022


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 58

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$8,001	20 YEARS
▼	SURFACE TREATMENT	\$2,310	8 YEARS
◆	CRACK REPAIR	\$540	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

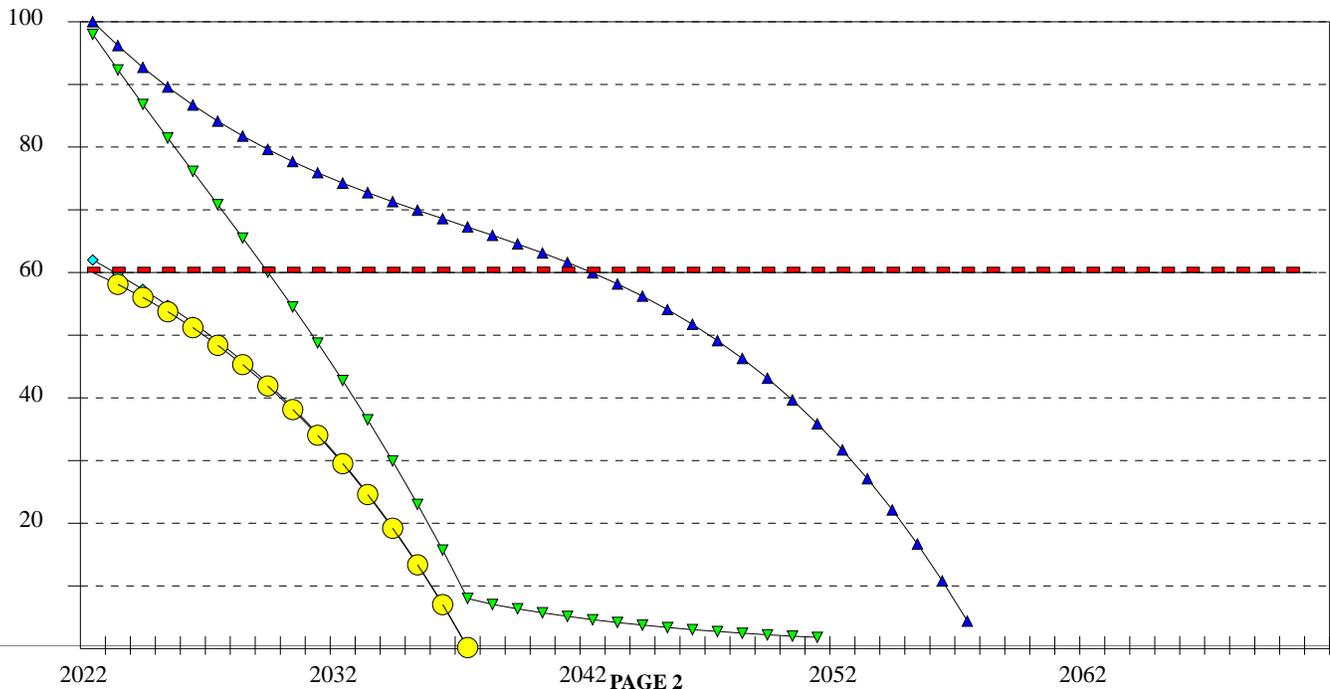

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 112	DESCRIPTION: TAXIWAY B
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 79
FEATURE AREA: 20,500	FEATURE'S LOW PCI: 76
INSPECTED AREA: 15,250	AVERAGE PCI: 78 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 78 in 2012

COMMENTS/HISTORY FOR FEATURE 112, TAXIWAY B

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 3" P401 / 3" P201
 1964: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 112

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	158	212	L.F.	37.5
LONG.& TRANS. CRACK	LOW	702	943	L.F.	48.4
WEATHERING	LOW	8,380	11,264	S.F.	13.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	62 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	38 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 112

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 78 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 78 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 72

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

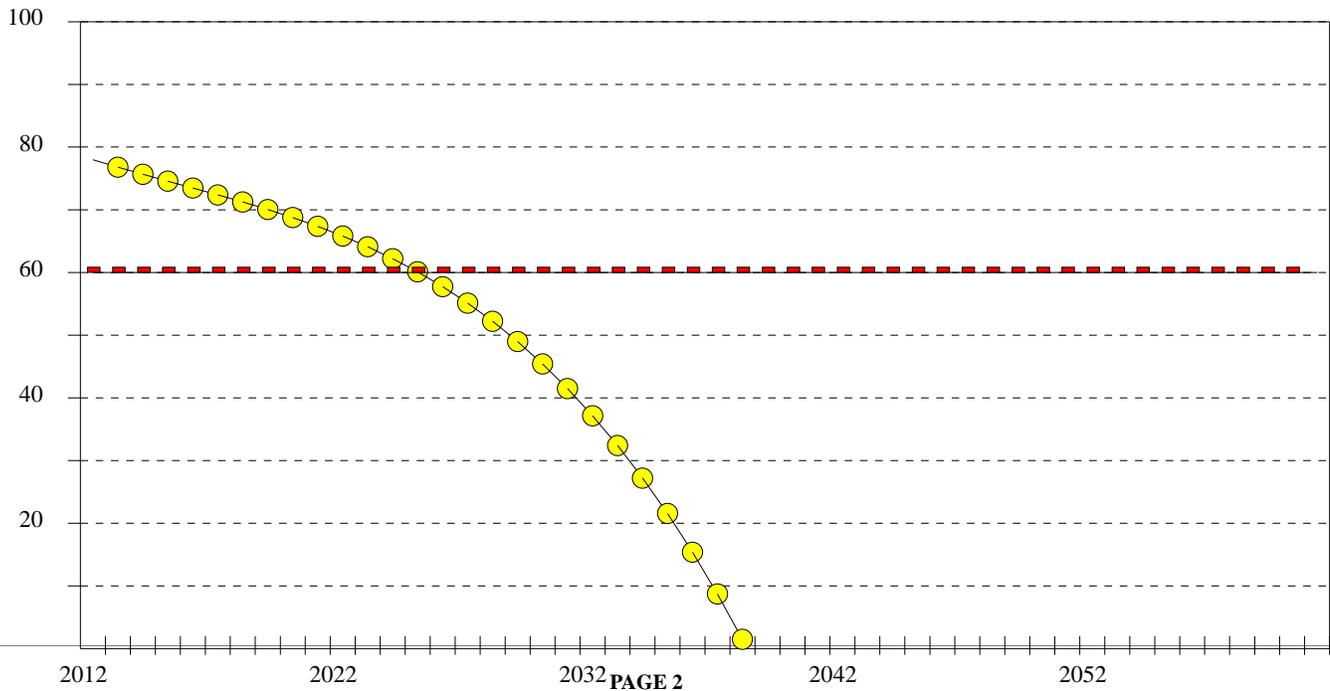

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 120	DESCRIPTION: TAXIWAY C-3
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 57
FEATURE AREA: 7,500	FEATURE'S LOW PCI: 57
INSPECTED AREA: 7,500	AVERAGE PCI: 57 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 57 in 2012

COMMENTS/HISTORY FOR FEATURE 120, TAXIWAY C-3

1996 1.5" P401
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 120

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	24	24	S.F.	31.8
LONG.& TRANS. CRACK	MED	206	206	L.F.	29.2
LONG.& TRANS. CRACK	LOW	154	154	L.F.	10.9
PATCH & UTILITY CUT	MED	12	12	S.F.	11.8
PATCH & UTILITY CUT	LOW	68	68	S.F.	6.3
WEATHERING	MED	108	108	S.F.	.8
WEATHERING	LOW	6,500	6,500	S.F.	8.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	44 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	36 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	20 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 120

DESCRIPTION: TAXIWAY C-3

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 57 FAIR

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 57 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 65

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	STRUCTURAL OVERLAY	\$16,574	20 YEARS
▼	SURFACE TREATMENT	\$3,101	5 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

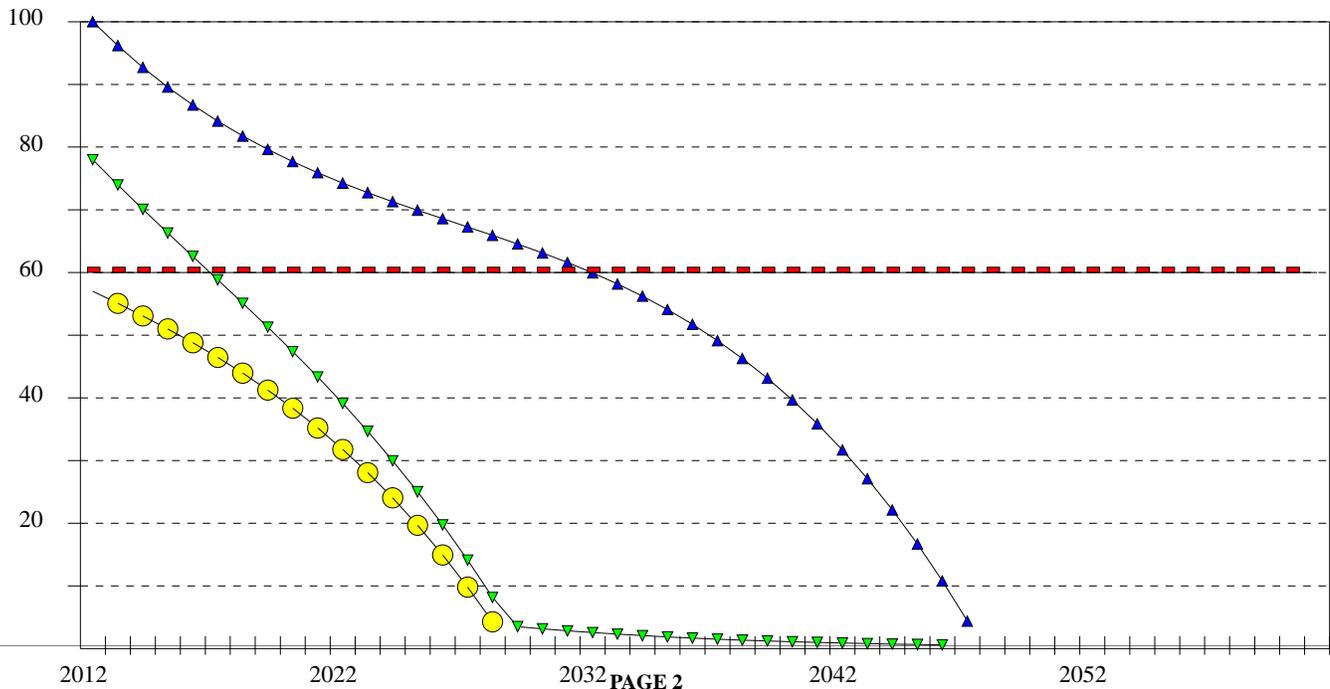

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 121	DESCRIPTION: TAXIWAY C-3
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 74
FEATURE AREA: 22,745	FEATURE'S LOW PCI: 69
INSPECTED AREA: 13,200	AVERAGE PCI: 72 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2021

COMMENTS/HISTORY FOR FEATURE 121, TAXIWAY C-3

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1996 1.5" P401
 1972: 4" P401 / 6" P201 / 14" P154
 *

DISTRESS QUANTITIES FOR FEATURE 121

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	LOW	43	74	S.F.	21.3
LONG.& TRANS. CRACK	MED	268	461	L.F.	33.5
LONG.& TRANS. CRACK	LOW	733	1,263	L.F.	36.5
WEATHERING	MED	230	396	S.F.	2.4
WEATHERING	LOW	3,400	5,858	S.F.	6

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	21 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	50 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	29 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 121

DESCRIPTION: TAXIWAY C-3

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 72 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2021


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 59

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$32,070	20 YEARS
▼	SURFACE TREATMENT	\$9,205	7 YEARS
◆	CRACK REPAIR	\$2,103	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

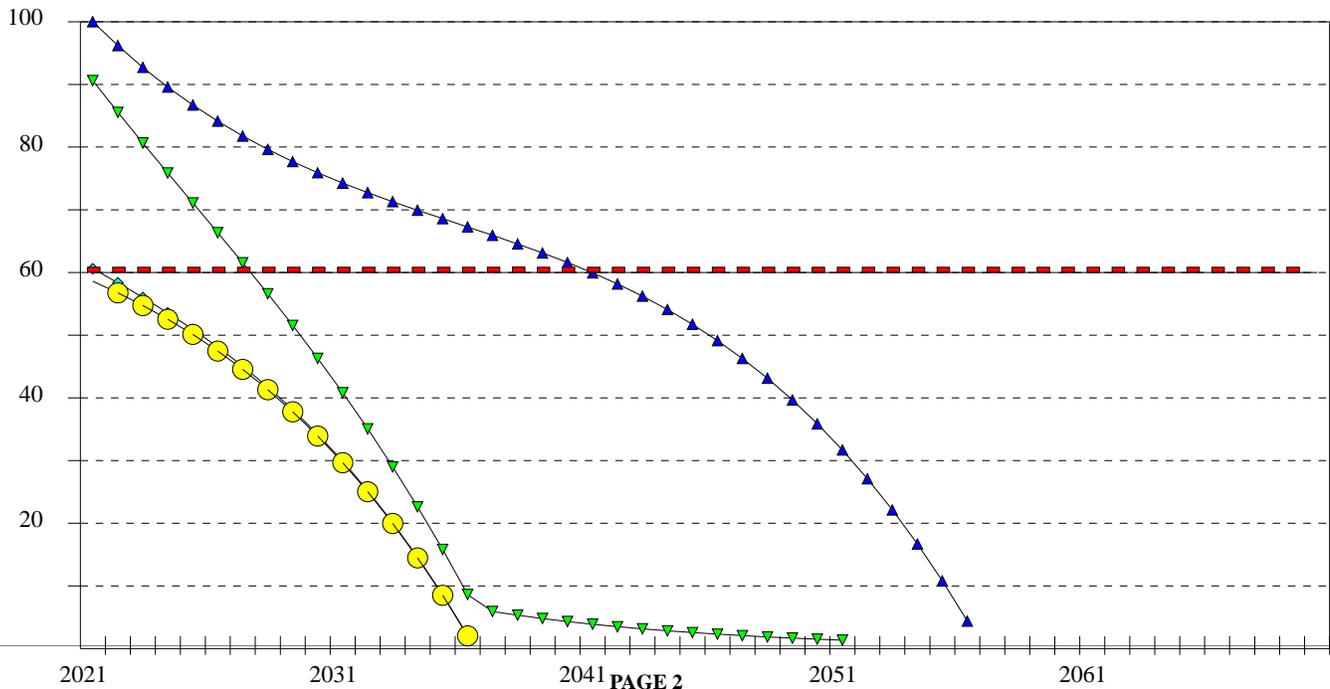

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 140	DESCRIPTION: TAXIWAY C-2
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 64
FEATURE AREA: 10,500	FEATURE'S LOW PCI: 30
INSPECTED AREA: 6,275	AVERAGE PCI: 47 POOR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 47 in 2012

COMMENTS/HISTORY FOR FEATURE 140, TAXIWAY C-2

1996 1.5" P401
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 140

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	HIGH	6	10	S.F.	10.3
ALLIGATOR CRACKING	MED	30	50	S.F.	14.4
ALLIGATOR CRACKING	LOW	20	33	S.F.	8.9
LONG.& TRANS. CRACK	MED	349	584	L.F.	24
LONG.& TRANS. CRACK	LOW	473	791	L.F.	19.3
RAVELING	MED	350	585	S.F.	15.2
WEATHERING	MED	250	418	S.F.	2.5
WEATHERING	LOW	5,350	8,952	S.F.	5.2

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	34 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	37 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	30 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 140

DESCRIPTION: TAXIWAY C-2

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 47 POOR

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 47 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 65

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$14,804	20 YEARS
▼	SURFACE TREATMENT	\$4,702	4 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

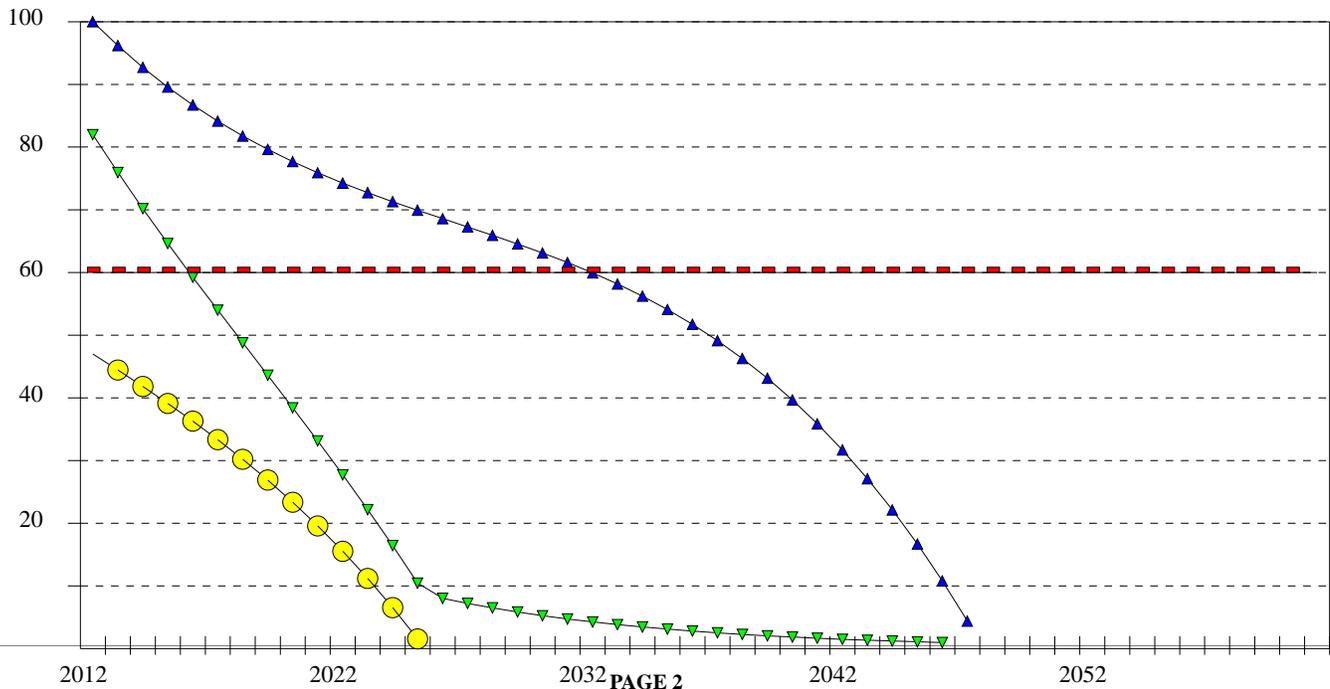

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 145	DESCRIPTION: TAXIWAY C-2
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 78
FEATURE AREA: 30,200	FEATURE'S LOW PCI: 65
INSPECTED AREA: 16,450	AVERAGE PCI: 73 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2022

COMMENTS/HISTORY FOR FEATURE 145, TAXIWAY C-2

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 145

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	452	829	L.F.	50.6
LONG.& TRANS. CRACK	LOW	758	1,391	L.F.	38.3
WEATHERING	MED	45	82	S.F.	.9
WEATHERING	LOW	6,800	12,483	S.F.	10

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	63 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	37 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 145

DESCRIPTION: TAXIWAY C-2

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 73 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2022


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 58

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$42,581	20 YEARS
▼	SURFACE TREATMENT	\$12,487	7 YEARS
◆	CRACK REPAIR	\$2,708	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

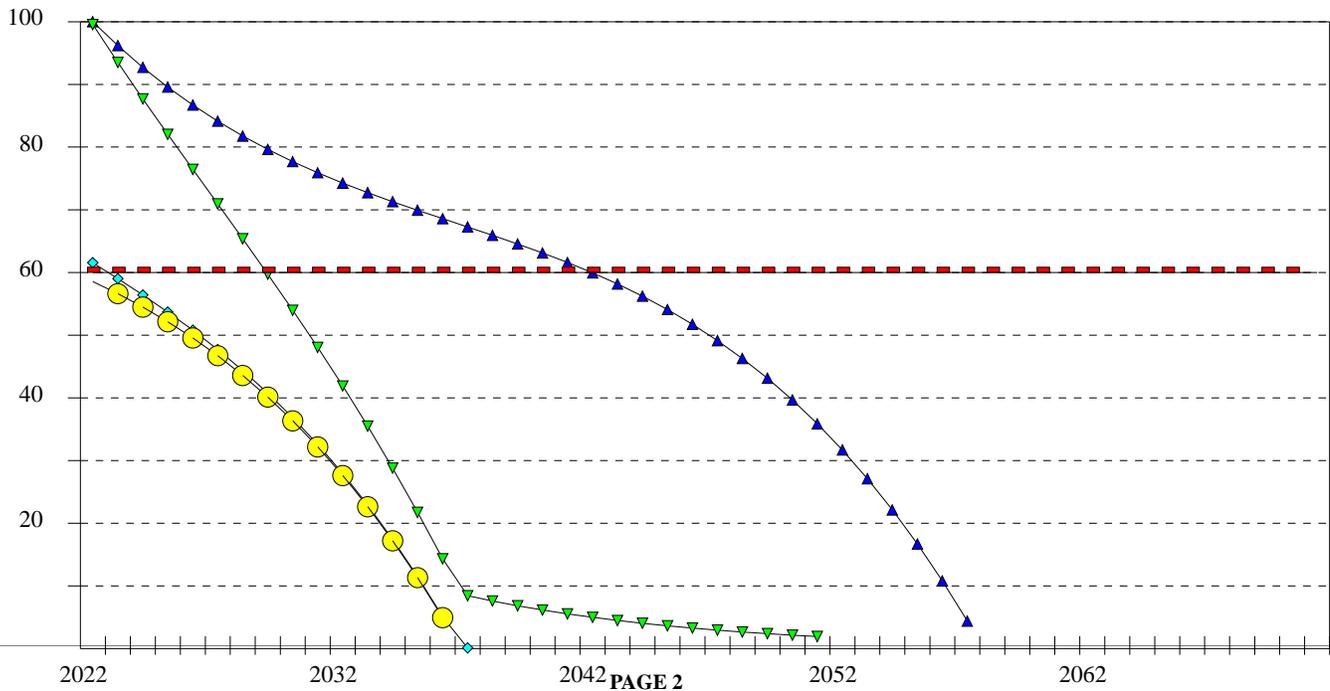

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 150	DESCRIPTION: TAXIWAY C-1
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2020	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 77
FEATURE AREA: 18,500	FEATURE'S LOW PCI: 68
INSPECTED AREA: 11,570	AVERAGE PCI: 72 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2020

COMMENTS/HISTORY FOR FEATURE 150, TAXIWAY C-1

1996 1.5" P401
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 150

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	332	530	L.F.	43.2
LONG.& TRANS. CRACK	LOW	741	1,184	L.F.	41.9
WEATHERING	MED	21	33	S.F.	.6
WEATHERING	LOW	11,400	18,228	S.F.	14.1

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	62 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	38 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 150

DESCRIPTION: TAXIWAY C-1

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2020

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 72 SATISFACTORY

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 59 in 2020


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 51

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$26,084	20 YEARS
▼	SURFACE TREATMENT	\$7,676	7 YEARS
◆	CRACK REPAIR	\$2,091	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

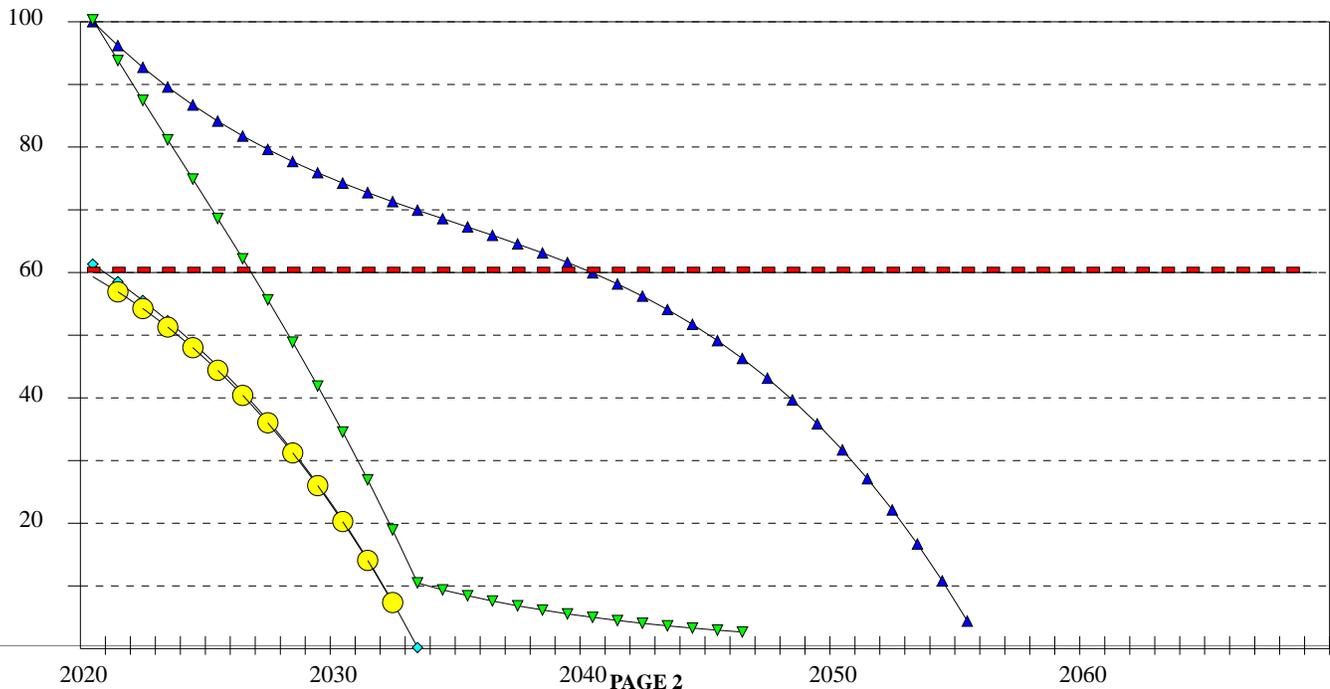

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 155	DESCRIPTION: TAXIWAY C-1
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 77
FEATURE AREA: 25,500	FEATURE'S LOW PCI: 67
INSPECTED AREA: 13,325	AVERAGE PCI: 72 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2021

COMMENTS/HISTORY FOR FEATURE 155, TAXIWAY C-1

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 155

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	6	11	S.F.	12.3
ALLIGATOR CRACKING	LOW	18	34	S.F.	15.1
LONG.& TRANS. CRACK	HIGH	24	45	L.F.	14.9
LONG.& TRANS. CRACK	MED	226	432	L.F.	31.7
LONG.& TRANS. CRACK	LOW	348	665	L.F.	21
WEATHERING	LOW	3,200	6,123	S.F.	4.7

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	28 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	47 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	26 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 155

DESCRIPTION: TAXIWAY C-1

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 72 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2021


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 59

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$35,954	20 YEARS
▼	SURFACE TREATMENT	\$10,271	7 YEARS
◆	CRACK REPAIR	\$1,393	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

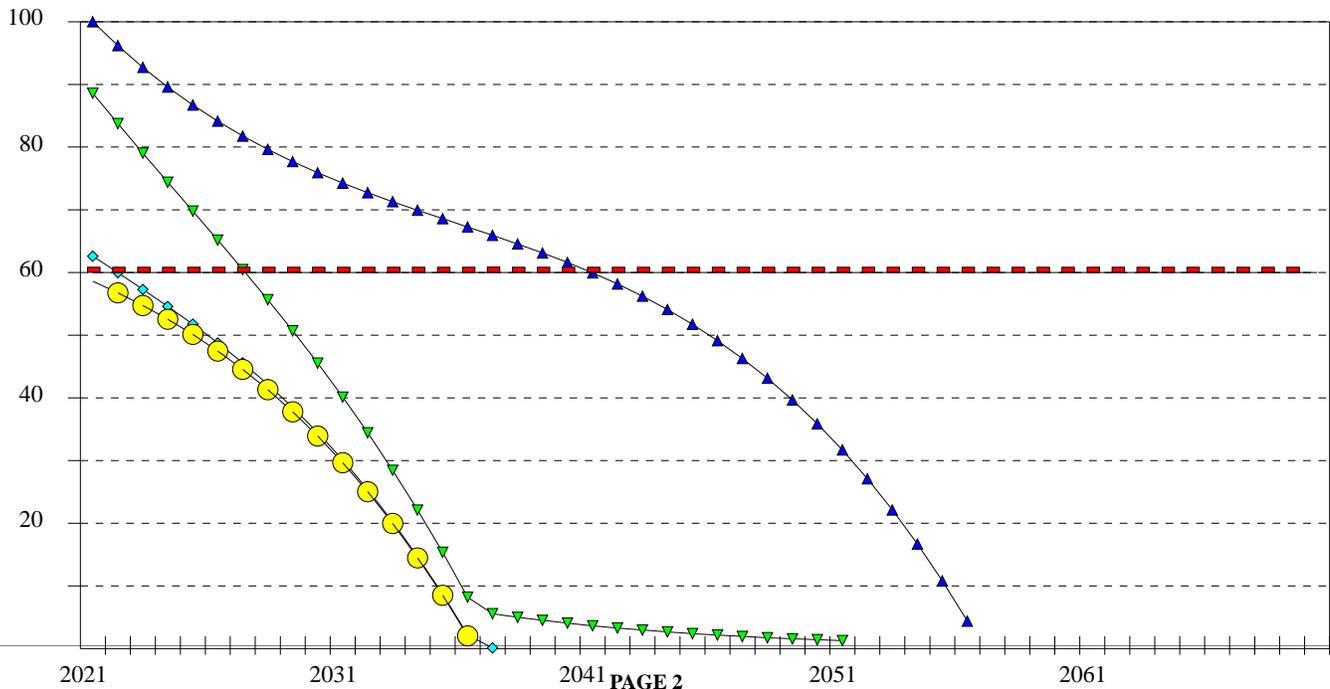

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 160	DESCRIPTION: TAXIWAY C-1
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 81
FEATURE AREA: 12,000	FEATURE'S LOW PCI: 76
INSPECTED AREA: 10,800	AVERAGE PCI: 78 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 78 in 2012

COMMENTS/HISTORY FOR FEATURE 160, TAXIWAY C-1

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 EST. 1972: 4" P401 / 6" P201 / 14" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 160

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
DEPRESSION	LOW	2	2	S.F.	0
LONG.& TRANS. CRACK	MED	79	87	L.F.	36.3
LONG.& TRANS. CRACK	LOW	406	451	L.F.	46.1
WEATHERING	MED	288	320	S.F.	5.5
WEATHERING	LOW	3,300	3,666	S.F.	12

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	61 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	39 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 160

DESCRIPTION: TAXIWAY C-1

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 78 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 78 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 72

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

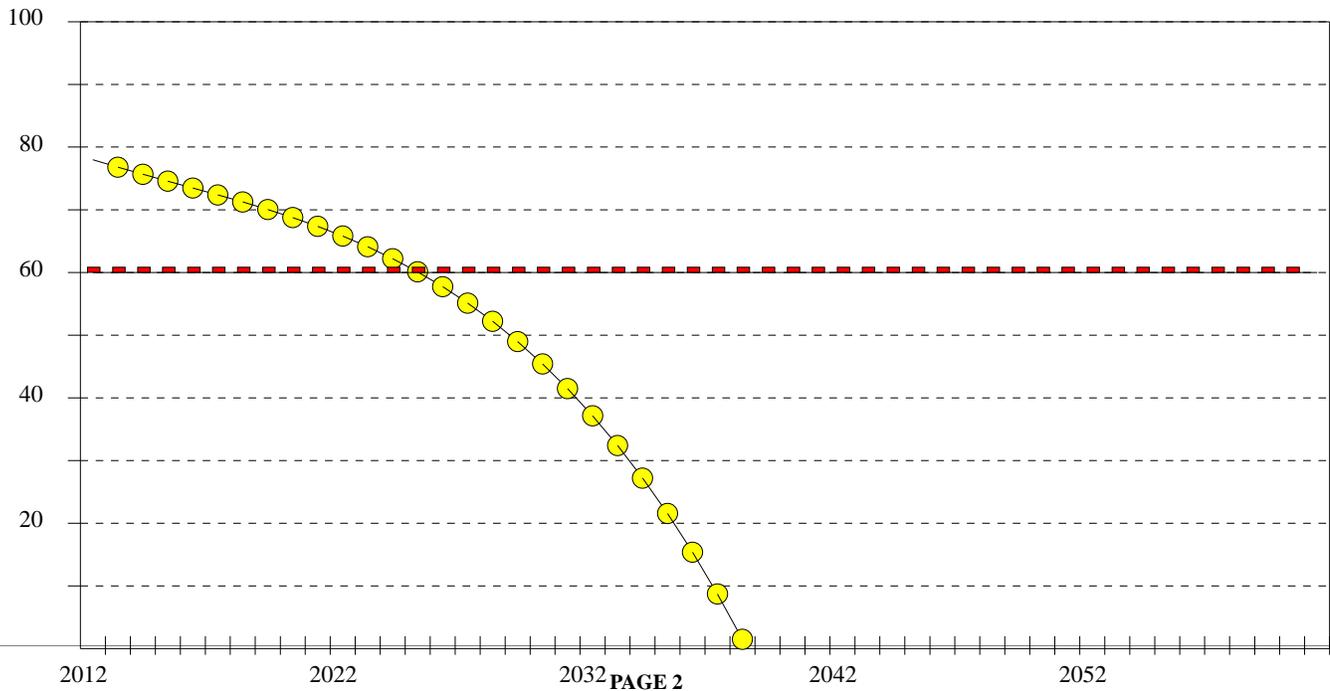

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 201	DESCRIPTION: TAXIWAY B
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 88
FEATURE AREA: 89,933	FEATURE'S LOW PCI: 84
INSPECTED AREA: 30,000	AVERAGE PCI: 85 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 85 in 2012

COMMENTS/HISTORY FOR FEATURE 201, TAXIWAY B

2005: AC Overlay
 1972: 4" P401 / 4" P201/ 10" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 201

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	343	1,028	L.F.	71
LONG.& TRANS. CRACK	LOW	315	944	L.F.	28.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 201

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 85 SATISFACTORY

CONSTRUCTION YEAR: 2005

ESTIMATED PCI IS: 85 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 79

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

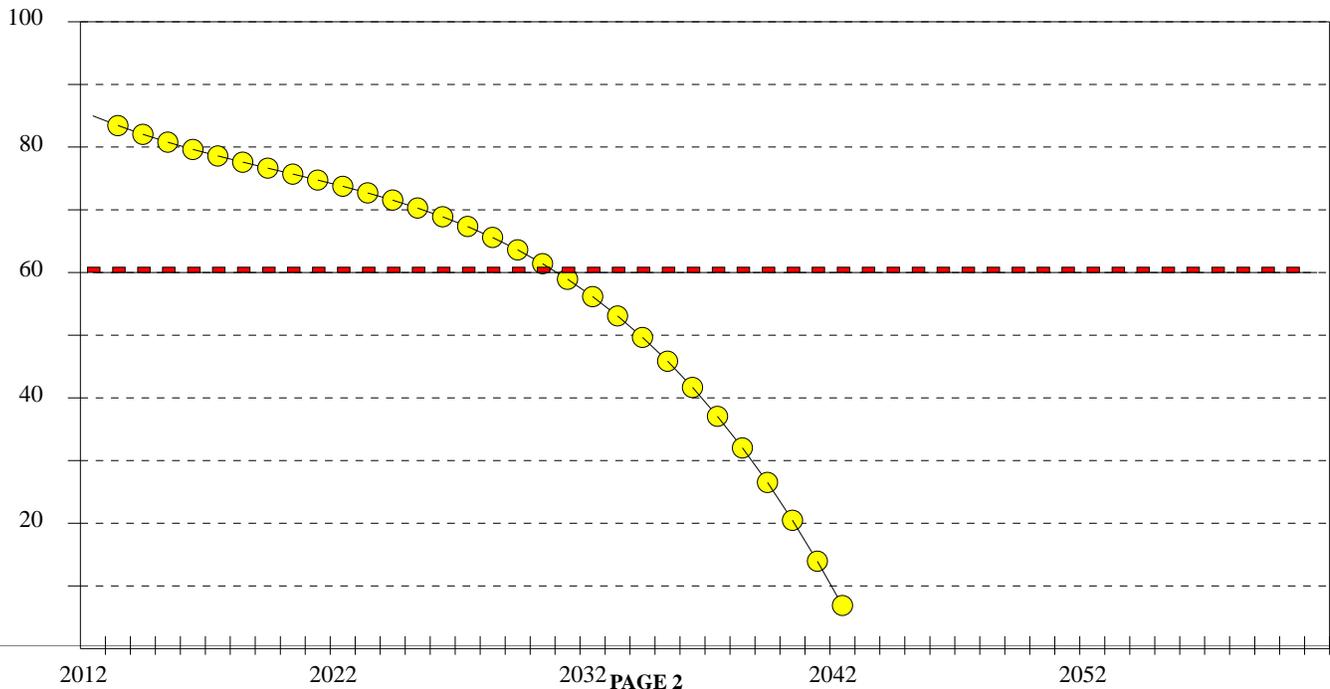

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 205	DESCRIPTION: TAXIWAY B
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 74
FEATURE AREA: 7,600	FEATURE'S LOW PCI: 74
INSPECTED AREA: 7,600	AVERAGE PCI: 74 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2021

COMMENTS/HISTORY FOR FEATURE 205, TAXIWAY B

1996 1.5" P401
 1972 4" P401
 4" P201
 10" P154

DISTRESS QUANTITIES FOR FEATURE 205

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	94	94	L.F.	34.2
LONG.& TRANS. CRACK	LOW	297	297	L.F.	34.6
WEATHERING	MED	700	700	S.F.	16.1
WEATHERING	LOW	6,000	6,000	S.F.	14.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	56 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	44 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 205

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 74 SATISFACTORY

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 59 in 2021


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 49

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$10,715	20 YEARS
▼	SURFACE TREATMENT	\$3,002	7 YEARS
◆	CRACK REPAIR	\$477	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

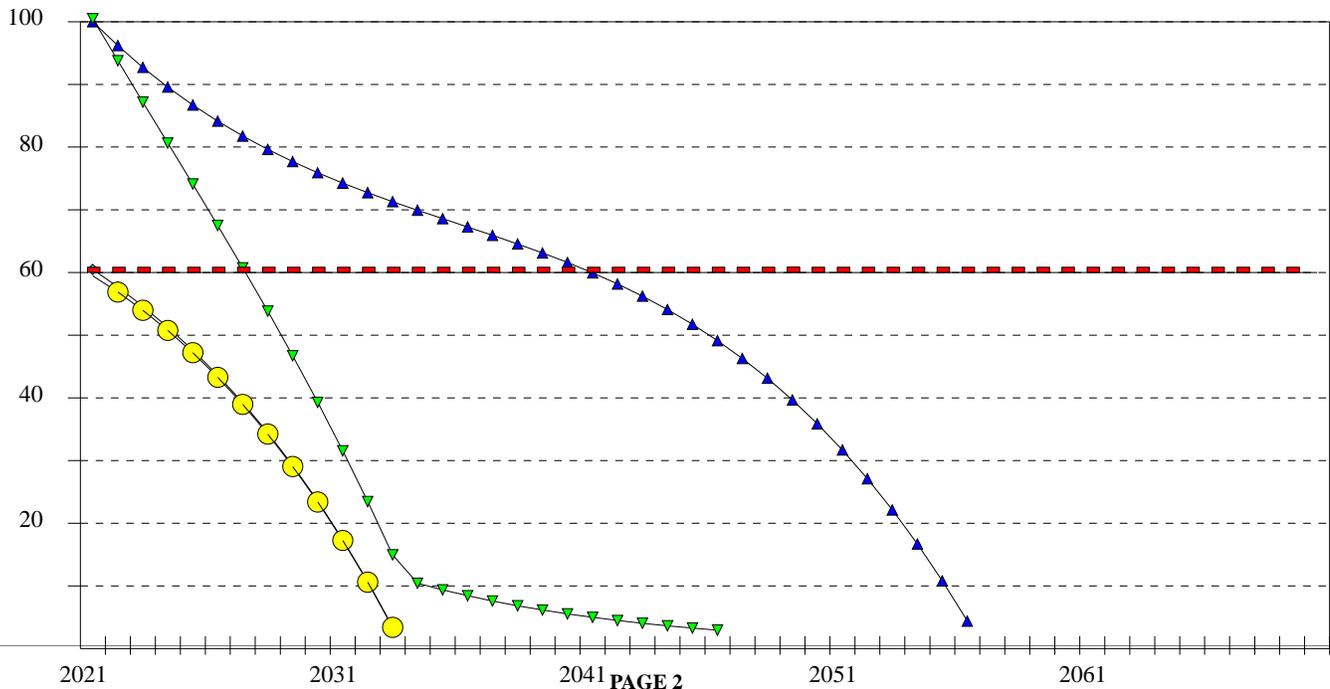

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 290	DESCRIPTION: TAXIWAY B-4
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 84
FEATURE AREA: 6,800	FEATURE'S LOW PCI: 84
INSPECTED AREA: 6,520	AVERAGE PCI: 84 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 84 in 2012

COMMENTS/HISTORY FOR FEATURE 290, TAXIWAY B-4

2005: AC Overlay
 1972: 4" P401 / 4" P201/ 10" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 290

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	14	14	L.F.	32.5
LONG.& TRANS. CRACK	LOW	238	248	L.F.	67.4

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 290

DESCRIPTION: TAXIWAY B-4

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 84 SATISFACTORY

CONSTRUCTION YEAR: 2005

ESTIMATED PCI IS: 84 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 79

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

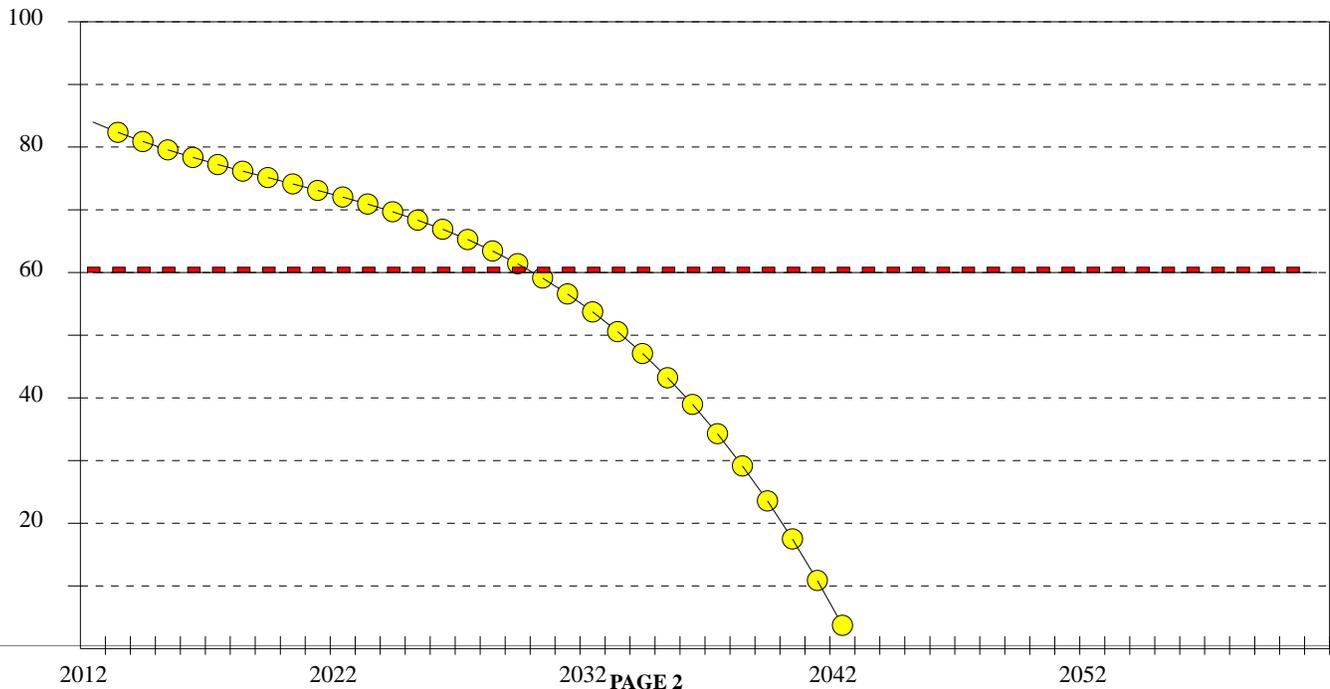

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 291	DESCRIPTION: TAXIWAY B-4
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 73
FEATURE AREA: 6,800	FEATURE'S LOW PCI: 73
INSPECTED AREA: 6,800	AVERAGE PCI: 73 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2022

COMMENTS/HISTORY FOR FEATURE 291, TAXIWAY B-4

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972: 4" P401 / 4" P201/ 10" P154
 *
 *

DISTRESS QUANTITIES FOR FEATURE 291

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	14	14	L.F.	18.9
LONG.& TRANS. CRACK	LOW	560	560	L.F.	75.1
WEATHERING	LOW	890	890	S.F.	5.8

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	65 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	35 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 291

DESCRIPTION: TAXIWAY B-4

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2022

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 73 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2022


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 58

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$9,587	20 YEARS
▼	SURFACE TREATMENT	\$2,601	7 YEARS
◆	CRACK REPAIR	\$700	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

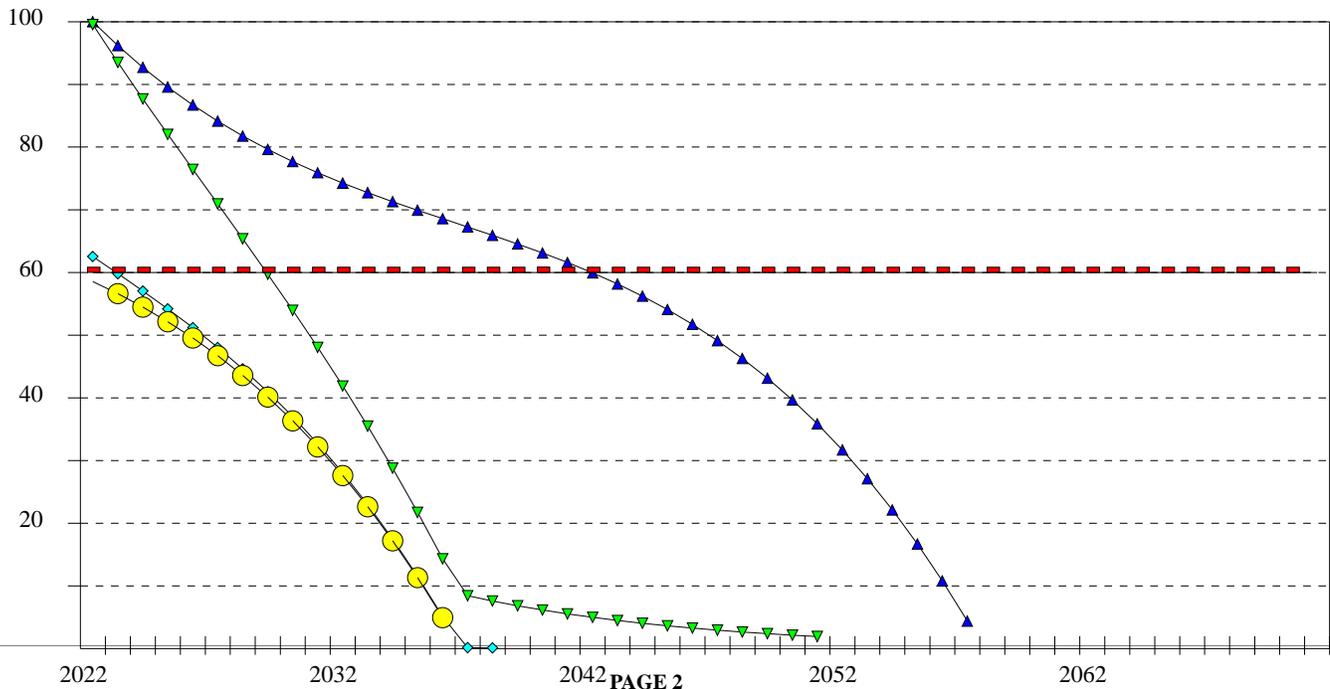

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 292

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC +

FEATURE'S HIGH PCI: 84

FEATURE AREA: 6,500

FEATURE'S LOW PCI: 84

INSPECTED AREA: 5,525

AVERAGE PCI: 84 SATISFACTORY

MINIMUM SERVICE LEVEL: 60

ESTIMATED PCI IS: 84 in 2012

COMMENTS/HISTORY FOR FEATURE 292, TAXIWAY B

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)

1972: 4" P401 / 4" P201 / 10" P154

*

*

DISTRESS QUANTITIES FOR FEATURE 292

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	34	40	L.F.	43.7
LONG.& TRANS. CRACK	LOW	174	204	L.F.	48.8
WEATHERING	LOW	630	741	S.F.	7.4

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	64 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	36 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 292

DESCRIPTION: TAXIWAY B

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC +

AVERAGE PCI AT INSPECTION: 84 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 84 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 85

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

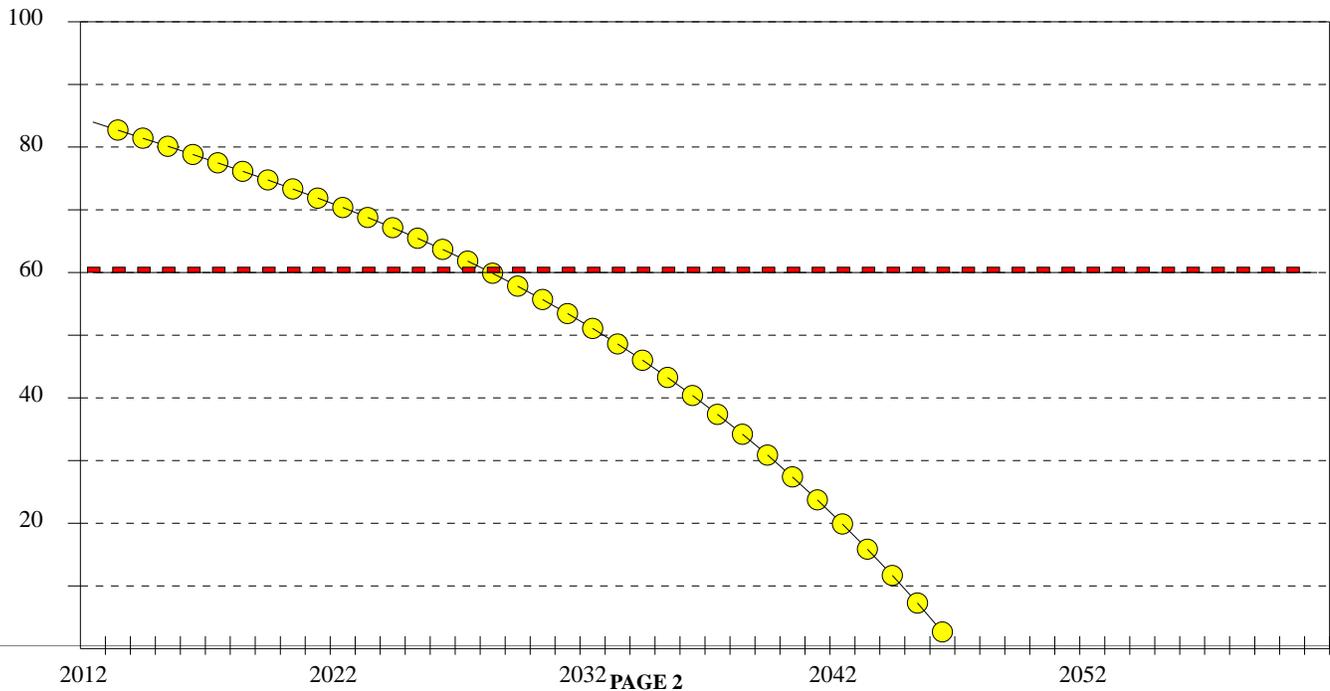

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 295	DESCRIPTION: TAXIWAY B-3
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2020	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 73
FEATURE AREA: 8,400	FEATURE'S LOW PCI: 69
INSPECTED AREA: 8,350	AVERAGE PCI: 71 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2020

COMMENTS/HISTORY FOR FEATURE 295, TAXIWAY B-3

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 EST. 1972: 3" P401 / 3" P201
 EST. 1964: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 295

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF ALL DISTRESS
LONG.& TRANS. CRACK	MED	21	21	L.F.	15.5
LONG.& TRANS. CRACK	LOW	468	470	L.F.	42.2
RAVELING	HIGH	22	22	S.F.	18
RAVELING	MED	38	38	S.F.	11.7
WEATHERING	MED	350	352	S.F.	6.4
WEATHERING	LOW	1,800	1,810	S.F.	5.9

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	53 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	47 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 295

DESCRIPTION: TAXIWAY B-3

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2020

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 71 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 59 in 2020


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 61

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$11,843	20 YEARS
▼	SURFACE TREATMENT	\$3,217	8 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

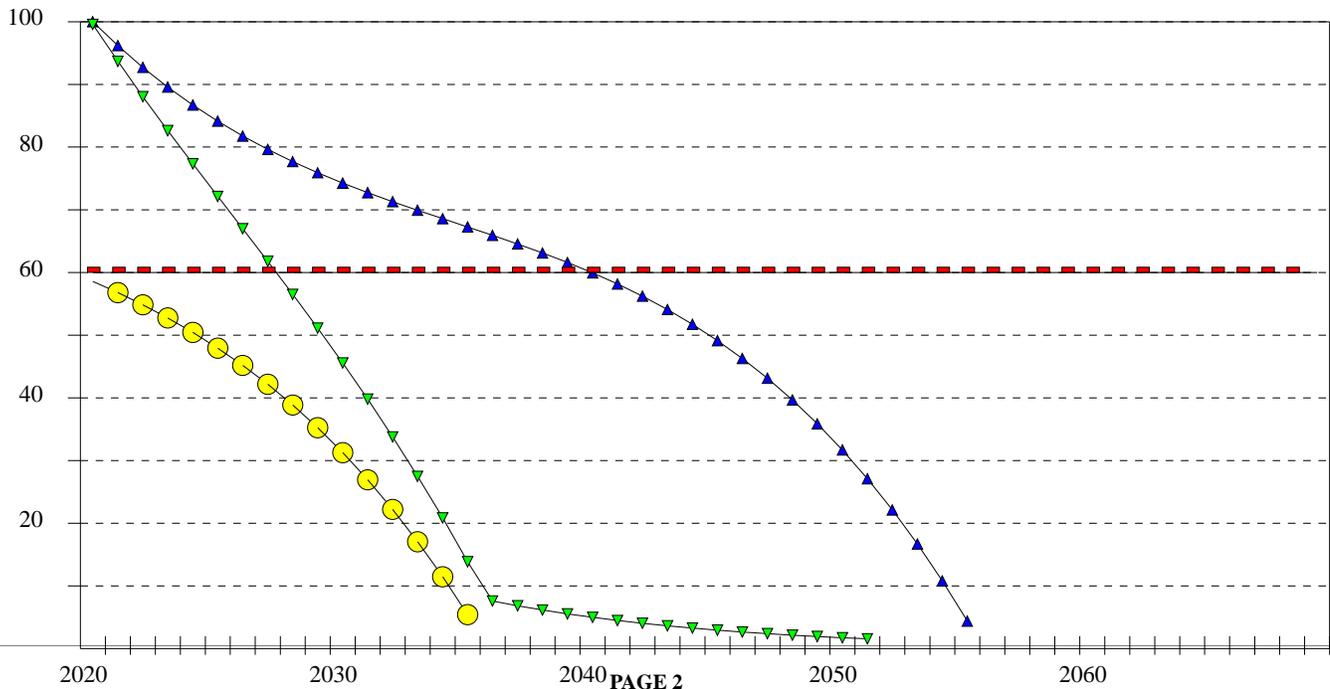

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 296	DESCRIPTION: TAXIWAY B-3
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 63
FEATURE AREA: 2,200	FEATURE'S LOW PCI: 63
INSPECTED AREA: 2,200	AVERAGE PCI: 63 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 58 in 2014

COMMENTS/HISTORY FOR FEATURE 296, TAXIWAY B-3

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 EST. 1972: 3" P401 / 3" P201
 EST. 1964: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 296

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
DEPRESSION	MED	6	6	S.F.	16.7
LONG.& TRANS. CRACK	MED	16	16	L.F.	19.5
LONG.& TRANS. CRACK	LOW	177	177	L.F.	42.5
RAVELING	MED	15	15	S.F.	16
WEATHERING	LOW	500	500	S.F.	5

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	65 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	35 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 296

DESCRIPTION: TAXIWAY B-3

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 63 FAIR

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 58 in 2014


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 69

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$3,101	20 YEARS
▼	SURFACE TREATMENT	\$855	7 YEARS
◆	CRACK REPAIR	\$235	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

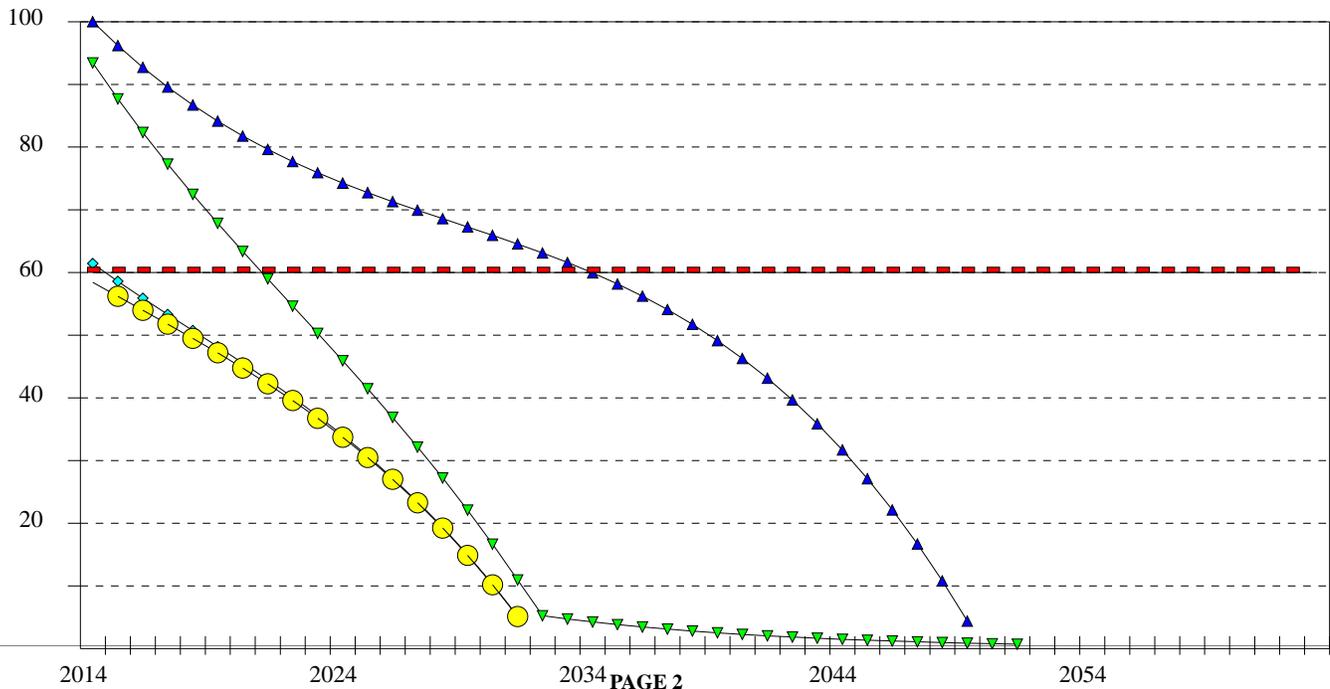

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 301	DESCRIPTION: TAXIWAY A
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 88
FEATURE AREA: 59,000	FEATURE'S LOW PCI: 83
INSPECTED AREA: 29,800	AVERAGE PCI: 85 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 82 in 2012

COMMENTS/HISTORY FOR FEATURE 301, TAXIWAY A

2005: AC Overlay
 1972: 3" P401
 1964: 4" P401 / 6" P201 / 10" P154
 *

DISTRESS QUANTITIES FOR FEATURE 301

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	280	554	L.F.	68.5
LONG.& TRANS. CRACK	LOW	345	683	L.F.	31.4

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 301

DESCRIPTION: TAXIWAY A

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 85 SATISFACTORY

CONSTRUCTION YEAR: 2005

ESTIMATED PCI IS: 82 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 79

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

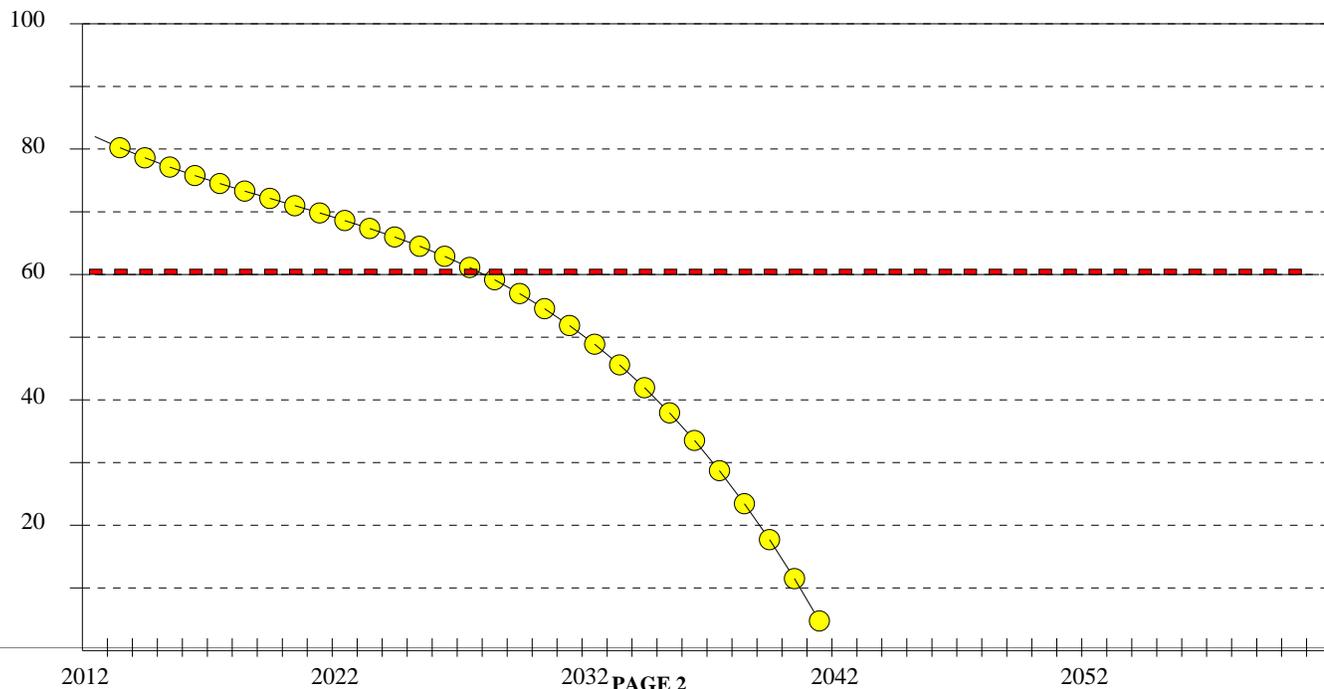

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 305	DESCRIPTION: TAXIWAY A
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2013	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 70
FEATURE AREA: 12,000	FEATURE'S LOW PCI: 52
INSPECTED AREA: 8,750	AVERAGE PCI: 61 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2013

COMMENTS/HISTORY FOR FEATURE 305, TAXIWAY A

1996 1.5" P401
 1972 3" P401
 1964 4" P401 ON 6" P201
 10" P154

DISTRESS QUANTITIES FOR FEATURE 305

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	16	21	S.F.	26
ALLIGATOR CRACKING	LOW	4	5	S.F.	6.4
DEPRESSION	LOW	16	21	S.F.	5.2
LONG.& TRANS. CRACK	MED	220	301	L.F.	28.5
LONG.& TRANS. CRACK	LOW	338	463	L.F.	25.8
WEATHERING	MED	70	96	S.F.	2.2
WEATHERING	LOW	3,200	4,388	S.F.	5.6

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	32 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	44 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	23 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 305

DESCRIPTION: TAXIWAY A

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2013

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 61 FAIR

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 59 in 2013


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 64

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$16,919	20 YEARS
▼	SURFACE TREATMENT	\$4,927	7 YEARS
◆	CRACK REPAIR	\$932	2 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

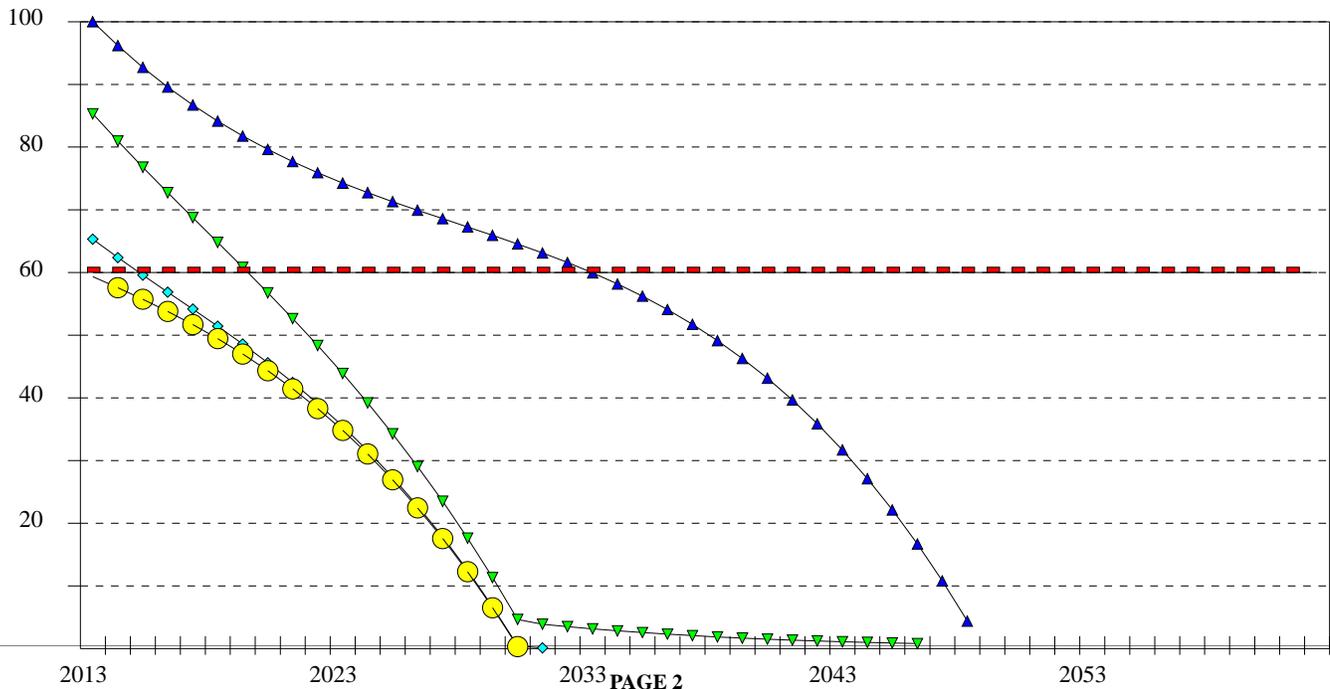

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 310	DESCRIPTION: TAXIWAY A-2
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 80
FEATURE AREA: 38,000	FEATURE'S LOW PCI: 77
INSPECTED AREA: 19,500	AVERAGE PCI: 79 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 79 in 2012

COMMENTS/HISTORY FOR FEATURE 310, TAXIWAY A-2

2005" AC Overlay
 1996: 1.5" P401
 1972: 3" P401 / 9" P208 / 7" P154
 *

DISTRESS QUANTITIES FOR FEATURE 310

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	HIGH	8	15	L.F.	11.4
LONG.& TRANS. CRACK	MED	435	847	L.F.	67.9
LONG.& TRANS. CRACK	LOW	108	210	L.F.	16.7
OIL SPILLAGE	N/A	9	17	S.F.	2.9
WEATHERING	LOW	300	584	S.F.	.8

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	64 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	36 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 310

DESCRIPTION: TAXIWAY A-2

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 79 SATISFACTORY

CONSTRUCTION YEAR: 2005

ESTIMATED PCI IS: 79 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 79

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

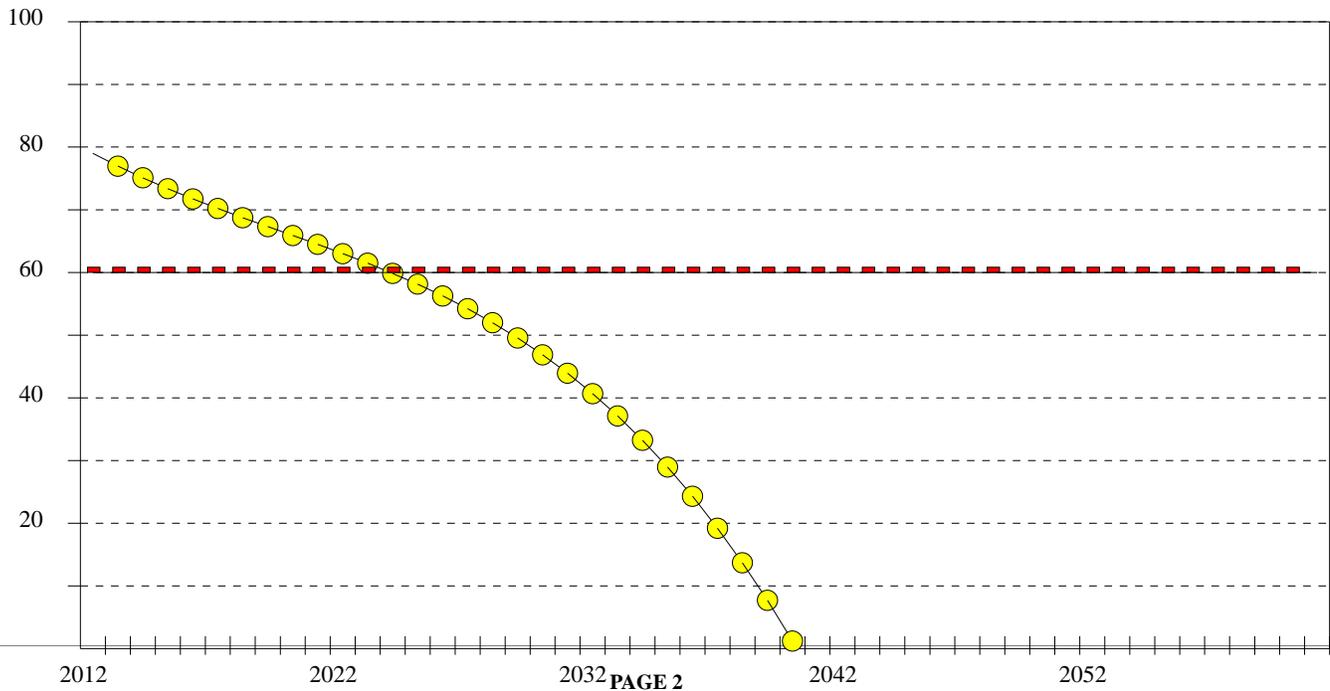

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 405	DESCRIPTION: TAXIWAY D
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2016	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 71
FEATURE AREA: 15,000	FEATURE'S LOW PCI: 66
INSPECTED AREA: 8,000	AVERAGE PCI: 68 FAIR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 60 in 2016

COMMENTS/HISTORY FOR FEATURE 405, TAXIWAY D

2002: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 Existing Pavement
 *
 *

DISTRESS QUANTITIES FOR FEATURE 405

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	223	418	L.F.	45.7
LONG.& TRANS. CRACK	LOW	248	465	L.F.	24.8
WEATHERING	MED	900	1,687	S.F.	16.2
WEATHERING	LOW	6,200	11,625	S.F.	13.1

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	57 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	43 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 405

DESCRIPTION: TAXIWAY D

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2016

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 68 FAIR

CONSTRUCTION YEAR: 2002

ESTIMATED PCI IS: 60 in 2016


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 68

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$21,149	20 YEARS
▼	SURFACE TREATMENT	\$6,209	8 YEARS
◆	CRACK REPAIR	\$1,077	2 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

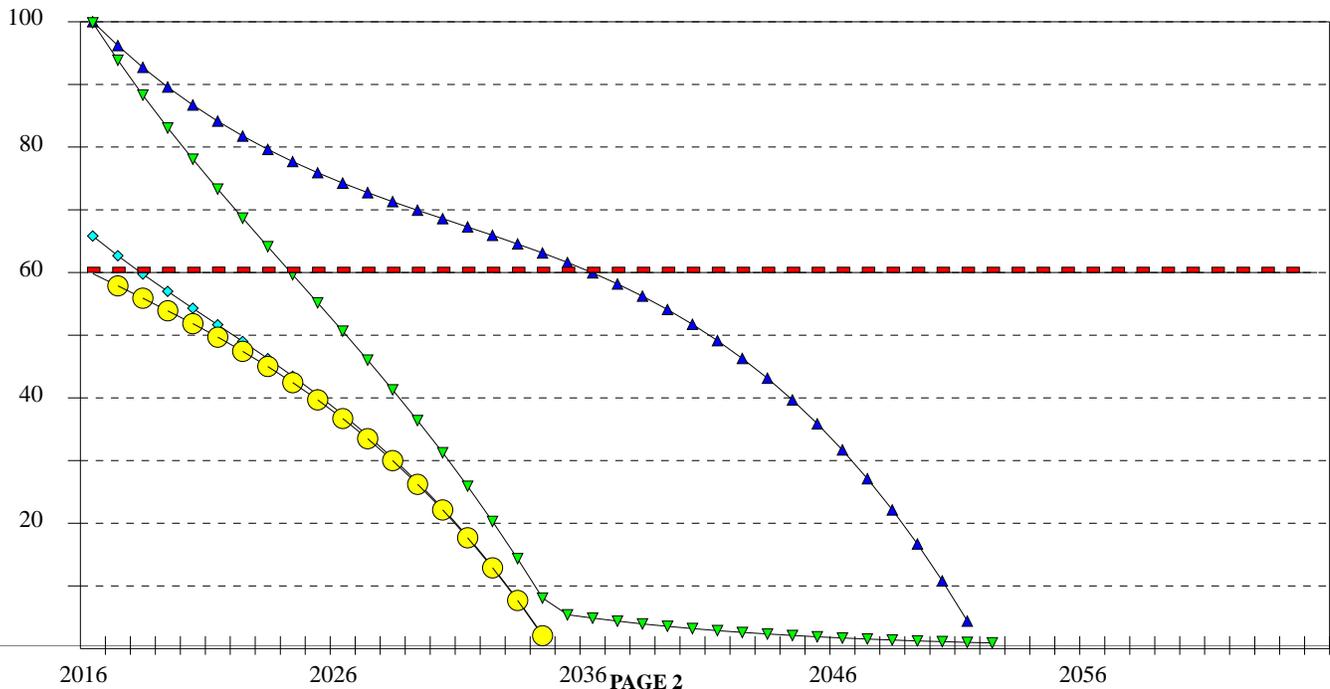

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 410	DESCRIPTION: TAXIWAY D
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2023	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 80
FEATURE AREA: 28,000	FEATURE'S LOW PCI: 71
INSPECTED AREA: 14,800	AVERAGE PCI: 76 SATISFACTORY
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 59 in 2023

COMMENTS/HISTORY FOR FEATURE 410, TAXIWAY D

2002: 1.5" P401 (1/2" Agg) / P603 / 2.5" P401 (3/4" Agg)
 / Remove Pulverized AC Material
 / Existing Pavement
 *

DISTRESS QUANTITIES FOR FEATURE 410

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	188	355	L.F.	38.7
LONG.& TRANS. CRACK	LOW	469	887	L.F.	34
WEATHERING	MED	900	1,702	S.F.	13.4
WEATHERING	LOW	6,900	13,054	S.F.	13.8

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	58 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	42 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 410

DESCRIPTION: TAXIWAY D

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2023

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 76 SATISFACTORY

CONSTRUCTION YEAR: 2002

ESTIMATED PCI IS: 59 in 2023


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 60

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$39,479	20 YEARS
▼	SURFACE TREATMENT	\$11,073	8 YEARS
◆	CRACK REPAIR	\$1,515	2 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

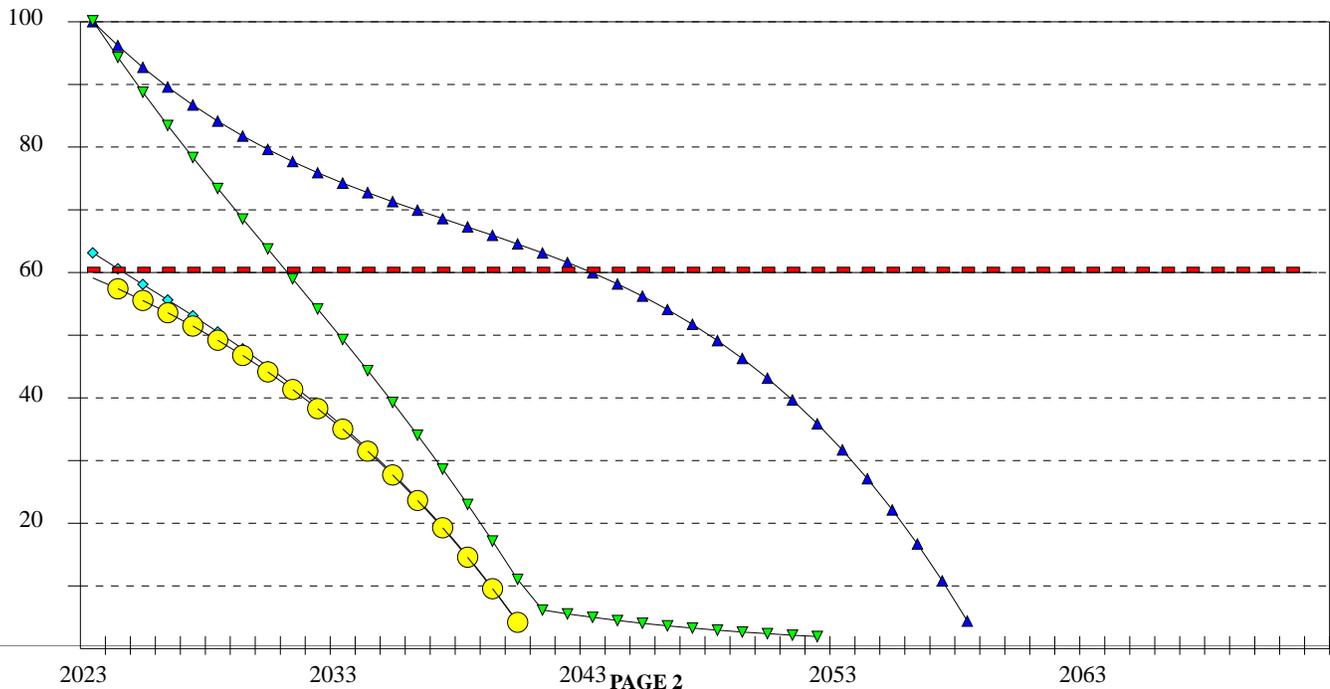

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 505	DESCRIPTION: TAXIWAY E
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 94
FEATURE AREA: 25,850	FEATURE'S LOW PCI: 89
INSPECTED AREA: 10,235	AVERAGE PCI: 93 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 93 in 2012

COMMENTS/HISTORY FOR FEATURE 505, TAXIWAY E

1990 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 505

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
JOINT SEAL DAMAGE	MED	120	303	SLABS	81.6
JOINT SEAL DAMAGE	LOW	20	50	SLABS	3.8
SPALLING-JOINTS	MED	1	2	SLABS	7.2
SPALLING-CORNERS	MED	1	2	SLABS	7.1

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	7 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	31 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	62 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 505

DESCRIPTION: TAXIWAY E

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 93 GOOD

CONSTRUCTION YEAR: 1990

ESTIMATED PCI IS: 93 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 73

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

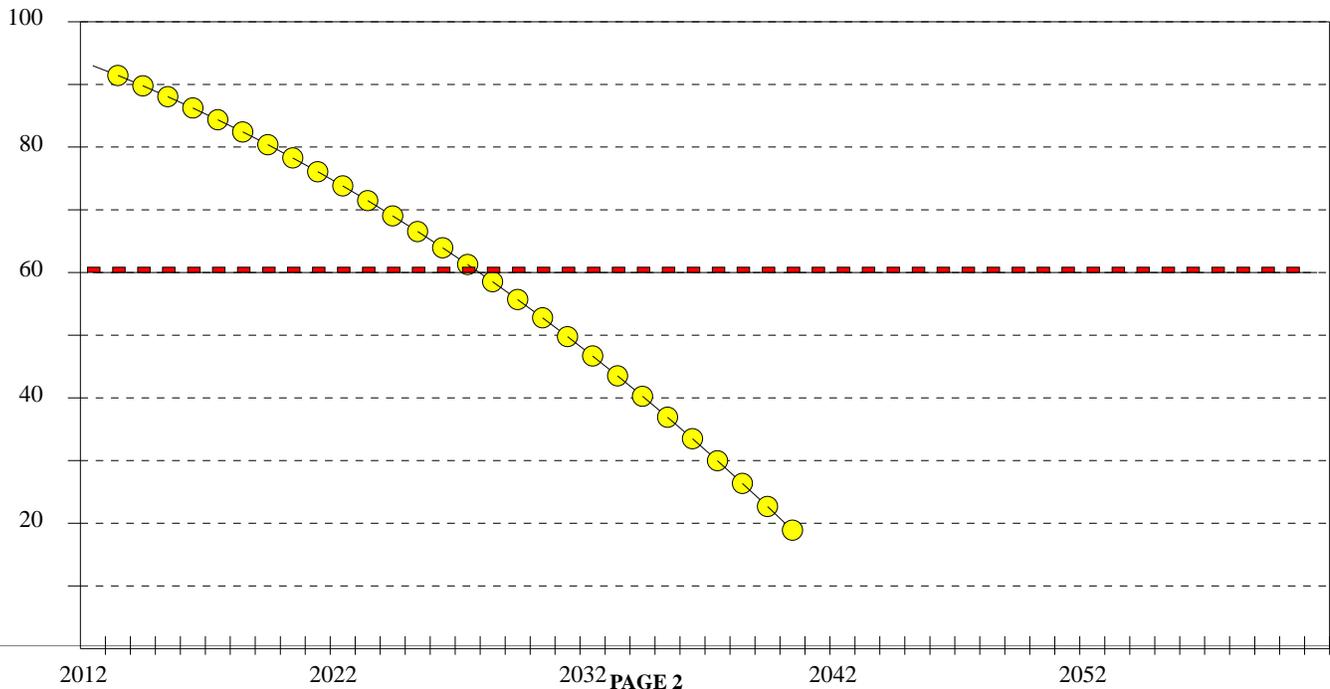

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 2015

DESCRIPTION: TEES

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

FEATURE'S HIGH PCI: 93

FEATURE AREA: 18,660

FEATURE'S LOW PCI: 84

INSPECTED AREA: 8,000

AVERAGE PCI: 88 GOOD

MINIMUM SERVICE LEVEL: 60

ESTIMATED PCI IS: 82 in 2012

COMMENTS/HISTORY FOR FEATURE 2015, TEES

2001 AC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 2015

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	15	35	L.F.	20.1
LONG.& TRANS. CRACK	LOW	202	471	L.F.	67.2
WEATHERING	LOW	1,050	2,449	S.F.	12.6

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	62 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	38 %

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 2015

DESCRIPTION: TEES

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 88 GOOD

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 82 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 74

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

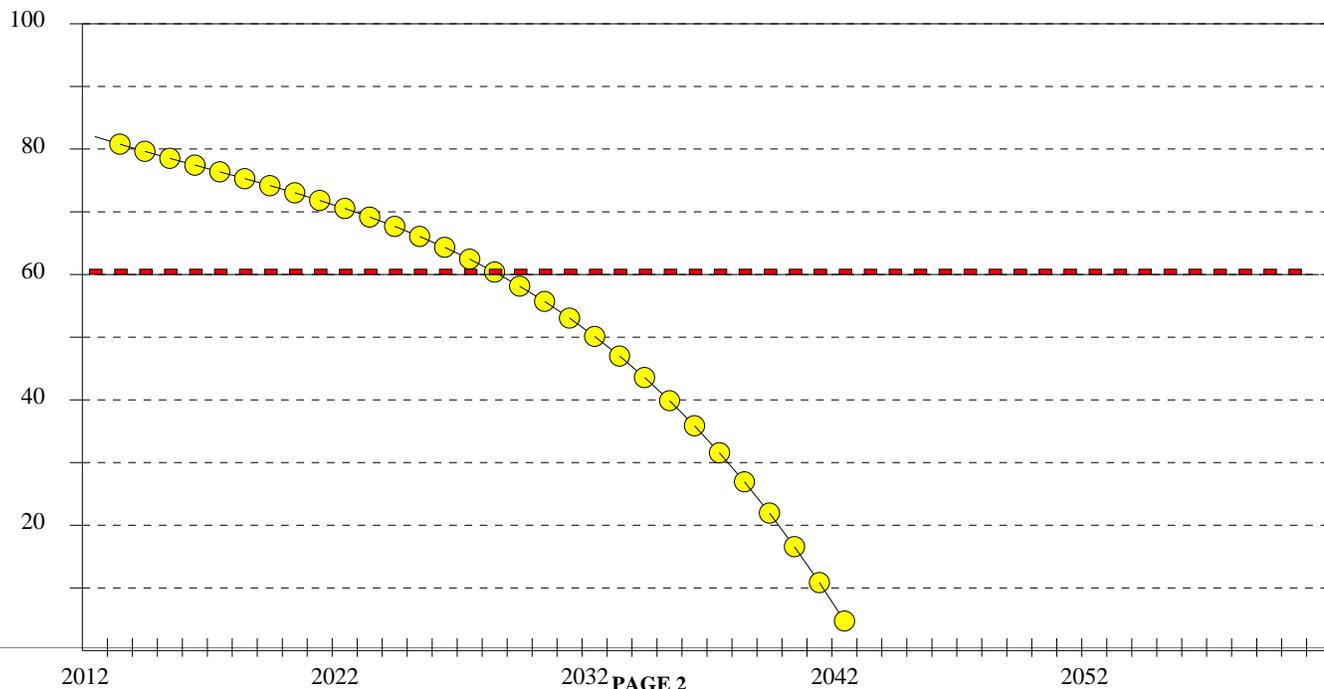

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3005	DESCRIPTION: TERMINAL RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 170,716	FEATURE'S LOW PCI: 69
INSPECTED AREA: 56,000	AVERAGE PCI: 87 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 87 in 2012

COMMENTS/HISTORY FOR FEATURE 3005, TERMINAL RAMP

1995 PCC 10" P501
 12" P201
 COMPACTED SUBGRADE
 *

DISTRESS QUANTITIES FOR FEATURE 3005

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG/TRAN/DIAG CRK.	MED	6	18	SLABS	53.5
LONG/TRAN/DIAG CRK.	LOW	5	15	SLABS	17.5
JOINT SEAL DAMAGE	LOW	20	61	SLABS	1.9
PATCH>5 SF/UTIL.CUT	LOW	2	6	SLABS	5.4
SETTLEMENT/FAULT	LOW	2	6	SLABS	8
SHRINKAGE CRACKS	N/A	3	9	SLABS	2.4
SPALLING-JOINTS	MED	3	9	SLABS	10.8

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	38 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	6 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	55 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3005

DESCRIPTION: TERMINAL RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 87 GOOD

CONSTRUCTION YEAR: 1995

ESTIMATED PCI IS: 87 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 82

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

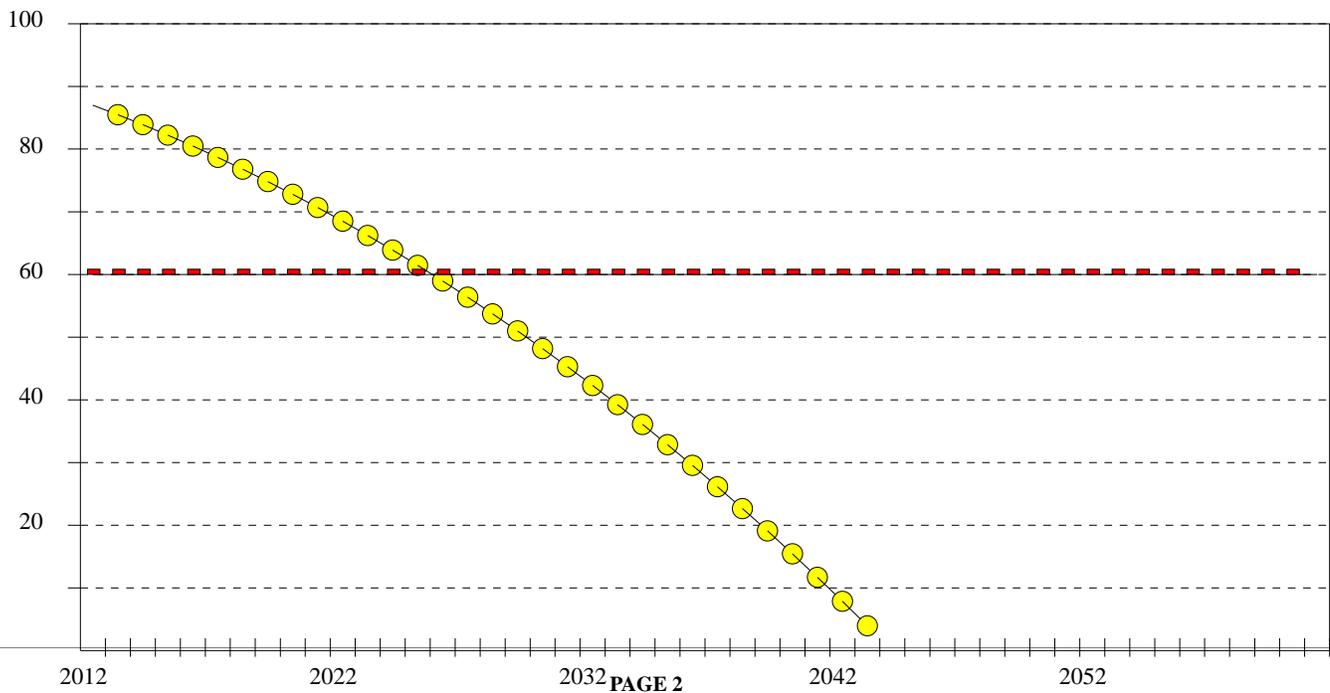

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3010	DESCRIPTION: TERMINAL RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 98
FEATURE AREA: 188,801	FEATURE'S LOW PCI: 81
INSPECTED AREA: 40,225	AVERAGE PCI: 90 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 90 in 2012

COMMENTS/HISTORY FOR FEATURE 3010, TERMINAL RAMP

1990 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3010

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
JOINT SEAL DAMAGE	MED	396	1,858	SLABS	62.7
JOINT SEAL DAMAGE	LOW	36	169	SLABS	1.6
SETTLEMENT/FAULT	LOW	4	18	SLABS	7.2
SPALLING-JOINTS	HIGH	1	4	SLABS	6.4
SPALLING-JOINTS	MED	5	23	SLABS	8.4
SPALLING-CORNERS	HIGH	4	18	SLABS	8.9
SPALLING-CORNERS	MED	2	9	SLABS	3.2
SPALLING-CORNERS	LOW	1	4	SLABS	1

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	19 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	28 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	52 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3010

DESCRIPTION: TERMINAL RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 90 GOOD

CONSTRUCTION YEAR: 1990

ESTIMATED PCI IS: 90 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 73

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

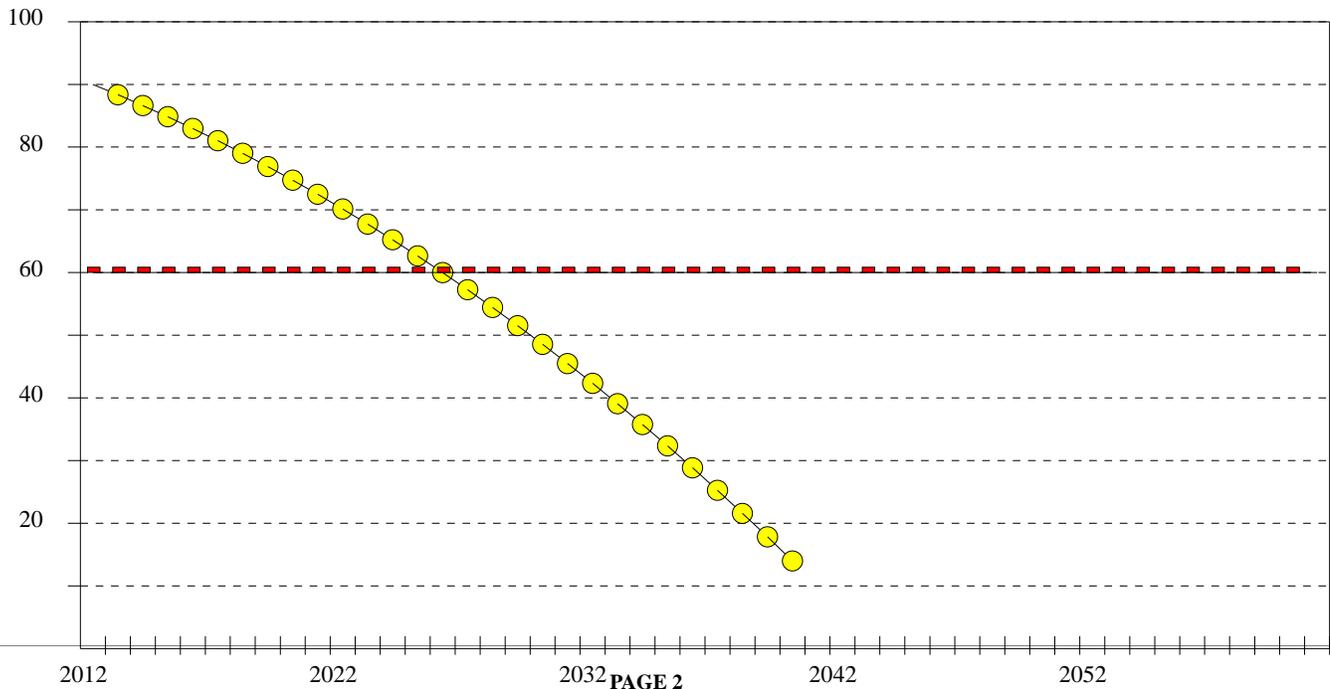

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3015	DESCRIPTION: TERMINAL RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 12,750	FEATURE'S LOW PCI: 100
INSPECTED AREA: 12,750	AVERAGE PCI: 100 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 100 in 2012

COMMENTS/HISTORY FOR FEATURE 3015, TERMINAL RAMP

2004 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3015

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
---------------	----------	----------------------	-----------------------------	-------	-------------------------------

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	0 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3015

DESCRIPTION: TERMINAL RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 100 GOOD

CONSTRUCTION YEAR: 2004

ESTIMATED PCI IS: 100 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 94

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

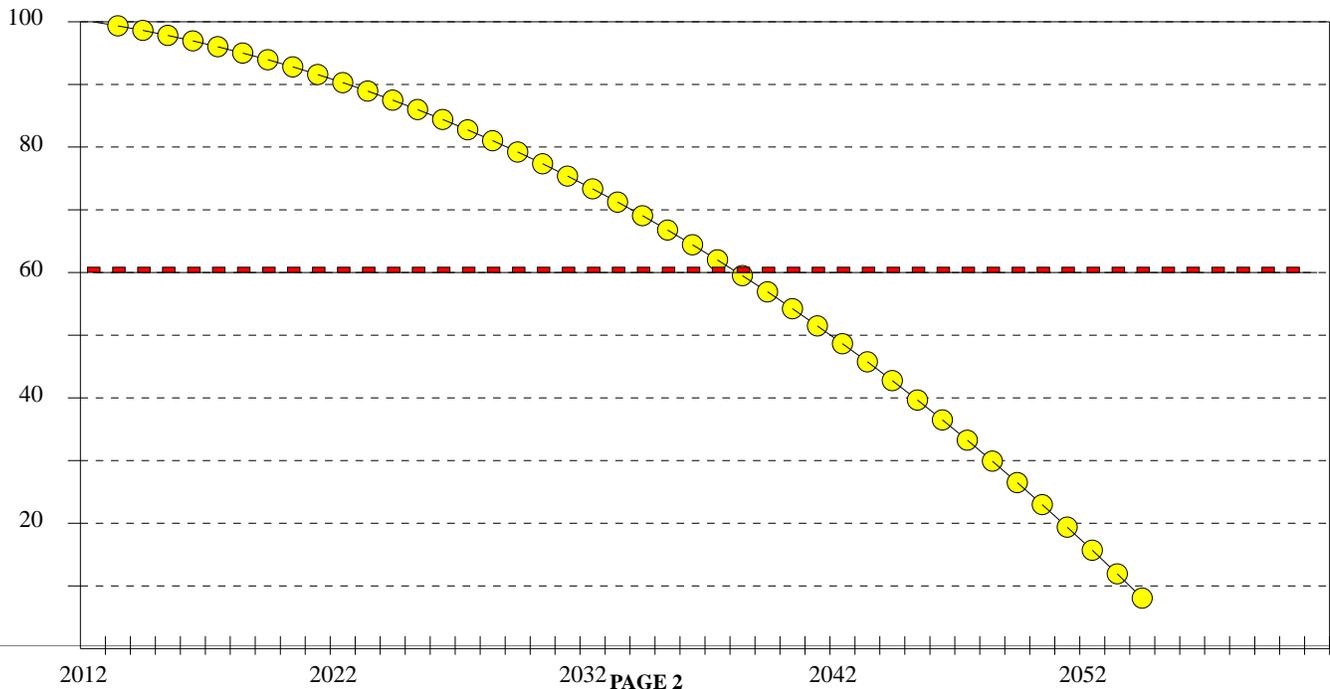

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3020	DESCRIPTION: TERMINAL RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 4,650	FEATURE'S LOW PCI: 100
INSPECTED AREA: 4,650	AVERAGE PCI: 100 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 100 in 2012

COMMENTS/HISTORY FOR FEATURE 3020, TERMINAL RAMP

2005 PCC est
 EST. 1964: PCC
 *
 *

DISTRESS QUANTITIES FOR FEATURE 3020

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
---------------	----------	----------------------	-----------------------------	-------	-------------------------------

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	0 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3020

DESCRIPTION: TERMINAL RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 100 GOOD

CONSTRUCTION YEAR: 2005

ESTIMATED PCI IS: 100 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 95

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

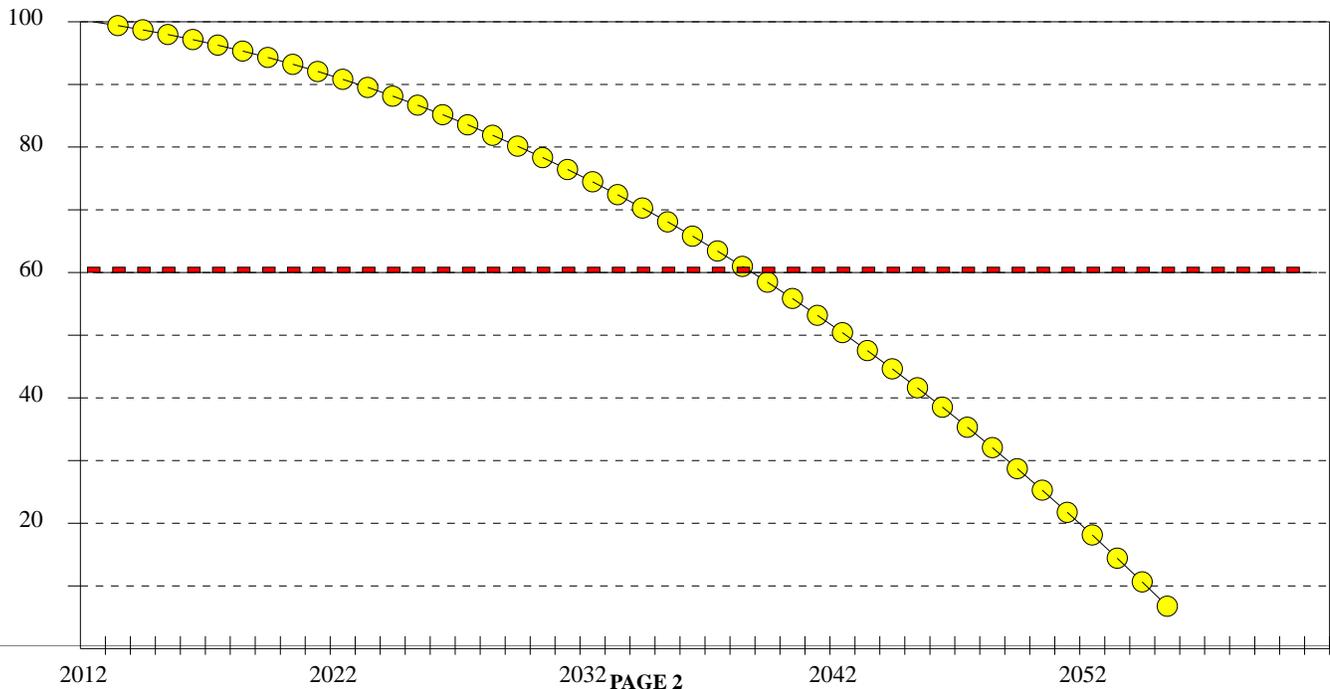

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3025	DESCRIPTION: RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 8,600	FEATURE'S LOW PCI: 100
INSPECTED AREA: 8,600	AVERAGE PCI: 100 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 100 in 2012

COMMENTS/HISTORY FOR FEATURE 3025, RAMP

2007 9" P-501/ 6" P-209/ COMP SUBGRADE

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3025

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
---------------	----------	----------------------	-----------------------------	-------	-------------------------------

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	0 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3025

DESCRIPTION: RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 100 GOOD

CONSTRUCTION YEAR: 2007

ESTIMATED PCI IS: 100 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 96

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

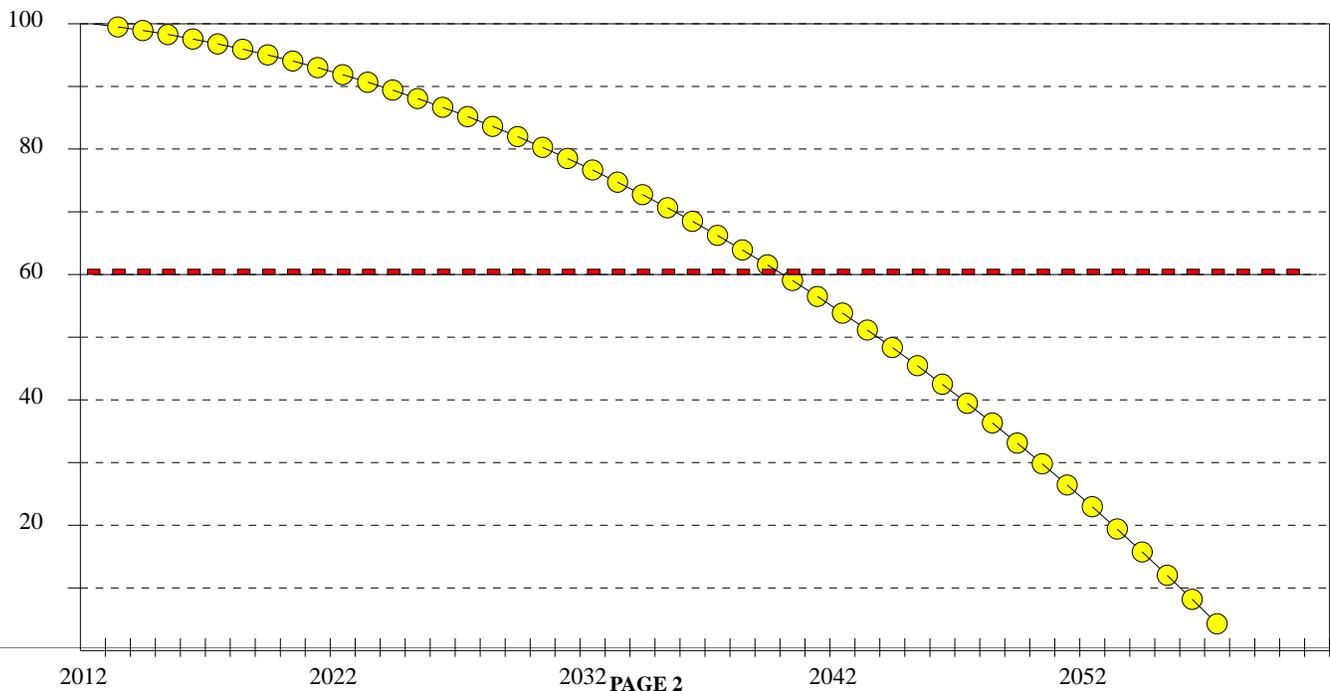

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3105	DESCRIPTION: TAXILANE
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 69
FEATURE AREA: 34,400	FEATURE'S LOW PCI: 38
INSPECTED AREA: 14,750	AVERAGE PCI: 51 POOR
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 51 in 2012

COMMENTS/HISTORY FOR FEATURE 3105, TAXILANE

2001 AC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3105

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	MED	405	944	S.F.	51.4
LONG.& TRANS. CRACK	HIGH	5	11	L.F.	2.8
LONG.& TRANS. CRACK	MED	448	1,044	L.F.	28.2
LONG.& TRANS. CRACK	LOW	431	1,005	L.F.	14.2
WEATHERING	LOW	2,600	6,063	S.F.	3.2

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	51 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	31 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	17 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3105

DESCRIPTION: TAXILANE

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 51 POOR

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 51 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 74

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	STRUCTURAL OVERLAY	\$76,023	20 YEARS
▼	SURFACE TREATMENT	\$14,359	3 YEARS
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

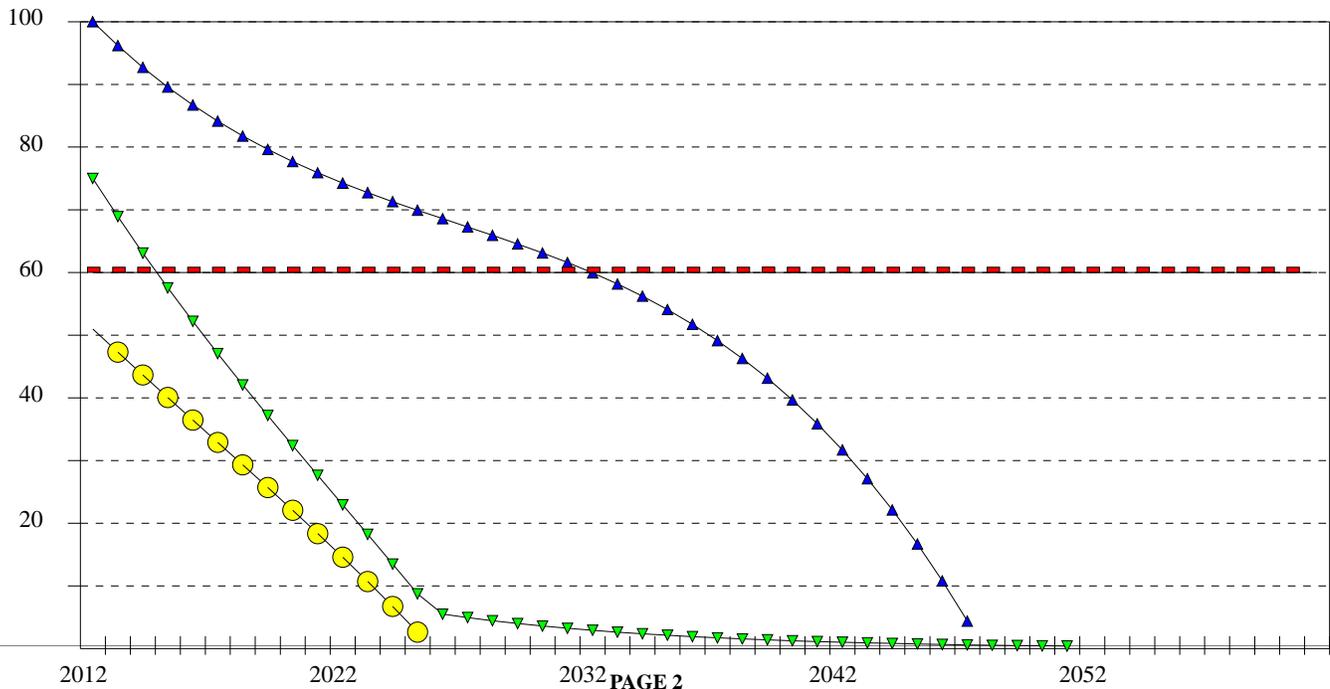

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3110	DESCRIPTION: TEE HANGARS
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 88
FEATURE AREA: 29,424	FEATURE'S LOW PCI: 83
INSPECTED AREA: 10,000	AVERAGE PCI: 86 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 86 in 2012

COMMENTS/HISTORY FOR FEATURE 3110, TEE HANGARS

2007 mill 2" and overlay with 1.5" p-401 .5 max agg/
 2.5" p-401 .75 max agg/ existing lime treated subgrade
 and p-209 as needed
 *

DISTRESS QUANTITIES FOR FEATURE 3110

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
LONG.& TRANS. CRACK	MED	18	52	L.F.	14.9
LONG.& TRANS. CRACK	LOW	457	1,344	L.F.	85

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	67 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3110

DESCRIPTION: TEE HANGARS

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 86 GOOD

CONSTRUCTION YEAR: 2007

ESTIMATED PCI IS: 86 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 86

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

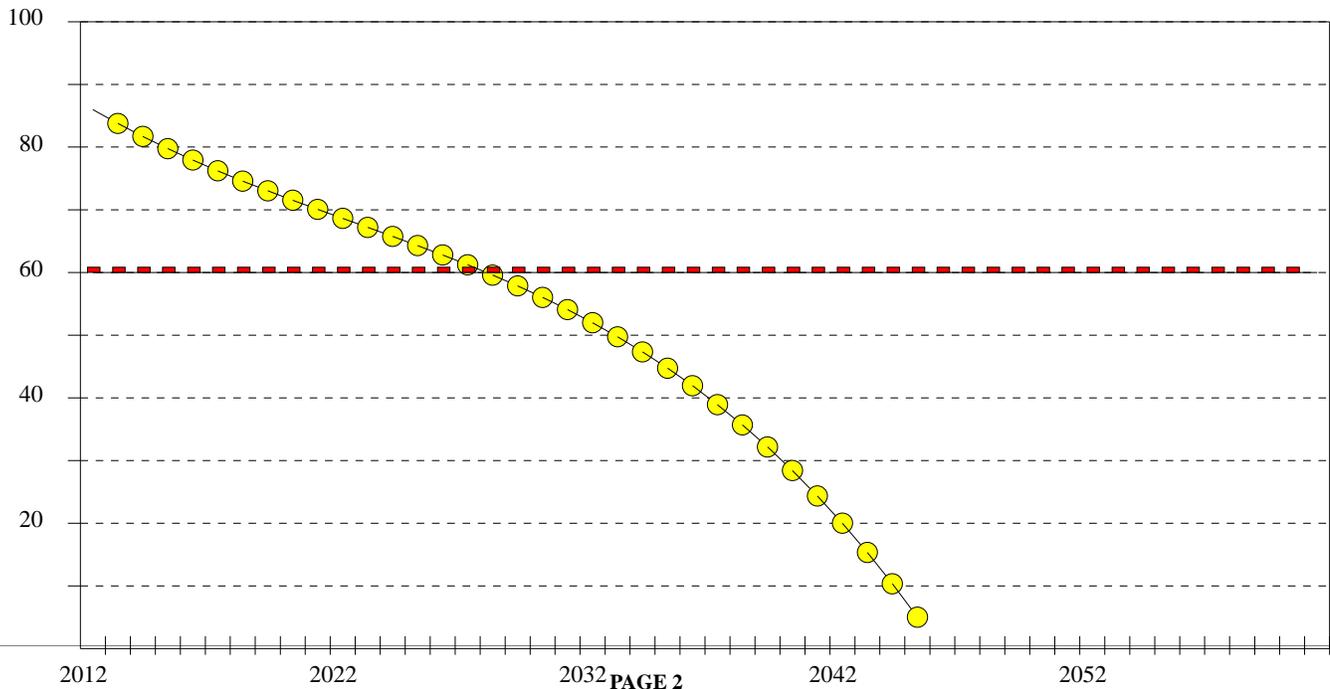

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3115	DESCRIPTION: GA RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 29,655	FEATURE'S LOW PCI: 98
INSPECTED AREA: 11,400	AVERAGE PCI: 99 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 99 in 2012

COMMENTS/HISTORY FOR FEATURE 3115, GA RAMP

2007 PCC 9" P-501/ 6" P-209/ COMP SUBGRADE est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3115

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
SPALLING-CORNERS	LOW	1	2	SLABS	100

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	33 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	33 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	33 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3115

DESCRIPTION: GA RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 99 GOOD

CONSTRUCTION YEAR: 2007

ESTIMATED PCI IS: 99 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 96

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

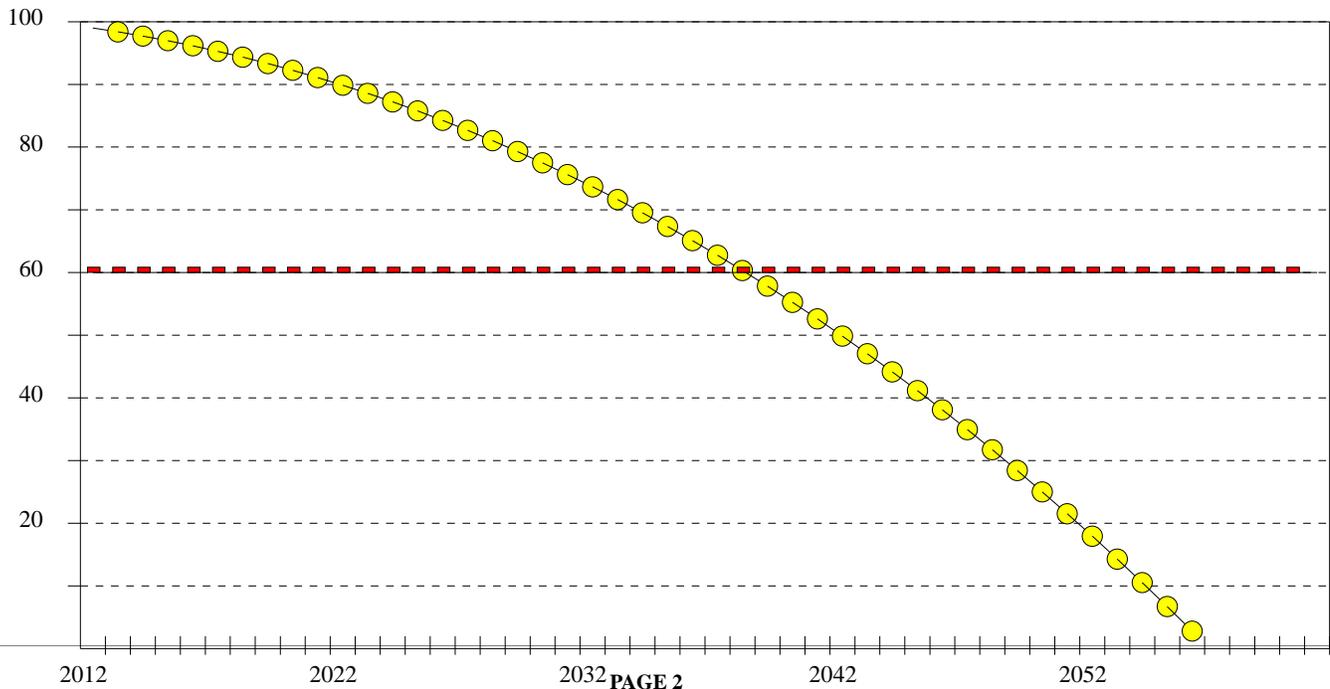

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3120	DESCRIPTION: GA RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 94
FEATURE AREA: 7,915	FEATURE'S LOW PCI: 86
INSPECTED AREA: 5,625	AVERAGE PCI: 90 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 90 in 2012

COMMENTS/HISTORY FOR FEATURE 3120, GA RAMP

1980 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3120

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
JOINT SEAL DAMAGE	MED	20	28	SLABS	22.3
JOINT SEAL DAMAGE	LOW	40	56	SLABS	12.7
SETTLEMENT/FAULT	LOW	4	5	SLABS	53.2
SPALLING-CORNERS	MED	1	1	SLABS	11.6

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	39 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	33 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	27 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3120

DESCRIPTION: GA RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 90 GOOD

CONSTRUCTION YEAR: 1980

ESTIMATED PCI IS: 90 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 49

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

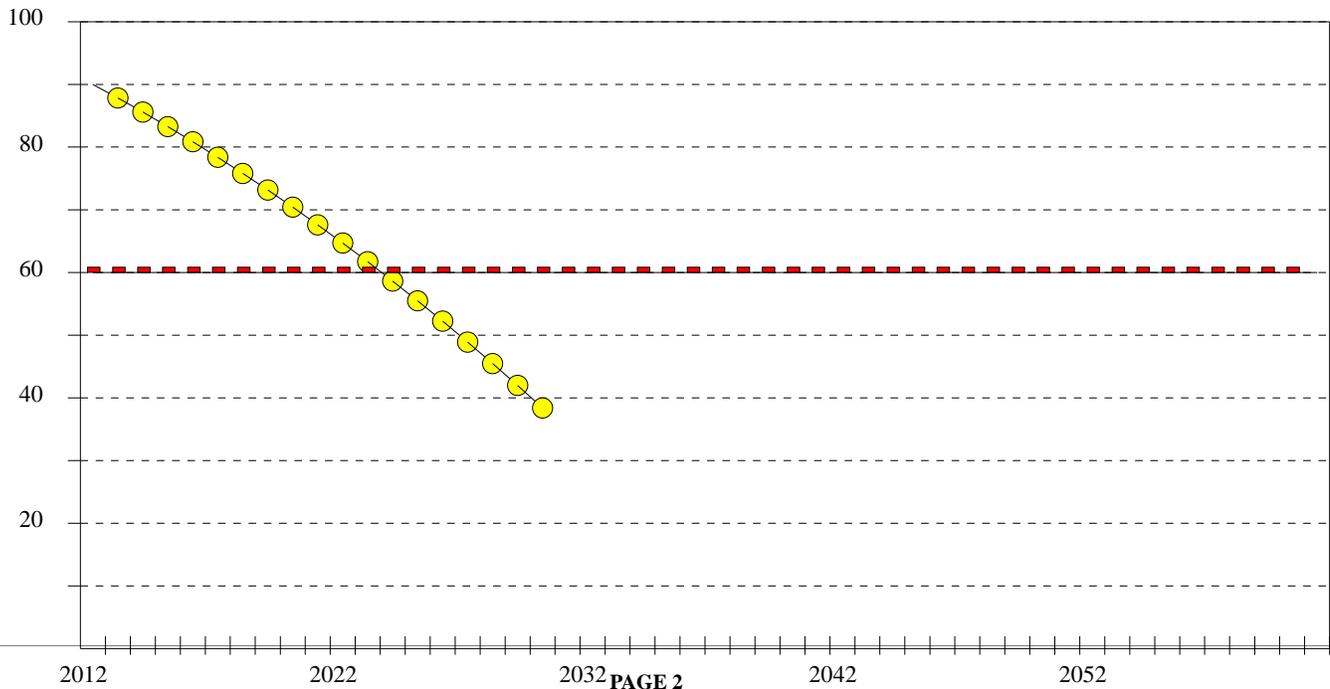

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3205	DESCRIPTION: FBO RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 98
FEATURE AREA: 120,000	FEATURE'S LOW PCI: 85
INSPECTED AREA: 22,500	AVERAGE PCI: 91 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 91 in 2012

COMMENTS/HISTORY FOR FEATURE 3205, FBO RAMP

1990 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3205

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
JOINT SEAL DAMAGE	MED	160	853	SLABS	53.7
JOINT SEAL DAMAGE	LOW	80	426	SLABS	7.6
SHRINKAGE CRACKS	N/A	2	10	SLABS	1.6
SPALLING-JOINTS	MED	1	5	SLABS	3.5
SPALLING-JOINTS	LOW	1	5	SLABS	1.5
SPALLING-CORNERS	HIGH	4	21	SLABS	18.4
SPALLING-CORNERS	MED	2	10	SLABS	7
SPALLING-CORNERS	LOW	3	16	SLABS	6.3

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	14 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	32 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	54 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3205

DESCRIPTION: FBO RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 91 GOOD

CONSTRUCTION YEAR: 1990

ESTIMATED PCI IS: 91 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 73

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

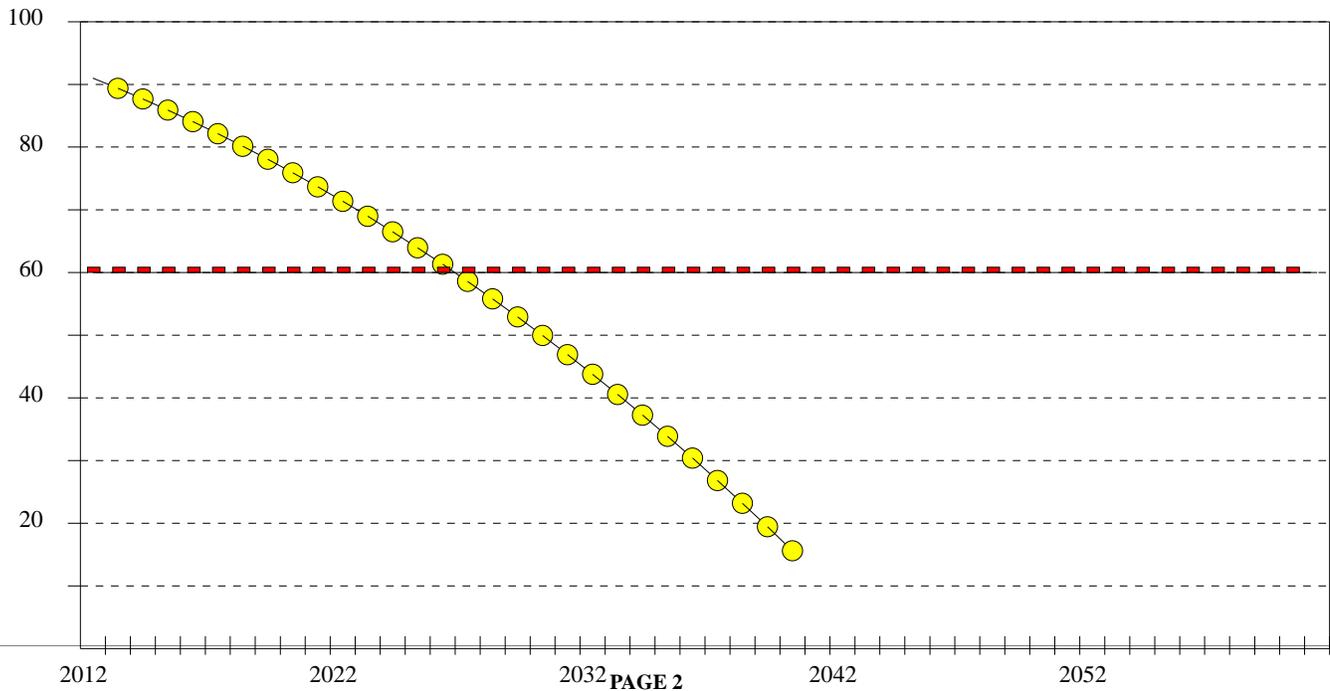

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3210	DESCRIPTION: TAXIWAY E RUNNUP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 100
FEATURE AREA: 11,820	FEATURE'S LOW PCI: 100
INSPECTED AREA: 6,300	AVERAGE PCI: 100 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 100 in 2012

COMMENTS/HISTORY FOR FEATURE 3210, TAXIWAY E RUNNUP

2009 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3210

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
---------------	----------	----------------------	-----------------------------	-------	-------------------------------

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	0 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3210

DESCRIPTION: TAXIWAY E RUNNUP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 100 GOOD

CONSTRUCTION YEAR: 2009

ESTIMATED PCI IS: 100 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 98

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

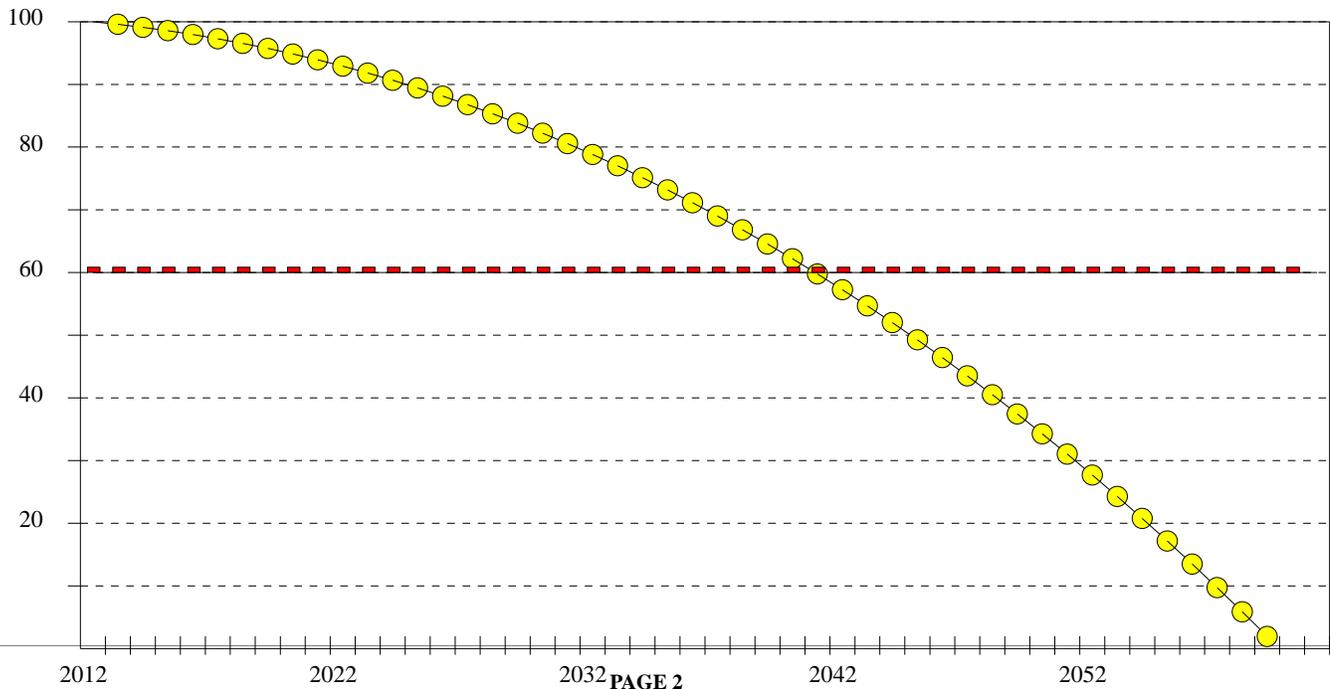

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3305	DESCRIPTION: PURDUE RAMP
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: PCC	FEATURE'S HIGH PCI: 98
FEATURE AREA: 120,500	FEATURE'S LOW PCI: 76
INSPECTED AREA: 26,339	AVERAGE PCI: 89 GOOD
MINIMUM SERVICE LEVEL: 60	ESTIMATED PCI IS: 89 in 2012

COMMENTS/HISTORY FOR FEATURE 3305, PURDUE RAMP

1980 PCC est

*
*
*

DISTRESS QUANTITIES FOR FEATURE 3305

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
JOINT SEAL DAMAGE	MED	230	1,052	SLABS	49.6
JOINT SEAL DAMAGE	LOW	50	228	SLABS	2.8
PATCH<5 SF	LOW	1	4	SLABS	.4
SETTLEMENT/FAULT	LOW	8	36	SLABS	18.1
SPALLING-JOINTS	HIGH	1	4	SLABS	7.7
SPALLING-JOINTS	MED	2	9	SLABS	4.2
SPALLING-CORNERS	HIGH	4	18	SLABS	11.3
SPALLING-CORNERS	MED	2	9	SLABS	4.2
SPALLING-CORNERS	LOW	1	4	SLABS	1.2

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	26 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	29 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	45 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 3305

DESCRIPTION: PURDUE RAMP

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: PCC

AVERAGE PCI AT INSPECTION: 89 GOOD

CONSTRUCTION YEAR: 1980

ESTIMATED PCI IS: 89 in 2012


MINIMUM SERVICE LEVEL: 60

NORMAL PCI FOR THIS AGE: 49

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 60		

PROJECTED PERFORMANCE

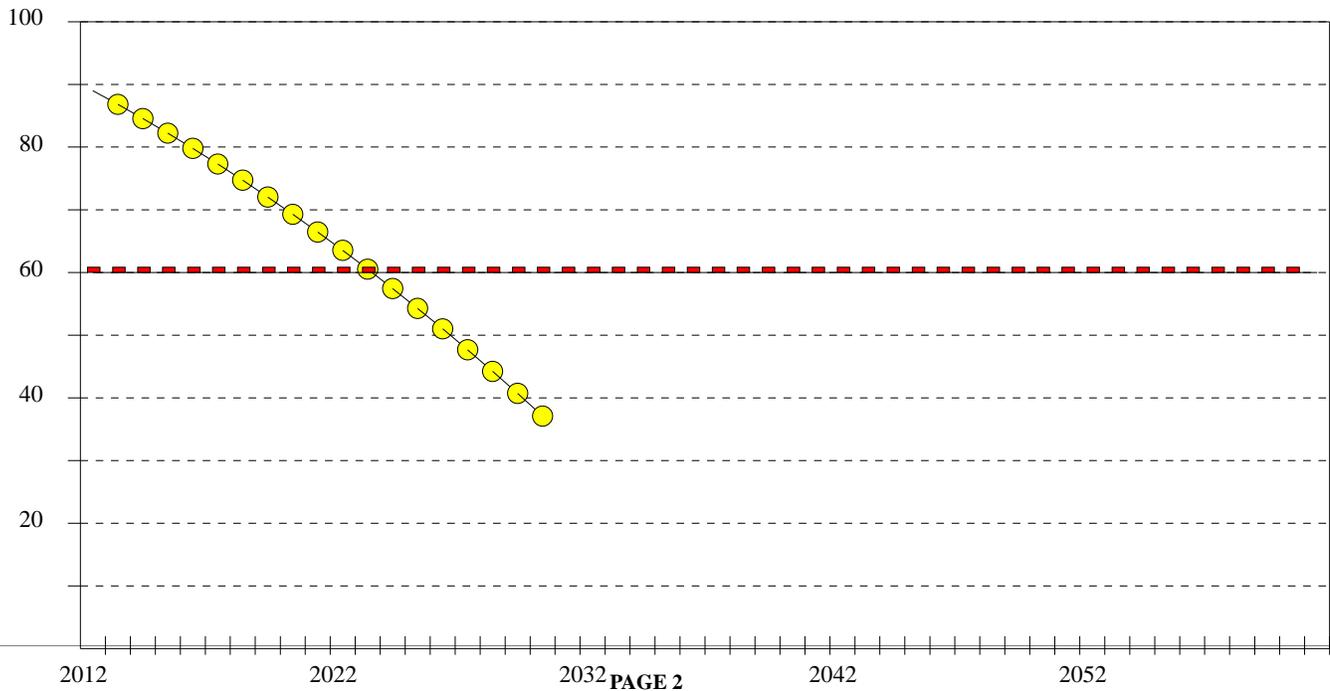

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 5010	DESCRIPTION: RUNWAY 10-28 KEEL
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 85
FEATURE AREA: 377,781	FEATURE'S LOW PCI: 68
INSPECTED AREA: 60,000	AVERAGE PCI: 77 SATISFACTORY
MINIMUM SERVICE LEVEL: 65	ESTIMATED PCI IS: 65 in 2021

COMMENTS/HISTORY FOR FEATURE 5010, RUNWAY 10-28 KEEL

1996 4" P401
 AVG 9.5" RECYCLED
 EXISTING SUBGRADE
 *

DISTRESS QUANTITIES FOR FEATURE 5010

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
DEPRESSION	LOW	21	132	S.F.	.4
LONG.& TRANS. CRACK	HIGH	8	50	L.F.	2.7
LONG.& TRANS. CRACK	MED	272	1,712	L.F.	19.2
LONG.& TRANS. CRACK	LOW	3,112	19,594	L.F.	55.7
WEATHERING	LOW	59,500	374,632	S.F.	21.7

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	60 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	40 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 5010

DESCRIPTION: RUNWAY 10-28 KEEL

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2021

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 77 SATISFACTORY

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 65 in 2021


MINIMUM SERVICE LEVEL: 65

NORMAL PCI FOR THIS AGE: 52

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$532,671	17 YEARS
▼	SURFACE TREATMENT	\$145,706	7 YEARS
◆	CRACK REPAIR	\$26,054	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 65		

PROJECTED PERFORMANCE

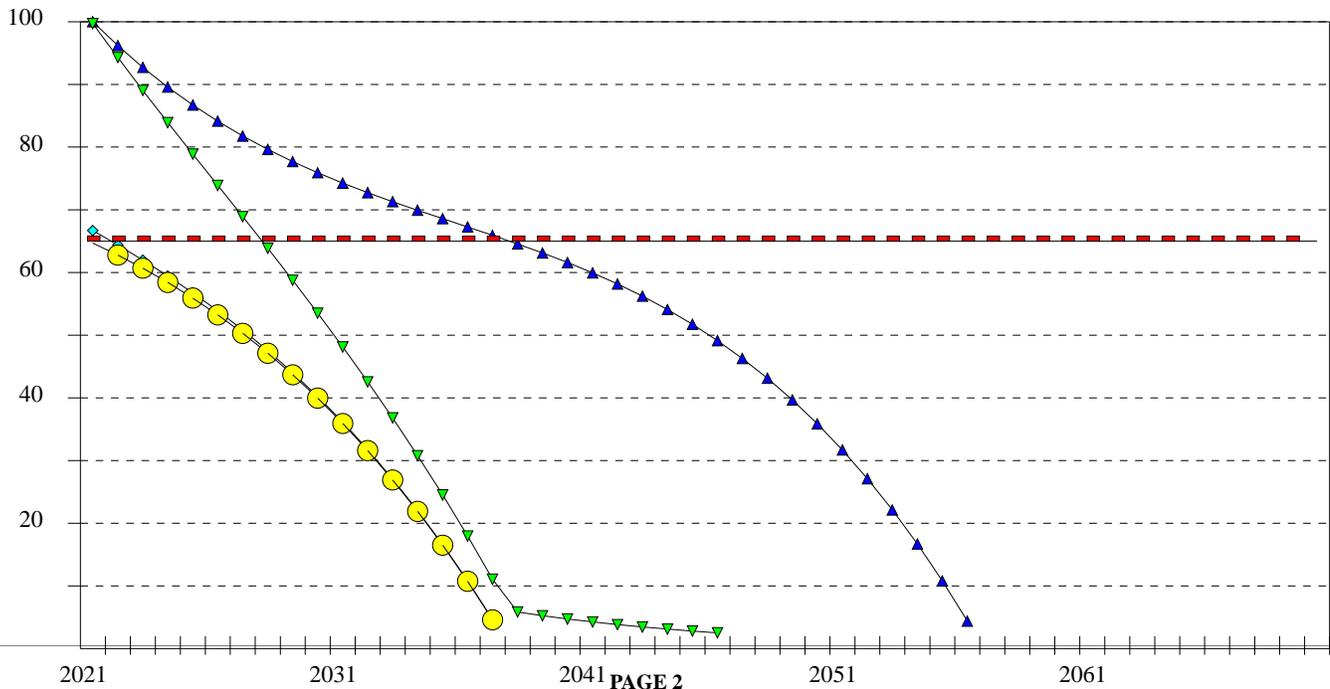

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 5015	DESCRIPTION: RUNWAY 10-28 WING
ANALYSIS YEAR: 2012	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC	FEATURE'S HIGH PCI: 90
FEATURE AREA: 665,525	FEATURE'S LOW PCI: 73
INSPECTED AREA: 105,000	AVERAGE PCI: 83 SATISFACTORY
MINIMUM SERVICE LEVEL: 65	ESTIMATED PCI IS: 83 in 2012

COMMENTS/HISTORY FOR FEATURE 5015, RUNWAY 10-28 WING

1996 4" P401
 AVG 9.5" RECYCLED
 EXISTING SUBGRADE
 *

DISTRESS QUANTITIES FOR FEATURE 5015

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
DEPRESSION	MED	14	88	S.F.	2
DEPRESSION	LOW	4	25	S.F.	0
LONG.& TRANS. CRACK	MED	135	855	L.F.	10.7
LONG.& TRANS. CRACK	LOW	3,903	24,738	L.F.	58.5
WEATHERING	MED	100	633	S.F.	.2
WEATHERING	LOW	98,900	626,861	S.F.	28.4

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	0 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	58 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	42 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 5015

DESCRIPTION: RUNWAY 10-28 WING

ANALYSIS YEAR: 2012

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC

AVERAGE PCI AT INSPECTION: 83 SATISFACTORY

CONSTRUCTION YEAR: 1996

ESTIMATED PCI IS: 83 in 2012


MINIMUM SERVICE LEVEL: 65

NORMAL PCI FOR THIS AGE: 67

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 65		

PROJECTED PERFORMANCE

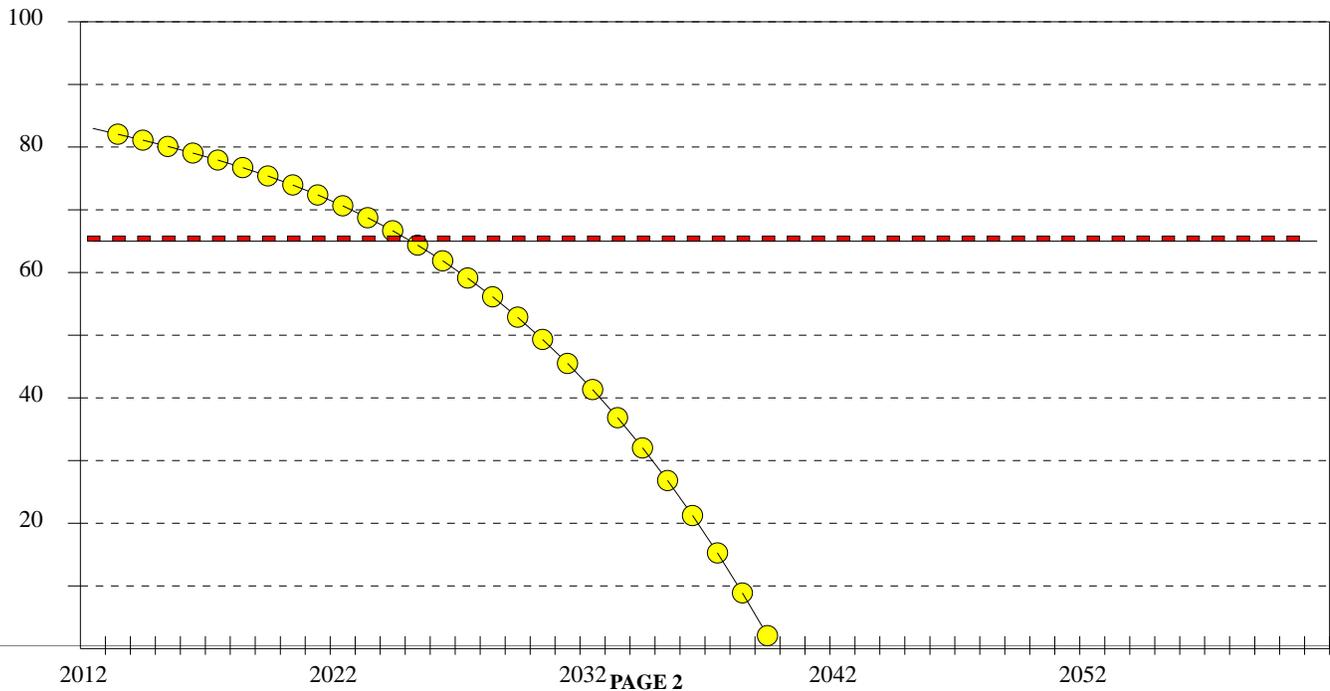

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 6005	DESCRIPTION: RUNWAY 5-23
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2019	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 85
FEATURE AREA: 350,500	FEATURE'S LOW PCI: 66
INSPECTED AREA: 60,000	AVERAGE PCI: 74 SATISFACTORY
MINIMUM SERVICE LEVEL: 65	ESTIMATED PCI IS: 65 in 2019

COMMENTS/HISTORY FOR FEATURE 6005, RUNWAY 5-23

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1972 5" P401 (First 1000' = 4"P401 / 6"P201 / 14"P154)
 1958 5" P401
 1946 5" P401 / 4" P208

DISTRESS QUANTITIES FOR FEATURE 6005

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	LOW	21	122	S.F.	5.3
LONG.& TRANS. CRACK	HIGH	2	11	L.F.	1.8
LONG.& TRANS. CRACK	MED	600	3,505	L.F.	30.7
LONG.& TRANS. CRACK	LOW	3,221	18,816	L.F.	45.1
PATCH & UTILITY CUT	LOW	100	584	S.F.	1.5
WEATHERING	MED	2,200	12,851	S.F.	6.2
WEATHERING	LOW	21,000	122,675	S.F.	9.2

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	6 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	57 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	36 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 6005

DESCRIPTION: RUNWAY 5-23

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2019

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 74 SATISFACTORY

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 65 in 2019


MINIMUM SERVICE LEVEL: 65

NORMAL PCI FOR THIS AGE: 63

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$494,204	17 YEARS
▼	SURFACE TREATMENT	\$137,479	8 YEARS
◆	CRACK REPAIR	\$27,245	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 65		

PROJECTED PERFORMANCE

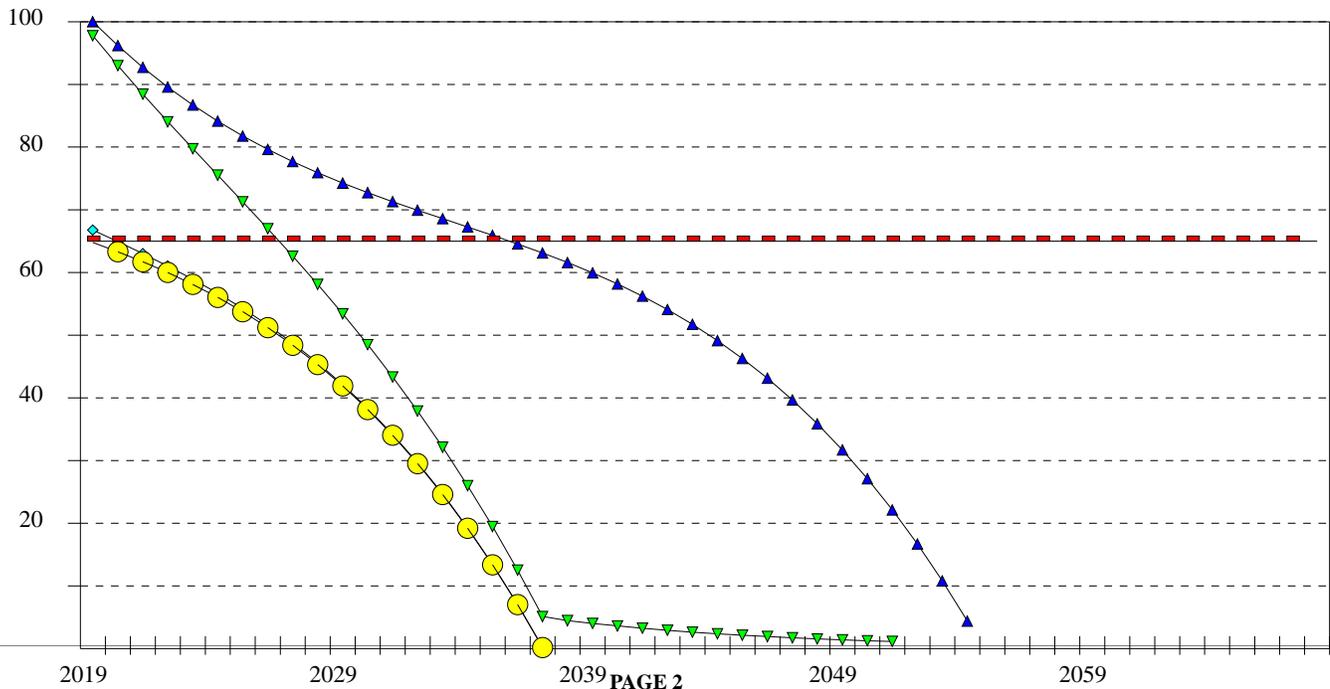

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 6010	DESCRIPTION: RUNWAY 5-23
ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014	INSPECTION DATE: 9-20-12
PAVEMENT TYPE: AC OVERLAY	FEATURE'S HIGH PCI: 75
FEATURE AREA: 61,500	FEATURE'S LOW PCI: 47
INSPECTED AREA: 30,000	AVERAGE PCI: 67 FAIR
MINIMUM SERVICE LEVEL: 65	ESTIMATED PCI IS: 63 in 2014

COMMENTS/HISTORY FOR FEATURE 6010, RUNWAY 5-23

2001: 1.5" P401 (1/2" Agg) / P603 / 1.5" P401 (3/4" Agg)
 1996 1.5" P401 / AVG 9.5" RECYCLED
 1946 AVG 4.5" P401 / 5" P154
 *

DISTRESS QUANTITIES FOR FEATURE 6010

DISTRESS TYPE	SEVERITY	MEASURED QUANTITY	ESTIMATED TOTAL QUANTITY	UNITS	PERCENTAGE OF All DISTRESS
ALLIGATOR CRACKING	LOW	195	356	S.F.	19.5
ALLIGATOR CRACKING	MED	11	21	S.F.	5.7
DEPRESSION	LOW	74	114	S.F.	1.2
LONG.& TRANS. CRACK	LOW	1,685	3,612	L.F.	33
LONG.& TRANS. CRACK	MED	593	1,076	L.F.	26.2
LONG.& TRANS. CRACK	HIGH	21	21	L.F.	.4
SWELL	LOW	24	54	S.F.	.7
WEATHERING	LOW	10,500	19,950	S.F.	5.8
WEATHERING	MED	440	994	S.F.	2.1

BASIC DISTRESS CAUSES

APPROXIMATE AMOUNT OF DISTRESS RELATED TO LOAD ON THE PAVEMENT IS:	27 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO MATERIALS PROBLEMS IN THE FEATURE IS:	47 %
APPROXIMATE AMOUNT OF DISTRESS RELATED TO AGE OF PAVEMENT AND TRAFFIC REPETITIONS IS:	27 %

AIRPORT: LAFAYETTE/PURDUE UNIVERSITY

AIRPAV FEATURE ANALYSIS PROGRAM OUTPUT

FEATURE: 6010

DESCRIPTION: RUNWAY 5-23

ANALYSIS YEAR: 2012 OPTIMIZED FOR: 2014

INSPECTION DATE: 9-20-12

PAVEMENT TYPE: AC OVERLAY

AVERAGE PCI AT INSPECTION: 67 FAIR

CONSTRUCTION YEAR: 2001

ESTIMATED PCI IS: 63 in 2014


MINIMUM SERVICE LEVEL: 65

NORMAL PCI FOR THIS AGE: 69

THE FOLLOWING PROJECTS HAVE BEEN SELECTED AS VIABLE ALTERNATIVES

LEGEND	DESCRIPTION	COST	LIFE EXTENSION
▲	RESURFACING	\$86,714	17 YEARS
▼	SURFACE TREATMENT	\$23,369	7 YEARS
◆	CRACK REPAIR	\$5,719	1 YEAR
●	NO ACTION	N/A	N/A
-	MINIMUM SERVICE LEVEL, CURRENTLY 65		


PROJECTED PERFORMANCE

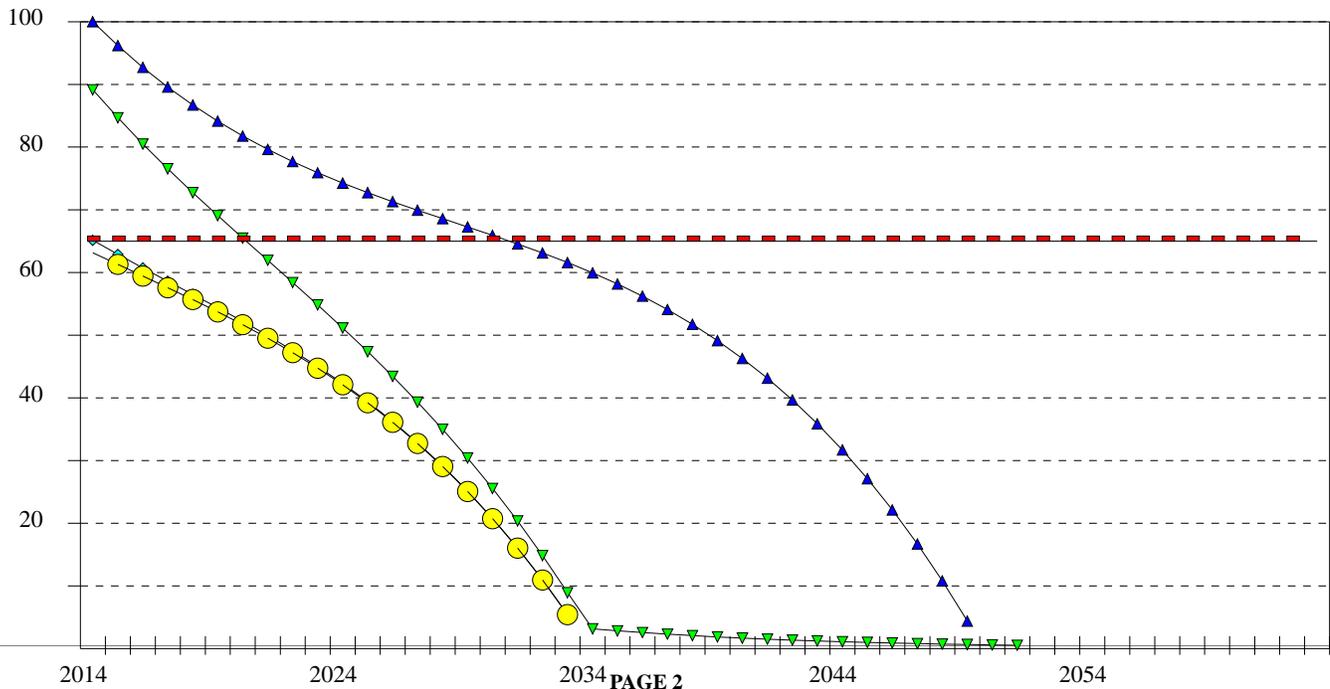

Appendix C. General Maintenance Techniques

Crack Sealing

- Cracks over ¼ inches wide should be sealed.
- Cracks wider than 3 inches should be patched.
- Sealant depth above the backer rope should be equal to the width of the reservoir, or as recommended by the manufacturer.
- Routed cracks should be sand blasted, to prepare for bonding with the sealant.
- Clean cracks with compressed air prior to sealing.
- Backing material should always be placed into the cracks. Commercial products are available. Several sizes of rope should be available to accommodate various crack sizes.
- Apply sealant after placing the backer rope. Follow the manufacturer's instructions. Sealant should be applied to within ¼ inch of the pavement surface.
- The final activity is to clean the surrounding pavement areas. A vacuum sweeper works well for this. Allow the sealant time to set before using a broom.
- Consider hot-applied, pourable patch material for cracks > ½ inch and any subsidence or depressions.

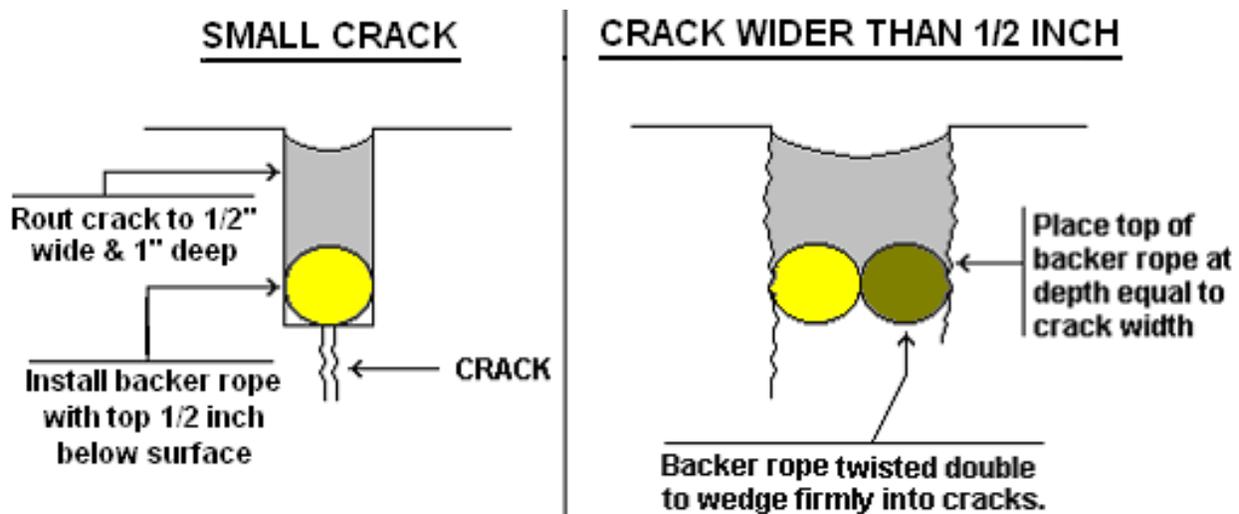

Overband Technique


An alternate crack sealing technique using the procedures outlined below.

Material

- Blend grade 20 or equivalent asphalt cement and latex rubber at 5 percent by weight asphalt.
- Again, at 5 percent by weight of asphalt, add polyester fibers into agitator tank.
- Maintain blended asphalt temperature at least 20 degrees below flash point.
- Continuously recycle hot blended asphalt through pumps and hoses when heating kettle is in standby mode.


Application

- Sealant should be applied to dry pavement, with ambient temperatures above 40 degrees.
- Cracks should be sand cleaned and blown free of debris immediately before sealing.
- Application of sealant immediately follows cleaning of the crack.
- Sealant should be pressure applied from a wand-type applicator with “overband” nozzle.
- Seat the sealant with a steel-wheeled roller immediately after placement.
- In wider cracks, a backer rope is recommended to limit material quantities required.

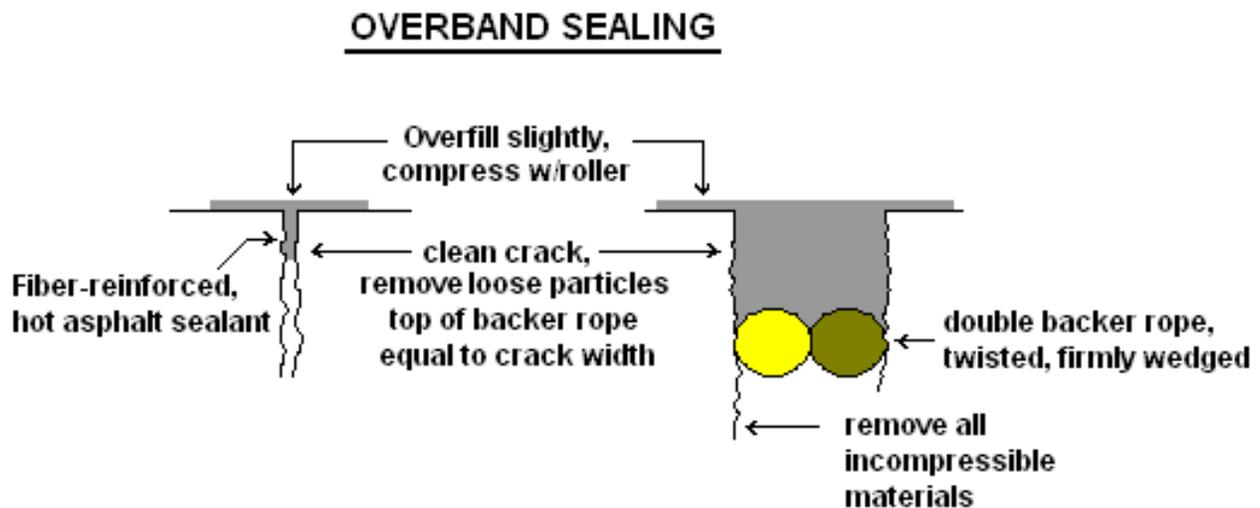


Joint Repair (portland cement)

- Rout a reservoir for the sealant ½ inch wide and 1 inch deep.
- Cracks wider than ½ inch should have reservoirs ¼ inch wider than the crack. Reservoir height above backer rope should be less than reservoir width, or as recommended by manufacturer.
- Routed cracks should be cleaned to expose fresh, vital pavement on the vertical crack edge.
- Cracks should be cleaned to remove all sand, debris, and other materials from the crack.
- Backing material should be placed into the crack.
- Apply sealant to within ¼ inch of pavement surface, following manufacturer’s instructions.
- Clean the surrounding pavement area.

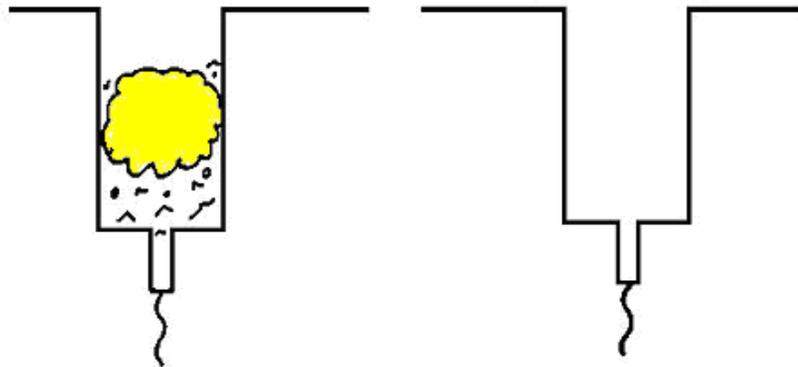



Typical failed joint sealant, w/ debris and incompressibles.

Clean joints exposing fresh, clean concrete and stone. Retain existing reservoir shape.

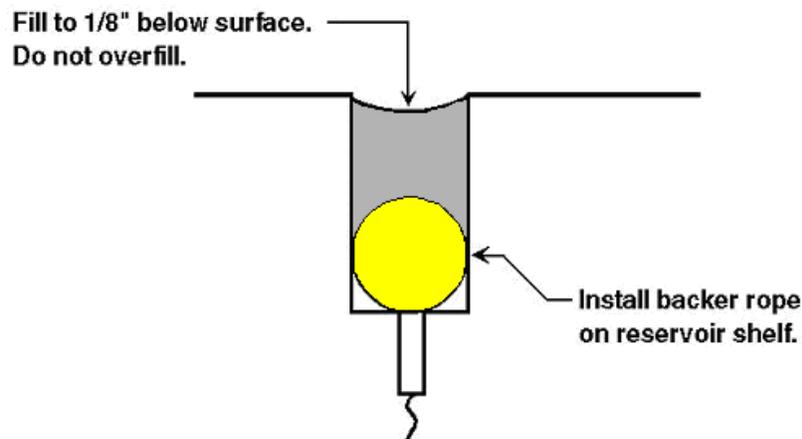

Patching (bituminous material)


- Examine distressed area and mark patch outline.
- Cut patch area with saw, no less than 3 inches deep.
- Remove enclosed pavement, leaving the vertical sawed edges undamaged.
- Clean sides and bottom and blow out with compressed air
- Paint sides and bottom with rapid curing asphalt tack coat. Prevent pooling on bottom.
- Allow tack coat to cure until it reaches a gummy consistency.
- Place hot mixed asphalt concrete and mound slightly, allowing for compaction.
- Compact with vibratory roller or plate compactor, in layers no greater than 6 inches.

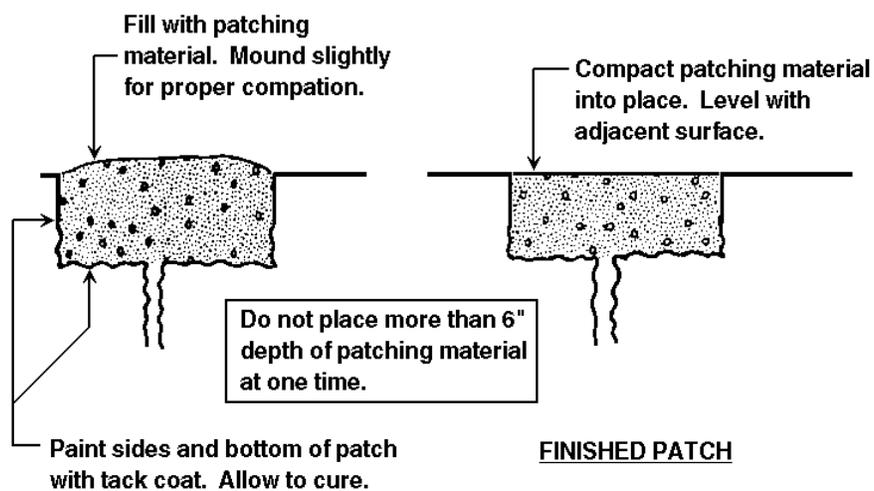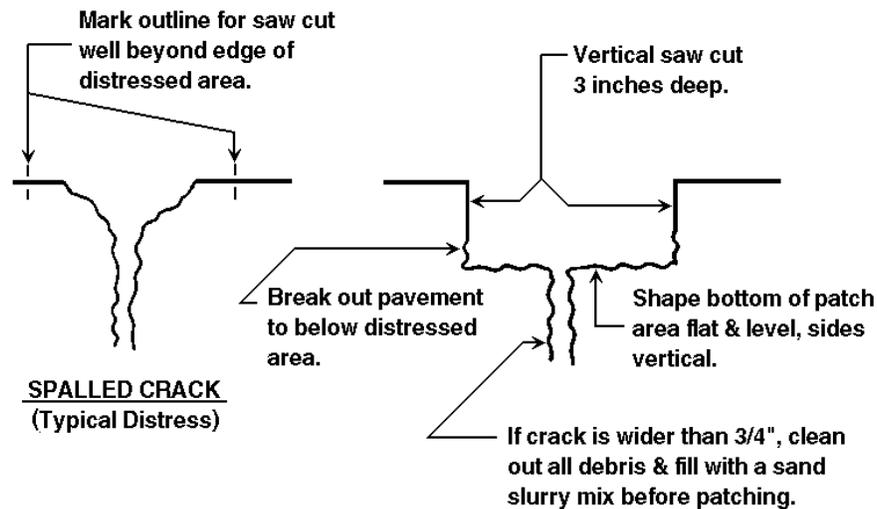

Patching (pourable materials)

Hot-applied, pourable materials generally are used to repair deficiencies larger than can be repaired by sealants, but smaller than those where traditional techniques would be required. Suggested uses for this type of repair include cracks over 2 inches wide, potholes less than 4 inches deep, as a leveling for small depressions, as a cap for settled utility cuts, and as a skin patch for areas of alligator cracking.



- Examine and mark the patch outline. Boundaries should extend to sound pavement.
- Apply patch material to clean, dry surfaces.
- A heating lance to preheat or dry existing pavement is recommended in cold or wet conditions.
- Patch material should be poured into the area to be repaired and leveled as appropriate.
- Patch edges should be sealed after application to assure good adhesion, preventing surface moisture from migrating under patch edges.

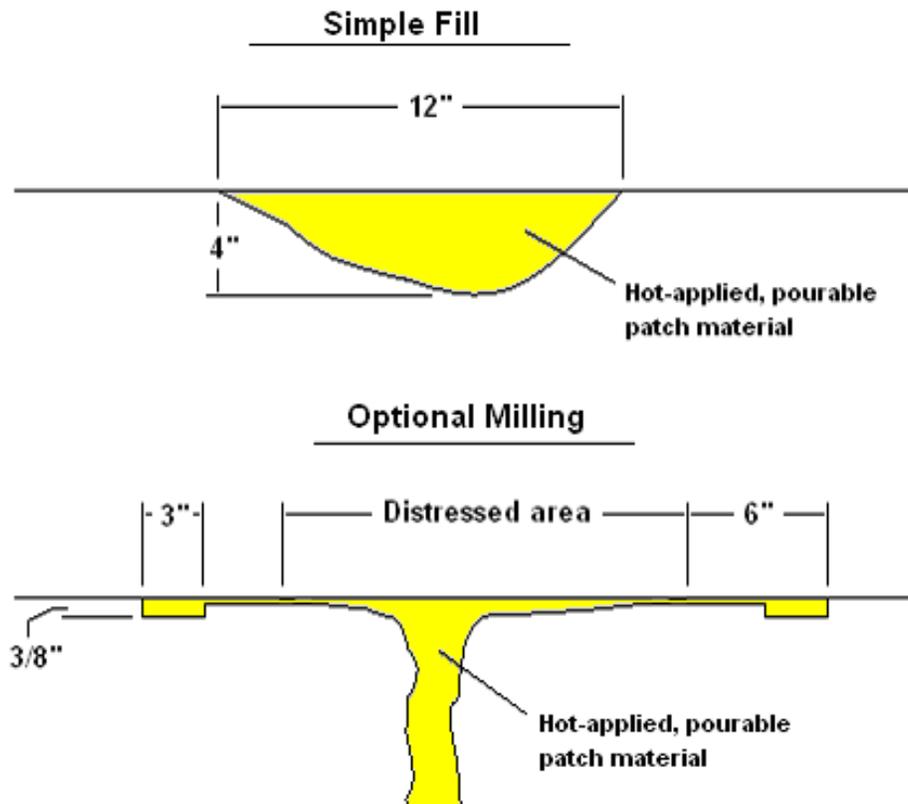

Patching (PCC)

The technique outlined here simulates a thin bonded PCC overlay. This procedure has been proven effective in service throughout the country.

- Examine and mark patch outline.
- Saw cut area to a depth of 2 inches. The enclosed area is then chipped or jack hammered to solid pavement, but not less than a 2-inch nominal depth.
- The sides and bottom are sand cleaned and air-blasted to expose vital, clean concrete.
- A 25 percent solution of muriatic acid is applied to all exposed surfaces within the patch.
- The muriatic acid solution is thoroughly flushed from the patch area with water.
- Compressed air is used to remove excess water from the area, but exposed concrete must be maintained in a moist condition.
- The sides and bottom of the area are then coated with approximately a 1/16-inch layer of cement grout applied at the consistency of paste. The grout acts as an adhesive to bond the fresh concrete to existing concrete.
- If the patch is adjacent to joints, the continuity of the joint must be maintained by placing inserts approximately the shape of the desired joint against the wall of the patch.
- Before concrete grout begins to dry, concrete is placed in the patch area and is compacted into position with hand tampers or a vibrating plate tamper.
- When the patch has been struck to the proper slope and elevation, a surface texture is applied to approximate the texture of adjacent pavement.
- Joint edges may be edged slightly to remove sharp edges. The patch should be covered with polyethylene or sprayed with a curing compound.
- Clean the surrounding pavement before concrete spillover has a chance to set up.
- The patch may be open to traffic in 72 hours.

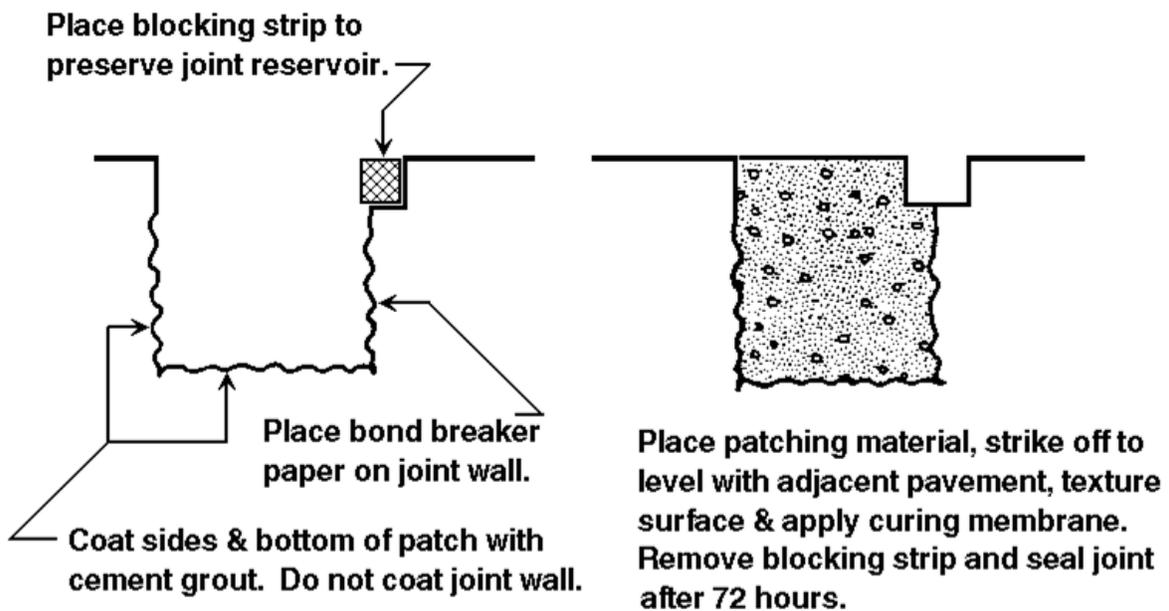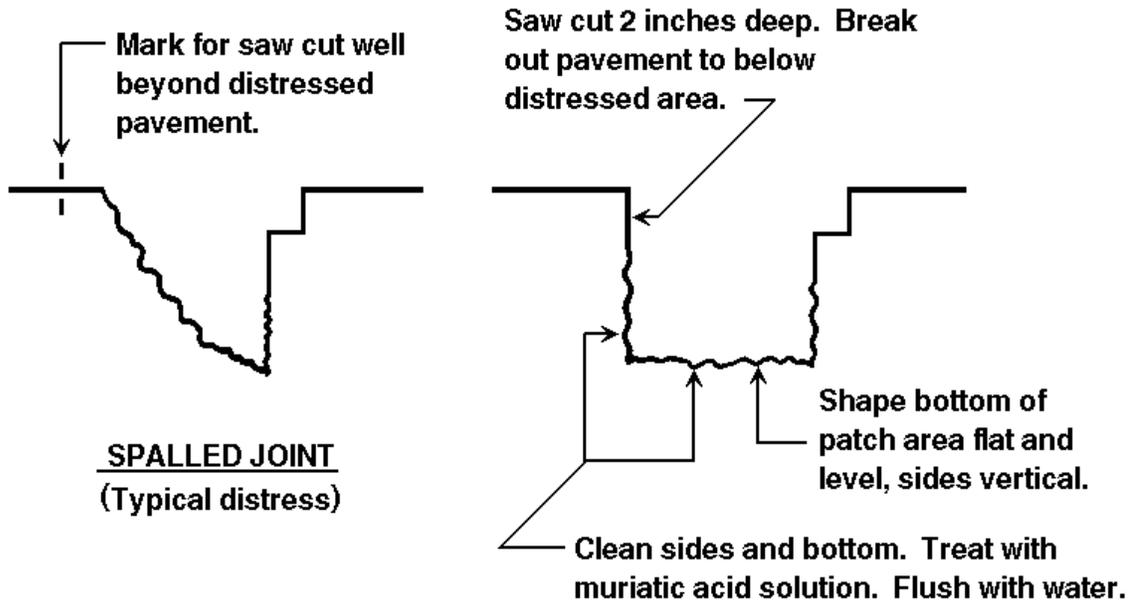

Appendix D. PCI Summary

The PCI summary provides an index of pavement conditions at the airport. The letter in the first column indicates the type of pavement, asphalt or portland cement. The last column lists the distress types found in each sample unit. The distress types are listed by a numbering code for each type of pavement, shown at the beginning of the summary.

AIRPAV							
CONDITION SURVEY SUMMARY							
AIRPORT: 417 GREENCASTLE-PUTNAM COUNTY				DATE: 12-30-2009			
"A" FLEXIBLE PAVEMENT DISTRESS CODES				"T" RIGID PAVEMENT DISTRESS CODES			
1. ALLIGATOR CRACKING 2. BLEEDING 3. BLOCK CRACKING 4. CORRUGATION 5. DEPRESSION 6. JET BLAST EROSION 7. JOINT REFL. CRACKING 8. LONG. & TRANS. CRACKING 9. OIL SPILL 10. PATCHING 11. POLISHED AGGREGATE 12. RAVELLING/WEATHERING 13. RUTTING 14. SHOIVING FROM PCC SLAB 15. SLIPPAGE CRACKING 16. SWELLING				1. BLOW UP 2. CORNER BREAK 3. LTD CRACKING 4. "D" CRACKING 5. JOINT SEAL DAMAGE 6. SMALL PATCH 7. LARGE PATCH 8. POPOUTS 9. PUMPING 10. SCALING-MAP CRACKING/CRAZING 11. FAULTING 12. SHATTERED SLAB 13. SHRINKAGE CRACKING 14. JOINT SPALLING 15. CORNER SPALLING			
FEATURE:	SAMPLE UNIT:	AREA:	DATE:	SURVEYED BY:	PCI:	DISTRESSES PRESENT:	
	105 A	105.100	3750	8-16-09	JB	83	8 12
	105 A	105.103	3500	8-16-09	JB	79	8 12
	105 A	105.105	3500	8-16-09	JB	63	5 8 10 12*
	105 A	105.106	3500	8-16-09	AN	79	1 8
	105 A	105.109	3500	8-16-09	AN	86	8
	105 A	105.112	3500	8-16-09	AN	84	8 12
MEAN FEATURE PCI = 81 BASED ON A SAMPLED AREA OF 21250 SQUARE FEET - PCI SPREAD FOR FEATURE = 22.74 DESCRIPTION: TAXIWAY A							
	110 A	110.102	3500	8-16-09	JB	100	
	110 A	110.106	3500	8-16-09	JB	100	
	110 A	110.110	3500	8-16-09	JB	100	
	110 A	110.112	3500	8-16-09	JB	100	
	110 A	110.114	3500	8-16-09	JB	100	
	110 A	110.118	1750	8-16-09	JB	94	8
AVERAGE FEATURE PCI = 99 BASED ON A SAMPLED AREA OF 19250 SQUARE FEET - PCI SPREAD FOR FEATURE = 6.20 DESCRIPTION: TAXIWAY A							
	115 A	115.118	1750	8-16-09	JB	94	8
	115 A	115.122	3500	8-16-09	JB	95	8
	115 A	115.126	3500	8-16-09	JB	96	8
	115 A	115.130	3500	8-16-09	JB	96	8
	115 A	115.134	3500	8-16-09	JB	96	8
	115 A	115.136	3500	8-16-09	JB	94	8
	115 A	115.138	3500	8-16-09	JB	96	8
	115 A	115.142	3500	8-16-09	AN	93	8
AVERAGE FEATURE PCI = 95 BASED ON A SAMPLED AREA OF 26250 SQUARE FEET - PCI SPREAD FOR FEATURE = 3.38 DESCRIPTION: TAXIWAY A							
	210 A	210.200	3500	8-16-09	AN	94	8
	210 A	210.201	3500	8-16-09	AN	94	8
	210 A	210.202	1190	8-16-09	AN	86	8
AVERAGE FEATURE PCI = 91 BASED ON A SAMPLED AREA OF 8190 SQUARE FEET - PCI SPREAD FOR FEATURE = 7.93 DESCRIPTION: CONNECTOR TAXIWAY B							

Sample units marked with an asterisk (*) are additional sample units. Additional sample units do not represent the typical condition of surrounding sample units in the pavement features.

The PCI summary provides a quick overview of the pavement condition and consistency. Are the distress types similar? Do the individual sample units have consistent PCI ratings? Answering these questions is a start to understanding your dynamic pavement system.

CONDITION SURVEY SUMMARY

AIRPORT: LAF LAFAYETTE/PURDUE UNIVERSITY

DATE: 10-02-2012

"A" FLEXIBLE PAVEMENT DISTRESS CODES

1. ALLIGATOR CRACKING
2. BLEEDING
3. BLOCK CRACKING
4. CORRUGATION
5. DEPRESSION
6. JET BLAST EROSION
7. JOINT REFL. CRACKING
8. LONG. & TRANS. CRACKING
9. OIL SPILL
10. PATCHING
11. POLISHED AGGREGATE
12. RAVELLING
13. RUTTING
14. SHOVING FROM PCC SLAB
15. SLIPPAGE CRACKING
16. SWELLING
17. WEATHERING

"P" RIGID PAVEMENT DISTRESS CODES

1. BLOW UP
2. CORNER BREAK
3. LTD CRACKING
4. "D" CRACKING
5. JOINT SEAL DAMAGE
6. SMALL PATCH
7. LARGE PATCH
8. POPOUTS
9. PUMPING
10. SCALING/MAP CRACKING/CRAZING
11. FAULTING
12. SHATTERED SLAB
13. SHRINKAGE CRACKING
14. JOINT SPALLING
15. CORNER SPALLING
16. ALKALI SILICA REACTION

FEATURE:	SAMPLE UNIT:	AREA:	DATE:	SURVEYED BY:	PCI:	DISTRESSES PRESENT:
101 A	101.101	5000	9-20-12	ABN	81	8 17
101 A	101.103	6500	9-20-12	EOJ	68	8 17
101 A	101.106	5000	9-20-12	ABN	76	8 17
101 A	101.111	5000	9-20-12	EOJ	79	8 17
101 A	101.116	5000	9-20-12	EOJ	80	8 17
101 A	101.121	5000	9-20-12	EOJ	78	8 17
101 A	101.125	5000	9-20-12	EOJ	78	8 17
101 A	101.130	5000	9-20-12	ABN	78	8 17
101 A	101.135	5000	9-20-12	EOJ	71	1 8 17
101 A	101.140	5000	9-20-12	EOJ	71	1 8 17
101 A	101.145	5000	9-20-12	ABN	79	8 17
101 A	101.149	5000	9-20-12	EOJ	82	8 17

AVERAGE FEATURE PCI = 77

BASED ON A SAMPLED AREA OF 61500 SQUARE FEET - PCI SPREAD FOR FEATURE = 14.33

DESCRIPTION: TAXIWAY C

102 A	102.159	5000	9-20-12	ARA	84	8
102 A	102.160	5000	9-20-12	ARA	85	8
102 A	102.161	5000	9-20-12	ARA	85	8

AVERAGE FEATURE PCI = 85

BASED ON A SAMPLED AREA OF 15000 SQUARE FEET - PCI SPREAD FOR FEATURE = 1.03

DESCRIPTION: TAXIWAY B @ RAMP

103 A	103.100	5000	9-20-12	ABN	84	8
103 A	103.101	5000	9-20-12	ABN	84	8

AVERAGE FEATURE PCI = 84

BASED ON A SAMPLED AREA OF 10000 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.30

DESCRIPTION: TAXIWAY @ RAMP

104 A	104.100	4250	9-20-12	ABN	79	5 8 17
104 A	104.101	2600	9-20-12	ABN	82	8

AVERAGE FEATURE PCI = 80

BASED ON A SAMPLED AREA OF 6850 SQUARE FEET - PCI SPREAD FOR FEATURE = 2.88

DESCRIPTION: TAXIWAY B2

FEATURE: SAMPLE UNIT: AREA: DATE: SURVEYED BY: PCI: DISTRESSES PRESENT:

105 A	105.100	3750	9-20-12	ARA	50	1 8 10 17
105 A	105.199	3675	9-20-12	ARA	73	1 10 17

**AVERAGE FEATURE PCI = 62
 BASED ON A SAMPLED AREA OF 7425 SQUARE FEET - PCI SPREAD FOR FEATURE = 22.39
 DESCRIPTION: TAXIWAY C**

106 A	106.103	2500	9-20-12	ARA	76	8 17
106 A	106.104	2850	9-20-12	ARA	64	1 8 17

**AVERAGE FEATURE PCI = 70
 BASED ON A SAMPLED AREA OF 5350 SQUARE FEET - PCI SPREAD FOR FEATURE = 12.12
 DESCRIPTION: TAXIWAY A**

108 A	108.101	1400	9-20-12	ARA	68	8 16 17
108 A	108.102	3000	9-20-12	ARA	81	8

**AVERAGE FEATURE PCI = 74
 BASED ON A SAMPLED AREA OF 4400 SQUARE FEET - PCI SPREAD FOR FEATURE = 13.17
 DESCRIPTION: TAXIWAY B2**

112 A	112.153	5500	9-20-12	EOJ	79	8 17
112 A	112.154	5000	9-20-12	ARA	78	8 17
112 A	112.156	4750	9-20-12	ARA	76	8 17

**AVERAGE FEATURE PCI = 78
 BASED ON A SAMPLED AREA OF 15250 SQUARE FEET - PCI SPREAD FOR FEATURE = 2.75
 DESCRIPTION: TAXIWAY B @ B3**

120 A	120.100	7500	9-20-12	ARA	57	1 8 10 17
-------	---------	------	---------	-----	----	-----------

**AVERAGE FEATURE PCI = 57
 BASED ON A SAMPLED AREA OF 7500 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY C3**

121 A	121.101	6600	9-20-12	ARA	69	1 8 17
121 A	121.102	6600	9-20-12	ARA	74	8 17

**AVERAGE FEATURE PCI = 72
 BASED ON A SAMPLED AREA OF 13200 SQUARE FEET - PCI SPREAD FOR FEATURE = 5.10
 DESCRIPTION: TAXIWAY C3**

140 A	140.100	3250	9-20-12	ARA	30	1 8 12 17
140 A	140.300	3025	9-20-12	ARA	64	8 12 17

**AVERAGE FEATURE PCI = 47
 BASED ON A SAMPLED AREA OF 6275 SQUARE FEET - PCI SPREAD FOR FEATURE = 33.92
 DESCRIPTION: TAXIWAY C2**

145 A	145.100	3250	9-20-12	ARA	65	8 17
145 A	145.101	6600	9-20-12	ARA	76	8 17
145 A	145.102	6600	9-20-12	ARA	78	8 17

**AVERAGE FEATURE PCI = 73
 BASED ON A SAMPLED AREA OF 16450 SQUARE FEET - PCI SPREAD FOR FEATURE = 13.46
 DESCRIPTION: TAXIWAY C2**

150 A	150.100	6270	9-20-12	ARA	68	8 17
150 A	150.300	5300	9-20-12	ARA	77	8 17

**AVERAGE FEATURE PCI = 72
 BASED ON A SAMPLED AREA OF 11570 SQUARE FEET - PCI SPREAD FOR FEATURE = 9.41
 DESCRIPTION: TAXIWAY C1**

155 A	155.101	6500	9-20-12	ARA	67	1 8 17
155 A	155.102	6825	9-20-12	ARA	77	1 8

**AVERAGE FEATURE PCI = 72
 BASED ON A SAMPLED AREA OF 13325 SQUARE FEET - PCI SPREAD FOR FEATURE = 10.13
 DESCRIPTION: TAXIWAY C1**

FEATURE: SAMPLE UNIT: AREA: DATE: SURVEYED BY: PCI: DISTRESSES PRESENT:

160 A	160.100	5800	9-20-12	ARA	81	5 8 17
160 A	160.101	5000	9-20-12	ARA	76	8 17

**AVERAGE FEATURE PCI = 78
 BASED ON A SAMPLED AREA OF 10800 SQUARE FEET - PCI SPREAD FOR FEATURE = 5.25
 DESCRIPTION: TAXIWAY C1 @ RAMP**

201 A	201.103	5000	9-20-12	ARA	84	8
201 A	201.106	5000	9-20-12	ARA	85	8
201 A	201.109	5000	9-20-12	ARA	88	8
201 A	201.112	5000	9-20-12	ARA	84	8
201 A	201.114	5000	9-20-12	ARA	84	8
201 A	201.115	5000	9-20-12	ARA	85	8

**AVERAGE FEATURE PCI = 85
 BASED ON A SAMPLED AREA OF 30000 SQUARE FEET - PCI SPREAD FOR FEATURE = 3.76
 DESCRIPTION: TAXIWAY B**

205 A	205.152	7600	9-20-12	ABN	74	8 17
-------	---------	------	---------	-----	----	------

**AVERAGE FEATURE PCI = 74
 BASED ON A SAMPLED AREA OF 7600 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY B**

290 A	290.101	6520	9-20-12	ARA	84	8
-------	---------	------	---------	-----	----	---

**AVERAGE FEATURE PCI = 84
 BASED ON A SAMPLED AREA OF 6520 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY B4**

291 A	291.100	6800	9-20-12	ABN	73	8 17
-------	---------	------	---------	-----	----	------

**AVERAGE FEATURE PCI = 73
 BASED ON A SAMPLED AREA OF 6800 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY B4**

292 A	292.100	5525	9-20-12	ABN	84	8 17
-------	---------	------	---------	-----	----	------

**AVERAGE FEATURE PCI = 84
 BASED ON A SAMPLED AREA OF 5525 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY B @ RUNWAY 5 APCH**

295 A	295.100	3750	9-20-12	ARA	69	8 12 17
295 A	295.101	4600	9-20-12	ARA	73	8 17

**AVERAGE FEATURE PCI = 71
 BASED ON A SAMPLED AREA OF 8350 SQUARE FEET - PCI SPREAD FOR FEATURE = 4.19
 DESCRIPTION: TAXIWAY B3**

296 A	296.100	2200	9-20-12	ARA	63	5 8 12 17
-------	---------	------	---------	-----	----	-----------

**AVERAGE FEATURE PCI = 63
 BASED ON A SAMPLED AREA OF 2200 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TAXIWAY B3**

301 A	301.106	5500	9-20-12	ARA	86	8
301 A	301.107	5500	9-20-12	ARA	85	8
301 A	301.109	6100	9-20-12	ABN	84	8
301 A	301.110	6200	9-20-12	ABN	83	8
301 A	301.113	6500	9-20-12	ABN	88	8

**AVERAGE FEATURE PCI = 85
 BASED ON A SAMPLED AREA OF 29800 SQUARE FEET - PCI SPREAD FOR FEATURE = 5.28
 DESCRIPTION: TAXIWAY A**

305 A	305.114	1750	9-20-12	ARA	52	1 5 8 17
305 A	305.115	7000	9-20-12	ARA	70	1 8 17

**AVERAGE FEATURE PCI = 61
 BASED ON A SAMPLED AREA OF 8750 SQUARE FEET - PCI SPREAD FOR FEATURE = 18.67
 DESCRIPTION: TAXIWAY A**

FEATURE: SAMPLE UNIT: AREA: DATE: SURVEYED BY: PCI: DISTRESSES PRESENT:

310 A	310.118	6500	9-20-12	EOJ	80	8
310 A	310.119	6500	9-20-12	EOJ	80	8 9
310 A	310.120	6500	9-20-12	EOJ	77	8 17

**AVERAGE FEATURE PCI = 79
 BASED ON A SAMPLED AREA OF 19500 SQUARE FEET - PCI SPREAD FOR FEATURE = 2.61
 DESCRIPTION: TAXIWAY A2**

405 A	405.101	4000	9-20-12	EOJ	66	8 17
405 A	405.102	4000	9-20-12	EOJ	71	8 17

**AVERAGE FEATURE PCI = 68
 BASED ON A SAMPLED AREA OF 8000 SQUARE FEET - PCI SPREAD FOR FEATURE = 4.31
 DESCRIPTION: TAXIWAY D**

410 A	410.105	4000	9-20-12	EOJ	71	8 17
410 A	410.107	4000	9-20-12	EOJ	77	8 17
410 A	410.109	4000	9-20-12	EOJ	74	8 17
410 A	410.111	2800	9-20-12	EOJ	80	8 17

**AVERAGE FEATURE PCI = 76
 BASED ON A SAMPLED AREA OF 14800 SQUARE FEET - PCI SPREAD FOR FEATURE = 8.89
 DESCRIPTION: TAXIWAY D**

505 P	505.101	1312	9-20-12	EOJ	94	5 15
505 P	505.102	1312	9-20-12	EOJ	93	5
505 P	505.104	1312	9-20-12	EOJ	93	5
505 P	505.106	1312	9-20-12	EOJ	93	5
505 P	505.108	1312	9-20-12	EOJ	93	5
505 P	505.111	1750	9-20-12	EOJ	93	5
505 P	505.114	1925	9-20-12	EOJ	89	5 14

**AVERAGE FEATURE PCI = 93
 BASED ON A SAMPLED AREA OF 10235 SQUARE FEET - PCI SPREAD FOR FEATURE = 5.08
 DESCRIPTION: TAXIWAY E**

2015 A	2015.100	2000	9-20-12	EOJ	85	8 17
2015 A	2015.101	2000	9-20-12	EOJ	93	8
2015 A	2015.201	2000	9-20-12	EOJ	92	8 17
2015 A	2015.301	2000	9-20-12	EOJ	84	8 17

**AVERAGE FEATURE PCI = 88
 BASED ON A SAMPLED AREA OF 8000 SQUARE FEET - PCI SPREAD FOR FEATURE = 8.52
 DESCRIPTION: TEES**

3005 P	3005.100	8000	9-20-12	EOJ	100	
3005 P	3005.103	8000	9-20-12	EOJ	69	3 14
3005 P	3005.105	8000	9-20-12	EOJ	100	
3005 P	3005.201	8000	9-20-12	EOJ	100	
3005 P	3005.204	8000	9-20-12	EOJ	78	3 13 14
3005 P	3005.302	8000	9-20-12	EOJ	71	3 11
3005 P	3005.305	8000	9-20-12	EOJ	92	5 7

**AVERAGE FEATURE PCI = 87
 BASED ON A SAMPLED AREA OF 56000 SQUARE FEET - PCI SPREAD FOR FEATURE = 30.86
 DESCRIPTION: TERMINAL RAMP**

3010 P	3010.200	3600	9-20-12	EOJ	87	5 14
3010 P	3010.203	3375	9-20-12	EOJ	85	5 14 15
3010 P	3010.301	3000	9-20-12	EOJ	93	5
3010 P	3010.304	2800	9-20-12	EOJ	81	5 14 15
3010 P	3010.402	3375	9-20-12	EOJ	93	5
3010 P	3010.405	3825	9-20-12	EOJ	93	5
3010 P	3010.500	3375	9-20-12	ABN	93	5
3010 P	3010.503	3375	9-20-12	ABN	93	5
3010 P	3010.506	3375	9-20-12	ABN	93	5
3010 P	3010.601	3375	9-20-12	ABN	98	5
3010 P	3010.604	3375	9-20-12	ABN	82	5 11 14
3010 P	3010.606	3375	9-20-12	ABN	93	5

**AVERAGE FEATURE PCI = 90
 BASED ON A SAMPLED AREA OF 40225 SQUARE FEET - PCI SPREAD FOR FEATURE = 17.33
 DESCRIPTION: TERMINAL RAMP**

FEATURE: SAMPLE UNIT: AREA: DATE: SURVEYED BY: PCI: DISTRESSES PRESENT:

3015 P 3015.307 12750 9-20-12 EOJ 100

**AVERAGE FEATURE PCI = 100
 BASED ON A SAMPLED AREA OF 12750 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TERMINAL RAMP**

3020 P 3020.206 4650 9-20-12 EOJ 100

**AVERAGE FEATURE PCI = 100
 BASED ON A SAMPLED AREA OF 4650 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: TERMINAL RAMP**

3025 P 3025.100 8600 9-20-12 ABN 100

**AVERAGE FEATURE PCI = 100
 BASED ON A SAMPLED AREA OF 8600 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: RAMP**

3105 A 3105.101 3250 9-20-12 ABN 55 1 8 17
 3105 A 3105.102 3250 9-20-12 ABN 41 1 8 17
 3105 A 3105.103 3250 9-20-12 ABN 38 1 8 17
 3105 A 3105.106 5000 9-20-12 ABN 69 8 17

**AVERAGE FEATURE PCI = 51
 BASED ON A SAMPLED AREA OF 14750 SQUARE FEET - PCI SPREAD FOR FEATURE = 30.37
 DESCRIPTION: TAXILANE**

3110 A 3110.205 2500 9-20-12 ABN 86 8
 3110 A 3110.305 2500 9-20-12 ABN 86 8
 3110 A 3110.405 2500 9-20-12 ABN 88 8
 3110 A 3110.505 2500 9-20-12 ABN 83 8

**AVERAGE FEATURE PCI = 86
 BASED ON A SAMPLED AREA OF 10000 SQUARE FEET - PCI SPREAD FOR FEATURE = 4.80
 DESCRIPTION: TEE HANGERS**

3115 P 3115.100 2850 9-20-12 ABN 100
 3115 P 3115.102 2850 9-20-12 ABN 98 15
 3115 P 3115.201 2850 9-20-12 ABN 100
 3115 P 3115.203 2850 9-20-12 ABN 100

**AVERAGE FEATURE PCI = 99
 BASED ON A SAMPLED AREA OF 11400 SQUARE FEET - PCI SPREAD FOR FEATURE = 2.45
 DESCRIPTION: RAMP**

3120 P 3120.100 1875 9-20-12 ABN 94 5 11
 3120 P 3120.101 1875 9-20-12 ABN 89 5 11
 3120 P 3120.102 1875 9-20-12 ABN 86 5 11 15

**AVERAGE FEATURE PCI = 90
 BASED ON A SAMPLED AREA OF 5625 SQUARE FEET - PCI SPREAD FOR FEATURE = 7.52
 DESCRIPTION: GA RAMP**

3205 P 3205.102 1875 9-20-12 EOJ 89 5 15
 3205 P 3205.106 1875 9-20-12 EOJ 85 5 14 15
 3205 P 3205.110 1875 9-20-12 ABN 93 5
 3205 P 3205.203 1875 9-20-12 EOJ 91 5 15
 3205 P 3205.207 1875 9-20-12 EOJ 88 5 15
 3205 P 3205.304 1875 9-20-12 EOJ 98 5
 3205 P 3205.308 1875 9-20-12 EOJ 93 5
 3205 P 3205.401 1875 9-20-12 ABN 85 5 15
 3205 P 3205.405 1875 9-20-12 EOJ 87 5 14 15
 3205 P 3205.409 1875 9-20-12 EOJ 91 5 13
 3205 P 3205.506 1875 9-20-12 EOJ 98 5
 3205 P 3205.510 1875 9-20-12 EOJ 98 5

**AVERAGE FEATURE PCI = 91
 BASED ON A SAMPLED AREA OF 22500 SQUARE FEET - PCI SPREAD FOR FEATURE = 12.60
 DESCRIPTION: FBO RAMP**

FEATURE: SAMPLE UNIT: AREA: DATE: SURVEYED BY: PCI: DISTRESSES PRESENT:

3210 P	3210.100	2700	9-20-12	EOJ	100	
3210 P	3210.200	3600	9-20-12	EOJ	100	

**AVERAGE FEATURE PCI = 100
 BASED ON A SAMPLED AREA OF 6300 SQUARE FEET - PCI SPREAD FOR FEATURE = 0.00
 DESCRIPTION: RUNUP @ TAXIWAY E**

3305 P	3305.068	2850	9-20-12	EOJ	93	5
3305 P	3305.077	2394	9-20-12	ABN	92	5 14 15
3305 P	3305.089	1922	9-20-12	ABN	88	5 6 11
3305 P	3305.098	2280	9-20-12	ABN	81	5 11 14 15
3305 P	3305.100	2480	9-20-12	EOJ	91	5 15
3305 P	3305.104	2356	9-20-12	ABN	87	5 15
3305 P	3305.201	2356	9-20-12	EOJ	81	5 14 15
3305 P	3305.205	2356	9-20-12	EOJ	93	5
3305 P	3305.302	2356	9-20-12	EOJ	98	5
3305 P	3305.306	2108	9-20-12	EOJ	76	5 11 15
3305 P	3305.407	2356	9-20-12	EOJ	93	5
3305 P	3305.508	525	9-20-12	EOJ	93	5

**AVERAGE FEATURE PCI = 89
 BASED ON A SAMPLED AREA OF 26339 SQUARE FEET - PCI SPREAD FOR FEATURE = 21.78
 DESCRIPTION: PURDUE RAMP**

5010 A	5010.202	5000	9-20-12	EOJ	81	8 17
5010 A	5010.207	5000	9-20-12	EOJ	85	8 17
5010 A	5010.212	5000	9-20-12	EOJ	78	8 17
5010 A	5010.217	5000	9-20-12	EOJ	85	8 17
5010 A	5010.222	5000	9-20-12	EOJ	72	8 17
5010 A	5010.227	5000	9-20-12	EOJ	79	8 17
5010 A	5010.232	5000	9-20-12	EOJ	80	8 17
5010 A	5010.242	5000	9-20-12	EOJ	68	8 17
5010 A	5010.247	5000	9-20-12	EOJ	77	8 17
5010 A	5010.252	5000	9-20-12	EOJ	68	5 8 17
5010 A	5010.257	5000	9-20-12	EOJ	76	5 8 17
5010 A	5010.262	5000	9-20-12	EOJ	76	8 17

**AVERAGE FEATURE PCI = 77
 BASED ON A SAMPLED AREA OF 60000 SQUARE FEET - PCI SPREAD FOR FEATURE = 16.42
 DESCRIPTION: RUNWAY 10-28 KEEL**

5015 A	5015.108	5000	9-20-12	ABN	89	8 17
5015 A	5015.113	5000	9-20-12	ABN	84	8 17
5015 A	5015.118	5000	9-20-12	ABN	84	8 17
5015 A	5015.123	5000	9-20-12	ABN	88	8 17
5015 A	5015.133	5000	9-20-12	ABN	85	8 17
5015 A	5015.143	5000	9-20-12	ABN	76	8 17
5015 A	5015.148	5000	9-20-12	ABN	79	8 17
5015 A	5015.153	5000	9-20-12	ABN	83	8 17
5015 A	5015.158	5000	9-20-12	ABN	79	8
5015 A	5015.163	5000	9-20-12	ABN	73	8 17
5015 A	5015.301	5000	9-20-12	ABN	87	8 17
5015 A	5015.306	5000	9-20-12	ABN	89	8 17
5015 A	5015.311	5000	9-20-12	ABN	82	8 17
5015 A	5015.316	5000	9-20-12	ABN	86	8 17
5015 A	5015.321	5000	9-20-12	ABN	81	8 17
5015 A	5015.326	5000	9-20-12	ABN	90	8 17
5015 A	5015.331	5000	9-20-12	ABN	89	8 17
5015 A	5015.341	5000	9-20-12	ABN	78	8 17
5015 A	5015.346	5000	9-20-12	ABN	75	5 8 17
5015 A	5015.356	5000	9-20-12	ABN	83	8 17
5015 A	5015.361	5000	9-20-12	ABN	78	8 17

**AVERAGE FEATURE PCI = 83
 BASED ON A SAMPLED AREA OF 105000 SQUARE FEET - PCI SPREAD FOR FEATURE = 16.77
 DESCRIPTION: RUNWAY 10-28 WING**

6005 A	6005.101	5000	9-20-12	EOJ	75	8 17
6005 A	6005.105	5000	9-20-12	EOJ	72	8 17

FEATURE:	SAMPLE UNIT:	AREA:	DATE:	SURVEYED BY:	PCI:	DISTRESSES PRESENT:
6005 A	6005.109	5000	9-20-12	EOJ	72	8 17
6005 A	6005.117	5000	9-20-12	ARA	66	8 17
6005 A	6005.125	5000	9-20-12	ARA	80	8 17
6005 A	6005.131	5000	9-20-12	ARA	74	8 17
6005 A	6005.149	5000	9-20-12	ARA	80	8 17
6005 A	6005.153	5000	9-20-12	ARA	85	8
6005 A	6005.160	5000	9-20-12	ABN	76	8 17
6005 A	6005.168	5000	9-20-12	ABN	67	8 10 17
6005 A	6005.176	5000	9-20-12	ABN	71	1 8 17
6005 A	6005.180	5000	9-20-12	ARA	70	1 8 17

AVERAGE FEATURE PCI = 74

BASED ON A SAMPLED AREA OF 60000 SQUARE FEET - PCI SPREAD FOR FEATURE = 18.58

DESCRIPTION: RUNWAY 5-23 SOUTH OF RUNWAY 28

6010 A	6010.133	5000	9-20-12	ARA	73	1 5 8 16 17
6010 A	6010.134	5000	9-20-12	EOJ	47	1 5 8 17*
6010 A	6010.135	5000	9-20-12	EOJ	75	8 17
6010 A	6010.143	5000	9-20-12	EOJ	70	5 8 17
6010 A	6010.145	5000	9-20-12	ABN	63	1 8 17
6010 A	6010.147	5000	9-20-12	ABN	63	1 8 17

MEAN FEATURE PCI = 67

BASED ON A SAMPLED AREA OF 30000 SQUARE FEET - PCI SPREAD FOR FEATURE = 27.88

DESCRIPTION: RUNWAY 5-23 @ RUNWAY 10-28

TOTAL NUMBER OF INSPECTED FEATURES = 45

TOTAL NUMBER OF INSPECTED SAMPLE UNITS = 196

TOTAL AREA OF INSPECTED PAVEMENT = 845,114 S.F.

* INDICATES "ADDITIONAL" SAMPLE UNITS.

Appendix E. Distress Identification

This chapter describes pavement distress types commonly identified during airport PCI inspections.

Rigid Pavement Distress

Longitudinal, Transverse & Diagonal Cracking

LTD cracking is often a result of load or temperature deformations. External loads cause flexure. Temperature changes can cause curling. When any of these stresses exceed the slab strength, cracking occurs.

LTD cracking is recorded at low, medium, or high severity, depending on the width of crack opening and degree of deterioration.

At low severity, a crack is less than 1/8 inch wide with little spalling, and no corrective action is indicated. At medium severity, LTD cracks can be up to 1 inch wide with moderate spalling and should be repaired using procedures similar to joint sealing. At high severity, cracks exceed 1 inch in width and may be severely spalled. High-severity LTD cracking is evidence of serious load failure, and correction may require patching or slab replacement. If distress occurs in several adjacent slabs at medium or high severity, major rehabilitation of that area is indicated.

A slab divided into four or more pieces is said to be “divided” or “shattered.” Shattered slab is a separate distress category and indicates a significant structural failure. A shattered slab has lost its ability to distribute loads. Shattered slabs are rated in three severities, but the recommended action in any case is slab replacement.



Shrinkage Cracking

Shrinkage cracks are small, non-working cracks visible at the pavement surface but not penetrating the full depth of concrete. Shrinkage cracks most commonly occur shortly after construction due to concrete shrinkage during the curing process.

Shrinkage cracks are usually so small that they are not visible until staining or loss of material at crack edges begins to take place. Shrinkage cracks do not represent structural weakness, and no corrective action is prescribed.



Durability Cracking

Durability cracking (D-cracking) is caused by environmental factors, the most common being freeze/thaw. D-cracking usually appears as either a pattern of hairline cracks running parallel to a joint or crack, or in a corner, where water tends to collect. D-cracking eventually leads to disintegration of the pavement, creating foreign object damage (FOD) potential.

At low severity, D-cracking is evident, but no disintegration has occurred. Medium severity is evident over a significant area of the slab, and some disintegration and FOD potential exist. High-severity D-cracking is evidenced by extensive cracking with loose and missing pieces and significant FOD potential.



Joint Spall and Corner Spall

Spalls at slab joints and corners are caused by excessive internal stress in the pavement. Spalls occur when these stresses exceed the shear strength of the concrete.

Spalling usually results from thermal expansion during hot weather when slabs push and expand against one another. If the joints are filled with incompressible material, such as sand, stresses can become severe, causing spalls. Spalling can be reduced significantly by maintenance of joint sealant.

Spall repair requires patching. The extent and severity of spalling suggests the appropriate action. At low severity, spalled concrete remains securely in place in the slab. A low-severity spall should be monitored closely for further deterioration and should be patched when spalled particles become loose, or during the next scheduled patching activity. Medium- and high-severity spalls should be repaired immediately to prevent FOD. If the pavement can be restored to serviceable condition, spalls should be patched for long-term service. If the pavement is beyond repair, temporary patching should be considered to control FOD.



Patches, Large and Small

Large and small patches, by PCI inspection criteria, are distress conditions. Patches indicate deterioration and aging of pavement that contributes to shortened service life. However, patching also indicates that pavement is being maintained.

A patch that is performing well and shows no outward distress is recorded at low severity, and no corrective action is required. Medium-severity patches are serviceable but are beginning to deteriorate. Maintenance or replacement is indicated. At high severity, replacement is indicated.

By definition, small patches are smaller than 5 square feet in surface area, and they usually result from spall repair at slab joints and corners.

Large patches also may be the result of spall repair, but they often indicate more serious deficiencies, such as corner breaks or other full-depth failure smaller than panel size.



Joint Seal Damage

When joint sealant is in perfect condition (no damage), there is no distress.

At low severity, at least 10 percent of the sealant is debonded but still in contact with the joint edges. Medium-severity joint seal damage is recorded when at least 10 percent of the sealant has visible gaps smaller than 1/8 inch and is an indicator that replacement should be programmed as soon as is practical. In the meantime, aggressive inspection and sustaining maintenance is recommended to minimize subsurface damage from moisture penetration. At high severity, visible gaps exceed 1/8 inch, and the amount and degree of joint seal damage typically requires complete removal and replacement of the existing sealant.

On serviceable pavement, deteriorated joint sealant should be repaired or replaced to preserve pavement and subgrade integrity and prolong service life. The issue is not so clear-cut with unserviceable pavement. Pavement that can be restored to serviceable condition by maintenance activities such as patching and joint seal repair, or by slab replacement, should be so maintained as long as the process is cost-effective. However, when age and condition preclude economical return to serviceable condition by such means, joint seal repair would no longer be cost-effective and should be suspended except for an interim maintenance program to control FOD potential.



Flexible Pavement Distress

Longitudinal & Trans. Cracking

L&T cracks are caused by age, construction, and subsurface conditions. Age-related cracking occurs as oxidizing pavement loses components to the atmosphere and becomes more brittle. Consistent application of seal coats can help to prevent age-related cracks.

Construction-related cracking often develops along paving joints. Ensuring that joints are made when both sides are still hot, and near the same temperature, is one of the best ways to mitigate this potential problem.

Seasonal movement caused by changes in subsurface moisture or temperature differences also can cause pavement cracking. Asphalt pavement placed over a PCC pavement or cement stabilized base course may evidence reflective cracking from the underlying material. Wheel loads do not cause L&T cracks, although traffic may worsen their condition.

Low-severity L&T cracks are less than ¼ inch wide, or if sealed with suitable filler material in satisfactory condition can be any width less than 3 inches, if they are not spalled. Maintenance usually is not indicated for low-severity cracking. Moderately spalled cracks and cracks wider than ¼ inch which are not satisfactorily sealed are at medium severity. Medium-severity cracks should be sealed with a high-quality crack filling material. Severely spalled cracks and cracks wider than 3 inches are at high severity. High-severity L&T cracks normally require patching.



Alligator Cracking

Alligator cracks are a series of interconnected load-related cracks caused by fatigue of the asphalt surface. Alligator cracking is a significant structural distress and develops only in places subject to traffic loads. These cracks typically initiate at the bottom of the asphalt layer and propagate upward. Once a fatigue crack is visible at the surface, significant damage has already occurred.

At low severity, alligator cracks are evidenced by a series of parallel hairline cracks (usually in a wheel path). Medium-severity alligator cracking is a well-defined pattern of interconnected cracks, and some spalling may be present. High-severity alligator cracks have lost aggregate interlock between adjacent pieces, and the cracks may be severely spalled with FOD potential. Most likely, the pieces will move freely under traffic.

Alligator cracking is a serious structural failure that cannot be repaired with sealant. The proper repair is patching.



Raveling/Weathering

Raveling and weathering are the wearing away of the pavement surface. Failure can be caused by the dislodging of aggregate particles or the loss of asphalt binder. These distresses are usually evident over large areas and may indicate that the asphalt binder has hardened significantly.

Raveling is the loss of coarse aggregate, weathering is the loss of fine aggregate or binder.

Raveling: At low severity, 5 to 20 coarse aggregate particles are missing per square yard. Medium severity is defined by 20 to 40 missing coarse aggregate particles per square yard. At high severity, more than 40 coarse aggregate particles are missing per square yard, and the top layer of aggregate has eroded away.

Weathering: At low severity, edges of coarse aggregate are exposed less than 1 mm. At medium severity, loss of fine aggregate is noticeable and edges of coarse aggregate are exposed up to 6 mm (1/4 inch). High severity weathering has edges of coarse aggregate exposed > 6 mm, with considerable loss of fine aggregate matrix and potential for loss of coarse aggregate.



Rutting

Ruts are localized areas of pavement having elevations lower than the surrounding sections.

Rutting is due to base and subgrade consolidation caused by excessive wheel loads or poor compaction. Ruts indicate structural failure and can cause hydroplaning.

At low severity, ruts have an average depth of ¼ to ½ inches. At medium severity, ruts have an average depth of ½ to 1 inch. At high severity, ruts have an average depth greater than 1 inch. Patching is the appropriate repair for ruts.



Appendix F. Airport Responsibilities

Grant Assurances

In 1995, Congress mandated that the FAA require, as a condition of grant funding, that airport sponsors prepare documentation of a maintenance management program on pavement that has been constructed, reconstructed, or repaired with Federal assistance.

This report fulfills many of the grant assurance requirements, including documenting:


- Locating all runways, taxiways, and aprons.
- Documenting pavement dimensions.
- Documenting types of pavement.
- Documenting year of construction or most recent major rehabilitation.

The airport owners must be an active participant in maintaining compliance. Actions taken to ensure compliance include:

- Annotating areas constructed or repaired with Federal aid.
- Conducting monthly drive-by inspections to detect changes in pavement condition.
- Recording each drive-by inspection and any maintenance performed as a result.
- Keeping complete records of all maintenance activities.
- Keeping records for 5 years.
- Documenting detailed inspection information with a history of recorded pavement deterioration by PCI survey (e.g., this report).

ASSURANCES Airport Sponsors	
A. General.	<ol style="list-style-type: none"> 1. These assurances shall be complied with in the performance of grant agreements for airport development, airport planning, and noise compatibility program grants for airport sponsors. 2. These assurances are required to be submitted as part of the project application by sponsors requesting funds under the provisions of Title 49, U.S.C., subtitle VII, as amended. As used herein, the term "public agency sponsor" means a public agency with control of a public-use airport; the term "private sponsor" means a private owner of a public-use airport; and the term "sponsor" includes both public agency sponsors and private sponsors. 3. Upon acceptance of the grant offer by the sponsor, these assurances are incorporated in and become part of the grant agreement.
B. Duration and Applicability.	<ol style="list-style-type: none"> 1. Airport development or Noise Compatibility Program Projects Undertaken by a Public Agency Sponsor. The terms, conditions and assurances of the grant agreement shall remain in full force and effect throughout the useful life of the facilities developed or equipment acquired for an airport development or noise compatibility program project, or throughout the useful life of the project items installed within a facility under a noise compatibility program project, but in any event not to exceed twenty (20) years from the date of acceptance of a grant offer of Federal funds for the project. However, there shall be no limit on the duration of the assurances regarding Exclusive Rights and Airport Revenue so long as the airport is used as an airport. There shall be no limit on the duration of the terms, conditions, and assurances with respect to real property acquired with federal funds. Furthermore, the duration of the Civil Rights assurance shall be specified in the assurances. 2. Airport Development or Noise Compatibility Projects Undertaken by a Private Sponsor. The preceding paragraph 1 also applies to a private sponsor except that the useful life of project items installed within a facility or the useful life of the facilities developed or equipment acquired under an airport development or noise compatibility program project shall be no less than ten (10) years from the date of acceptance of Federal aid for the project. 3. Airport Planning Undertaken by a Sponsor. Unless otherwise specified in the grant agreement, only Assurances 1, 2, 3, 5, 6, 13, 18, 30, 32, 33, and 34 in section C apply to planning projects. The terms, conditions, and assurances of the grant agreement shall remain in full force and effect during the life of the project.
C. Sponsor Certification.	<p>The sponsor hereby assures and certifies, with respect to this grant that:</p> <ol style="list-style-type: none"> 1. General Federal Requirements. It will comply with all applicable Federal laws, regulations, executive orders, policies, guidelines, and requirements as they relate to the application, acceptance and use of Federal funds for this project including but not limited to the following: <ul style="list-style-type: none"> Federal Legislation <ol style="list-style-type: none"> a. Title 49, U.S.C., subtitle VII, as amended. b. Davis-Bacon Act - 40 U.S.C. 276(a), <i>et seq.</i>¹ c. Federal Fair Labor Standards Act - 29 U.S.C. 201, <i>et seq.</i> d. Hatch Act - 5 U.S.C. 1501, <i>et seq.</i>²
<hr/> Airport Assurances (3/2005)	

The table on the following pages is available for maintaining a record of drive-by inspections and maintenance repairs.

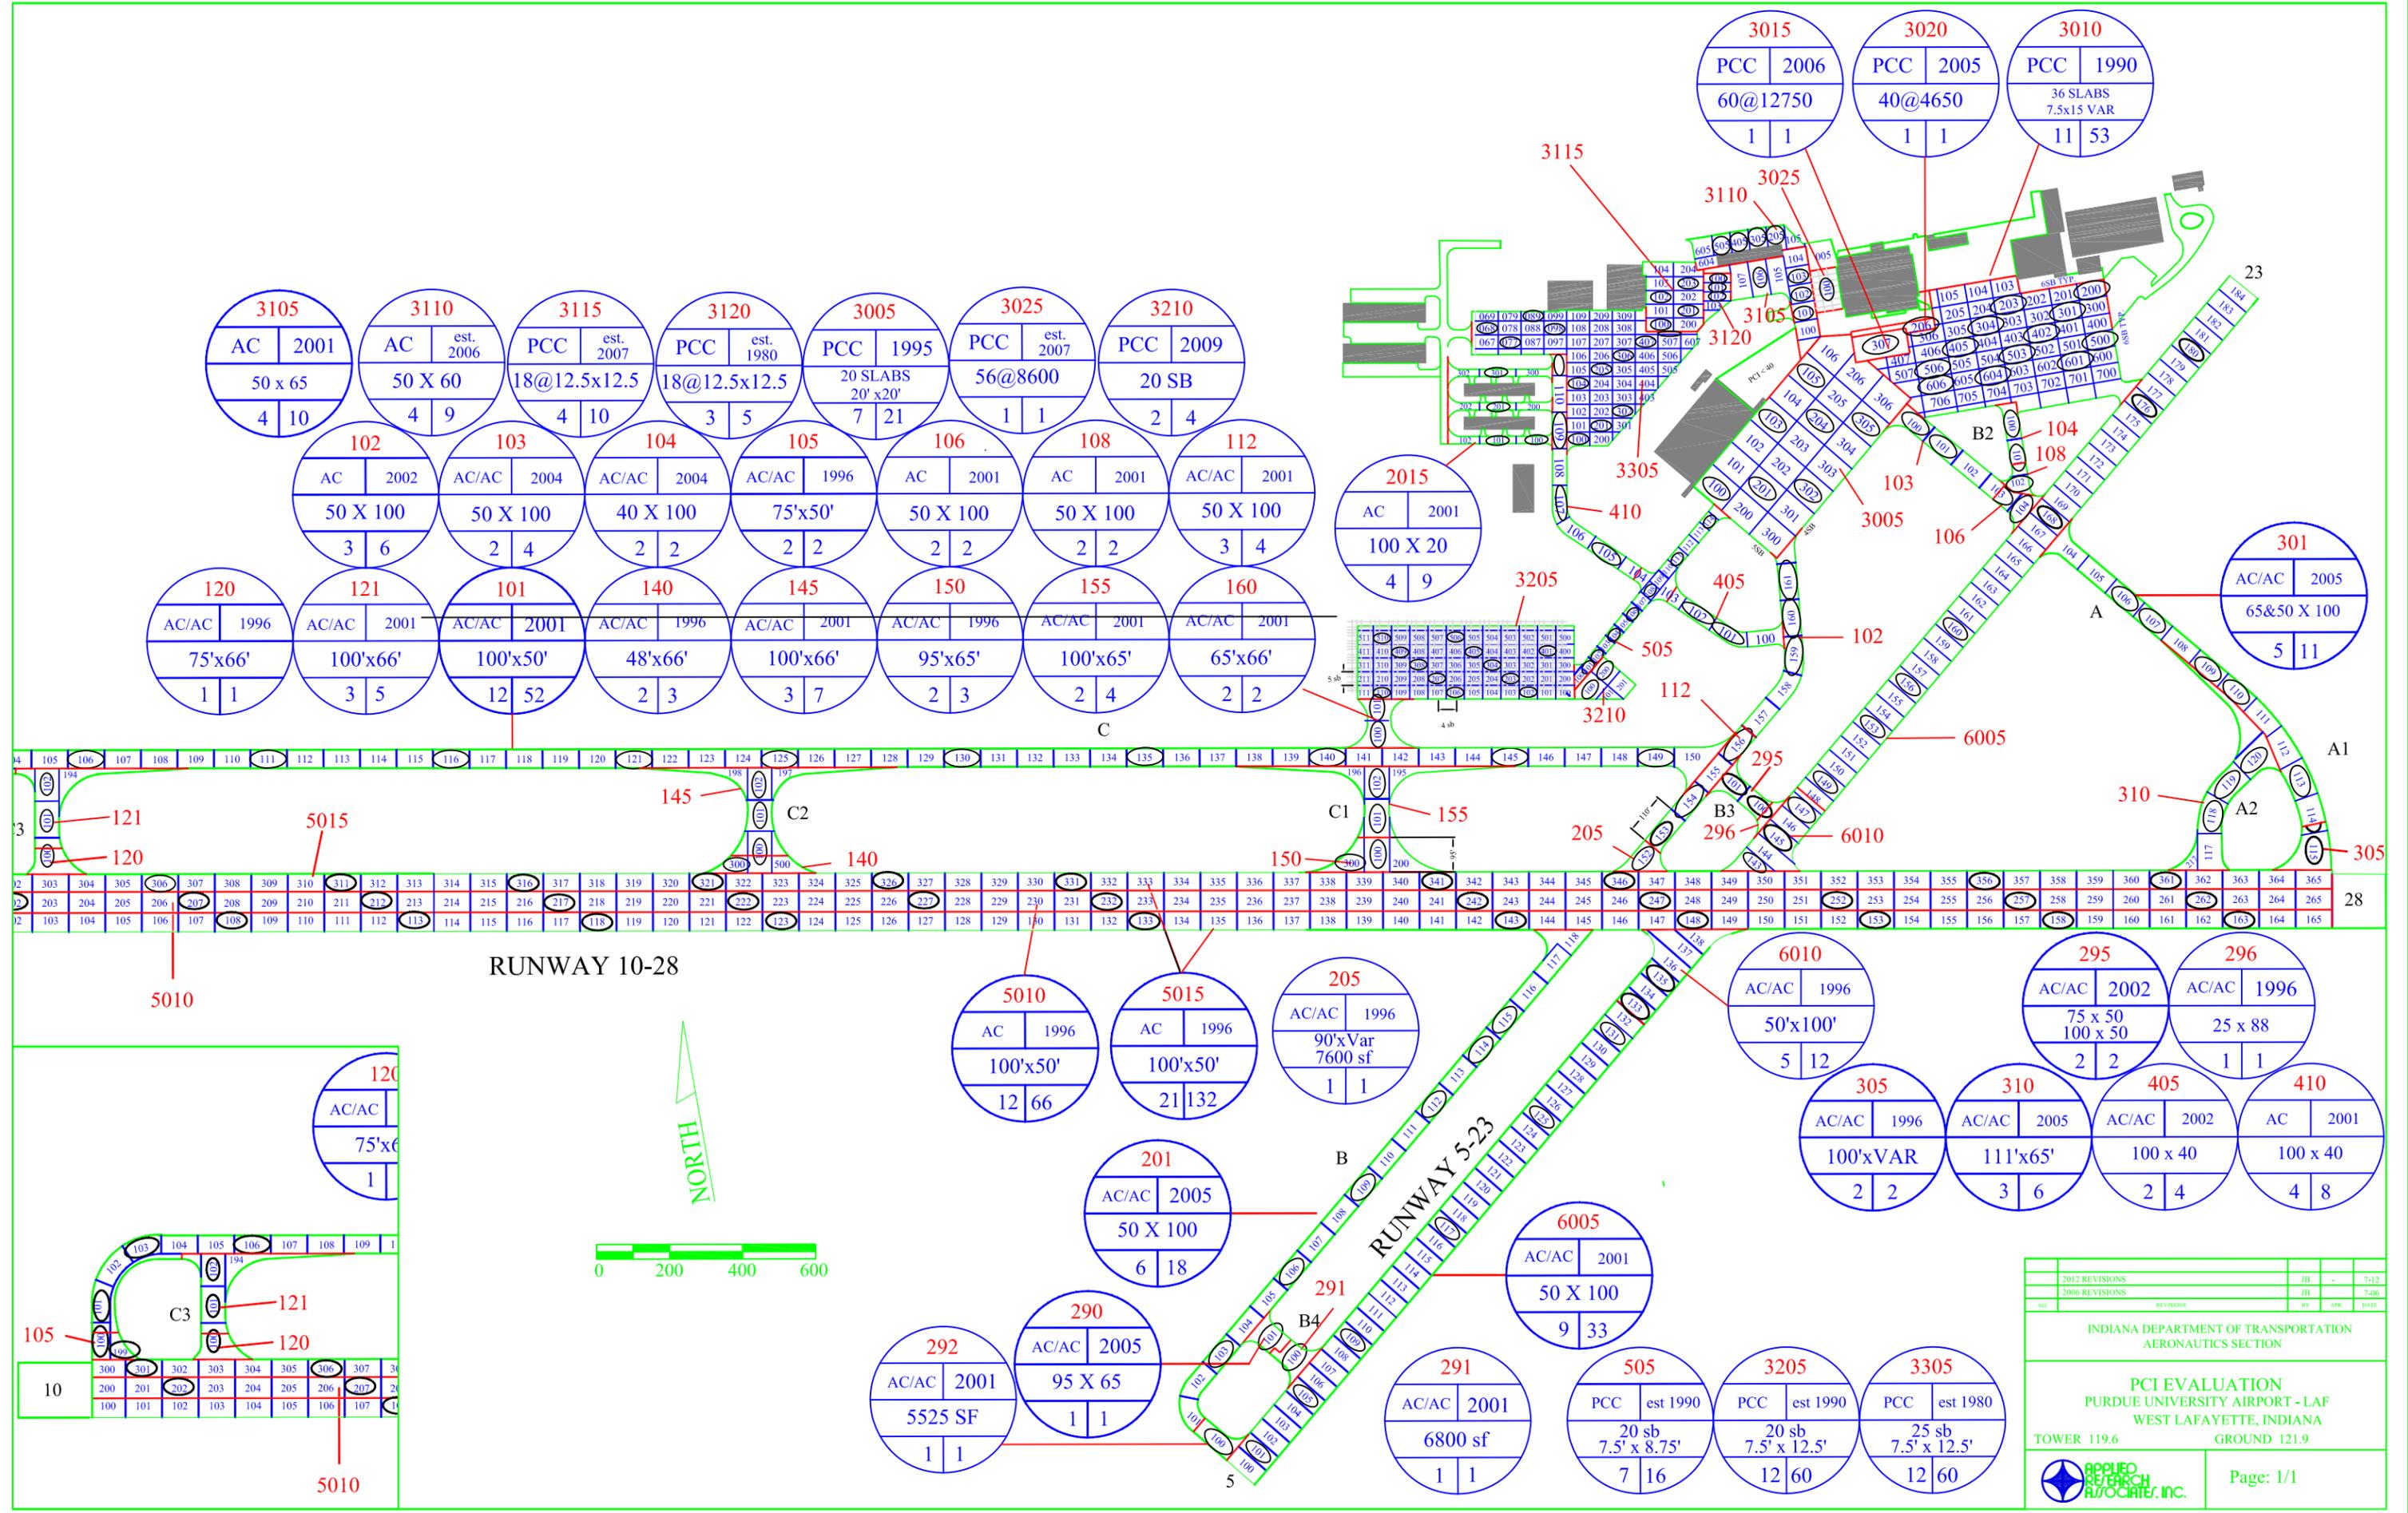

RUNWAY 10-28

RUNWAY 5-23



2012 REVISIONS	JB	-	7-12
2006 REVISIONS	JB	-	7-06
NO.	REVISIONS	BY	DATE
INDIANA DEPARTMENT OF TRANSPORTATION AERONAUTICS SECTION			
PCI EVALUATION PURDUE UNIVERSITY AIRPORT - LAF WEST LAFAYETTE, INDIANA TOWER 119.6 GROUND 121.9			
			Page: 1/1

LAFAYETTE - PURDUE UNIVERSITY AIRPORT

2012 PCI Inspection

