



HAZARDOUS AND REGULATED MATERIALS INSPECTION REPORT

Former City Methodist Church
549 Washington Street
Parcel ID: 45-08-04-429-004
Gary, IN 46402

Prepared for:

Northwest Indiana Regional Development Authority
9800 Connecticut Drive
Crown Point, Indiana 46307
Client Reference: Gary Blight Elimination Program

Prepared by:

Egis
48797 Alpha Drive, Suite 130
Wixom, MI 48393
Egis Project ID: 240100
April 15, 2025

TABLE OF CONTENTS

1.0	Introduction.....	1
1.1	Certification	1
2.0	Description of Structure.....	2
2.1	Accessibility Limitations	2
3.0	General Inspection Methodology	4
4.0	Laboratory Analytical Results.....	5
5.0	Other Hazardous and/or Regulated Materials	7
6.0	Conclusions and Recommendations.....	9
7.0	Limitations	9

ATTACHMENTS

Attachment 1 – Laboratory Analytical Report

Attachment 2 – Figures

Attachment 3 – Photographic Log

1.0 INTRODUCTION

Egis has been contracted by Northwest Indiana Regional Development Authority (the RDA) to provide industrial hygiene services for commercial properties in the City of Gary. Egis industrial hygienists are conducting hazardous and regulated materials (HRM) inspections of commercial buildings and associated exterior portions of properties for select properties in the City of Gary. The properties to be inspected by Egis are included in a portfolio of work provided by the RDA, in concurrence with City of Gary governance for the Gary Blight Elimination Program.

To facilitate demolition of blighted buildings, Egis has completed a HRM inspection (including asbestos) of, a multi-story vacant church building located at 549 Washinton Street, Gary, Indiana (Site) commonly referred to as the Former City Methodist Church. The HRM inspection was conducted on March 24-25, 2025. During the inspection bulk material samples were collected, and quantities of suspect asbestos-containing materials (ACM) were estimated where applicable. This inspection also included identification and quantification of other hazardous and/or regulated materials (ORM) within the building structure and in exterior portions of the Site.

1.1 CERTIFICATION

The asbestos inspection was conducted by State of Indiana (SOI) Accredited Asbestos Inspectors identified below.

TABLE 1.1.1 – Asbestos Inspectors	
Inspector Name and SOI Accreditation Number	Contact Information
Keith Ventimiglia - 19A015969	keith.ventimiglia@egis-group.com / (248) 459-5090
Andrew Ketchum - 19A015961	andrew.ketchum@egis-group.com / (248) 829-0900
Osvaldo Castellanos - 19A016055	osvaldo.castellanos@egis-group.com / 248-568-8700

2.0 DESCRIPTION OF STRUCTURE

The structure is approximately 103,934 square feet in size. It is a concrete and brick structure with a stone façade, with a full basement.

Property information and a description of the structure and other improvements are provided below. Information was gathered from the site reconnaissance and review of municipal records.

TABLE 2.0.1 – PROPERTY INFORMATION	
Parcel Number	45-08-04-429-004
Square Footage	103,934 square feet
Foundation Type	Concrete Block Basement
Building Type	Commercial Building
Exterior Description	Concrete and brick structure with a stone façade
Secondary structure(s)	NA
Pavement/Hardscape	Sidewalk

2.1 ACCESSIBILITY LIMITATIONS

As part of conducting the HRM inspection, Egis asbestos inspectors assessed the condition of the structure holistically, beginning with the foundation and structural members, and specifically by exterior area (EA) and functional space (FS) for safe accessibility. EA and FS may be considered inaccessible as a result of fire damage, water damage, and/or an unstable foundation. Egis asbestos inspectors made reasonable efforts to sample (by reaching through doorways or windows), or assume, and quantify any suspect ACM visible from outside the structure that is located in an EA or FS determined to be inaccessible. See Table 2.1.1 below for a summary of inaccessibility.

TABLE 2.1.1 ACCESSIBILITY LIMITATIONS		
Space Designation	Inaccessibility Determination	Reason
EA5	Completely Inaccessible	Structural Damage
FS2	Partially Inaccessible	Structural Damage
FS3	Partially Inaccessible	Structural Damage
FS5	Completely Inaccessible	Flooded
FS6	Completely Inaccessible	Structural Damage
FS17	Completely Inaccessible	Structural Damage
FS19	Partially Inaccessible	Structural Damage
FS27	Partially Inaccessible	Structural Damage

TABLE 2.1.1 ACCESSIBILITY LIMITATIONS

Space Designation	Inaccessibility Determination	Reason
FS29	Completely Inaccessible	Structural Damage
FS30	Completely Inaccessible	Structural Damage
FS31	Completely Inaccessible	Structural Damage
FS32	Completely Inaccessible	Structural Damage
FS33	Completely Inaccessible	Structural Damage
FS34	Completely Inaccessible	Structural Damage
FS35	Partially Inaccessible	Structural Damage
FS45	Partially Inaccessible	Structural Damage
FS52	Completely Inaccessible	Structural Damage
FS53	Completely Inaccessible	Structural Damage
FS54	Completely Inaccessible	Structural Damage
FS55	Completely Inaccessible	Structural Damage
FS57	Completely Inaccessible	Structural Damage
FS58	Completely Inaccessible	Structural Damage

3.0 GENERAL INSPECTION METHODOLOGY

This inspection provides information on the presence of Asbestos Containing Materials (ACMs) in accordance with the National Emission Standard for a Hazardous Air Pollutant (NESHAP) for Asbestos, 40 CFR 61 Subpart M. The Clean Air Act (CAA) requires the U.S. Environmental Protection Agency (EPA) to develop and enforce regulations to protect the public from exposure to airborne contaminants that are known to be hazardous to human health. The U.S. EPA established the NESHAP under the authority of Section 112 of the CAA, and asbestos was one of the first hazardous air pollutants regulated.

NESHAP requires a thorough inspection of the facility for asbestos, including Category I and Category II non-friable ACM. ACM is material containing more than 1% asbestos as determined using the methods specified in Appendix E, subpart E, 40 CFR part 763, section 1, Polarized Light Microscopy (PLM). The NESHAP classifies ACM as friable or non-friable. Per 40 CFR 61, Subpart M, friable ACM is that which, when dry, may be crumbled, pulverized, or reduced to powder by hand pressure. Non-friable ACM is ACM that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure.

Non-friable ACM is further classified as Category I or Category II. Category I and Category II ACM are distinguished from each other by their potential to release fibers when damaged. Examples of Category I non-friable ACM include but are not limited to: asbestos containing packing, gaskets, resilient floor coverings, resilient floor covering mastic and asphalt roofing products containing more than 1% asbestos as determined using PLM/EPA Method 600R. Category II ACM includes all other non-friable ACM, such as asbestos-cement (A/C) shingles, A/C tiles, and Transite® boards or panels containing more than 1% asbestos. Generally, Category II ACM is more likely to become friable when damaged than Category I ACM. The applicability of NESHAP to Category I and II ACM depends on:

- (1) the condition of the material at the time of demolition or renovation
- (2) the nature of the operation to which the material will be subjected
- (3) the amount of ACM involved

ACM regulated under NESHAP are identified as Regulated ACMs (RACMs). RACM is defined in §61.141 of the NESHAP and includes:

- (1) Friable ACM
- (2) Category I non-friable ACM that has become friable
- (3) Category I non-friable ACM that will be or has been subjected to sanding, grinding, cutting, or abrading
- (4) Category II non-friable ACM that has already been or is likely to become crumbled, pulverized, or reduced to powder by forces expected to act on the material during demolition or renovation operations regulated by EPA 40 CFR 61 Subpart M, NESHAP for Asbestos

The determination of suspect ACMs was based on visual examination, material age and professional experience. Specifically, materials similar in color and texture were classified into homogenous areas. A homogeneous area is an area of surfacing material (SM), thermal system insulation material (TSI), or miscellaneous material (MM) that is uniform in color, texture, and/or date of installation. The appropriate number of samples were collected from suspect material in each established homogenous area. Egis implemented the “3-5-7” rule of sampling surfacing materials required by the Asbestos Hazard Emergency Response Act (AHERA). Samples were analyzed by PLM via EPA Method 600/R-93/116, by EMSL Laboratories, an NVLAP accredited laboratory.

4.0 LABORATORY ANALYTICAL RESULTS

Forty-three (43) bulk materials (homogenous areas [HA]) identified as suspect ACM were sampled and submitted for laboratory analysis and 17 HAs tested positive for the presence of asbestos fibers greater than 1% by weight. Table 4.0.1 below provides details for these ACM. Bulk materials were analyzed for asbestos pursuant to EPA Method 600/R-93/116 using PLM, unless otherwise indicated. Bulk material samples that tested between a trace amount and one percent (1%) asbestos were point counted (400-point counts; EPA 600/R-93/116) to confirm the result. A copy of the laboratory analytical report is provided as *Attachment 1, Laboratory Analytical Report*. Figures depicting the building layout and sample locations are included as *Attachment 2, Figures*. A photographic log that documents the inspection is provided as *Attachment 3, Photographic Log*.

TABLE 4.0.1 – LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
4	Exterior Caulk - on Brick Siding air handler building	N	MM	EA3	220 LF	Non-Friable - Category 2
5	Exterior Caulk - Around all basement and all other windows	N	MM	EA3	3,120 LF	Non-Friable - Category 2
8	Waterproofing Sealant - On some concrete blocks	N	MM	EA2	50 SF	Non-Friable - Category 2
14	Plaster - Skim & Base Coat Ceilings on Wire Mesh	N	SM	FS1-FS18	14,250 SF	Regulated Asbestos Containing Material
16	Plaster - Skim & Base Coat Walls on Brick/Block	N	SM	FS1-FS18	30,940 SF	Regulated Asbestos Containing Material
17	Flooring - 12X12 Floor Tile with Glue-White with Mosaic pattern (Floor Tile)	N	MM	FS11; FS12	1,820 SF	Non-Friable - Category 1
18	Terra Cotta - Interior Walls	N	MM	FS1-FS18	13,100 SF	Regulated Asbestos Containing Material

TABLE 4.0.1 – LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
22	Flooring - 9X9 Floor Tile with Mastic- Gray	N	MM	FS8; FS9	405 SF	Non-Friable - Category 1
30	Plaster - Skim & Base Coat Walls on Brick/Terra Cotta	N	SM	FS18-FS34	84,956 SF	Regulated Asbestos Containing Material
35	Plaster - Base Coat Walls on Brick/Terra Cotta ceilings	N	SM	FS26-FS54	18,350 SF	Regulated Asbestos Containing Material
36	Plaster - Skim & Base Coat Ceilings on Wire Mesh	N	SM	FS26-FS54	11,250 SF	Regulated Asbestos Containing Material
38	Ceiling Panel - 2X2, White with Pinholes and Glue Pods	N	MM	FS42; FS43; FS44; FS46	1,105 SF	Non-Friable - Category 2
39	Flooring - 9X9 Floor Tile with Mastic and Tar Paper- Gray and Green checkerboard Pattern	N	MM	FS42	250 SF	Non-Friable - Category 1
40	Wallboard - with Mud & Tape	N	MM	FS41; FS42; FS43; FS45; FS46	2,350 SF	Regulated Asbestos Containing Material
41	Roofing Material - Flat Roof Materials	N	MM	EA5	7,250 SF	Non-Friable - Category 1
42	Flooring - 9X9 Floor Tile with Glue- Beige	N	MM	FS47	150 SF	Non-Friable - Category 1
43	Transite sheeting - Chalkboard	N	MM	FS48	20 SF	Non-Friable - Category 2

5.0 OTHER HAZARDOUS AND/OR REGULATED MATERIALS

In addition to inspecting the structure(s) for ACMs pursuant to the NESHAP for Asbestos, 40 CFR 61 Subpart M, Egis conducted a visual, non-intrusive inspection of hazardous and/or regulated materials, which did not involve testing. Egis has attempted to accurately quantify the number of hazardous and/or regulated materials that may require decontamination or disposal prior to demolition. Further inspecting, testing, sampling, and/or remediation of any conditions inspected or noted in this report, including actual quantities, remain the sole responsibility of others. Potential hazardous and/or regulated materials addressed by the inspection include, but are not limited to, the following:

- (1) Refrigerants and related chemicals (40 CFR 82);
- (2) Solid wastes which exhibit any of the characteristics of ignitability, corrosivity, reactivity, or toxicity (40 CFR 261.20 – 261.24);
- (3) Hazardous wastes (40 CFR 261.31, 261.32) and discarded commercial chemical products (40 CFR 261.33 & Part 111, Public Act 451 of 1994, as amended);
- (4) Universal wastes, including batteries, pesticides, mercury-containing products, and certain household wastes (40 CFR 273);
- (5) PCB-containing products (40 CFR 761);
- (6) Scrap tires (IC 13-20-14-4);
- (7) Medical or Infectious Wastes (IC 16-41-16 and 410 IAC 1-3-22);
- (8) Electronic Waste (IC 13-20.5)

Lead-based paint (LBP) may be present on the site and is a hazardous substance. Its condition, handling and disposal are regulated by federal, state, and local agencies. LBP does not pose a health threat unless particles are disturbed, become airborne and are inhaled or ingested. Contractors and their employers that will be disturbing the building during demolition should follow all applicable requirements in the OSHA Lead in Construction Standard.

Further testing of debris generated from demolition activities may be required to determine whether the debris should be disposed of as hazardous waste under the Resource Conservation and Recovery Act (RCRA) in accordance with 40-CFR Part 261 Subpart C.

Table 5.0.1 below summarizes other regulated materials (ORM) that were observed at the Site by Egis field staff the day of the inspection.

TABLE 5.0.1 – OTHER REGULATED MATERIALS			
Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
LEAD WINDOWS	EA1; EA2; EA3; EA4	83 UNITS	
TIRES	EA3; FS14	2 UNITS	Car
BALLASTS	FS42; FS51	24 UNITS	

TABLE 5.0.1 – OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
FLUORESCENT LAMP	FS42; FS51	36 UNITS	4' tubes
FLUORESCENT LAMP	FS39	1 UNIT	14' Tube
DOOR CLOSERS	FS19; FS20; FS36; FS38; FS39; FS41	15 UNITS	
ELECTRONICS (CRTs, TVs, MONITORS)	EA3	5 UNITS	

6.0 CONCLUSIONS AND RECOMMENDATIONS

The Indiana Department of Environmental Management (IDEM) Air Quality Division requires formal notification of demolition activities for all structures with, or without, regulated asbestos containing materials (RACM) by using state form *Notification of Demolition and Renovation Operations (State Form 44593, available on the IDEM Agency Forms page)*. Notifications must be made at least 10 business days prior to start of work.

Laboratory results for bulk material samples collected during the HRM inspection indicate several building materials are ACMs and are subject to proper abatement and/or disposal based upon planned demolition activities. Refer to 4.0.1 – Laboratory Analytical Results, for a list of all confirmed and assumed ACMs.

7.0 LIMITATIONS

Egis BLN USA, Inc. sampled portions of the roof that could be accessed safely. If sample collection and friability assessment could not be completed for a suspect material, then the material should be considered a friable ACM, and managed in accordance with the applicable regulations governing such material. However, if later the asbestos removal contractor or demolition contractor gains access to the roof, the friability can be assessed, and samples collected (where applicable and determined necessary by said contractor). This secondary assessment will provide the necessary information to determine if the roofing material can remain in place, or if it is required (in part or whole) to be removed prior to demolition. Egis BLN USA, Inc. is not responsible for this secondary inspection unless specifically requested to do so.

The conclusions of this report are based solely upon observations made during this evaluation. This report is intended to present a professional opinion of potential asbestos containing materials that may or may not be present at the project property. Our opinions should not be construed as relating to health and safety issues directly. Should additional information become available, this information should be reviewed, and the conclusions herein modified as appropriate. In addition, this report should not be construed as verification of compliance by the present owners or operators of the Site with federal, state, or local laws and regulations. Egis BLN USA, Inc. is responsible to perform services in a professional manner, consistent with typical industry practice. The conclusions drawn based on this evaluation are deemed as appropriate by Egis BLN USA, Inc. in the exercise of professional judgment.

Our observations did not indicate conditions existing beyond those discussed, although it is possible, limitation of scope or the standard practice precluded recognition of asbestos containing materials present at the site, such as inaccessible and/or confined spaces of the structure. Egis BLN USA, Inc. staff do not enter confined spaces as part of the inspection process. Confined spaces include crawlspaces and attics or any other such space where there is limited ingress and egress.

Egis BLN USA, Inc. reserves the right to determine when and where a confined space may be present and use professional judgment when deciding upon entry. We cannot be held liable for materials that may be present in these spaces and unable to be reported as part of our inspection process. The presence of confined spaces will be reported as applicable, and all limitations expressed herein will apply. Any confined spaces encountered during the inspection are identified in Table 2.1.1 – Accessibility Limitations.

We cannot be held liable for consequential damages, if it is determined in the future that contamination of some type is present at the site. This report should not be considered as a recommendation to purchase, sell, or develop the Site, and the opinions expressed herein are not legal opinions. To evaluate the information contained in this report, the reader must understand the limitations associated with this assessment. Specifically, the services for this project have been performed in general conformance with the contract negotiated between the RDA and Egis

BLN USA, Inc. This report was prepared for the benefit and exclusive use of the RDA, its agents and assigns. Any third-party use of this report or reliance upon the information and opinions therein is the sole responsibility of the third party. Egis BLN USA, Inc. has no responsibility for any damages that may be suffered by a third party because of any decision made or action taken by a third party based on this report.

ATTACHMENT 1 – LABORATORY REPORT



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/24/2025
Received: 3/27/2025
Analyzed: 4/01/2025

Proj: IC-005 / 549 Washington Street - Basement & Exterior / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 1-A **Lab Sample ID:** 042505764-0001

Sample Description: EA 1-4/Stairs To Building Concrete Sidewalk

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 1-B **Lab Sample ID:** 042505764-0002

Sample Description: EA 1-4/Stairs To Building Concrete Sidewalk

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 1-C **Lab Sample ID:** 042505764-0003

Sample Description: EA 1-4/Stairs To Building Concrete Sidewalk

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 2-A-Brick **Lab Sample ID:** 042505764-0004

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: 2-A-Mortar **Lab Sample ID:** 042505764-0004A

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 2-B-Brick **Lab Sample ID:** 042505764-0005

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: 2-B-Mortar **Lab Sample ID:** 042505764-0005A

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 2-C-Brick **Lab Sample ID:** 042505764-0006

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: 2-C-Mortar **Lab Sample ID:** 042505764-0006A

Sample Description: EA 1-4/Exterior Building Foundation Block Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 3-A-Brick **Lab Sample ID:** 042505764-0007

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 3-A-Mortar **Lab Sample ID:** 042505764-0007A

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 3-B-Brick **Lab Sample ID:** 042505764-0008

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 3-B-Mortar **Lab Sample ID:** 042505764-0008A

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 3-C-Brick **Lab Sample ID:** 042505764-0009

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 3-C-Mortar **Lab Sample ID:** 042505764-0009A

Sample Description: EA 1-4/Exterior Building Foundation Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 4-A **Lab Sample ID:** 042505764-0010

Sample Description: EA 3/Brick Siding Air Handler Building Exterior Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	<1%	98.0%	2% Chrysotile	

Client Sample ID: 4-B **Lab Sample ID:** 042505764-0011

Sample Description: EA 3/Brick Siding Air Handler Building Exterior Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 4-C **Lab Sample ID:** 042505764-0012

Sample Description: EA 3/Brick Siding Air Handler Building Exterior Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 5-A **Lab Sample ID:** 042505764-0013

Sample Description: EA 3/Exterior Caulk around all Basement & other Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	95.0%	5% Chrysotile	

Client Sample ID: 5-B **Lab Sample ID:** 042505764-0014

Sample Description: EA 3/Exterior Caulk around all Basement & other Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 5-C **Lab Sample ID:** 042505764-0015

Sample Description: EA 3/Exterior Caulk around all Basement & other Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 6-A **Lab Sample ID:** 042505764-0016

Sample Description: EA 2/Foundation Wall Support Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 6-B **Lab Sample ID:** 042505764-0017

Sample Description: EA 2/Foundation Wall Support Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 6-C **Lab Sample ID:** 042505764-0018

Sample Description: EA 2/Foundation Wall Support Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: 7-A **Lab Sample ID:** 042505764-0019

Sample Description: EA 5/Roofing Material Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 7-B **Lab Sample ID:** 042505764-0020

Sample Description: EA 5/Roofing Material Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 7-C **Lab Sample ID:** 042505764-0021

Sample Description: EA 5/Roofing Material Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: 8-A **Lab Sample ID:** 042505764-0022

Sample Description: EA 2/Waterproof Sealant on Concrete Blocks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/Black	10.0%	85.0%	5% Chrysotile	

Client Sample ID: 8-B **Lab Sample ID:** 042505764-0023

Sample Description: EA 2/Waterproof Sealant on Concrete Blocks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 8-C **Lab Sample ID:** 042505764-0024

Sample Description: EA 2/Waterproof Sealant on Concrete Blocks

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 9-A **Lab Sample ID:** 042505764-0025

Sample Description: FS 1-16/Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 9-B **Lab Sample ID:** 042505764-0026

Sample Description: FS 1-16/Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 9-C **Lab Sample ID:** 042505764-0027

Sample Description: FS 1-16/Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: 10-A-Tile **Lab Sample ID:** 042505764-0028

Sample Description: FS 14/12x12 Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown	0.0%	100.0%	<1% Chrysotile	

Client Sample ID: 10-A-Mastic **Lab Sample ID:** 042505764-0028A

Sample Description: FS 14/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	2.0%	98.0%	None Detected	

Client Sample ID: 10-A-Glue **Lab Sample ID:** 042505764-0028B

Sample Description: FS 14/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 10-B-Tile **Lab Sample ID:** 042505764-0029

Sample Description: FS 14/12x12 Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown	0.0%	100.0%	<1% Chrysotile	

Client Sample ID: 10-B-Mastic **Lab Sample ID:** 042505764-0029A

Sample Description: FS 14/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	<1%	100.0%	None Detected	

Client Sample ID: 10-B-Glue **Lab Sample ID:** 042505764-0029B

Sample Description: FS 14/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 10-C-Tile **Lab Sample ID:** 042505764-0030
Sample Description: FS 14/12x12 Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	<1% Chrysotile	

Client Sample ID: 10-C-Mastic **Lab Sample ID:** 042505764-0030A
Sample Description: FS 14/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	<1%	100.0%	None Detected	

Client Sample ID: 10-C-Glue **Lab Sample ID:** 042505764-0030B
Sample Description: FS 14/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: 11-A-Wallboard **Lab Sample ID:** 042505764-0031
Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	15.0%	85.0%	None Detected	

Client Sample ID: 11-A-Mud **Lab Sample ID:** 042505764-0031A
Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	2.0%	98.0%	None Detected	

Client Sample ID: 11-A-Tape **Lab Sample ID:** 042505764-0031B
Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/White	85.0%	15.0%	None Detected	

Client Sample ID: 11-B-Wallboard **Lab Sample ID:** 042505764-0032
Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	15.0%	85.0%	None Detected	

Client Sample ID: 11-B-Mud **Lab Sample ID:** 042505764-0032A
Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	2.0%	98.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 11-B-Tape **Lab Sample ID:** 042505764-0032B

Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	85.0%	15.0%	None Detected	

Client Sample ID: 11-C-Wallboard **Lab Sample ID:** 042505764-0033

Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	10.0%	90.0%	None Detected	

Client Sample ID: 11-C-Mud **Lab Sample ID:** 042505764-0033A

Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 11-C-Tape **Lab Sample ID:** 042505764-0033B

Sample Description: FS 8-10, 14/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown	85.0%	15.0%	None Detected	

Client Sample ID: 12-A **Lab Sample ID:** 042505764-0034

Sample Description: FS 1-18/Foundation Wall Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 12-B **Lab Sample ID:** 042505764-0035

Sample Description: FS 1-18/Foundation Wall Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 12-C **Lab Sample ID:** 042505764-0036

Sample Description: FS 1-18/Foundation Wall Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 13-A **Lab Sample ID:** 042505764-0037

Sample Description: FS 1-18/Pillar Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 13-B **Lab Sample ID:** 042505764-0038
Sample Description: FS 1-18/Pillar Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 13-C **Lab Sample ID:** 042505764-0039
Sample Description: FS 1-18/Pillar Concrete

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: 14-A-Skim Coat **Lab Sample ID:** 042505764-0040
Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-A-Base Coat **Lab Sample ID:** 042505764-0040A
Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	2.0%	95.0%	3% Chrysotile	

Client Sample ID: 14-B-Skim Coat **Lab Sample ID:** 042505764-0041
Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-B-Base Coat **Lab Sample ID:** 042505764-0041A
Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 14-C-Skim Coat **Lab Sample ID:** 042505764-0042
Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-C-Base Coat **Lab Sample ID:** 042505764-0042A
Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 14-D-Skim Coat **Lab Sample ID:** 042505764-0043

Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-D-Base Coat **Lab Sample ID:** 042505764-0043A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 14-E-Skim Coat **Lab Sample ID:** 042505764-0044

Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-E-Base Coat **Lab Sample ID:** 042505764-0044A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 14-F-Skim Coat **Lab Sample ID:** 042505764-0045

Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-F-Base Coat **Lab Sample ID:** 042505764-0045A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 14-G-Skim Coat **Lab Sample ID:** 042505764-0046

Sample Description: FS 1-18/Plaster Skim Coat Ceiling on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 14-G-Base Coat **Lab Sample ID:** 042505764-0046A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 15-A-Wallboard **Lab Sample ID:** 042505764-0047

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	15.0%	85.0%	None Detected	

Client Sample ID: 15-A-Adhesive **Lab Sample ID:** 042505764-0047A

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	2.0%	98.0%	None Detected	

Client Sample ID: 15-B-Wallboard **Lab Sample ID:** 042505764-0048

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Gray	15.0%	85.0%	None Detected	

Client Sample ID: 15-B-Adhesive **Lab Sample ID:** 042505764-0048A

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	2.0%	98.0%	None Detected	

Client Sample ID: 15-C-Wallboard **Lab Sample ID:** 042505764-0049

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/White	12.0%	88.0%	None Detected	

Client Sample ID: 15-C-Adhesive **Lab Sample ID:** 042505764-0049A

Sample Description: FS 14/Yellow Construction Adhesive on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: 16-A-Skim Coat **Lab Sample ID:** 042505764-0050

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan/White	0.0%	98.0%	2% Chrysotile	Inseparable paint / coating layer included in analysis

Client Sample ID: 16-A-Base Coat **Lab Sample ID:** 042505764-0050A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/White	2.0%	95.0%	3% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 16-B-Skim Coat **Lab Sample ID:** 042505764-0051

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-B-Base Coat **Lab Sample ID:** 042505764-0051A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-C-Skim Coat **Lab Sample ID:** 042505764-0052

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-C-Base Coat **Lab Sample ID:** 042505764-0052A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-D-Skim Coat **Lab Sample ID:** 042505764-0053

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-D-Base Coat **Lab Sample ID:** 042505764-0053A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-E-Skim Coat **Lab Sample ID:** 042505764-0054

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-E-Base Coat **Lab Sample ID:** 042505764-0054A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 16-F-Skim Coat **Lab Sample ID:** 042505764-0055

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-F-Base Coat **Lab Sample ID:** 042505764-0055A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-G-Skim Coat **Lab Sample ID:** 042505764-0056

Sample Description: FS 1-18/Plaster Skim Coat Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 16-G-Base Coat **Lab Sample ID:** 042505764-0056A

Sample Description: FS 1-18/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 17-A-Tile **Lab Sample ID:** 042505764-0057

Sample Description: FS 11-12/12x12 White w/Mosaic Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/Tan	0.0%	98.0%	2% Chrysotile	

Client Sample ID: 17-A-Glue **Lab Sample ID:** 042505764-0057A

Sample Description: FS 11-12/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 17-B-Tile **Lab Sample ID:** 042505764-0058

Sample Description: FS 11-12/12x12 White w/Mosaic Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 17-B-Glue **Lab Sample ID:** 042505764-0058A

Sample Description: FS 11-12/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 17-C-Tile **Lab Sample ID:** 042505764-0059

Sample Description: FS 11-12/12x12 White w/Mosaic Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 17-C-Glue **Lab Sample ID:** 042505764-0059A

Sample Description: FS 11-12/Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: 18-A-Layer 1 **Lab Sample ID:** 042505764-0060

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 18-A-Layer 2 **Lab Sample ID:** 042505764-0060A

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	<1%	97.0%	3% Chrysotile	

Client Sample ID: 18-B-Layer 1 **Lab Sample ID:** 042505764-0061

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 18-B-Layer 2 **Lab Sample ID:** 042505764-0061A

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 18-C-Layer 1 **Lab Sample ID:** 042505764-0062

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 18-C-Layer 2 **Lab Sample ID:** 042505764-0062A

Sample Description: FS 1-18/Interior Wall Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 19-A **Lab Sample ID:** 042505764-0063

Sample Description: FS 16/Brown Construction Adhesive on Brown Wall Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan/White	0.0%	100.0%	None Detected	

Client Sample ID: 19-B **Lab Sample ID:** 042505764-0064

Sample Description: FS 16/Brown Construction Adhesive on Brown Wall Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan/White	0.0%	100.0%	None Detected	

Client Sample ID: 19-C **Lab Sample ID:** 042505764-0065

Sample Description: FS 16/Brown Construction Adhesive on Brown Wall Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown	<1%	100.0%	None Detected	

Client Sample ID: 20-A **Lab Sample ID:** 042505764-0066

Sample Description: FS 16/Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Tan/White	0.0%	100.0%	None Detected	

Client Sample ID: 20-B **Lab Sample ID:** 042505764-0067

Sample Description: FS 16/Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Tan/White	0.0%	100.0%	None Detected	

Client Sample ID: 20-C **Lab Sample ID:** 042505764-0068

Sample Description: FS 16/Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 21-A-Brick **Lab Sample ID:** 042505764-0069

Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 21-A-Mortar **Lab Sample ID:** 042505764-0069A

Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 21-B-Brick **Lab Sample ID:** 042505764-0070
Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 21-B-Mortar **Lab Sample ID:** 042505764-0070A
Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 21-C-Brick **Lab Sample ID:** 042505764-0071
Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: 21-C-Mortar **Lab Sample ID:** 042505764-0071A
Sample Description: FS 1-18/Interior Wall Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 22-A-Tile **Lab Sample ID:** 042505764-0072
Sample Description: FS 8, 9/9x9 Gray Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	95.0%	5% Chrysotile	

Client Sample ID: 22-A-Mastic **Lab Sample ID:** 042505764-0072A
Sample Description: FS 8, 9/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	<1%	95.0%	5% Chrysotile	

Client Sample ID: 22-B-Tile **Lab Sample ID:** 042505764-0073
Sample Description: FS 8, 9/9x9 Gray Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 22-B-Mastic **Lab Sample ID:** 042505764-0073A
Sample Description: FS 8, 9/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 22-C-Tile **Lab Sample ID:** 042505764-0074

Sample Description: FS 8, 9/9x9 Gray Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 22-C-Mastic **Lab Sample ID:** 042505764-0074A

Sample Description: FS 8, 9/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025					Positive Stop (Not Analyzed)

Client Sample ID: 23-A **Lab Sample ID:** 042505764-0075

Sample Description: FS 14/2x2 White w/Pinhole Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/White	85.0%	15.0%	None Detected	

Client Sample ID: 23-B **Lab Sample ID:** 042505764-0076

Sample Description: FS 14/2x2 White w/Pinhole Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/White	85.0%	15.0%	None Detected	

Client Sample ID: 23-C **Lab Sample ID:** 042505764-0077

Sample Description: FS 14/2x2 White w/Pinhole Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/White	85.0%	15.0%	None Detected	

Client Sample ID: 24-A-Brick **Lab Sample ID:** 042505764-0078

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 24-A-Mortar **Lab Sample ID:** 042505764-0078A

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 24-B-Brick **Lab Sample ID:** 042505764-0079

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505764
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 24-B-Mortar

Lab Sample ID: 042505764-0079A

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 24-C-Brick

Lab Sample ID: 042505764-0080

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 24-C-Mortar

Lab Sample ID: 042505764-0080A

Sample Description: FS 9, 11-12/Interior Fireplace Fire-Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Beige	0.0%	100.0%	None Detected	

Analyst(s):

Billy Barnes PLM (30)
Joshua Moorman PLM (68)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Morrisville, NC NVLAP Lab Code 200671-0, VA 3333 000278, WVA LT000296

Initial report from: 04/01/2025 15:41:04



EMSL Analytical, Inc.

200 Route 130 North, Cinnaminson, NJ 08077

Phone/Fax: (800) 220-3675 / (856) 786-5974

<http://www.EMSL.com>

cinnasblab@EMSL.com

EMSL Order: 042505764

CustomerID: BLNL75

CustomerPO: 240100-IN

ProjectID:

Attn: **Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393**

Phone: (313) 408-4893
Fax:
Received: 3/27/2025 12:55 PM
Analysis Date: 4/9/2025
Collected: 3/24/2025

Project: **IC-005 / 549 Washington Street - Basement & Exterior / RDA Program**

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy with Gravimetric Reduction. Quantitation using 400 Point Count Procedure.

SAMPLE ID	DESCRIPTION	APPEARANCE	(% Matrix Organic Acid		NON- ASBESTOS % Fibrous	NON- ASBESTOS % NON-FIBROUS	ASBESTOS % TYPES
10-A-Tile 042505764-0028	FS 14 - 12x12 Floor Tile	Brown Fibrous Homogeneous	35.6	40.2		23.4 Non-fibrous (other)	0.7 Chrysotile
HA: FLM							
10-B-Tile 042505764-0029	FS 14 - 12x12 Floor Tile	Brown Fibrous Homogeneous	41.5	41.0		16.7 Non-fibrous (other)	0.8 Chrysotile
HA: FLM							
10-C-Tile 042505764-0030	FS 14 - 12x12 Floor Tile	Brown/Gray Fibrous Homogeneous	36.1	44.5		18.9 Non-fibrous (other)	0.4 Chrysotile
HA: FLM							

Analyst(s)

Joshua Moorman (2)

Roxsee Stover (1)

Samantha Rundstrom, Laboratory Manager
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Some samples may contain asbestos fibers present in dimensions below PLM resolution limits. EMSL suggests that samples reported as <0.25% or none detected undergo additional analysis via TEM. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Morrisville, NC NVLAP Lab Code 200671-0, VA 3333 000278, WVA LT000296

Initial report from 04/09/2025 13:18:55



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAININGPHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

RECEIVED EMSL CINNAMINSON, NJ 3/24/25 12:54 PM

Customer Information	Customer ID:	BLNL75	Billing ID:	BLNL75
	Company Name:	Egis	Company Name:	Egis
	Contact Name:	Craig Willey	Billing Contact:	Ryan Jones
	Street Address:	48797 Alpha Drive	Street Address:	8320 Craig Street
	City, State, Zip:	Wixom, MI 48393	City, State, Zip:	Indianapolis, IN 46250
	Country:	USA	Country:	USA
Phone:	(248) 863-2934	Phone:	(248) 863-2762	
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com
Project Information				
Project Name/No:			Purchase Order:	
IC-005 - 549 Washington Street (Basement and Exterior)			240100-IN RDA Program	
EMSL LIMS Project ID: (If applicable, EMSL will provide)			US State where samples collected: MICHIGAN	
			State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature:	Date Sample	No. of Samples
			3/24/2025	80

Turn-Around-Time (TAT)



72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx #

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
1 - A, B, C	CC	EA 1-4	Concrete - Sidewalks, stairs to building
2 - A, B, C	BM	EA 1-4	Block_Mortar - Exterior building foundation
3 - A, B, C	BM	EA 1-4	Brick_Mortar - Exterior building foundation
4 - A, B, C	EC	EA 3	Exterior_Caulk - on Brick Siding air handler building
5 - A, B, C	EC	EA 3	Exterior_Caulk - Around all basement and all other windows
6 - A, B, C	CC	EA 2	Concrete - Foundation Wall supports
7 - A, B, C		EA 5	Slate - Roofing Material
8 - A, B, C	WP	EA 2	Waterproofing_Sealant - On some concrete blocks

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location 0		Sample Condition Upon Receipt:	
Relinquished by:		Date/Time:	3-24-25 1800	Received by:	
Relinquished by:		Date/Time:		Received by:	

EMSL Order Number / Lab Use Only

Agrobacterium

PHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

IC-005 - 549 Washington Street (Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

[illegible]

RECEIVED
EMSL
CINNAMINSON, NJ
2015 MAR 27 1 P 12:54

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: <i>[Signature]</i>	Date/Time: 3-26-25 18W	Received by: <i>[Signature]</i> GOR	Date/Time: 3/27/25 185JP
Relinquished by:	Date/Time:	Received by:	Date/Time:

Page 2 of 2



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/25/2025
Received: 3/27/2025
Analyzed: 4/01/2025

Proj: IC-005 / 549 Washington Street - 1st Floor / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 25-A-Tile **Lab Sample ID:** 042505733-0001

Sample Description: FS 19/Isle Way to Alter Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/Red	0.0%	100.0%	None Detected	

Client Sample ID: 25-A-Grout **Lab Sample ID:** 042505733-0001A

Sample Description: FS 19/Grout

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 25-B-Tile **Lab Sample ID:** 042505733-0002

Sample Description: FS 19/Isle Way to Alter Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/Red	0.0%	100.0%	None Detected	

Client Sample ID: 25-B-Grout **Lab Sample ID:** 042505733-0002A

Sample Description: FS 19/Grout

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 25-C-Tile **Lab Sample ID:** 042505733-0003

Sample Description: FS 19/Isle Way to Alter Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/Red	0.0%	100.0%	None Detected	

Client Sample ID: 25-C-Grout **Lab Sample ID:** 042505733-0003A

Sample Description: FS 19/Grout

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 26-A-Slate **Lab Sample ID:** 042505733-0004

Sample Description: FS 19/Alter Platform Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 26-A-Mortar **Lab Sample ID:** 042505733-0004A

Sample Description: FS 19/Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 26-B-Slate **Lab Sample ID:** 042505733-0005

Sample Description: FS 19/Alter Platform Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 26-B-Mortar **Lab Sample ID:** 042505733-0005A

Sample Description: FS 19/Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 26-C-Slate **Lab Sample ID:** 042505733-0006

Sample Description: FS 19/Alter Platform Slate

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: 26-C-Mortar **Lab Sample ID:** 042505733-0006A

Sample Description: FS 19/Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: 27-A **Lab Sample ID:** 042505733-0007

Sample Description: FS 23-24/Paper under Wood Floor Vapor Barrier

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Black	60.0%	40.0%	None Detected	

Client Sample ID: 27-B **Lab Sample ID:** 042505733-0008

Sample Description: FS 23-24/Paper under Wood Floor Vapor Barrier

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Black	60.0%	40.0%	None Detected	

Client Sample ID: 27-C **Lab Sample ID:** 042505733-0009

Sample Description: FS 23-24/Paper under Wood Floor Vapor Barrier

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	70.0%	30.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 28-A **Lab Sample ID:** 042505733-0010

Sample Description: FS 20, 23-24/Fireplace Flooring Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 28-B **Lab Sample ID:** 042505733-0011

Sample Description: FS 20, 23-24/Fireplace Flooring Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 28-C **Lab Sample ID:** 042505733-0012

Sample Description: FS 20, 23-24/Fireplace Flooring Brick Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 29-A-Skim Coat **Lab Sample ID:** 042505733-0013

Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 29-A-Base Coat **Lab Sample ID:** 042505733-0013A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-B-Skim Coat **Lab Sample ID:** 042505733-0014

Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 29-B-Base Coat **Lab Sample ID:** 042505733-0014A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-C-Skim Coat **Lab Sample ID:** 042505733-0015

Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 29-C-Base Coat **Lab Sample ID:** 042505733-0015A
Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-D-Skim Coat **Lab Sample ID:** 042505733-0016
Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 29-D-Base Coat **Lab Sample ID:** 042505733-0016A
Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-E-Skim Coat **Lab Sample ID:** 042505733-0017
Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 29-E-Base Coat **Lab Sample ID:** 042505733-0017A
Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-F-Skim Coat **Lab Sample ID:** 042505733-0018
Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 29-F-Base Coat **Lab Sample ID:** 042505733-0018A
Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 29-G-Skim Coat **Lab Sample ID:** 042505733-0019
Sample Description: FS 18-34/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 29-G-Base Coat **Lab Sample ID:** 042505733-0019A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Beige	15.0%	85.0%	None Detected	

Client Sample ID: 30-A-Skim Coat **Lab Sample ID:** 042505733-0020

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White/Pink	0.0%	98.0%	2% Chrysotile	

Client Sample ID: 30-A-Base Coat **Lab Sample ID:** 042505733-0020A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	15.0%	83.0%	2% Chrysotile	

Client Sample ID: 30-B-Skim Coat **Lab Sample ID:** 042505733-0021

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 30-B-Base Coat **Lab Sample ID:** 042505733-0021A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 30-C-Skim Coat **Lab Sample ID:** 042505733-0022

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 30-C-Base Coat **Lab Sample ID:** 042505733-0022A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 30-D-Skim Coat **Lab Sample ID:** 042505733-0023

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	Inseparable paint / coating layer included in analysis



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 30-D-Base Coat **Lab Sample ID:** 042505733-0023A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-E-Skim Coat **Lab Sample ID:** 042505733-0024

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-E-Base Coat **Lab Sample ID:** 042505733-0024A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-F-Skim Coat **Lab Sample ID:** 042505733-0025

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-F-Base Coat **Lab Sample ID:** 042505733-0025A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-G-Skim Coat **Lab Sample ID:** 042505733-0026

Sample Description: FS 18-34/Plaster Skim Coat Walls on Brick/Terracotta

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 30-G-Base Coat **Lab Sample ID:** 042505733-0026A

Sample Description: FS 18-34/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 31-A **Lab Sample ID:** 042505733-0027

Sample Description: FS 23/Interior Wall Chimney Liner

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 31-B **Lab Sample ID:** 042505733-0028

Sample Description: FS 23/Interior Wall Chimney Liner

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 31-C **Lab Sample ID:** 042505733-0029

Sample Description: FS 23/Interior Wall Chimney Liner

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: 32-A **Lab Sample ID:** 042505733-0030

Sample Description: EA 1-4/Metal Framed Windows Window Glaze

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 32-B **Lab Sample ID:** 042505733-0031

Sample Description: EA 1-4/Metal Framed Windows Window Glaze

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 32-C **Lab Sample ID:** 042505733-0032

Sample Description: EA 1-4/Metal Framed Windows Window Glaze

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM		White	0.0%	100.0%	None Detected	

Client Sample ID: 33-A **Lab Sample ID:** 042505733-0033

Sample Description: FS 23-27/Decorative Moldings Plaster

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	5.0%	95.0%	None Detected	

Client Sample ID: 33-B **Lab Sample ID:** 042505733-0034

Sample Description: FS 23-27/Decorative Moldings Plaster

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	10.0%	90.0%	None Detected	

Client Sample ID: 33-C **Lab Sample ID:** 042505733-0035

Sample Description: FS 23-27/Decorative Moldings Plaster

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM		White	10.0%	90.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505733
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 34-A

Lab Sample ID: 042505733-0036

Sample Description: FS 27/Auditorium Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/White	10.0%	90.0%	None Detected	

Client Sample ID: 34-B

Lab Sample ID: 042505733-0037

Sample Description: FS 27/Auditorium Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/White	10.0%	90.0%	None Detected	

Client Sample ID: 34-C

Lab Sample ID: 042505733-0038

Sample Description: FS 27/Auditorium Concrete Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM		Gray/White	10.0%	90.0%	None Detected	

Analyst(s):

Faeryn Swift PLM (32)
Michelle Leggett PLM (11)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Houston, TX NVLAP Lab Code 102106-0, AZ 0925, CO AL-15355, LA 04126, TX 300159

Initial report from: 04/01/2025 09:33:32



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

PHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

042505733

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
Project Information							
Project Name/No:				IC-005 - 549 Washington Street (1st Floor)		Purchase Order:	240100-IN RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Sampled By Signature:		Date Sample		No. of Samples	
Keith Ventimiglia		<i>[Signature]</i>		3/25/2025		38	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx #

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
25 - A, B, C	CTG	FS 19	Ceramic_Tile_with_Grout - Isle way to Alter
26 - A, B, C		FS 19	Slate with Mortar - Alter Platform
27 - A, B, C	VB	FS 23-24	Vapor_Barrier - Paper Under Wood Floors
28 - A, B, C	BM	FS 20.23-24	Brick_Mortar - Fireplace flooring
29 - A, B, C, D, E, F, G	PL	FS 18-34	Plaster - Skim & Base Coat Ceilings on Wire Mesh
30 - A, B, C, D, E, F, G	PL	FS 18-34	Plaster - Skim & Base Coat Walls on Brick/Terra Cotta
31 - A, B, C		FS 23	Chimney Liner - Interior Wall
32 - A, B, C	WG	EA 1-4	Window_Glaze - Metal Framed Windows

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location 0		Sample Condition Upon Receipt:	
Relinquished by:	<i>[Signature]</i>	Date/Time:	3-26-25 1:40	Received by:	<i>[Signature]</i>
Relinquished by:		Date/Time:		Received by:	<i>[Signature]</i>

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

04805733

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

IC-005 - 549 Washington Street (1st Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

[illegible]

RECEIVED
EMSL
CINNAMINSON, NJ
25 MAR 27 PM 12:37

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: <i>[Signature]</i>	Date/Time: 3-26-25 1800	Received by: <i>[Signature]</i> 452	Date/Time: 3/27/25 1015
Relinquished by:	Date/Time:	Received by:	Date/Time:

Page 2 of 2



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/25/2025
Received: 3/27/2025
Analyzed: 4/01/2025

Proj: IC-005 / 549 Washington Street - 2nd Floor / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 35-A **Lab Sample ID:** 042505725-0001

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan/White	2.0%	95.0%	3% Chrysotile	

Client Sample ID: 35-B **Lab Sample ID:** 042505725-0002

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 35-C **Lab Sample ID:** 042505725-0003

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 35-D **Lab Sample ID:** 042505725-0004

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 35-E **Lab Sample ID:** 042505725-0005

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 35-F **Lab Sample ID:** 042505725-0006

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 35-G **Lab Sample ID:** 042505725-0007

Sample Description: FS 26-54/Plaster Base Coat Walls on Brick/Terracotta Ceilings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 36-A-Skim Coat **Lab Sample ID:** 042505725-0008

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-A-Base Coat **Lab Sample ID:** 042505725-0008A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Tan	2.0%	95.0%	3% Chrysotile	

Client Sample ID: 36-B-Skim Coat **Lab Sample ID:** 042505725-0009

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-B-Base Coat **Lab Sample ID:** 042505725-0009A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 36-C-Skim Coat **Lab Sample ID:** 042505725-0010

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-C-Base Coat **Lab Sample ID:** 042505725-0010A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 36-D-Skim Coat **Lab Sample ID:** 042505725-0011

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-D-Base Coat **Lab Sample ID:** 042505725-0011A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 36-E-Skim Coat **Lab Sample ID:** 042505725-0012

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-E-Base Coat **Lab Sample ID:** 042505725-0012A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 36-F-Skim Coat **Lab Sample ID:** 042505725-0013

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/White	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 36-F-Base Coat **Lab Sample ID:** 042505725-0013A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 36-G-Skim Coat **Lab Sample ID:** 042505725-0014

Sample Description: FS 26-54/Plaster Skim Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 36-G-Base Coat **Lab Sample ID:** 042505725-0014A

Sample Description: FS 26-54/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 37-A-Skim Coat **Lab Sample ID:** 042505725-0015

Sample Description: Throughout/Plaster Skim Coat Ceiling/Walls on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White/Red/Orange	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 37-A-Base Coat **Lab Sample ID:** 042505725-0015A

Sample Description: Throughout/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 37-B-Skim Coat **Lab Sample ID:** 042505725-0016

Sample Description: Throughout/Plaster Skim Coat Ceiling/Walls on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White/Red	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 37-B-Base Coat **Lab Sample ID:** 042505725-0016A

Sample Description: Throughout/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: 37-C-Skim Coat **Lab Sample ID:** 042505725-0017

Sample Description: Throughout/Plaster Skim Coat Ceiling/Walls on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	White/Red	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 37-C-Base Coat **Lab Sample ID:** 042505725-0017A

Sample Description: Throughout/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: 37-D-Skim Coat **Lab Sample ID:** 042505725-0018

Sample Description: Throughout/Plaster Skim Coat Ceiling/Walls on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White/Red	0.0%	100.0%	None Detected	Inseparable paint / coating layer included in analysis

Client Sample ID: 37-D-Base Coat **Lab Sample ID:** 042505725-0018A

Sample Description: Throughout/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: 37-E-Skim Coat **Lab Sample ID:** 042505725-0019

Sample Description: Throughout/Plaster Skim Coat Ceiling/Walls on Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: 37-E-Base Coat **Lab Sample ID:** 042505725-0019A

Sample Description: Throughout/Plaster Base Coat

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Gray/Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 38-A-Ceiling Panel **Lab Sample ID:** 042505725-0020

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/White	80.0%	20.0%	None Detected	

Client Sample ID: 38-A-Glue **Lab Sample ID:** 042505725-0020A

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown	0.0%	93.0%	7% Chrysotile	

Client Sample ID: 38-B-Ceiling Panel **Lab Sample ID:** 042505725-0021

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/White	80.0%	20.0%	None Detected	

Client Sample ID: 38-B-Glue **Lab Sample ID:** 042505725-0021A

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 38-C-Ceiling Panel **Lab Sample ID:** 042505725-0022

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Brown/White	80.0%	20.0%	None Detected	

Client Sample ID: 38-C-Glue **Lab Sample ID:** 042505725-0022A

Sample Description: FS 42-44, 46/2x2 White w/Pinholes & Glue Pod Ceiling Panel

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025				Positive Stop (Not Analyzed)	

Client Sample ID: 39-A-Tile **Lab Sample ID:** 042505725-0023

Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Green	0.0%	98.0%	2% Chrysotile	

Client Sample ID: 39-A-Tile 2 **Lab Sample ID:** 042505725-0023A

Sample Description: FS 42/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray	0.0%	98.0%	2% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 39-A-Mastic **Lab Sample ID:** 042505725-0023B
Sample Description: FS 42/Tar Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: 39-A-Paper **Lab Sample ID:** 042505725-0023C
Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: 39-B-Tile **Lab Sample ID:** 042505725-0024
Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/31/2025		Positive Stop (Not Analyzed)			

Client Sample ID: 39-B-Tile 2 **Lab Sample ID:** 042505725-0024A
Sample Description: FS 42/Mastic

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/31/2025		Positive Stop (Not Analyzed)			

Client Sample ID: 39-B-Mastic **Lab Sample ID:** 042505725-0024B
Sample Description: FS 42/Tar Paper

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/31/2025		Positive Stop (Not Analyzed)			

Client Sample ID: 39-B-Paper **Lab Sample ID:** 042505725-0024C
Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: 39-C-Tile **Lab Sample ID:** 042505725-0025
Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025		Positive Stop (Not Analyzed)			

Client Sample ID: 39-C-Tile 2 **Lab Sample ID:** 042505725-0025A
Sample Description: FS 42/Mastic

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025		Positive Stop (Not Analyzed)			



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 39-C-Mastic **Lab Sample ID:** 042505725-0025B
Sample Description: FS 42/Tar Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 39-C-Paper **Lab Sample ID:** 042505725-0025C
Sample Description: FS 42/9x9 Gray/Green Checkerboard Pattern Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: 40-A-Wallboard **Lab Sample ID:** 042505725-0026
Sample Description: FS 41-46/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/White	10.0%	90.0%	None Detected	

Client Sample ID: 40-A-Mud **Lab Sample ID:** 042505725-0026A
Sample Description: FS 41-46/Mud

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	0.0%	98.0%	2% Chrysotile	

Client Sample ID: 40-A-Tape **Lab Sample ID:** 042505725-0026B
Sample Description: FS 41-46/Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	95.0%	5.0%	None Detected	

Client Sample ID: 40-B-Wallboard **Lab Sample ID:** 042505725-0027
Sample Description: FS 41-46/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/White	10.0%	90.0%	None Detected	

Client Sample ID: 40-B-Mud **Lab Sample ID:** 042505725-0027A
Sample Description: FS 41-46/Mud

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 40-B-Tape **Lab Sample ID:** 042505725-0027B
Sample Description: FS 41-46/Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Beige	95.0%	5.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 40-C-Wallboard **Lab Sample ID:** 042505725-0028
Sample Description: FS 41-46/Wallboard

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	10.0%	90.0%	None Detected	

Client Sample ID: 40-C-Mud **Lab Sample ID:** 042505725-0028A
Sample Description: FS 41-46/Mud

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 40-C-Tape **Lab Sample ID:** 042505725-0028B
Sample Description: FS 41-46/Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	4/01/2025	White	95.0%	5.0%	None Detected	

Client Sample ID: 41-A-Roofing 1 **Lab Sample ID:** 042505725-0029
Sample Description: EA 5/Flat Roof Roofing Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/Black	50.0%	43.0%	7% Chrysotile	

Client Sample ID: 41-A-Roofing 2 **Lab Sample ID:** 042505725-0029A
Sample Description: EA 5/Flat Roof Roofing Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/Black	0.0%	88.0%	12% Chrysotile	

Client Sample ID: 41-B **Lab Sample ID:** 042505725-0030
Sample Description: EA 5/Flat Roof Roofing Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 41-C **Lab Sample ID:** 042505725-0031
Sample Description: EA 5/Flat Roof Roofing Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 42-A **Lab Sample ID:** 042505725-0032
Sample Description: FS 47/9x9 Beige Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Brown/Tan	0.0%	94.0%	6% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505725
Customer ID: BLNL75
Customer PO: 240100-IN
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: 42-B **Lab Sample ID:** 042505725-0033
Sample Description: FS 47/9x9 Beige Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 42-C **Lab Sample ID:** 042505725-0034
Sample Description: FS 47/9x9 Beige Floor Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 43-A **Lab Sample ID:** 042505725-0035
Sample Description: FS 48/Chalkboard Transite Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025	Gray/Tan	0.0%	82.0%	18% Chrysotile	

Client Sample ID: 43-B **Lab Sample ID:** 042505725-0036
Sample Description: FS 48/Chalkboard Transite Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)

Client Sample ID: 43-C **Lab Sample ID:** 042505725-0037
Sample Description: FS 48/Chalkboard Transite Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/31/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042505725
Customer ID:	BLNL75
Customer PO:	240100-IN
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Faeryn Swift PLM (10)
Michelle Leggett PLM (30)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Houston, TX NVLAP Lab Code 102106-0, AZ 0925, CO AL-15355, LA 04126, TX 300159

Initial report from: 04/01/2025 09:36:44



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

RECEIVED
EMSL
CINNAMINSON, NJ
25 MAR 27 PM 12:45

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75					
	Company Name:	Egis		Company Name:	Egis					
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones					
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street					
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:	USA		
	Phone:	(248) 863-2934		Phone:	(248) 863-2762					
	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com					
Project Information										
Project Name/No:				IC-005 - 549 Washington Street (2nd Floor)		Purchase Order:	240100-IN RDA Program			
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected:	MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)			
Sampled By Name:		Keith Ventimiglia		Sampled By Signature:	<i>[Signature]</i>		Date Sample	3/25/2025	No. of Samples	37

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx #

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
35 - A, B, C, D, E, F, G	PL	FS 26-54	Plaster - Base Coat Walls on Brick/Terra Cotta ceilings
36 - A, B, C, D, E, F, G	PL	FS 26-54	Plaster - Skim & Base Coat Ceilings on Wire Mesh
37 - A, B, C, D, E	PL	Throughout	Plaster - Skim & Base Coat Ceilings and Walls on Wall Board
38 - A, B, C	CP	FS 42-44,46,	Ceiling_Panel - 2X2, White with Pinholes and Glue Pods
39 - A, B, C	FLM	FS 42	Flooring - 9X9 Floor Tile with Mastic and Tar Paper- Gray and Green checkerboard Pattern
40 - A, B, C	WB	FS 41-46	Wallboard - with Mud & Tape
41 - A, B, C	RM	EA 5	Roofing_Material - Flat Roof Materials
42 - A, B, C	FLM	FS 47	Flooring - 9X9 Floor Tile with Glue- Beige

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location 0		Sample Condition Upon Receipt:	
Relinquished by:	<i>[Signature]</i>	Date/Time:	3-26-25 / 180	Received by:	<i>[Signature]</i>
Relinquished by:		Date/Time:		Received by:	

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

CinnAsblab@EMSL.com

047505728


IC-005 - 549 Washington Street (2nd Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

[illegible]


RECEIVED
EAST
CINNAPRINSON, N.J.
25 MAR 27 PM 12:48

ATTACHMENT 2 – FIGURES

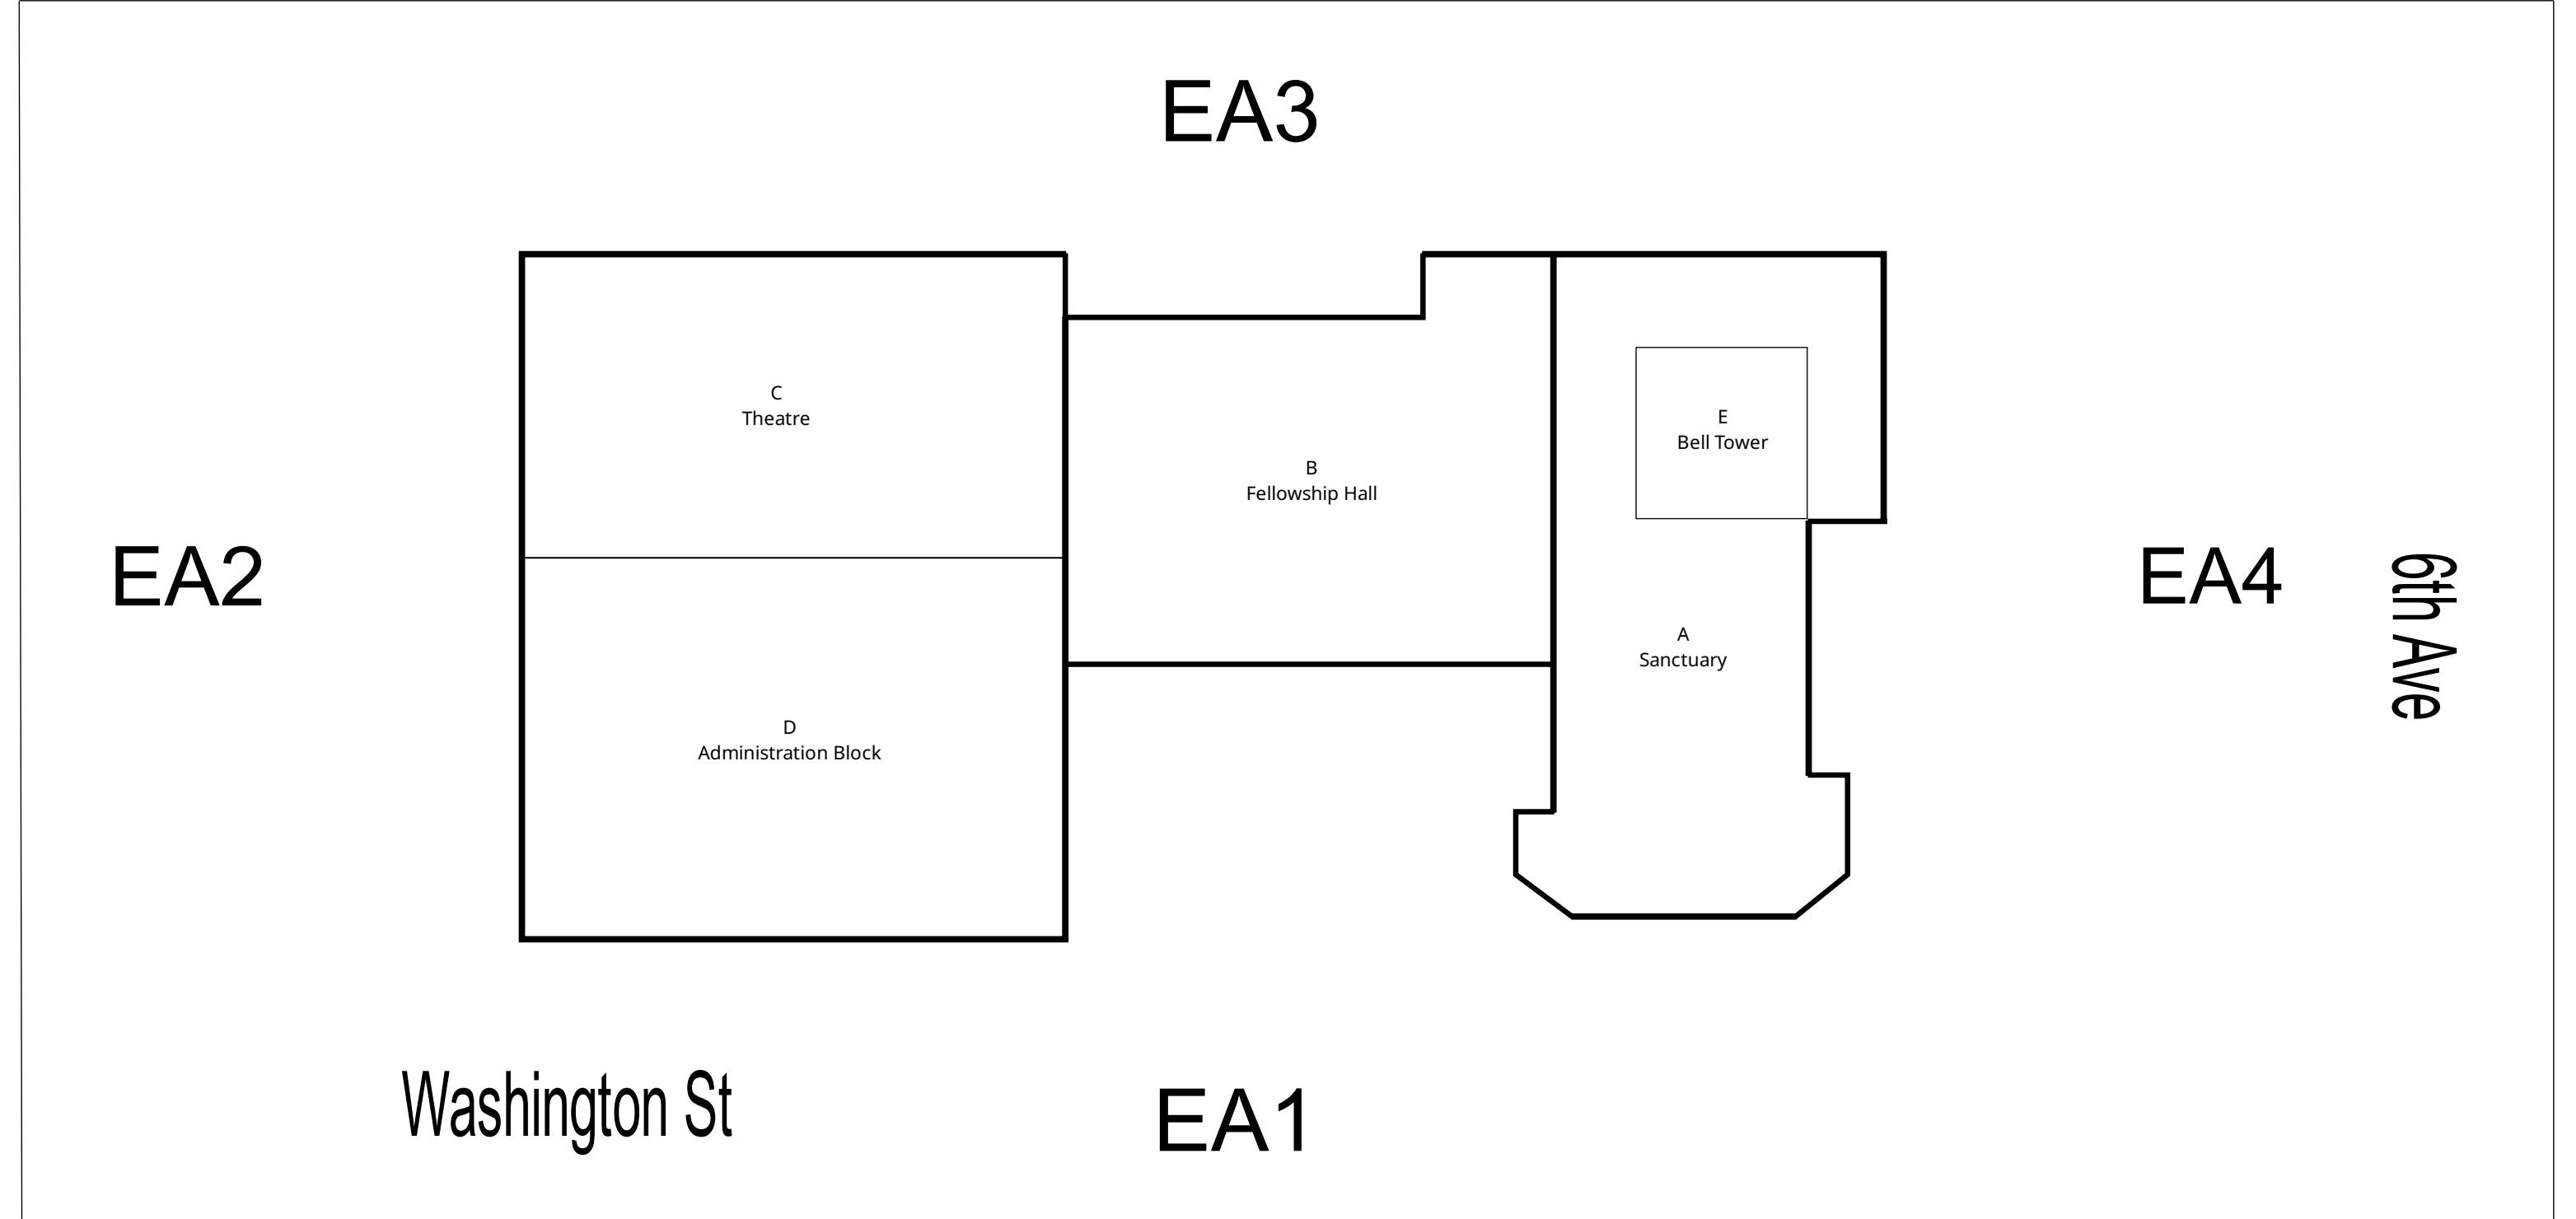

Legend

- ← Sample location
- ← ACM Sample location
-  Functional space inaccessible
-  Staircase

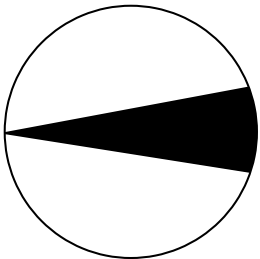


N



Figure 1 - Structure Layout
Former City Methodist Church
Gary, IN 46402


DATE: 04-15-25	DRAWN BY: ADK	PROJECT NO. 240100
-------------------	------------------	-----------------------

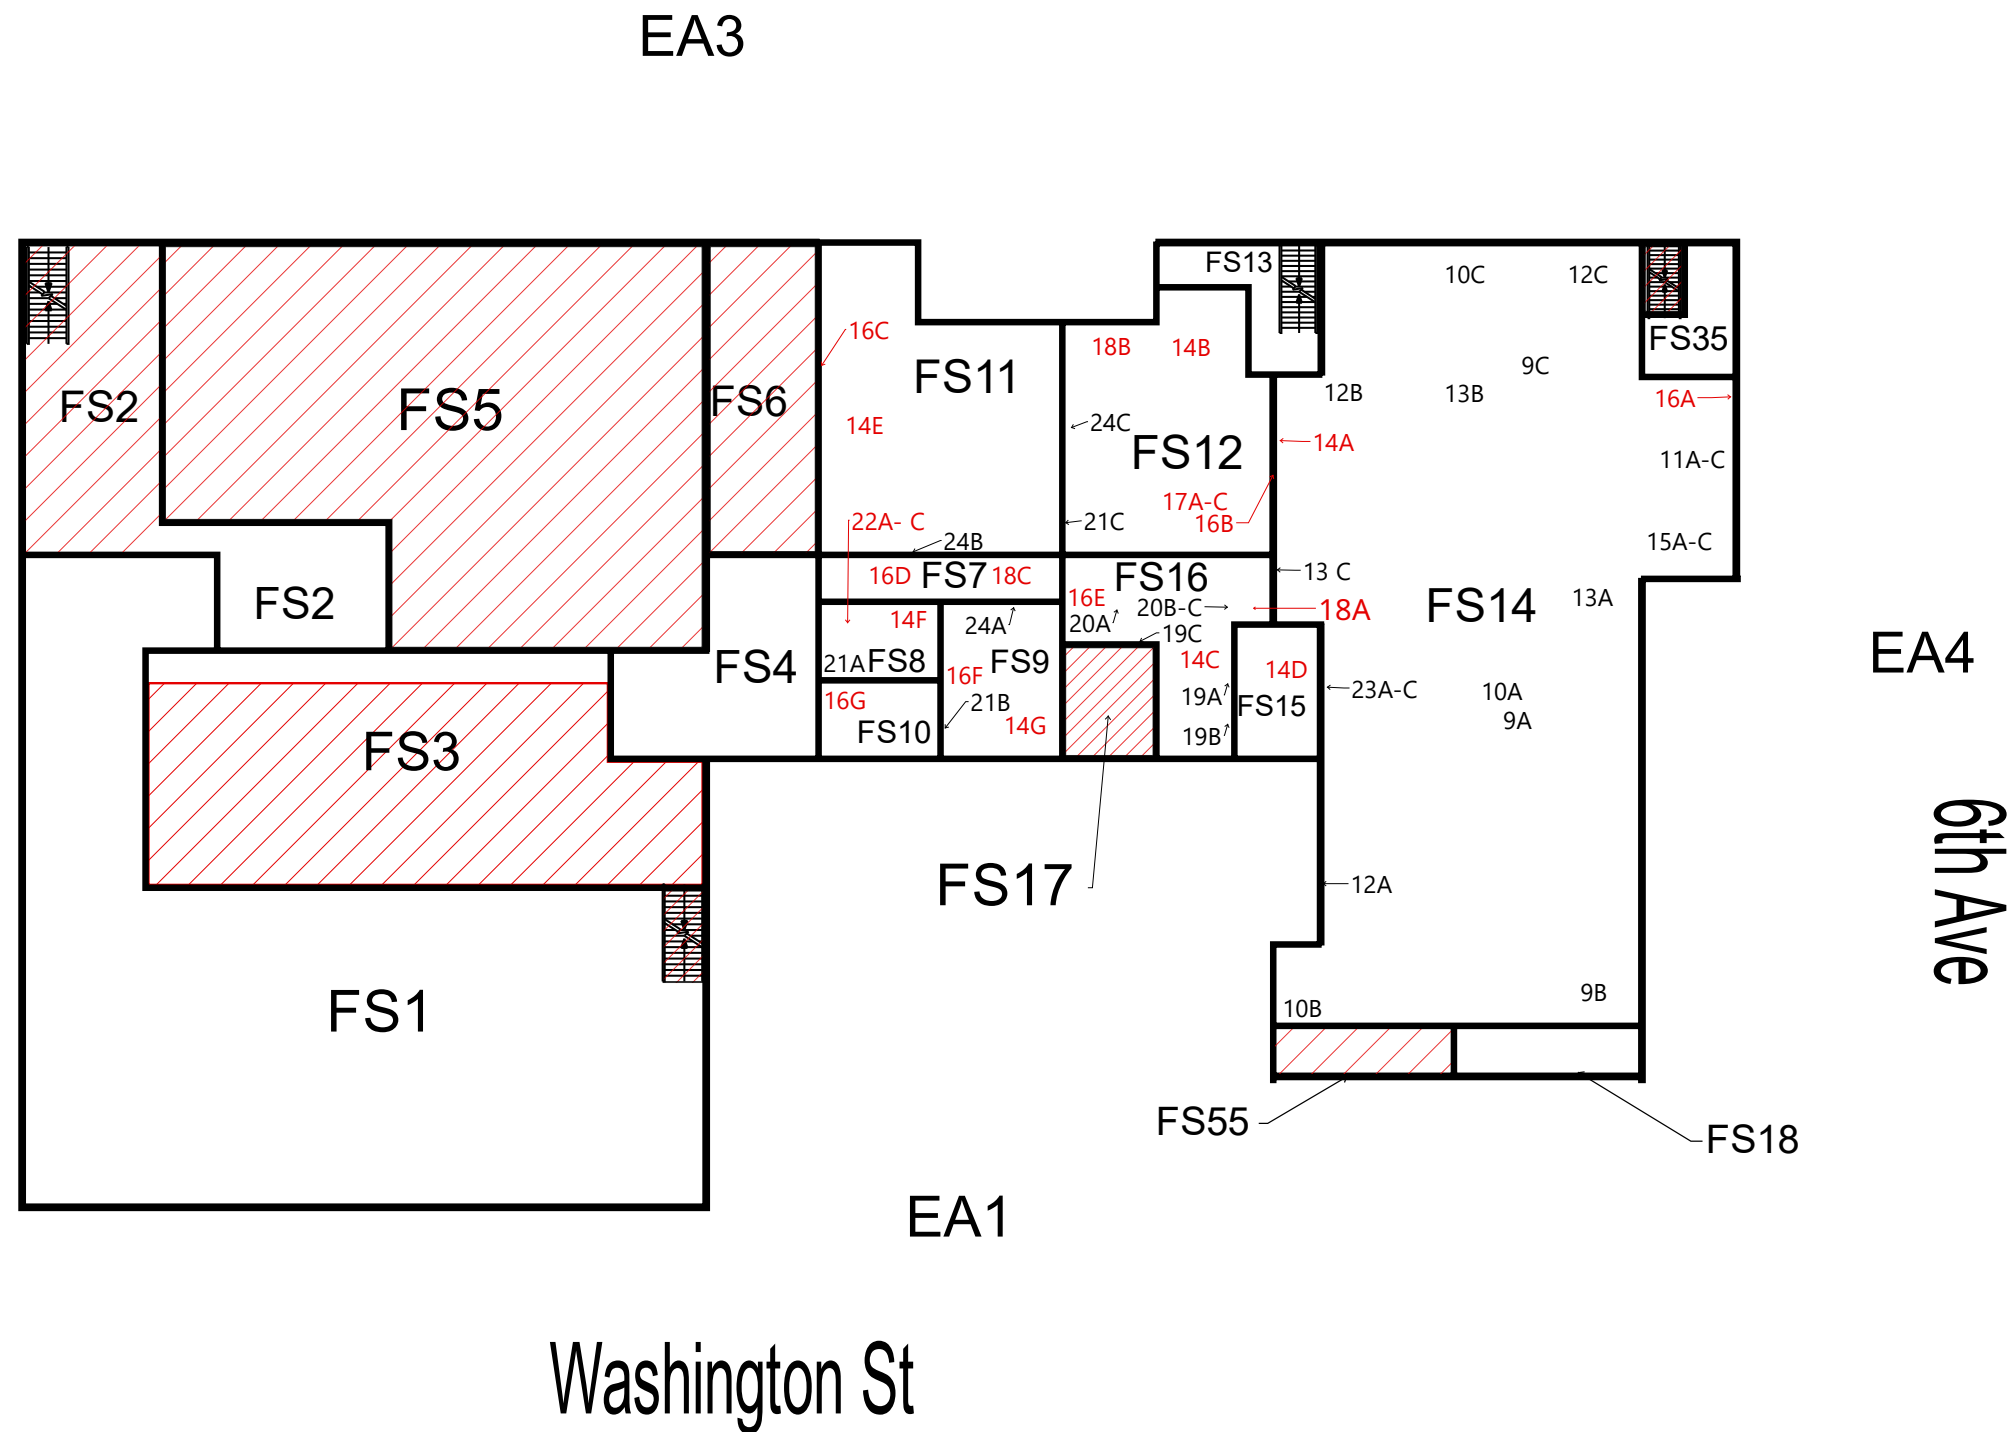

Legend

- ← Sample location
- ← ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 24,716 SF

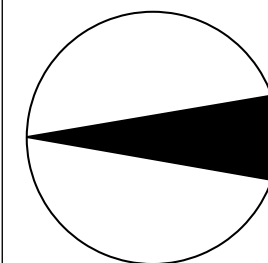

N

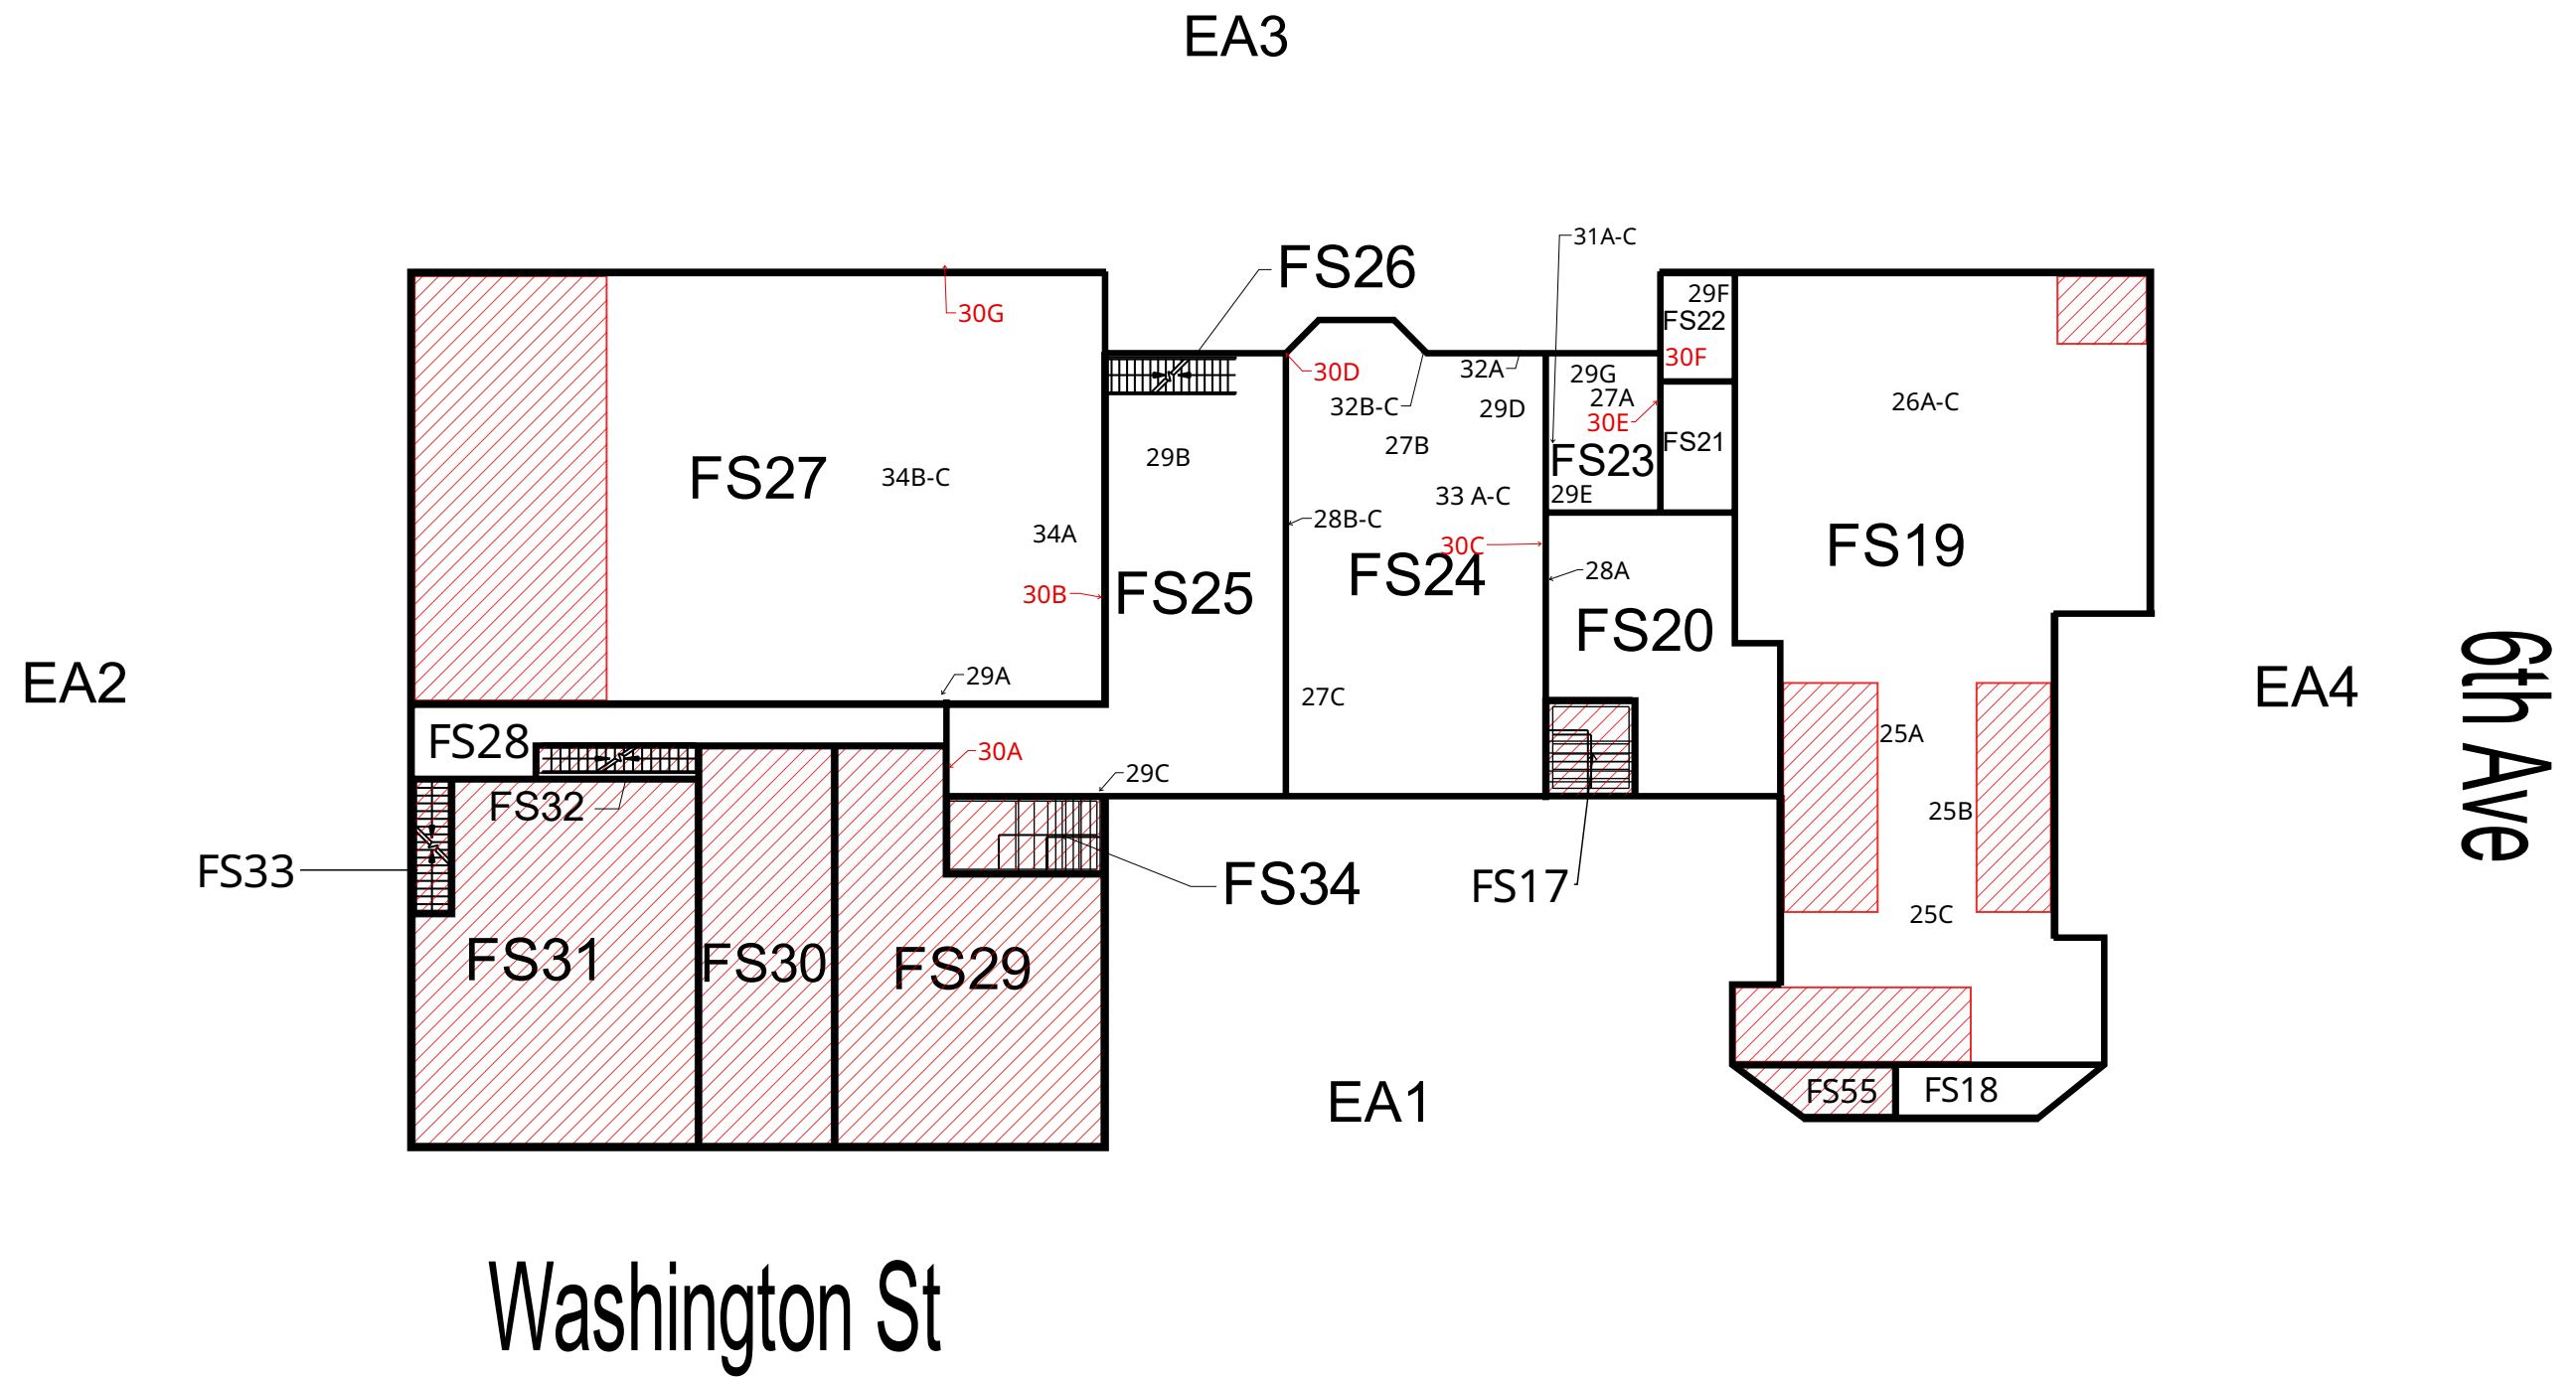


Figure 2 - Basement
Former City Methodist Church
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
ADK


PROJECT NO.
240100



Legend

- ← Sample location
- ← ACM Sample location
-  Functional space inaccessible
-  Staircase

Approximate Building Area 21,896 SF

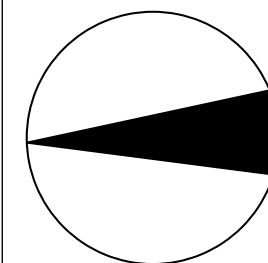

N

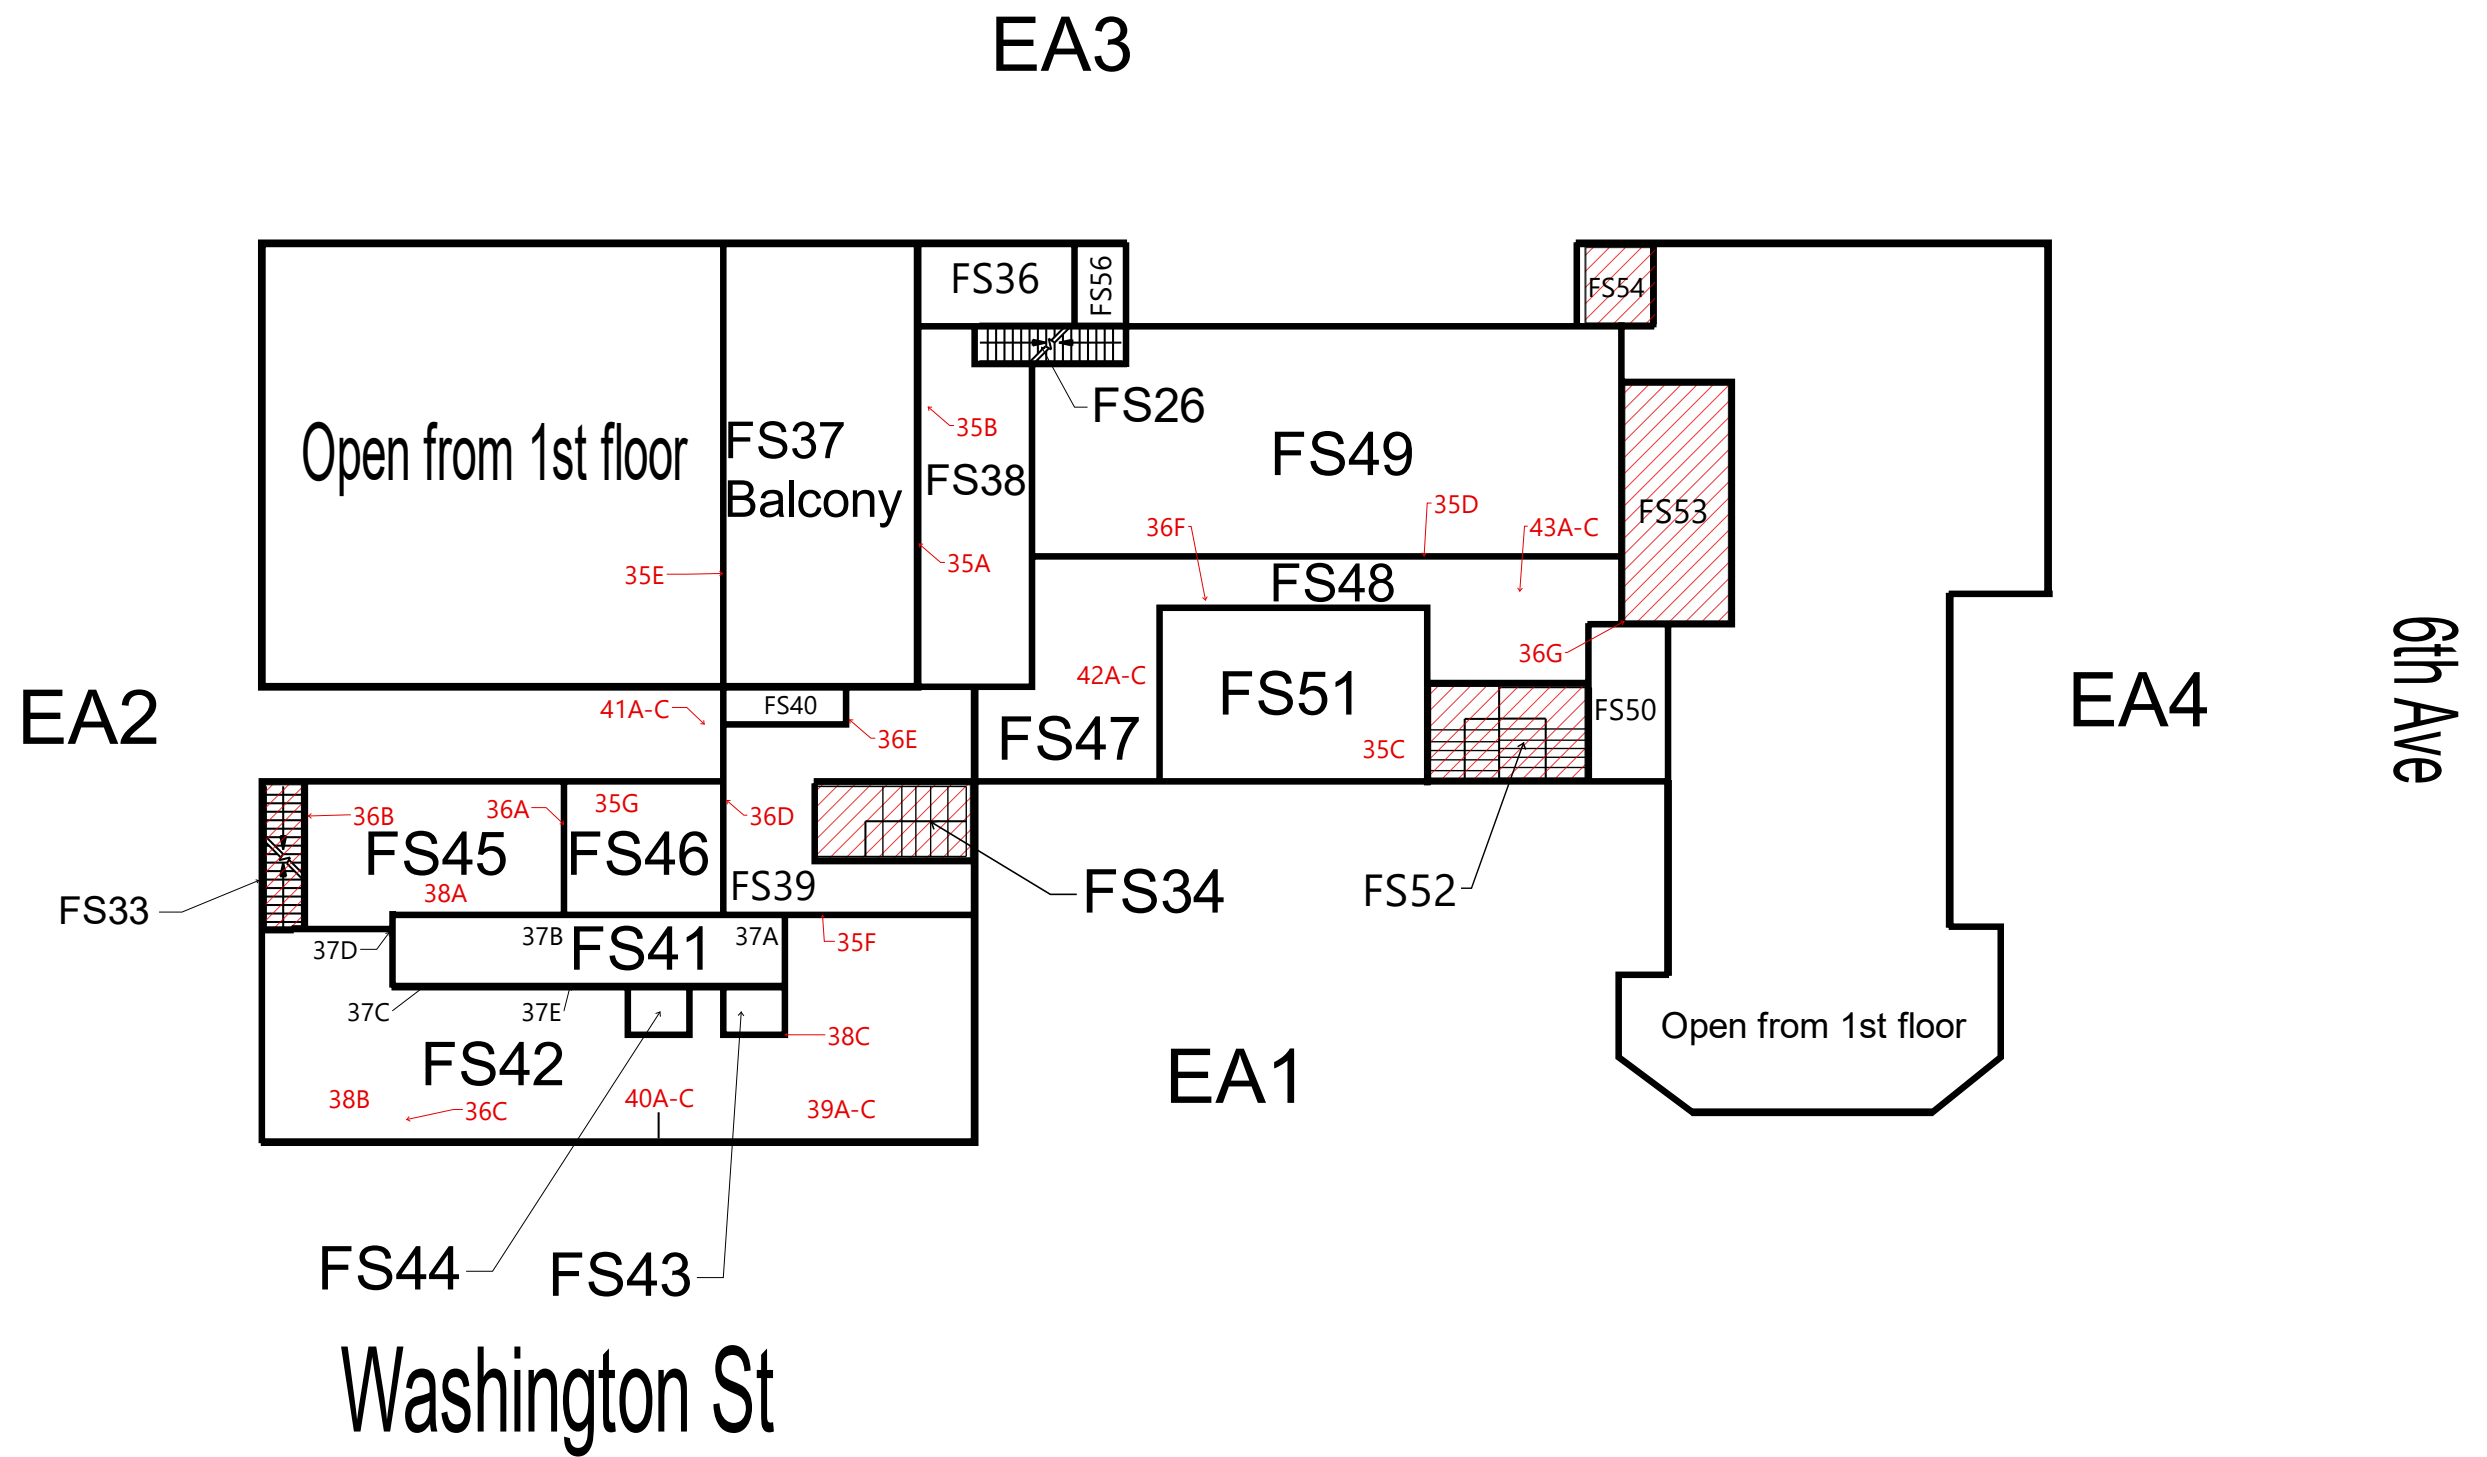


Figure 3 - First Floor
Former City Methodist Church
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
ADK


PROJECT NO.
240100



Legend

- ← Sample location
- ← ACM Sample location
-  Functional space inaccessible
-  Staircase

Approximate Building Area 13,650 SF

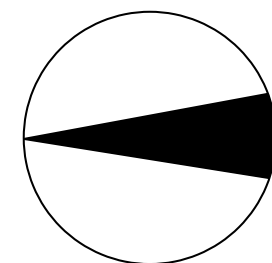

N

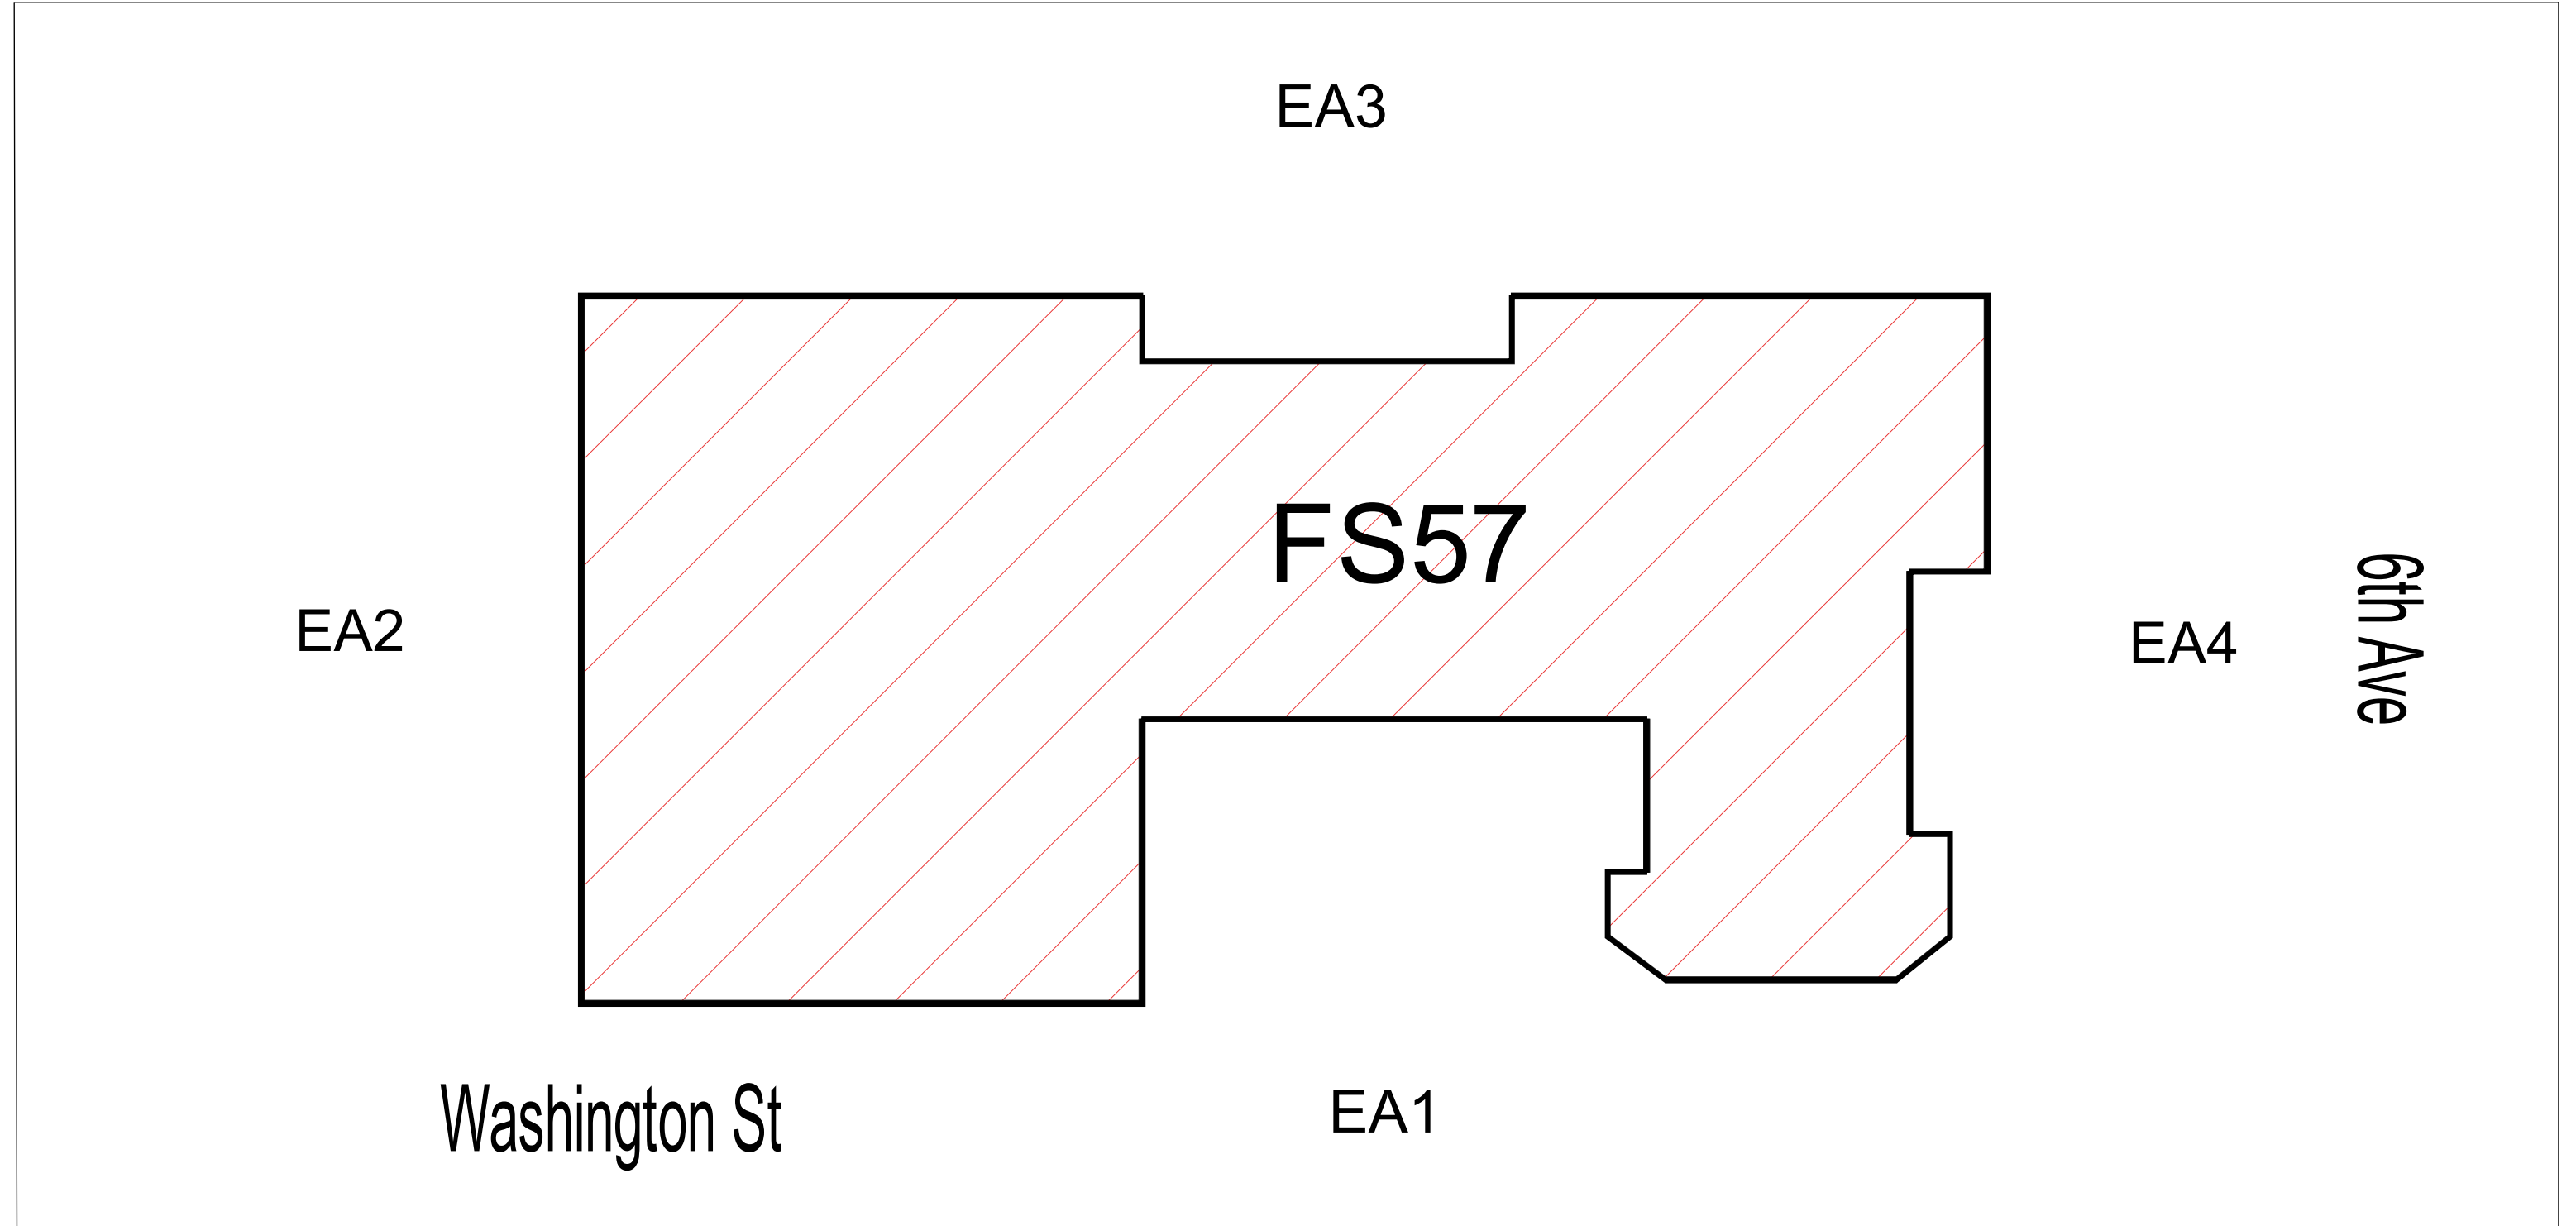


Figure 4 - Second Floor
Former City Methodist Church
Gary, IN 46402

DATE:
04-15-25


DRAWN BY:
ADK

PROJECT NO.
240100



Legend

- ← Sample location
- ← ACM Sample location
-  Functional space inaccessible
-  Staircase

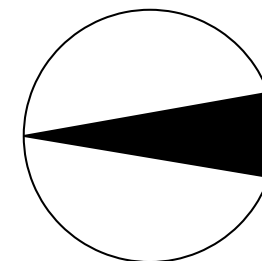

N

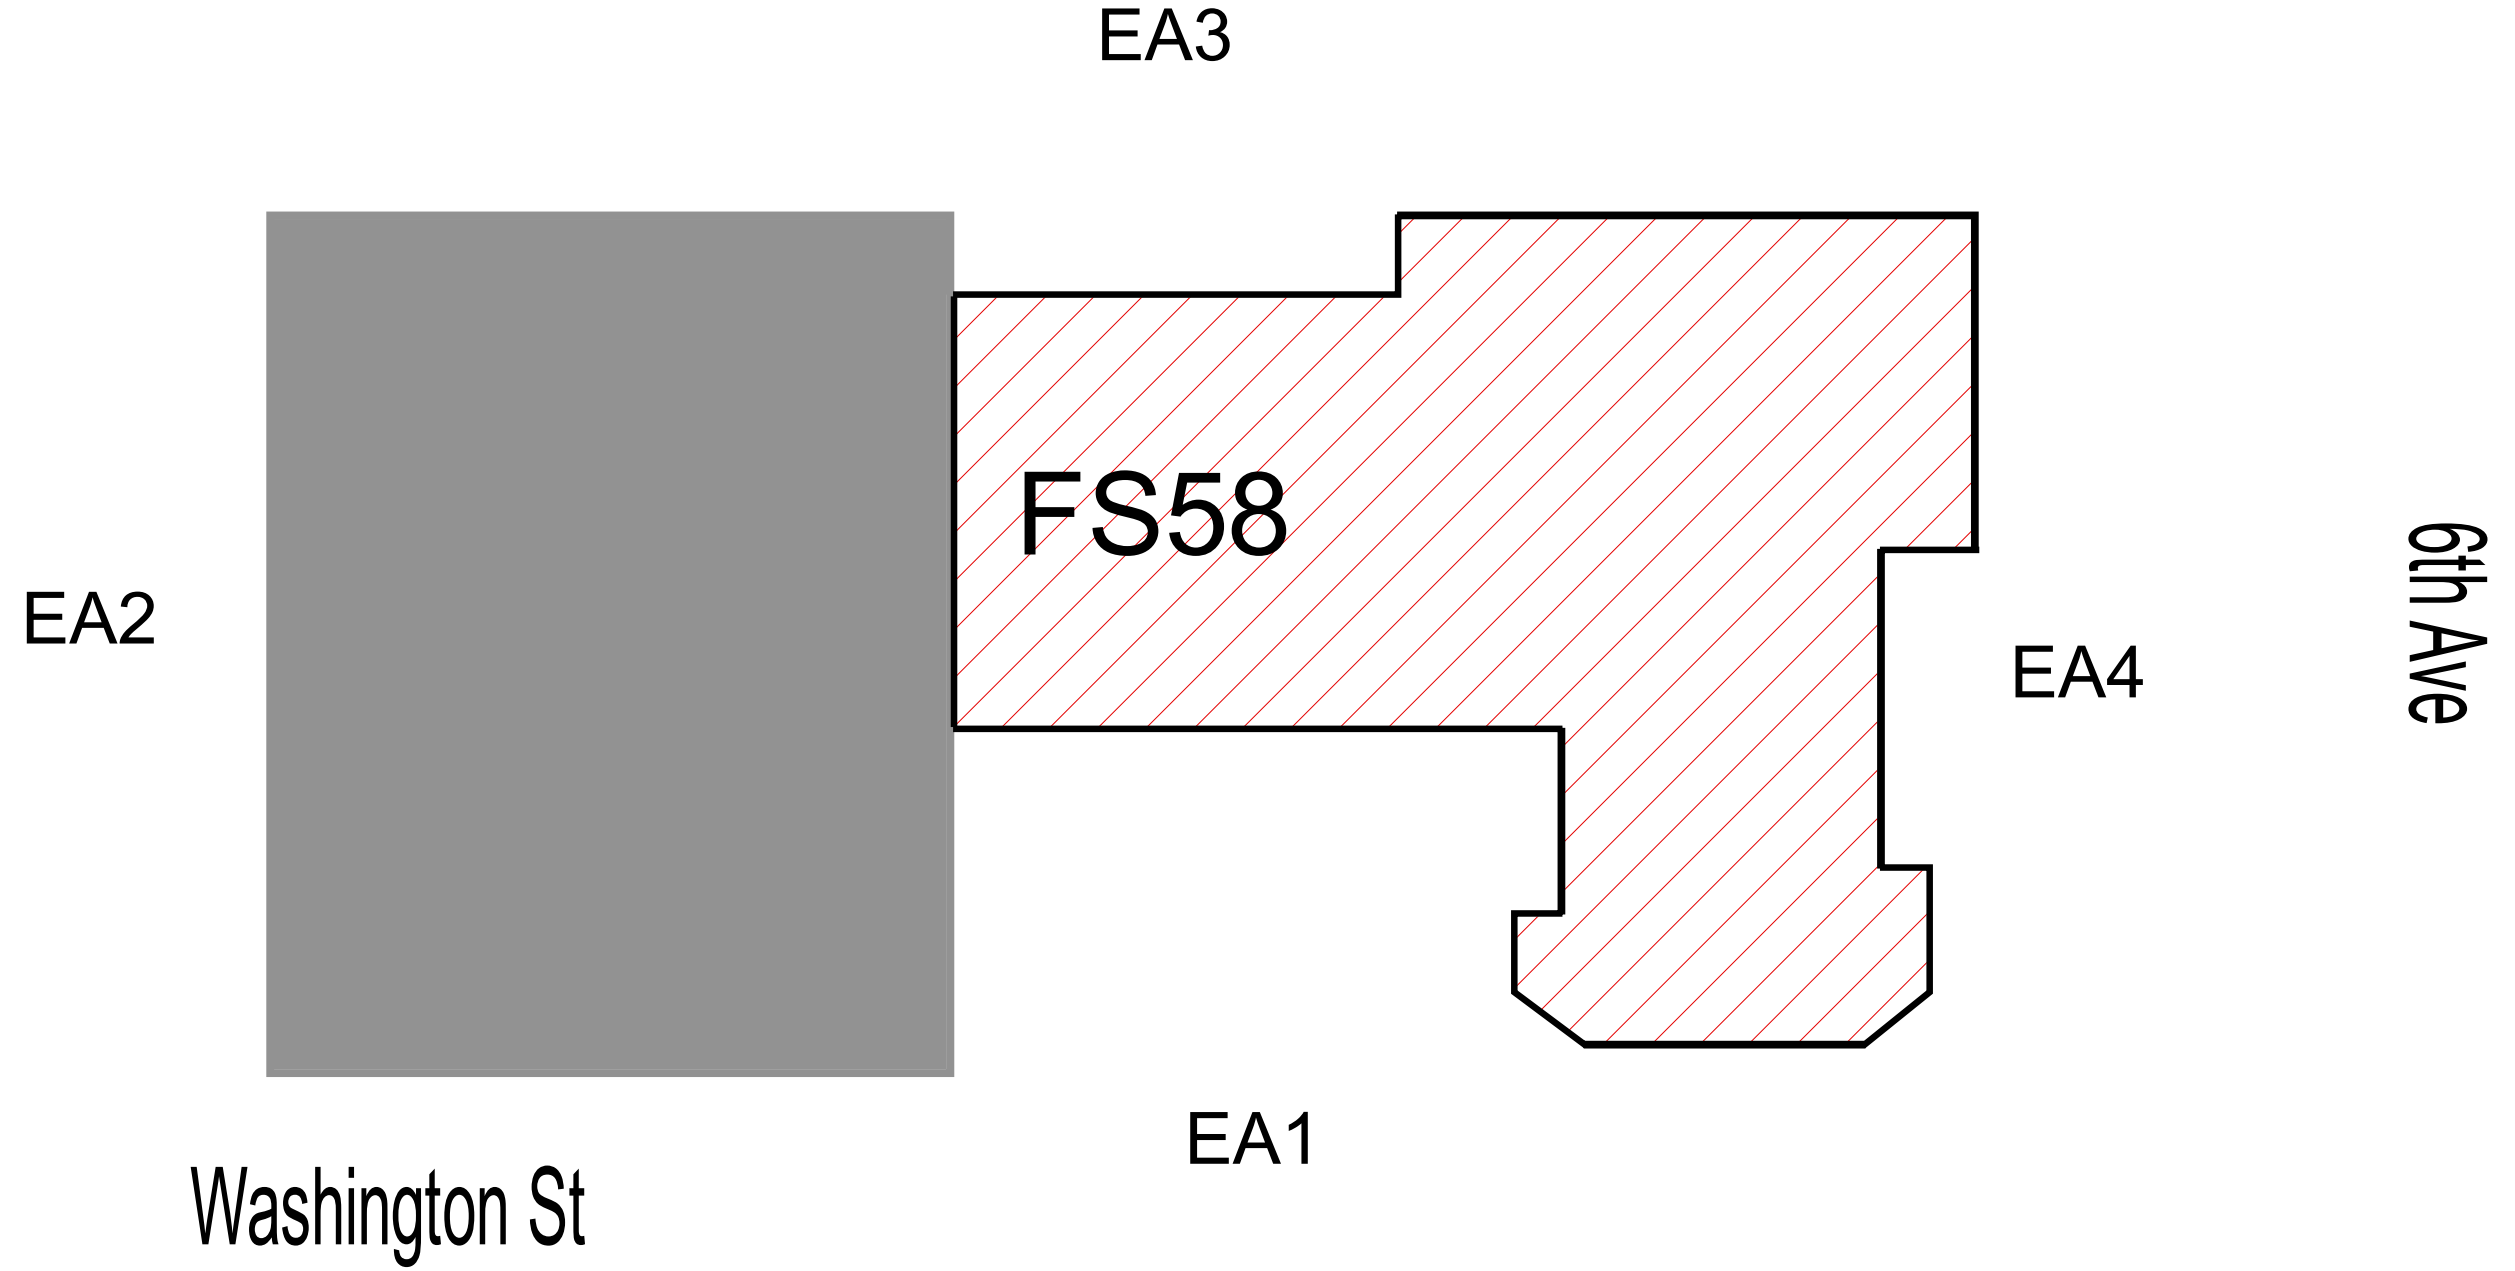


Figure 5 - Third Floor
Former City Methodist Church
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
ADK


PROJECT NO.
240100



Legend

- ← Sample location
- ← ACM Sample location
-  Functional space inaccessible
-  Staircase

Approximate Building Area 7,446 SF

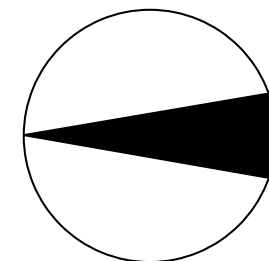

N

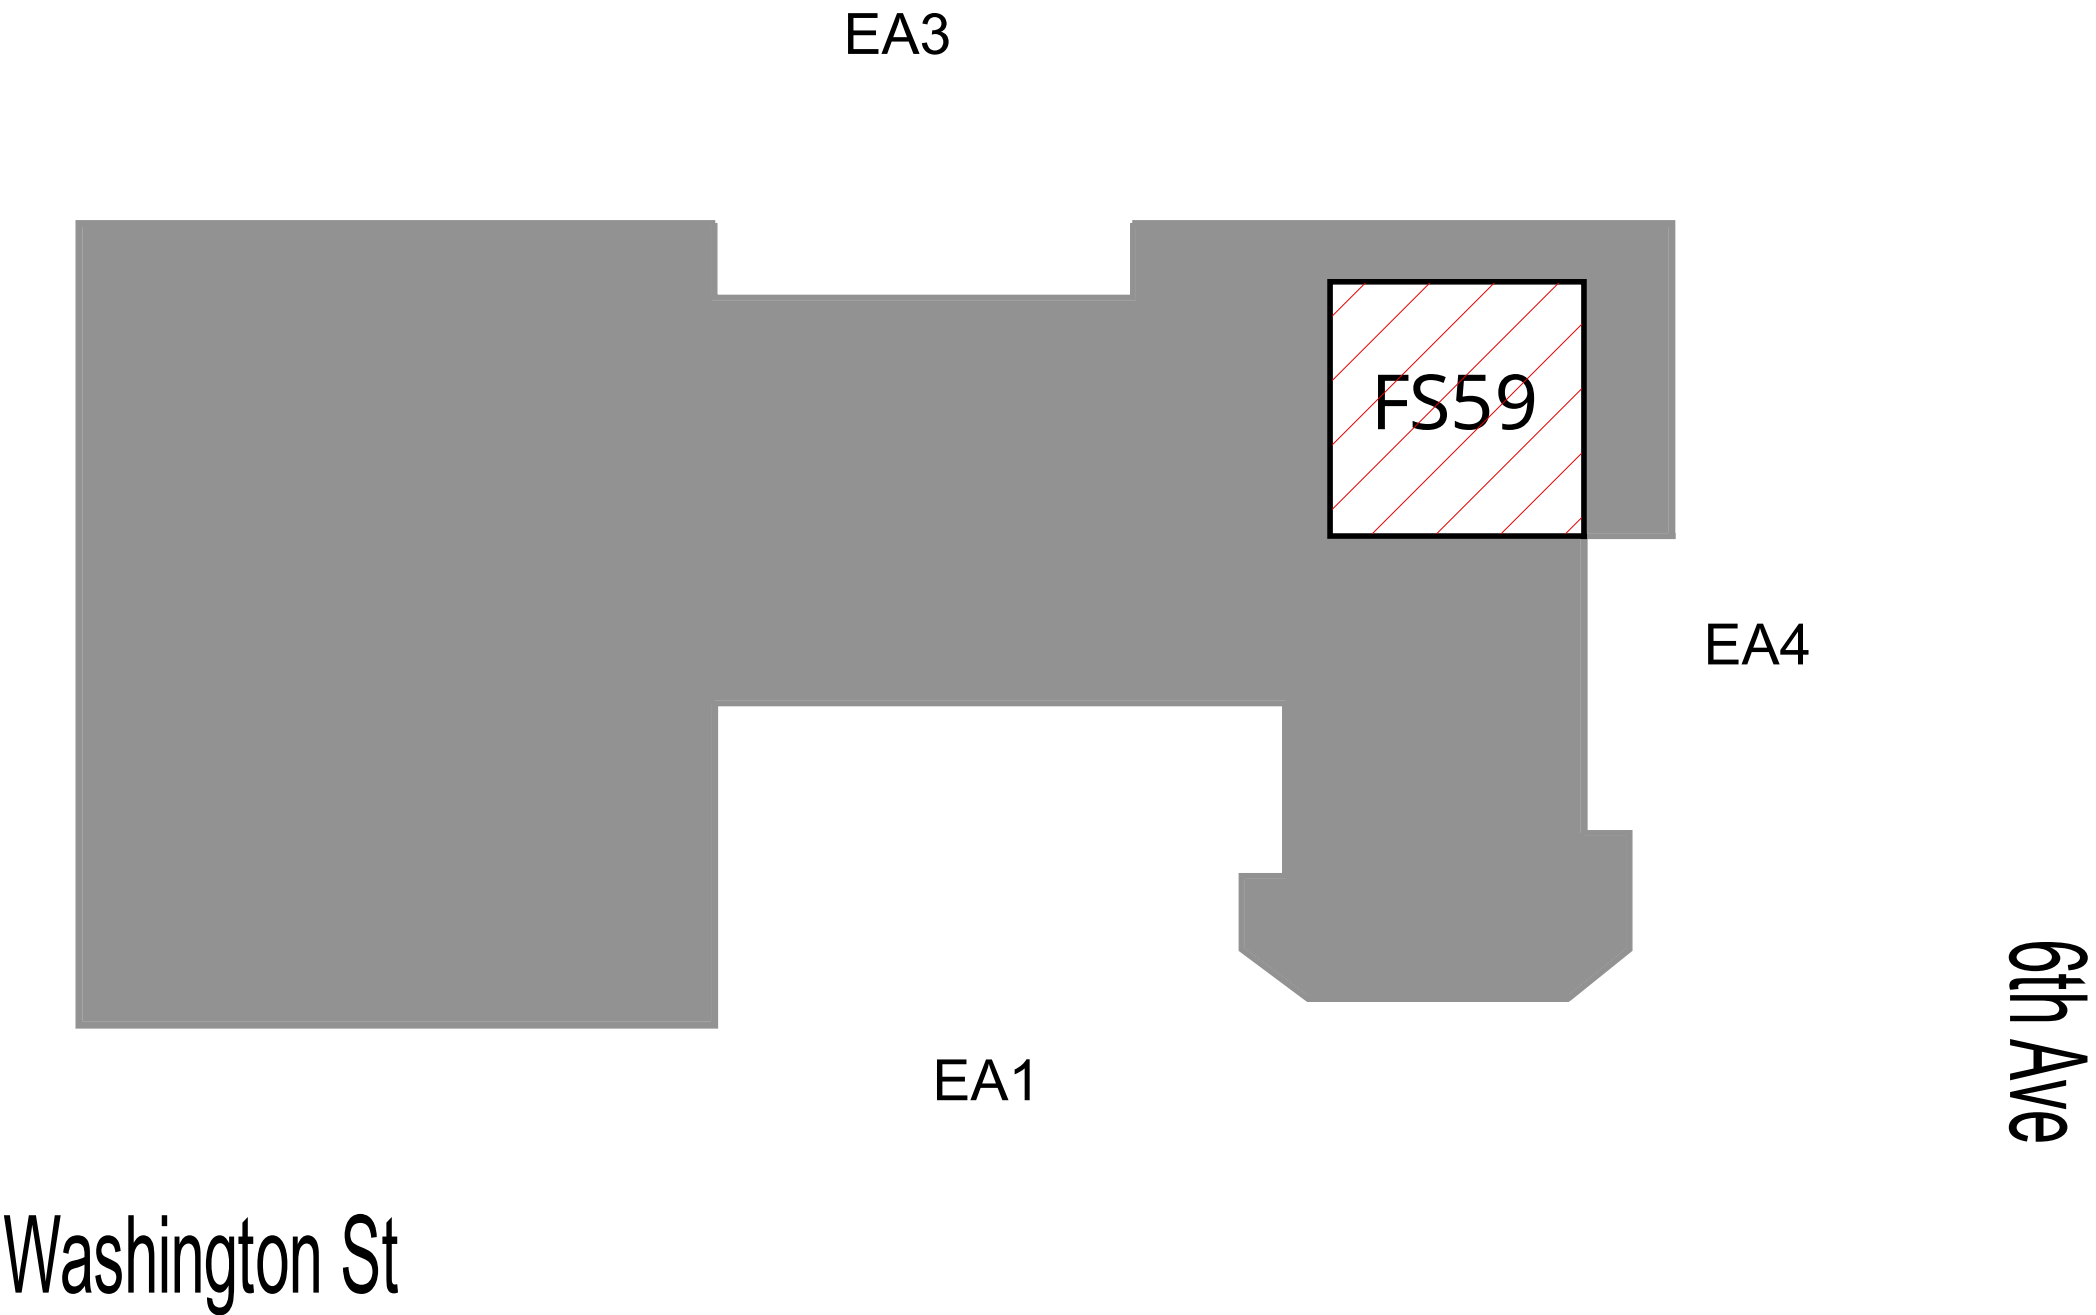


Figure 6 - Fourth Floor
Former City Methodist Church
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
ADK

PROJECT NO.
240100




Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 1,444 SF

Figure 7 - Bell Tower
Former City Methodist Church
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: ADK	PROJECT NO. 240100
-------------------	------------------	-----------------------

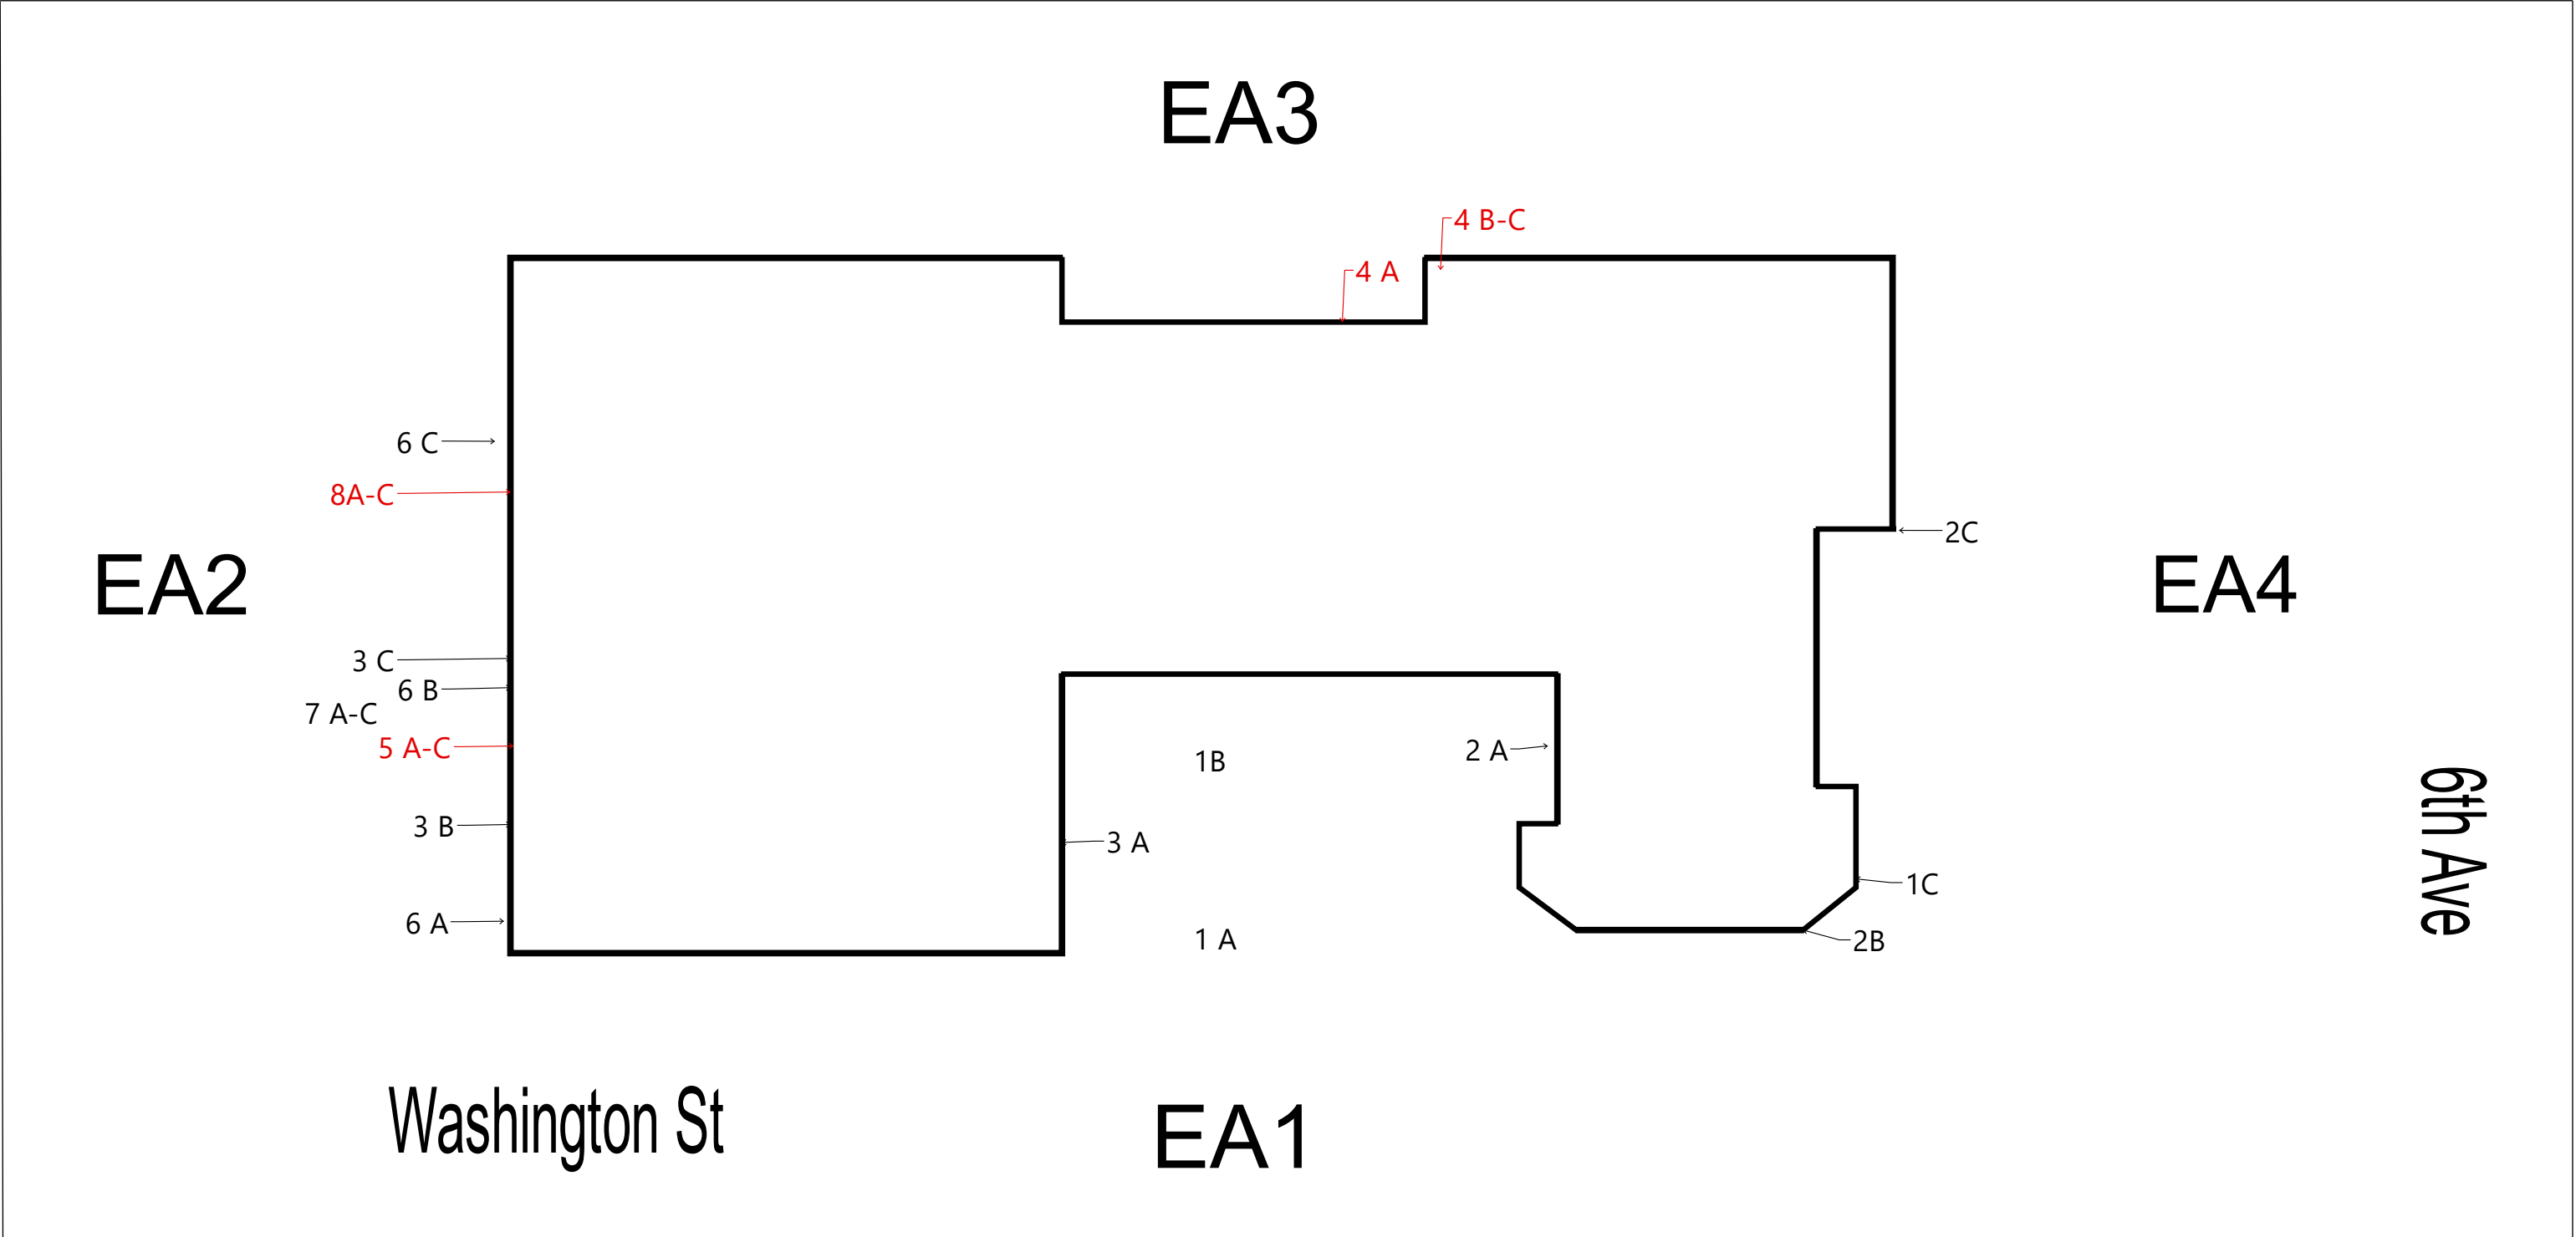


Legend

← Sample location

← ACM Sample location

 Functional space inaccessible

 Staircase

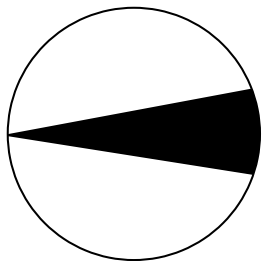

N




Figure 8 - Exterior
Former City Methodist Church
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: ADK	PROJECT NO. 240100
-------------------	------------------	-----------------------

ATTACHMENT 3 – PHOTOGRAPHIC LOG

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

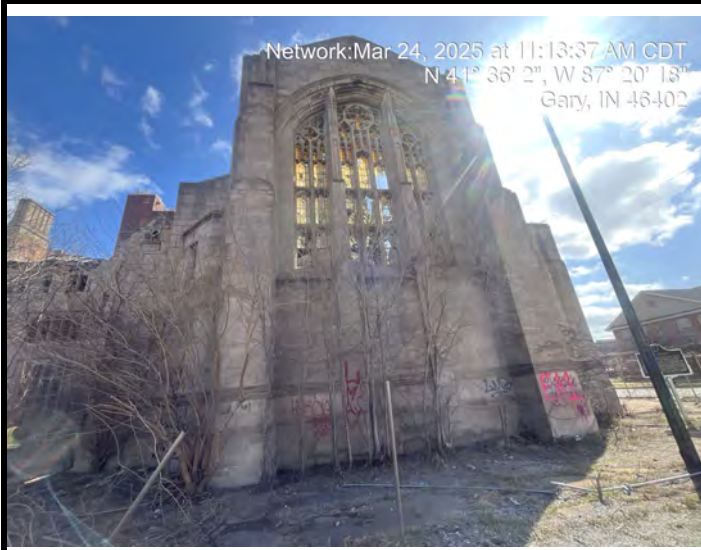


EA-1 Front of church Accessible No Issues



EA-2 Left side of church Accessible No Issues

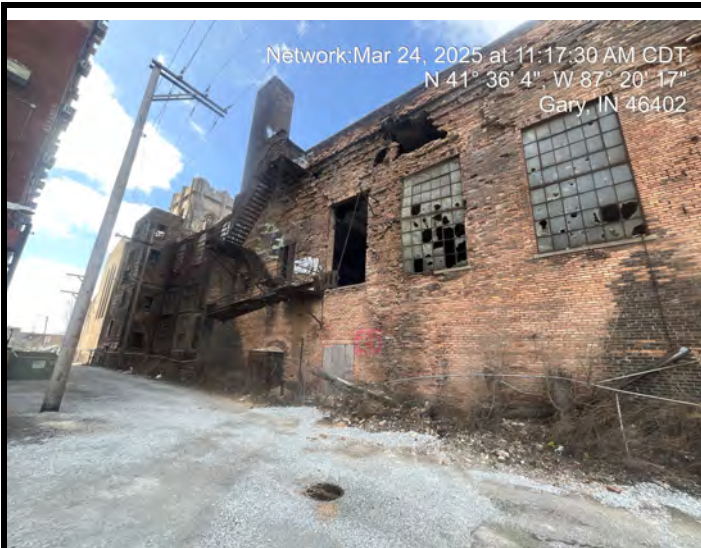

EA-3 Rear of church Accessible No Issues

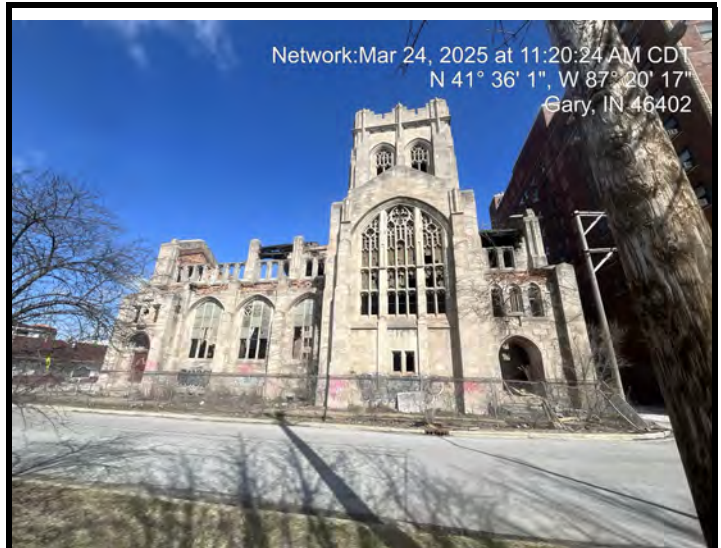


EA-4 Right side of church Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN




EA-5 Roof Completely inaccessible Structural Damage

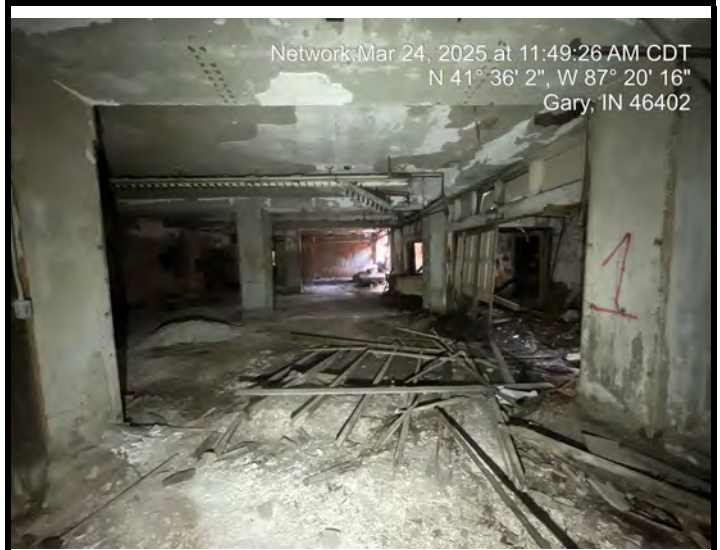

FS-1 Basement Accessible No Issues

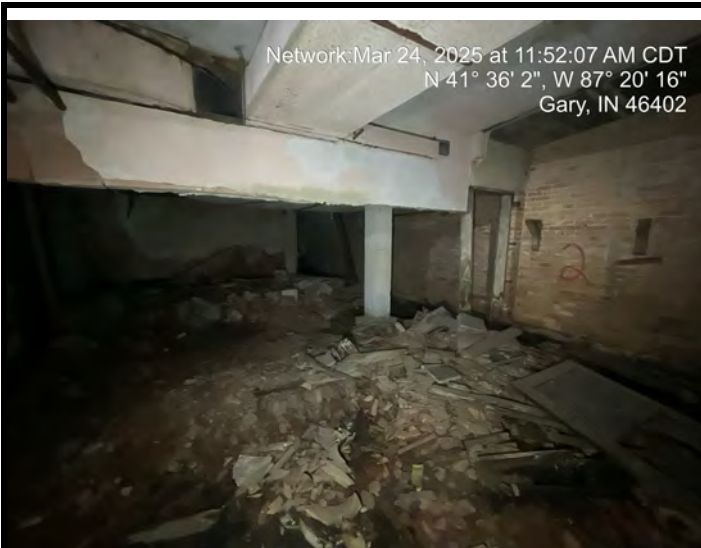


FS-2 Basement room Partially inaccessible Structural Damage

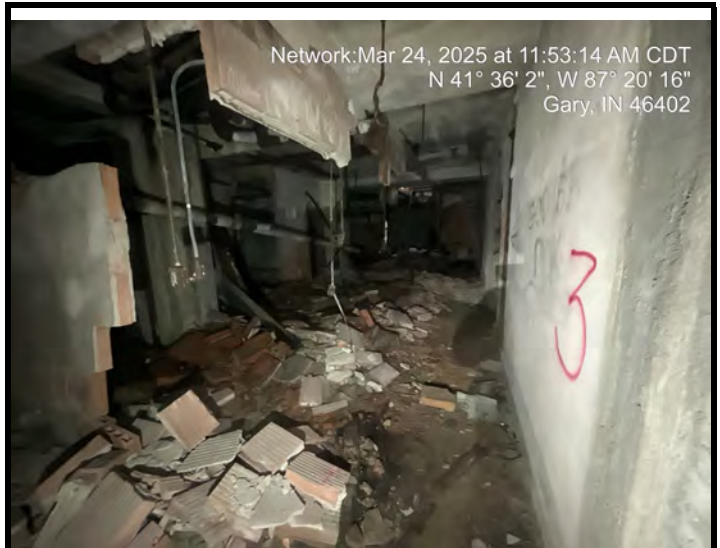

FS-3 Basement Hall Partially inaccessible Structural Damage

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

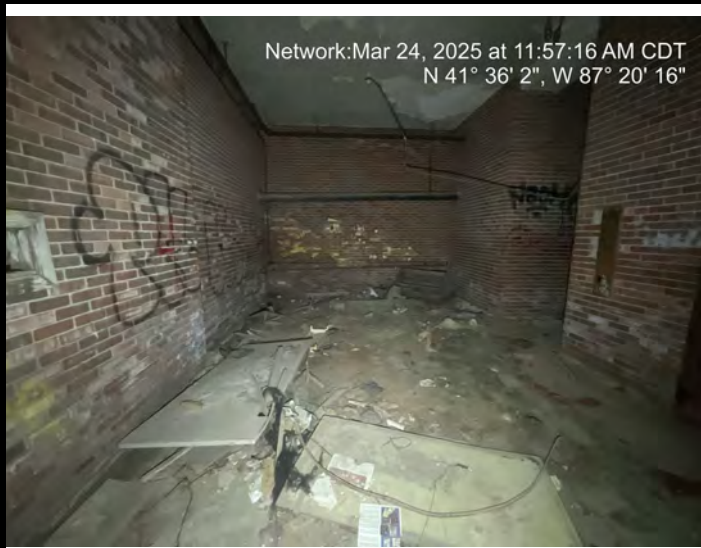


FS-4 Basement Accessible No Issues



FS-5 Boiler room Completely inaccessible Water Damage

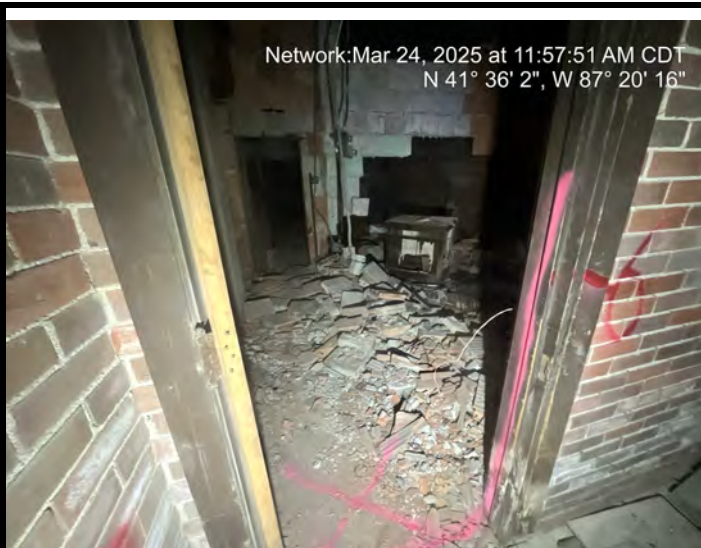


FS-6 Fan room Completely inaccessible Structural Damage

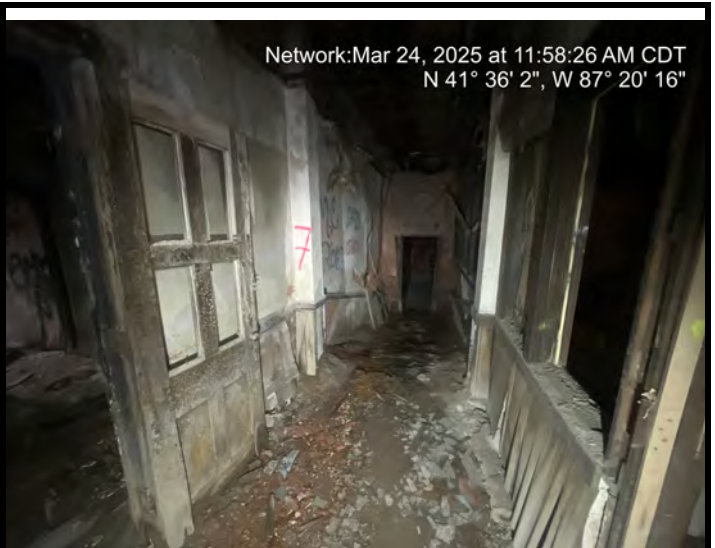


FS-7 Basement hallway Accessible No Issues

**RDA Commercial Blight Elimination
Exterior & Functional Spaces**

549 Washington Street Gary, IN

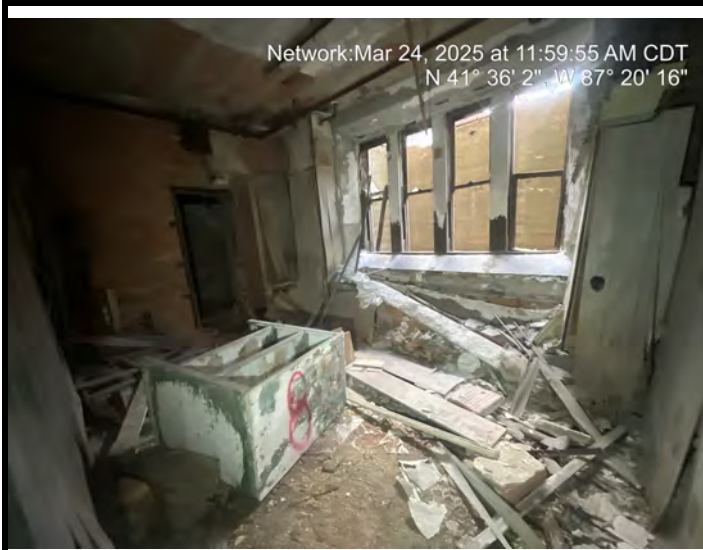

FS-8 Basement classroom Accessible No Issues

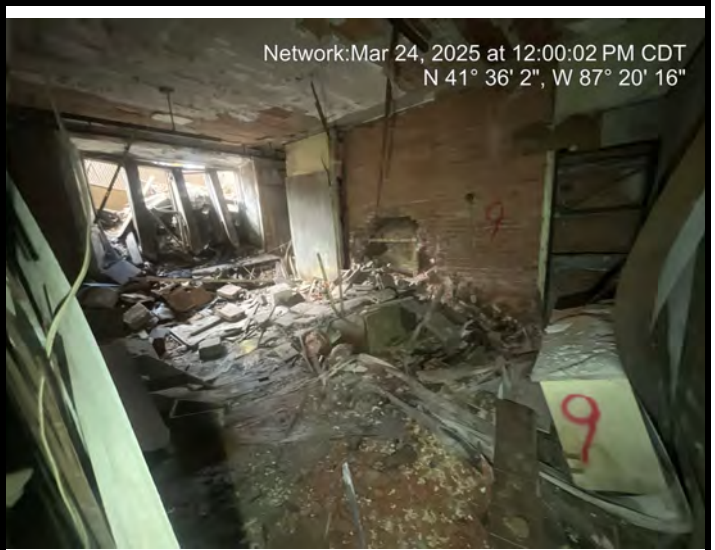

FS-9 Basement classroom Accessible No Issues




FS-10 Basement classroom Accessible No Issues



FS-11 Basement room Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

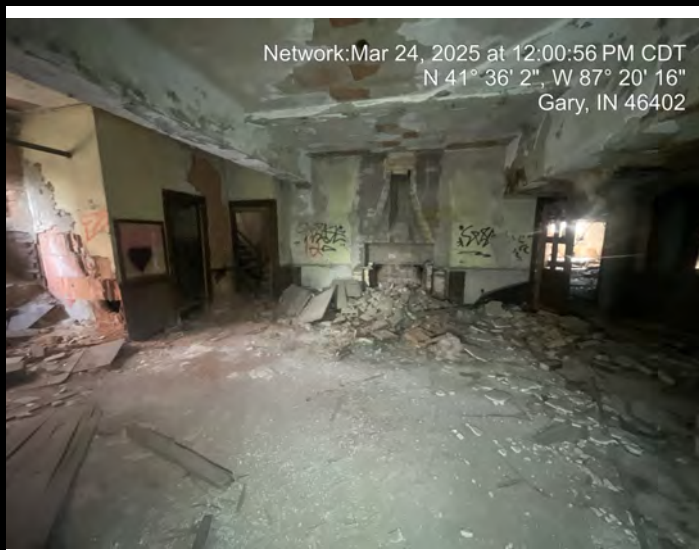

FS-12 Basement room Accessible No Issues



FS-13 Staircase Accessible No Issues

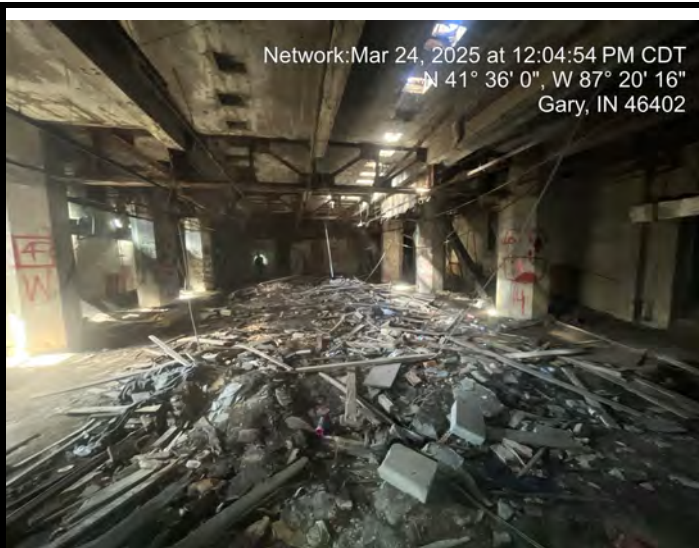

FS-14 Basement Accessible No Issues



FS-15 Basement coat room Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

549 Washington Street Gary, IN




FS-16 Basement Accessible No Issues



FS-17 Staircase Completely inaccessible Structural Damage




FS-18 Staircase Accessible No Issues

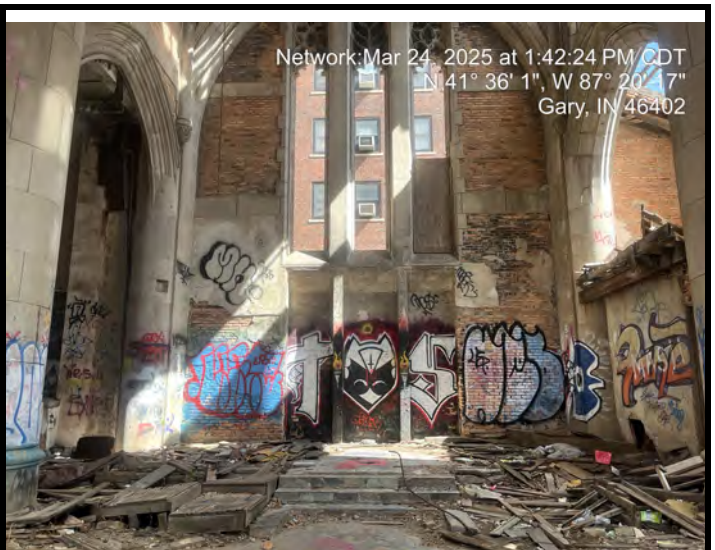

FS-19 Sanctuary Partially inaccessible Structural Damage

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

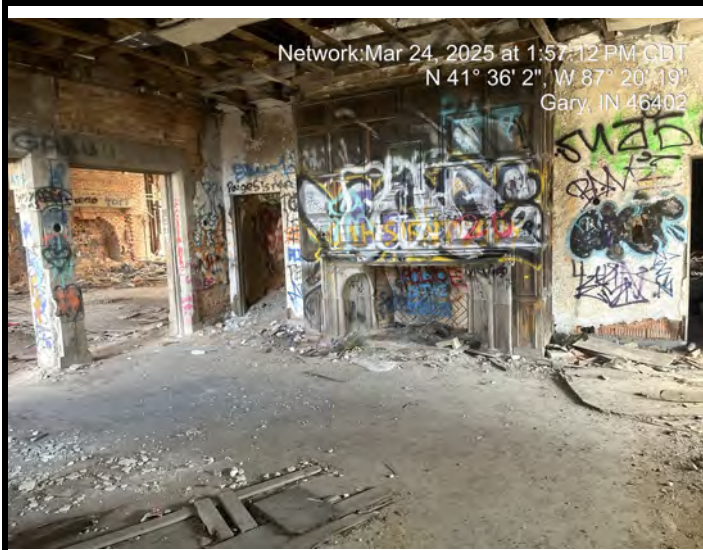


FS-20 Lobby/Narthex Accessible No Issues



FS-21 Bathroom Accessible No Issues

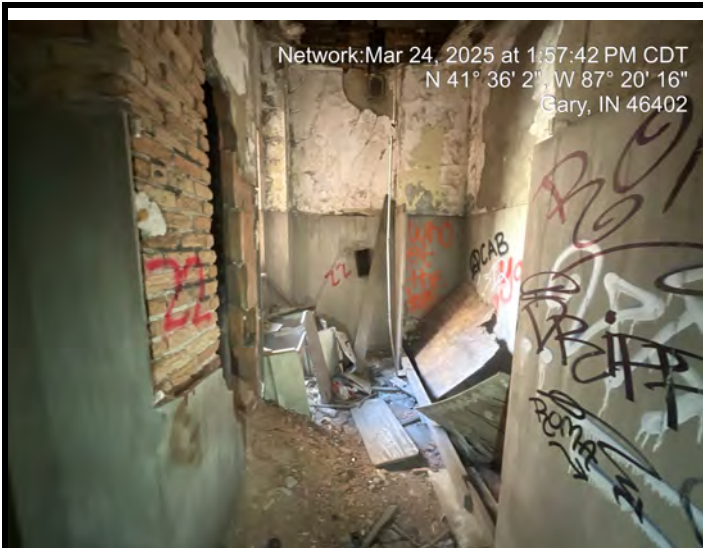


FS-22 Bathroom Accessible No Issues

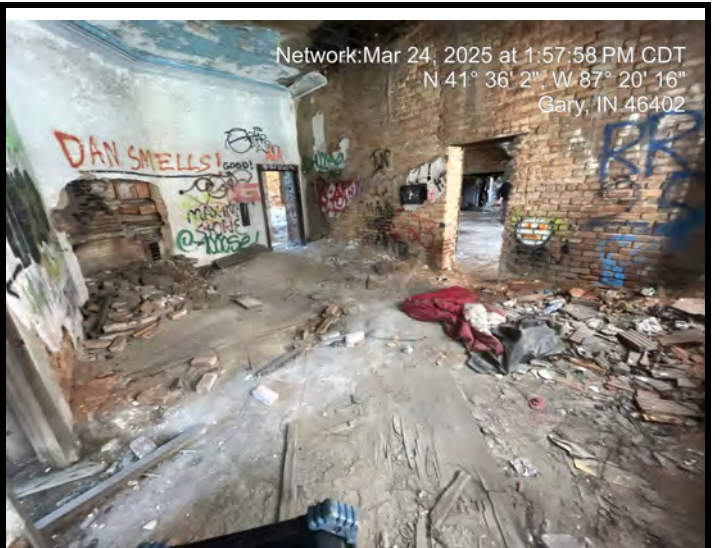

FS-23 1st floor room Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

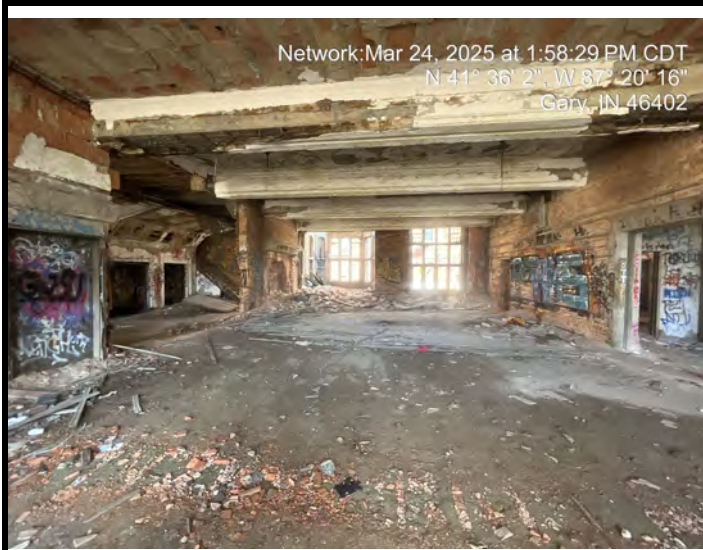


FS-24 Fellowship room Accessible No Issues



FS-25 Hallway outside auditorium Accessible No Issues

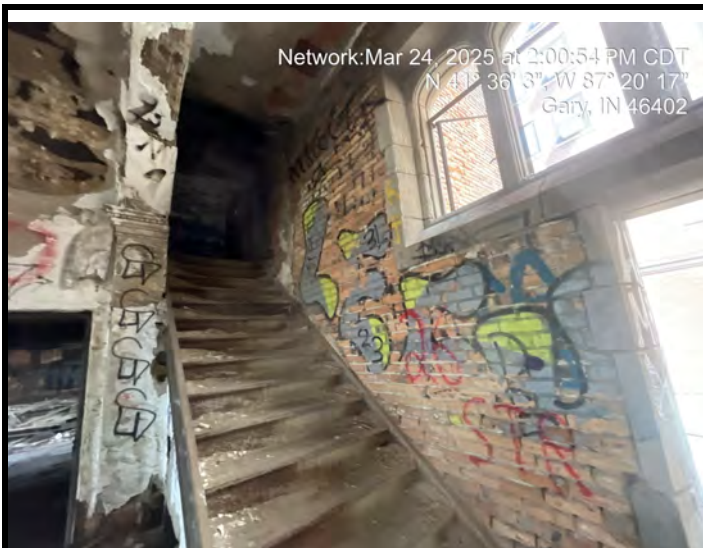

FS-26 Staircase Accessible No Issues

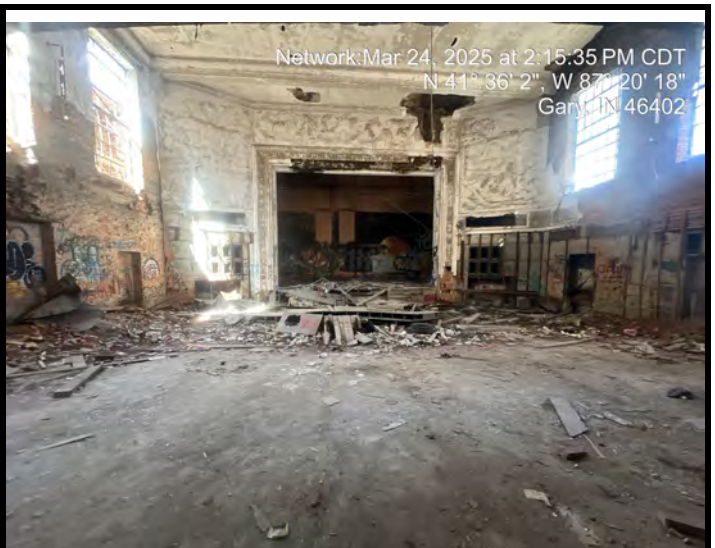


FS-27 Auditorium Partially inaccessible Structural Damage

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN




FS-28 Hallway Accessible No Issues

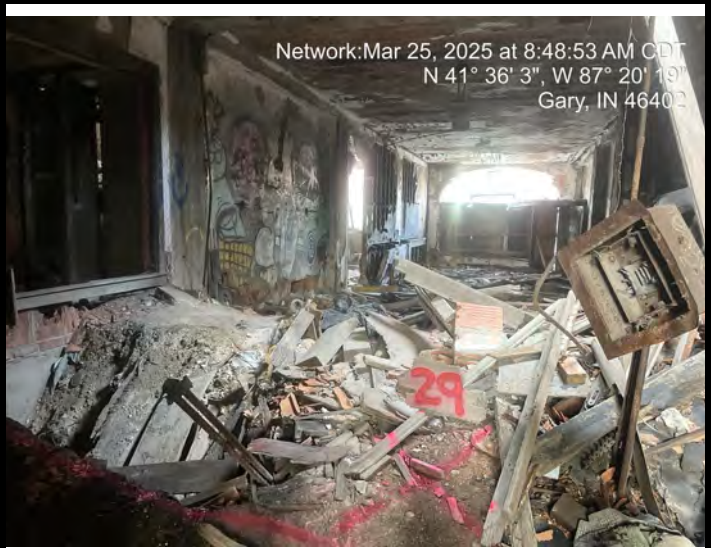

FS-29 1st floor room Completely inaccessible
Structural Damage

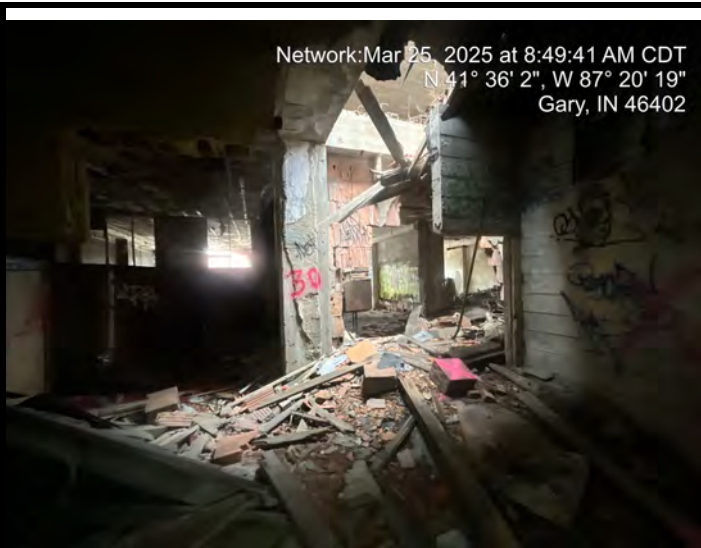

FS-30 1st floor room Completely inaccessible
Structural Damage

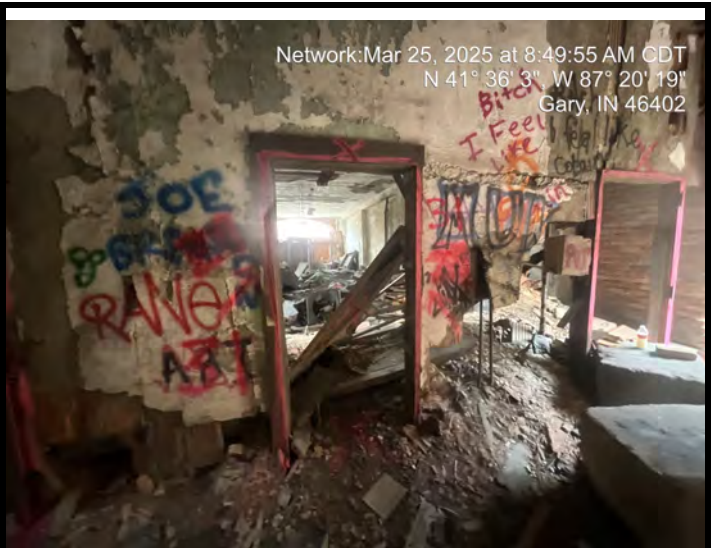

FS-31 1st floor room Completely inaccessible
Structural Damage

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

549 Washington Street Gary, IN



FS-32 Staircase Completely inaccessible Structural Damage



FS-33 Staircase Completely inaccessible Structural Damage




FS-34 Staircase Completely inaccessible Structural Damage



FS-35 Staircase Partially inaccessible

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

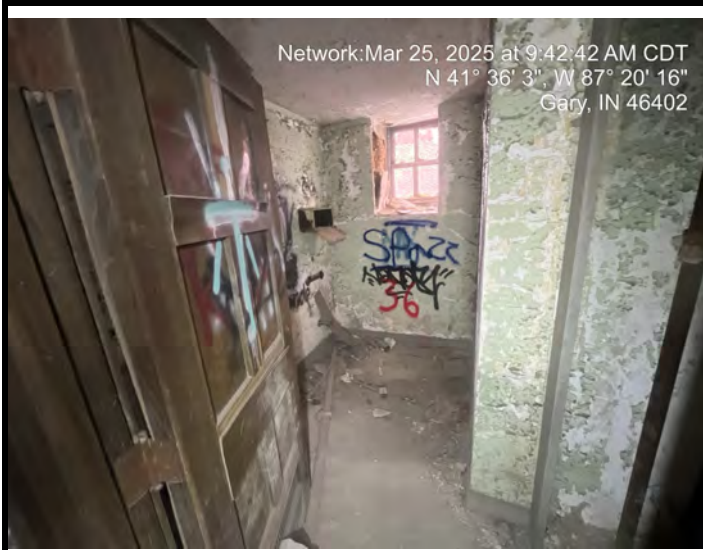


FS-36 Bathroom Accessible No Issues



FS-37 Auditorium balcony Accessible No Issues

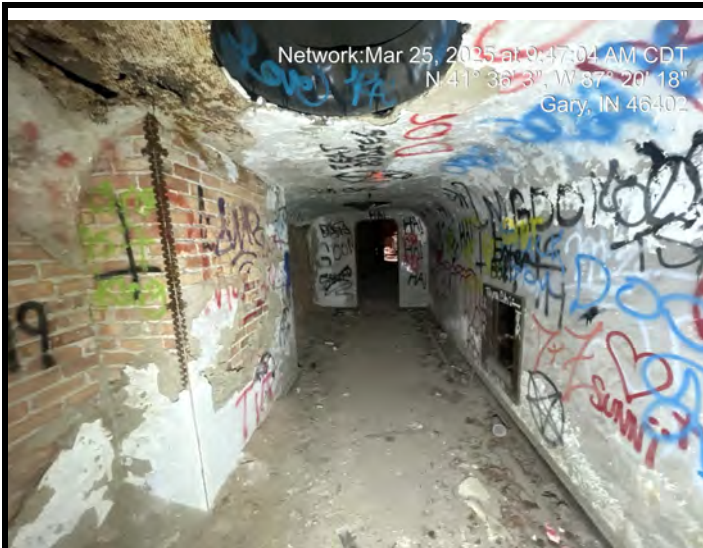


FS-38 Hallway Accessible No Issues

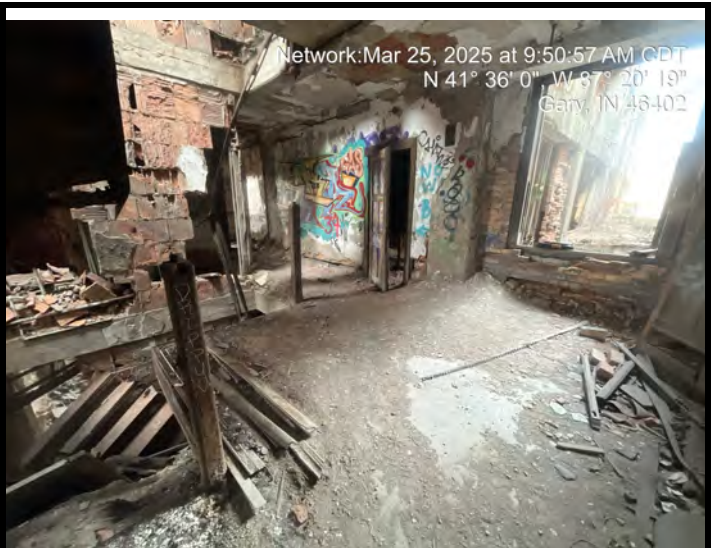


FS-39 Hallway Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

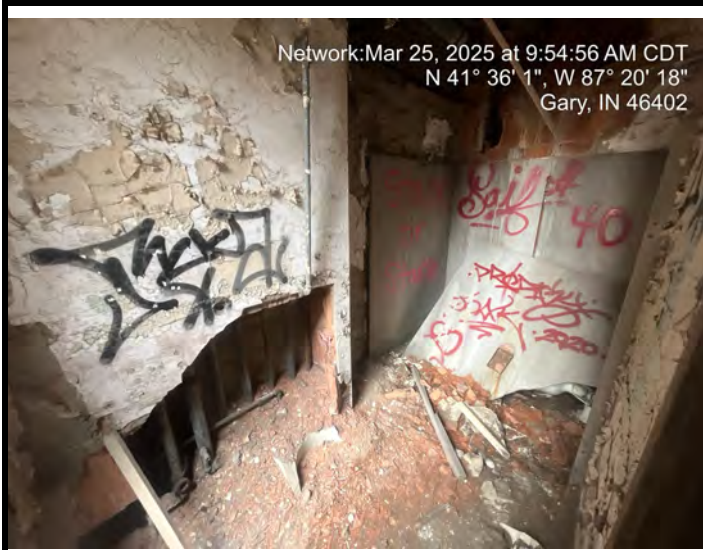


FS-40 Bathroom Accessible No Issues

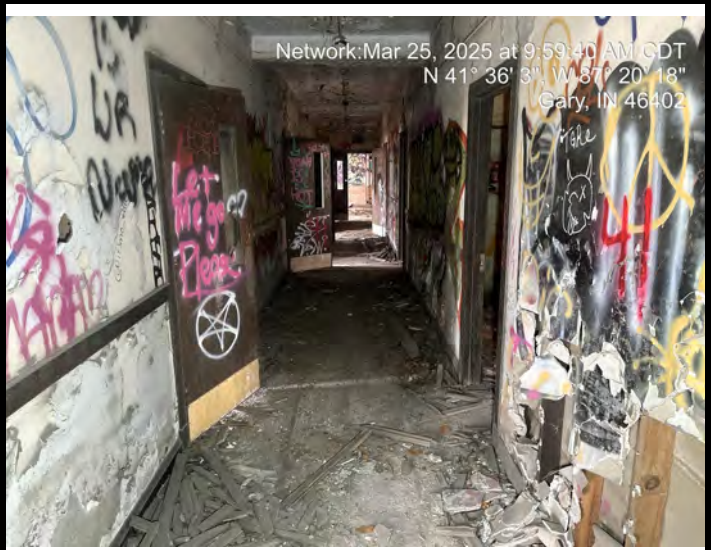

FS-41 Hallway Accessible No Issues

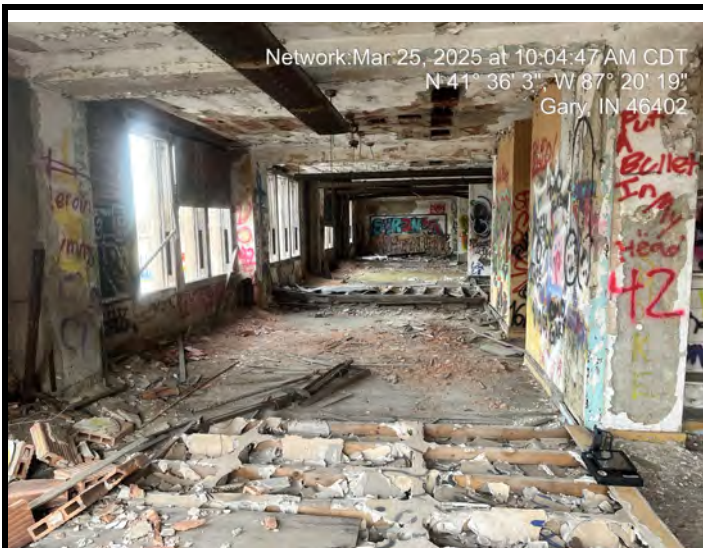


FS-42 2nd Floor room Accessible No Issues

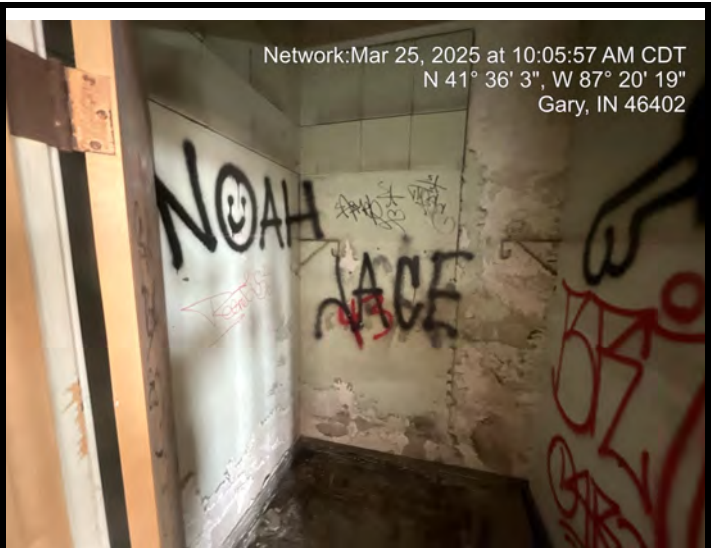


FS-43 Storage Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


549 Washington Street Gary, IN

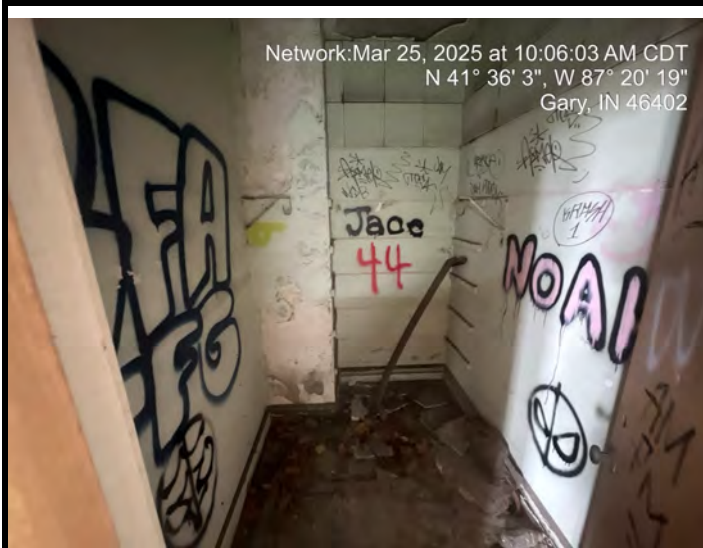


FS-44 Storage Accessible No Issues

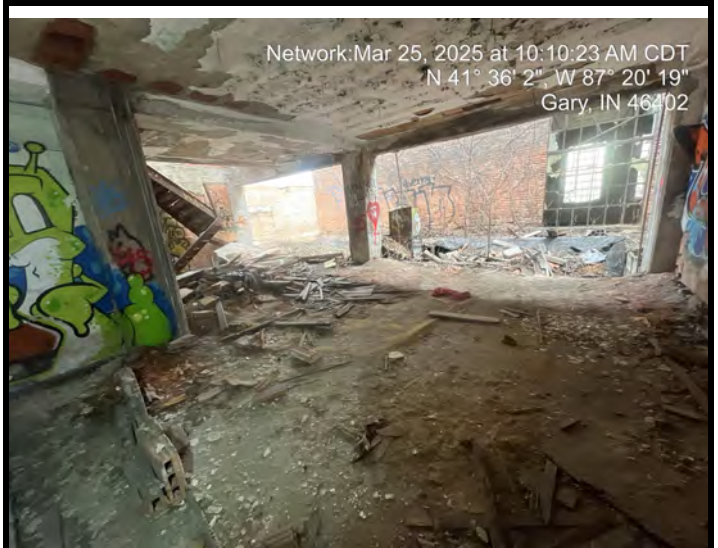

FS-45 2nd Floor room Partially inaccessible
Structural Damage

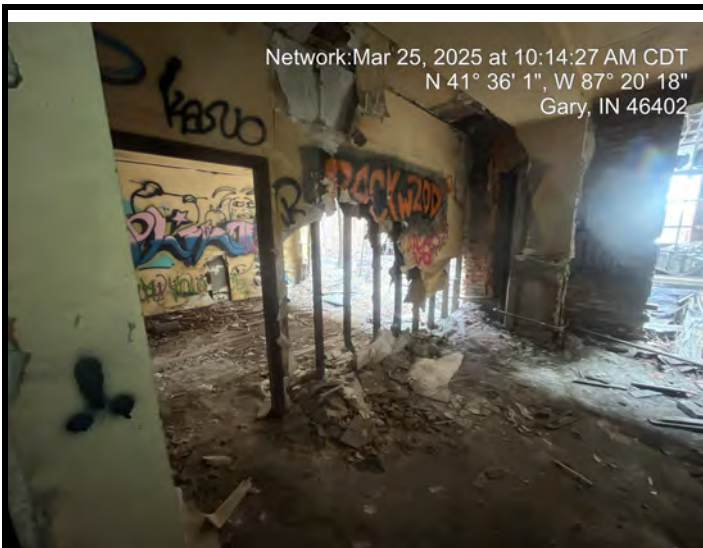


FS-46 2nd Floor room Accessible No Issues

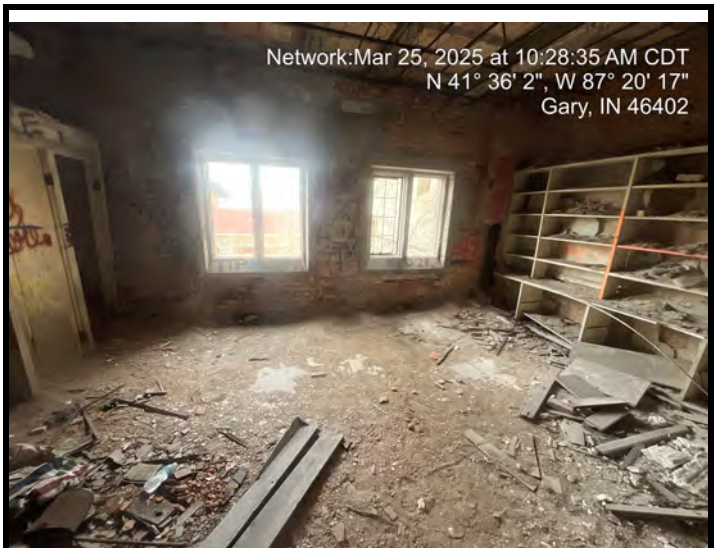

FS-47 Second floor office Accessible No Issues

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


549 Washington Street Gary, IN

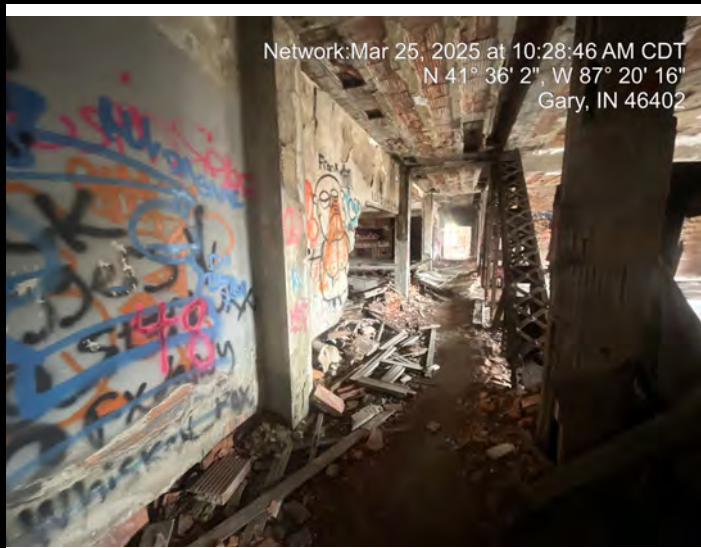


FS-48 Second floor hallway Accessible No Issues



FS-49 Second floor room Accessible No Issues

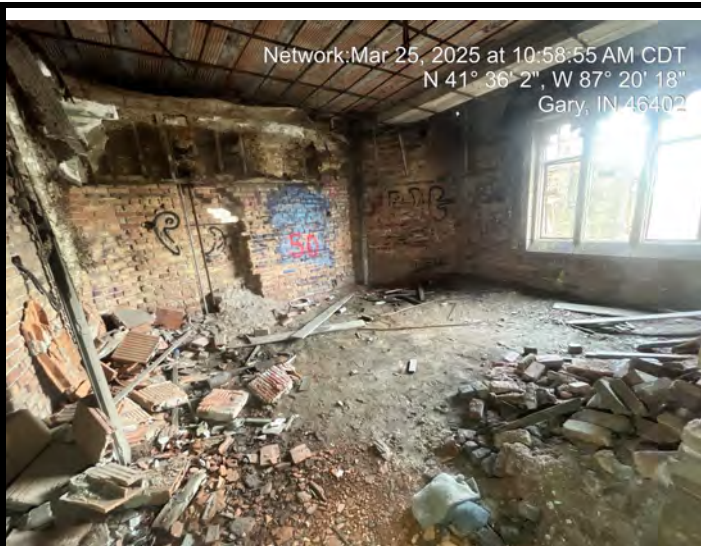

FS-50 Second floor office Accessible No Issues

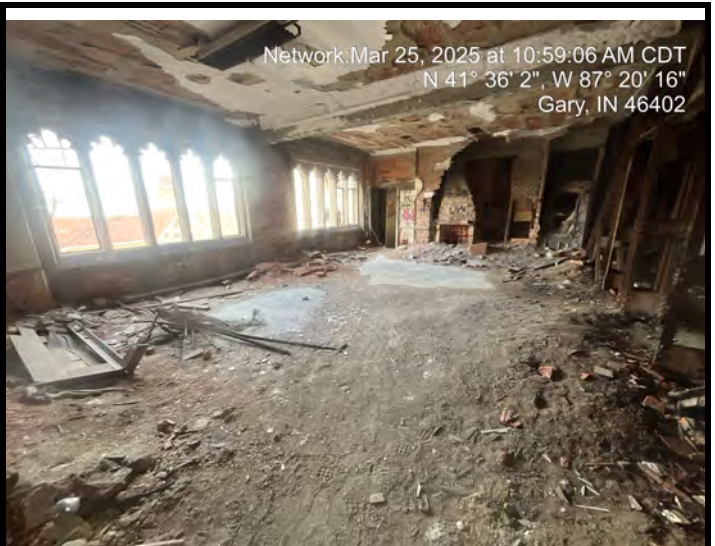


FS-51 Second floor room Accessible No Issues

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

549 Washington Street Gary, IN




FS-52 Staircase Completely inaccessible Structural Damage

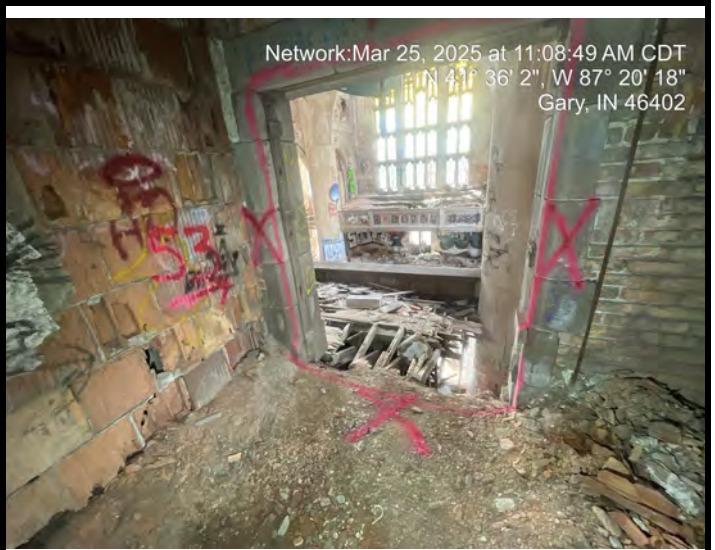

FS-53 Balcony Completely inaccessible Structural Damage




FS-54 Bathroom Completely inaccessible Structural Damage

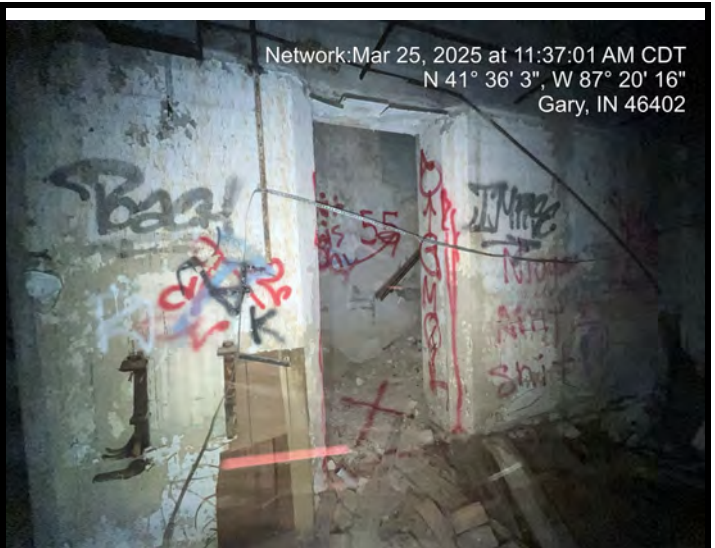

FS-55 Staircase Completely inaccessible Structural Damage

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

549 Washington Street Gary, IN

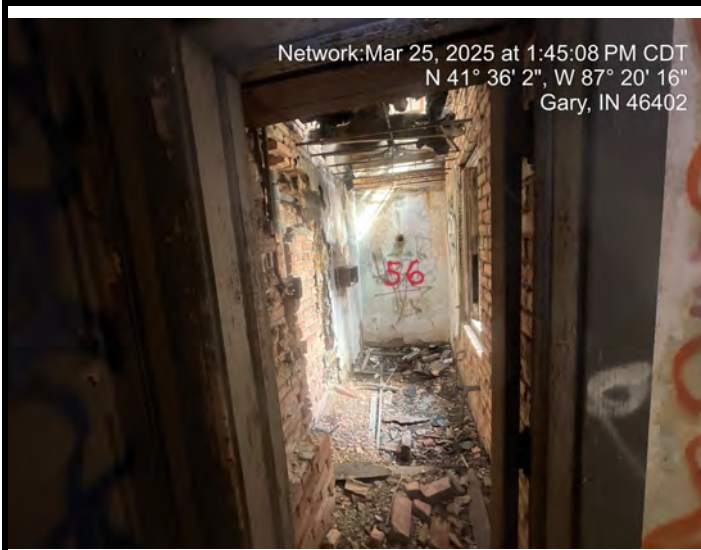

FS-56 Bathroom Accessible



FS-57 3rd Floor Completely inaccessible Structural Damage



FS-58 4th Floor Completely inaccessible Structural Damage



FS-59 Bell Tower Completely inaccessible Unreachable

**Gary Commercial Blight Elimination Program
Asbestos Containing Samples**

549 Washington Street Gary, IN



Sample # 4 Exterior Caulk - on Brick Siding air handler building



Sample # 5 Exterior Caulk - Around all basement and all other windows



Sample # 8 Waterproofing Sealant - On some concrete blocks



Sample # 14 Plaster - Skim & Base Coat Ceilings on Wire Mesh

**Gary Commercial Blight Elimination Program
Asbestos Containing Samples**

549 Washington Street Gary, IN



Sample # 16 Plaster - Skim & Base Coat Walls on Brick/Block



Sample # 17 Flooring - 12X12 Floor Tile with Glue- White with Mosaic pattern



Sample # 18 Terra Cotta - Interior Walls



Sample # 22 Flooring - 9X9 Floor Tile with Mastic- Gray

Gary Commercial Blight Elimination Program Asbestos Containing Samples

549 Washington Street Gary, IN



Sample # 30 Plaster - Skim & Base Coat Walls on Brick/Terra Cotta



Sample # 35 Plaster - Base Coat Walls on Brick/Terra Cotta ceilings



Sample # 36 Plaster - Skim & Base Coat Ceilings on Wire Mesh




Sample # 38 Ceiling Panel - 2X2, White with Pinholes and Glue Pods

Gary Commercial Blight Elimination Program Asbestos Containing Samples

549 Washington Street Gary, IN



Sample # 39 Flooring - 9X9 Floor Tile with Mastic and Tar Paper- Gray and Green checkerboard Pattern

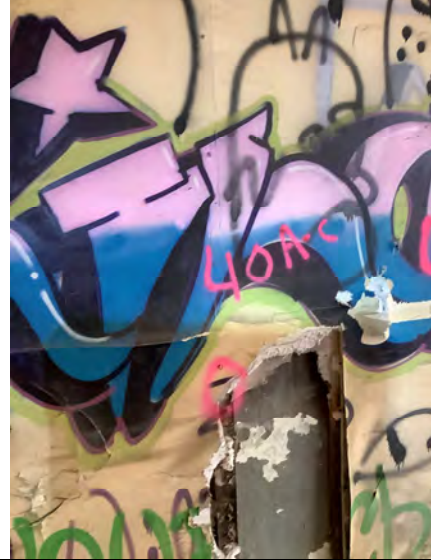

Sample # 40 Wallboard - with Mud & Tape



Sample # 41 Roofing Material - Flat Roof Materials



Sample # 42 Flooring - 9X9 Floor Tile with Glue- Beige

**Gary Commercial Blight Elimination Program
Asbestos Containing Samples**

549 Washington Street Gary, IN



Sample
43

Transite sheeting - Chalkboard

**Gary Commercial Blight Elimination Program
Non-Asbestos Samples**

549 Washington Street Gary, IN



Sample
1

Concrete - Sidewalks, stairs to building



Sample
2

Block Mortar - Exterior building foundation



Sample
3

Brick Mortar - Exterior building foundation



Sample
6

Concrete - Foundation Wall supports

**Gary Commercial Blight Elimination Program
Non-Asbestos Samples**

549 Washington Street Gary, IN



Sample
7

Slate - Roofing Material



Sample
9

Concrete - Flooring



Sample
10

Flooring - 12X12 Floor Tile with Mastic &
Glue



Sample
11

Wallboard - with Mud & Tape

Gary Commercial Blight Elimination Program Non-Asbestos Samples

549 Washington Street Gary, IN



Sample
12

Concrete - Foundation Walls



Sample
13

Concrete - Pillars



Sample
15

Construction Adhesive - Yellow on
Wallboard



Sample
19

Construction Adhesive - Brown on Brown
wall paneling

**Gary Commercial Blight Elimination Program
Non-Asbestos Samples**

549 Washington Street Gary, IN



Sample
20

Flooring - Terrazzo Flooring



Sample
21

Brick Mortar - Interior Walls



Sample
23

Ceiling Panel - 2X2, White with Pinholes



Sample
24

Fire Brick - Mortar Interior Fireplace

Gary Commercial Blight Elimination Program Non-Asbestos Samples

549 Washington Street Gary, IN



Sample
25

Ceramic Tile with Grout - Isle way to Alter



Sample
26

Slate with Mortar - Alter Platform



Sample
27

Vapor Barrier - Paper Under Wood Floors



Sample
28

Brick Mortar - Fireplace flooring

Gary Commercial Blight Elimination Program Non-Asbestos Samples

549 Washington Street Gary, IN



Sample # 29 Plaster - Skim & Base Coat Ceilings on Wire Mesh



Sample # 31 Chimney Liner - Interior Wall



Sample # 32 Window Glaze - Metal Framed Windows



Sample # 33 Plaster - Decorative Moldings

Gary Commercial Blight Elimination Program Non-Asbestos Samples

549 Washington Street Gary, IN



Sample
34

Concrete - Auditorium Flooring



Sample
37

Plaster - Skim & Base Coat Ceilings and Walls
on Wall Board

