## THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

BOOK 2 TECHNICAL PROVISIONS

ATTACHMENT 01-1 PROJECT MANAGEMENT PLAN

INDIANA FINANCE AUTHORITY THE EAST END CROSSING (This page intentionally blank.)

Project Management Plan contents and schedule for provision of the component parts.

Legend:

- A = Approved by IFA prior to Commencement of Design
- B = Approved by IFA prior to Commencement of Construction
- C = Approved by IFA 180 days prior to Substantial Completion

Part	Section	Contents	Required by
1. Pro	ject Administration	·	
	Organization	Organizational diagram	А
	Personnel	Names and contact details, titles, and job roles	А
	Contractors Contracting Plan		А
	Schedule	Design Submittal portion of the Baseline Project Schedule in accordance with Section 1	А
		Balance of Baseline Project Schedule in accordance with Section 1	В
	Quality Control	Procedures to establish and encourage continuous improvement	А
	Audit	Procedures to facilitate review and audit by IFA	А
		Auditing and management review of Developer's own activities under the PMP	А
		Auditing and management review of Contractor's activities and management procedures	А
	PMP Update	Procedures for preparation of amendments and submission of amendments to any part of the PMP	А
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	A
		Document management procedures in compliance with Section 1	А
. Qua	ality Management Pla	n	
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	А
	Personnel	Resource plan for the Developer and its Contractors	А
		Arrangements for coordinating and managing staff interaction with IFA and its consultants	А

Part	Section	Contents	Required by
		including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	
		Names and contact details, titles, job roles and specific experience required for the Key Personnel and for other principal personnel during design	А
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate activities	А
2A. De	esign QA/QC Plan		
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	А
	Personnel	Resource plan for the Developer and its Contractors	А
		Arrangements for coordinating and managing staff interaction with IFA and its consultants including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	A
		Names and contact details, titles, job roles and specific experience required for the Key Personnel and for other principal personnel during design	А
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate activities	А
	Offices and equipment	Description of the necessary offices and office equipment to be provided by Developer during design	А
	Contractors	Overall control procedures for Contractors, including consultants and subconsultants	А
		Responsibility of Contractors and affiliates	А
		Steps taken to ensure Contractors and Suppliers meet the obligations imposed by their respective Contracts	А
	Interfaces	Interfacing between the Developer, Contractors and independent certifiers during design including interfaces between the structural design auditor, the safety auditor, and any quality reviewer	А
		Coordination with Utility Owners	А
	Environmental	Control of the interface between environmental requirements (including landscaping) and the design of the East End Crossing	А

art	Section	Contents	Required by
	Procedures	Procedures describing how the principal activities will be performed during the design stage: to include geotechnical site investigation, surveys and mapping, environmental management, safety audit, structural audit, and checking	А
	Quality Control/Quality	Quality control and quality assurance procedures including a resource table for monitoring and auditing all design services, design review and certification, verification of plans	А
	Assurance	Procedures for environmental compliance	А
		Procedures to establish Developer's hold points in design process where checking and review will take place	А
		Procedures to ensure accuracy, completion, and quality in submittals to IFA and Governmental Entities	А
		Procedures to establish and encourage continuous improvement	А
	Audit	Name of Developer's representative(s) with defined authority for establishing, maintaining, auditing and reporting on the PMP	А
		Name, title, roles and responsibilities of supporting quality management staff reporting to the person with defined authority	А
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	А
		Document management procedures in compliance with Section 3	А
		Identify environmental documentation and reporting requirements for the Environmental Compliance Plan	А
Сс	onstruction QA/QC P	lan	
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	A
	Personnel	Resource plan for the Developer and its Contractors	В
		Arrangements for coordinating and managing staff interaction with IFA and its consultants including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	В
		Names and contact details, titles, job roles and specific experience required for the Key Personnel as related to construction	А
		2	

Part	Section	Contents	Required by
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate his activities	В
		Procedures for implementation of Environmental Compliance and Mitigation Training Program for all employees in accordance with <u>Section 7.3</u>	В
	Offices and equipment	Description of the necessary offices and office equipment to be provided by Developer during construction	А
	Contractors	Overall control procedures for Contractors, including consultants and subconsultants	В
		Responsibility of Contractors and affiliates	В
		Steps taken to ensure Contractors and Suppliers meet the obligations imposed by their respective Contracts	В
		Procedures for implementation of Environmental Compliance and Mitigation Training Program for employees of subcontractors in accordance with <u>Section 7.3</u>	В
	Interfaces	Interfacing between the Developer, Contractors and independent certifiers during construction, including any testing contractor	A
	Procedures	List of East End Crossing specific construction procedures	В
		Construction detailed procedure for each major activity whether directly undertaken or subcontracted to include pavement, structures, drainage, communications	В
		Construction Transportation Management Plan	В
	Quality Control/Quality Assurance	Construction Monitoring Plan	В
		Construction Monitoring Program (Environmental)	В
		Procedures for environmental compliance	
		Control, identification and traceability of materials, including any material or samples temporarily or otherwise removed from site for testing or other reasons.	В
		Examinations and audit of Construction Work, review of examination and audit, issue of certificates	В
		Observation and reporting of all tests in compliance with Section 3	В
		Procedures for tests and inspections for the purpose of the Contractor certifying that prior to burying, each part of the Works is complete and conforms to the PPA Documents.	В
λΑΝΑ	FINANCE AUTHORITY	4	JULY 31.2

rt	Section	Contents	Required by
		Quality control and quality acceptance procedures including a resource table for monitoring and auditing during construction any work and testing undertaken by Contractors and Suppliers both on and off Site	В
		Procedures to establish Developer's hold points in construction	В
		Procedures to ensure accuracy, completion, and quality in submittals to IFA and Governmental Entities	В
		Procedures to establish and encourage continuous improvement	А
	Audit	Inspection and test plans that identify the proforma and/or databases to be used for recording the inspection and test results and methodology for transmitting acceptance testing and inspection reports to IFA	В
		Name of Developer's representative with defined authority for establishing, maintaining, auditing and reporting on the PMP	А
		Name, title, roles and responsibilities of supporting quality management staff reporting to the person with defined authority	В
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	В
		Document management procedures in compliance with Section 4	А
Envi	ironmental Manage	ment	
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	А
		Environmental Contact Tree	А
	Personnel	Resource plan for the Developer and its Contractors	В
		Arrangements for coordinating and managing staff interaction with IFA and its consultants, including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	A
		Names and contact details, titles, job roles and specific experience required for Key Personnel and for other environmental personnel	А
		Implement Environmental Compliance and Mitigation Training Program for all employees in accordance with Section 7.3	А

Part	Section	Contents	Required by
	Contractors	Overall control procedures for Contractors, including consultants and subconsultants	А
		Responsibility of Contractors and affiliates	А
	Environmental	Environmental Compliance and Mitigation Plan	В
		Sustainability Management Plan	А
		Spill Prevention Plan	В
		Hazardous Materials Management Plan	В
	Quality Control and Quality Acceptance	Procedures to ensure accuracy, completion, and quality in submittals to IFA and Governmental Entities	А
		Procedures to establish and encourage continuous improvement	А
		Procedures for environmental compliance	А
	Audit	Name, title, roles and responsibilities of supporting quality management staff reporting to the person with defined authority	В
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	А
		Identify environmental documentation and reporting requirements	А
. Puk	olic Involvement Plan		
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	А
	Personnel	Resource plan for the Developer and its Contractors	А
		Arrangements for coordinating and managing staff interaction with IFA and its consultants, including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	A
		Names and contact details, titles, job roles and specific experience required for Key Personnel and for other principal personnel	A
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate his activities	A
	Offices and equipment	Description of the necessary offices and office equipment to be provided by Developer during design	A

Part	Section	Contents	Required by
	Contractors	Overall control procedures for Contractors, including consultants and subconsultants	А
		Responsibility of Contractors and affiliates	А
		Steps taken to ensure Contractors and Suppliers meet the obligations imposed by their respective Contracts	А
		Procedures for implementation of Environmental Compliance and Mitigation Training Program for employees of Contractors	A
	Interfaces	Community Outreach Plan in accordance with Section 6.3	А
		Procedures for liaison with the public, the media and other Customer Groups in accordance with <u>Section 6</u> and the press media policy of IFA	А
		Procedures to coordinate with East End Crossing stakeholders such as municipalities, counties, MPOs, RMAs and other Customer Groups	А
	Procedures	Procedures describing how the principal activities will be performed	А
	Quality Control	Quality control procedures including a resource table for monitoring and auditing all public information and communication services	А
		Procedures to ensure accuracy, completion, and quality in submittals to IFA, Governmental Entities and Customer Groups	А
		Procedures to establish and encourage continuous improvement	А
	Audit	Name of Developer's representative with defined authority for establishing, maintaining, auditing and reporting on the PMP	А
		Name, title, roles and responsibilities of supporting quality management staff reporting to the person with defined authority	A
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	А
		Document management procedures in compliance with the Technical Provisions Section 1	А
		Identify environmental documentation and reporting requirements	А
5. Safe	ety Plan		
	Organization	Policies, plans, training programs, Work Site controls, and Incident response plans to ensure the health and safety of personnel involved in the East End Crossing and the general public affected by the East End Crossing	A
		7	II II V 24 - 20

Part	Section	Contents	Required by
		Procedures for immediately notifying IFA of all incidents arising out of or in connection with the performance of the Work	А
	Personnel	Resource plan for the Developer and its Contractors	А
		Arrangements for coordinating and managing staff interaction with IFA and its consultants, including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	A
		Names and contact details, titles, job roles and specific experience required for Key Personnel and for other principal personnel	А
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate his activities	А
	Incident Management Plan	Incident Management Plan in compliance with the Technical Provisions Section 6.5.5	А
6. Cor	mmunications Plan		
		he Developer's organization will respond to unexpected requests for information, communicate to necessary Developer personnel, and notify affected stakeholders before and after changes	A
	Processes and proceed organization and IFA.	dures for communication of East End Crossing information between the Developer's	А
7. Ope	erations and Maintenar	nce Plan	
	Organization	Developer's main contractual arrangements	А
		Organizational structure covering the activities to be performed in accordance with the PPA Documents	А
	Personnel	Resource plan for the Developer and its Contractors	А
		Arrangements for coordinating and managing staff interaction with IFA and its consultants, including collocation of Key Personnel and description of approach to coordinating work of off-site personnel	A
		Names and contact details, titles, job roles and specific experience required for the Key Personnel as related to Operations and Maintenance (O&M) activities.	А
		Names and contact details, titles, job roles of principal personnel for Contractors and any third party with which Developer will coordinate activities	А

Part	Section	Contents	Required by
	Contractors	Overall control procedures for Contractors, including consultants and subconsultants	А
		Responsibility of Contractors and affiliates	А
		Steps taken to ensure Contractors and Suppliers meet the obligations imposed by their respective Contracts	С
		Procedures for implementation of Environmental Compliance and Mitigation Training Program for employees of Contractors in accordance with <u>Section 7.2</u>	С
	Environmental	Control of the interface between environmental requirements (including Hazardous Materials and demolition) and Operations and Maintenance activities	С
		Applicable procedures for the Hazardous Materials Management Plan in accordance with Section 7.9.1	С
	Health and Safety	O&M Safety Plan in accordance with Section 22.1.7	С
	Quality Control	O&M Quality Plan in accordance with Section 22.1.8	С
		Procedures to ensure accuracy, completion, and quality in submittals to IFA and Governmental Entities	С
		Procedures to establish and encourage continuous improvement	С
		Quality control procedures and quality review standards in accordance with Section 22	С
		Procedures for environmental compliance	С
	Audit	Name, title, roles and responsibilities of supporting quality management staff reporting to the person with defined authority	A
	Document Management	The manner in which records will be maintained in compliance with the Technical Provisions, including any specific systems Developer will use	С
		Document management procedures in compliance with Section 22	С
		Identify environmental documentation and reporting requirements	С

Note - in this PMP Contents the term "Contractor" shall be taken to mean "Subcontractor"

## THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

**PUBLIC-PRIVATE AGREEMENT** 

BOOK 2 TECHNICAL PROVISIONS

ATTACHMENT 07-1 PERMITS AND STATUS

INDIANA FINANCE AUTHORITY THE EAST END CROSSING (This page intentionally blank.)

IFA-PROVIDED APPROVALS				
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	ANTICIPATED APPROVAL DATE	
Project	2012 ROD	FHWA	Approved 06/20/2012	
Structures 1, 11, & 12	2012 ROD Reevaluation	FHWA	12/31/2012	
Kentucky Approach (Section 4)	Section 401 Water Quality Certification Permit Discharge of dredged or fill material into the Waters of the U.S. (Harrods Creek)	Kentucky Department of Water (KDOW)	4/1/2013	
Kentucky Approach (Section 4)	Floodplain Construction Permit [The Floodplain Management Section of Louisville Metro require permits.] (Harrods Creek)	Metropolitan Sewer District in Louisville (MSD)	4/1/2013	
Kentucky Approach (Section 4)	Section 404 Permit Discharge of dredged or fill material into the Waters of the U.S. (jurisdiction begins at OHWM). (Harrods Creek) Section 10 Bridge Permit Construction of all work, other than bridges or Causeways over Navigable Waters(below the OHW elevation). (Harrods Creek) (Combined application)	US Corps of Army Engineers (USACE)	4/1/2013	
Kentucky Approach (Section 4)	Section 9 Bridge Permit Construction of Bridges or Causeways Over Navigable Waters of the U.S. (Harrods Creek)	United States Coast Guard (USCG)	4/1/2013	
Kentucky Approach (Section 4)	Federal Permit for Eagle Take to Protect an Interest in a Particular Locality	US Fish and Wildlife Service (USFWS)	12/31/2012	

IFA-PROVIDED APPROVALS					
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	ANTICIPATED APPROVAL DATE		
East End Main Span Bridge (Section 5)	Construction In A Floodway [IC 14-28- 1 Flood Control Act] Indiana IC 14-29-1 Navigable Waterways Act [covered by Construction in a Floodway permit] (Combined application)	Indiana Department of Natural Resources (IDNR), Div. of Water Indiana Department of Environmental Management (IDEM)	1/31/2013		
East End Main Span Bridge (Section 5)	Section 401 Water Quality Certification Permit Discharge of dredged or fill material into the Waters of the U.S.	KDOW	1/31/2013		
East End Main Span Bridge (Section 5)	Floodplain Construction Permit [The Floodplain Management Section of Louisville Metro require permits.]	MSD	1/31/2013		
East End Main Span Bridge (Section 5)	Section 404 Permit Discharge of dredged or fill material into the Waters of the U.S. (jurisdiction begins at OHWM). Section 10 Bridge Permit Construction of all work, other than bridges or Causeways over Navigable Waters(below the OHW elevation). (Combined application)	USACE	1/31/2013		
East End Main Span Bridge (Section 5)	Section 9 Bridge Permit Construction of Bridges or Causeways Over Navigable Waters of the U.S.	USCG	1/31/2013		

IFA-PROVIDED APPROVALS				
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	ANTICIPATED APPROVAL DATE	
East End Main Span Bridge (Section 5)	Aviation Lighting Permit [TC 56-50e APPLICATION FOR PERMIT TO CONSTRUCT OR ALTER A STRUCTURE] - for crane Aviation Lighting Permit [TC 56-50e APPLICATION FOR PERMIT TO CONSTRUCT OR ALTER A STRUCTURE] - for bridge (Combined application)	Kentucky Airport Zoning Commission (KAZC)	1/31/2013	
East End Main Span Bridge (Section 5)	Tall Structure Permit [FAA FORM 7460-1, NOTICE OF PROPOSED CONSTRUCTION OR ALTERATION] - for crane Tall Structure Permit [FAA FORM 7460-1, NOTICE OF PROPOSED CONSTRUCTION OR ALTERATION] - for bridge (Combined application)	Fed. Aviation Admin. (FAA)	Approved 5/31/12. FAA issued determination of "No Hazard"	
East End Main Span Bridge (Section 5) Indiana Approach (Section 6)	Section 401 Water Quality Certification Permit Discharge of dredged or fill material into the Waters of the U.S. (Combined application)	IDEM	Approved 8/14/12 with conditions.	
Indiana Approach (Section 6)	Construction In A Floodway [IC 14-28- 1 Flood Control Act]	IDNR, Div. of Water	4/1/2013	
Indiana Approach (Section 6)	Indiana IC 14-29-1 Navigable Waterways Act [covered by Construction in a Floodway permit]	IDEM	4/1/2013	
Indiana Approach (Section 6)	Section 404 Permit Discharge of dredged or fill material into the Waters of the U.S. (jurisdiction begins at OHWM).	USACE	4/1/2013	

IFA-PROVIDED APPROVALS			
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	ANTICIPATED APPROVAL DATE
Indiana Approach (Section 6)	Tall Structure Permit [FAA FORM 7460-1, NOTICE OF PROPOSED CONSTRUCTION OR ALTERATION] - for crane Tall Structure Permit [FAA FORM 7460-1, NOTICE OF PROPOSED CONSTRUCTION OR ALTERATION] - for bridge (Combined application)	FAA	FAA Determination of No Hazard Received 05/31/2012

IFA-INITIATED APPROVALS <sup>1</sup>			
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	MAJOR ENVIRONMENTAL APPROVAL DEADLINE
Blank			
1. All IFA-Initiated Approvals are Major Environmental Approvals			

MAJOR ENVIRONMENTAL APPROVALS				
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	MAJOR ENVIRONMENTAL APPROVAL DEADLINE	
Kentucky Approach (Section 4)	Erosion and Sediment Control Plan	MSD	28 days after receiving satisfactory submission	
Kentucky Approach (Section 4)	Risk Management Plan (HAZMAT/Contamination)	Kentucky Division of Waste	28 days after receiving satisfactory submission	
Kentucky Approach (Section 4)	Kentucky Pollution Discharge Elimination System	KDOW	28 days after receiving satisfactory submission	
East End Main Span Bridge (Section 5)	Construction/Land Disturbance Storm Water Permitting (327 IAC 15-5, Rule 5) / NOI	IDEM	IDEM will respond to a submission within 28 days	

MAJOR ENVIRONMENTAL APPROVALS			
LOCATION	APPROVAL NAME	ADMINISTERING AGENCY	MAJOR ENVIRONMENTAL APPROVAL DEADLINE
Indiana Approach (Section 6)	Construction/Land Disturbance Storm Water Permitting (327 IAC 15-5, Rule 5) / NOI	IDEM	IDEM will respond to a submission within 28 days

## THE EAST END CROSSING

## (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

#### PUBLIC-PRIVATE AGREEMENT

#### BOOK 2 TECHNICAL PROVISIONS

## ATTACHMENT 09-02 LEVEL ONE DESIGN EXCEPTION - SUPERELEVATION

JULY 31, 2012 TECHNICAL PROVISIONS ATTACHMENT 09-2 ADDENDUM 5 – OCTOBER 4, 2012 (This page intentionally blank.)

#### LEVEL ONE DESIGN EXCEPTION REQUEST

June 7, 2012

#### MEMORANDUM

TO: John Wright, PE Director, Highway Design A Bridges THRU: Him Ude, PE Hother Frey North-frey Director, Seymour District Production Division

THRU: Kevin Hetrick, PE INDOT Project Manager

THRU: Jim Hilton, CTS Deputy Project Manager Hilton

FROM: Burgess & Niple, Inc.

THRU: James M. Johnson, Beam, Longest, and Neff, LLC Project Reviewer James M, Johnson, defermine M, Johnson, deferminger and Neff LLC, uer-Transportation, mits Bohrson Phane, Discourse and Neff LLC, uer-Transportation, mits Bohrson T A3558 -0490

Development of Preliminary Road Plans and Level 1 Analysis (attached)

SUBJECT:Design Exception Request for ST: Superelevation Transition<br/>Des. No.: 0201297<br/>Route No. or Road Name: SR 265<br/>PE Project No.: 0201297<br/>Structure No.: 1265-9-2620 & 1265-9-2620J

Transmitted, herewith, is a Design Exception request for the above referenced project. The documentation has been reviewed for compliance with the Design Exception requirements included in *Indiana Design Manual* Section 40-8.0. Based on the analysis of the substandard Level One design features, we believe that the design exception is justified and we therefore recommend approval.

	Concur: Director, Highway Design Date Director of Bridges Date	2)/23/12
7 TR	FHWA oversight required: Yes No	7-25-12
	INDOT Design Exception Database Information Des. No.: 0201297 Request Date: June 7, 2012	
	Approved 🗹 Rejected 🗌 Commitment Made: Yes 🗌 No 🗹	

cc: John Wright, PE, Director, Highway Design 🖄 Bridges 🗌 file

#### SUMMARY

#### **Project Description**

The Ohio River Bridges East End Project - SR 265 is divided into three main sections: the Kentucky approach, the main bridge spanning the Ohio River, and the Indiana approach. The project is located in eastern Clark County Indiana, south of the Indiana Army Ammunition Plant and north of the Town of Utica. It begins approximately six tenths (0.6) of a mile west of the existing interchange of SR 265 and SR 62 and extends across new terrain to the Ohio River.

#### **Design Feature**

#### Superelevation (SE) Transition Length and Distribution on the Horizontal Curves

The west end of proposed construction for this project is located at the east abutments of the bridges carrying SR 265 over Charlestown Pike and the Conrail Railroad.

When SR 265 was originally constructed, the superelevation transition lengths were based upon rotation of both eastbound and westbound pavements about Line "A" (See Exhibit D). According to the superelevation calculations developed by Burgess & Niple the existing superelevation lengths and the cross slopes at the bridge termini are as follows:

	Existing SE Runoff	Existing SE Runout	Existing Total Transition	Existing Pavement Cross Slope at East Bridge Abutments
Eastbound	772.73 ft	303.03 ft	1075.76 ft	4.27%
Westbound	800.00 ft	307.69 ft	1107.69 ft	3.62%

The proposed westbound and eastbound lanes of S.R. 265 have two separate horizontal alignments. These two separated alignments (LA-WB) and (LA-EB) are needed to establish different profile grades and have to tie into the existing grades at the end of the existing bridge structures. The SE design and distribution is designed separately for each horizontal curve.

The total existing SE transition length, based upon rotating the eastbound and westbound lanes about Line "A" exceeds the SE transition lengths that would be required for the separate eastbound and westbound alignments.

#### Applying SE Transition to Curve

The issue that needs to be addressed is distribution of the transition length on the curve. IDM Section 43-3.03(03) states the superelevation runoff may be distributed 50% to 70% on the tangent with the remainder on the curve; and that it is acceptable to use IDM Figure 43-3F. IDM Figure 43-3F indicates that for 70 mph design speeds and 2 lanes rotated; the transition length may be distributed 80% on the tangent and 20% on the curve.

If the existing bridges are retained, the SE transition must be positioned to match the existing pavement cross slopes at the east bridge abutments (4.27% eastbound and 3.62% westbound). For the westbound lanes, a portion of the SE transition is located on the curve. However, for the eastbound lanes, the entire SE transition is located off of the curve.

Therefore, the Level 1 Design Exception Request is for distribution of the SE transition relative to the horizontal curve.

#### **Construction Costs**

The additional construction cost (2012 cost) associated with modifying the bridges to meet superelevation transition distribution criteria is estimated as follows:

Bridges	\$2,850,000.00
Road *	\$ 250,000.00
Total	\$3,100,000.00

• The road portion is the cost required to reconstruct approximately 271 ft of pavement west of the existing bridge to transition cross slopes to meet the modified bridges.

This cost was developed by Beam, Longest and Neff, as a verification of the cost in the original Level 1 Exception documentation, attached.

#### **Additional Information**

Additional supporting data for the Level 1 Design Exception Request is in the original documentation developed by Burgess & Niple, Inc; attached.

#### **PROJECT DESCRIPTION**

Interstate 265 (I-265) encircles Louisville, Kentucky and the surrounding communities in northern Kentucky and southern Indiana. Portions of I-265 have not been built to date due to a lack of demand and funding. One such section is the stretch from the intersection with State Road 62 (SR 62) extending over the Ohio River to the intersection with Interstate 71 (I-71) in Worthington, KY. The I-265 Extension is divided into three main sections: the Kentucky approach, the main bridge spanning the Ohio River, and the Indiana approach. The project is located in eastern Clark County Indiana, south of the Indiana Army Ammunition Plant and north of the Town of Utica. It begins approximately six tenths (0.6) of a mile west of the existing interchange of SR 265 and SR 62 and extends across new terrain to the Ohio River near River Mile 595. The project is located in the Jeffersonville Quadrangle. The Project Design Criteria is New Construction (Freeway) and the Functional Classification is aFreeway. The new roadway is part of National highway System (NHS) but not currently on the national Truck network. Once this connection is completed FHWA will be adopting S.R. 265 into the interstate system as I-265.

#### **DESIGN FEATURE**

Proposed westbound lanes and eastbound lanes of S.R. 265 have two separate horizontal alignments. These two separated alignments (LA-WB) and (LA-EB) are needed to establish different profile grades and would have to tie into the existing grades at the end of the project and the existing bridge structures. The existing alignment ("A") at the center median cannot be used. Superelevated pavement is required for both horizontal curves

The existing superelevation was established using line "A", but eastbound and westbound travel lanes were transitioning to a wider median, therefore creating the condition where the runoff length was completely on tangent. Based on the proposed horizontal alignment analysis, superelevation transition for line "LA-WB" (westbound lanes) met the IDM requirements, except line "LA-EB" (eastbound lanes). A Level One design exception is required for the superelevation transition of Line "LA-EB" as it ties into existing alignment.

The length of the S/E transition at the west end of the Line "LA-EB" curve is satisfied, but the distribution of the runoff length on/off of the curve is not. Figure 43-3F of the INDOT Design Manual (Exhibit B) states that for 70 mph design speed and rotating two lanes the S/E runoff length should be 20% on the curve and 80% on the tangent. The eastbound lane transition will not be able to meet this requirement. The difference between the point of curvature (PC) in the existing alignment ("A") and the point of curvature (PC) along the eastbound travel way ("LA-EB") is significant enough to cause this distribution discrepancy (See Exhibit C). The existing bridge pavement is in S/E transition (see Exhibit D). In order to meet the transition of the existing bridge pavement established from line "A", the eastbound lane transition will have the entire length of the S/E transition on tangent off the curve (see Exhibit E).

#### CONSTRUCTION COSTS

The additional cost associated with modifying the structure and rehabilitation to meet the superelevation transition is approximately \$ 2,286,000.00.

Revised construction cost estimate = \$3,100,000 \*

#### **PROJECT DESIGN**

Project Design Criteria: New Construction (Freeway) Functional Classification: Freeway

\* Revised by Reviewer, 5/02/12

Rural/Urban: Urban Terrain: Level Design Speed: 70 mph Posted Design Speed: 55 mph Access Control: Full Number of Lanes and Width: 3 – 12 ft lanes Shoulders (width and Material): 13' Usable - 12 ft paved and 1ft aggregate (outside) Maximum Right of Way Width: 155'- 180' ft - Existing Typical Right of Way Width: 155'-180' ft Existing Structure Clear Roadway Width: N/A Clear Zone: 30' Side Slopes: 2:1 max 3:1 Typical (2:1 Max)\*\*

#### TRAFFIC DATA

AADT (1999):	12,710	VPD
AADT (2030):	29,700	VPD
DHV (2030):	3,600	VPH
Comm. Veh.:	10%	DHV
	16%	AADT

#### CRASH ANALYSIS

According to the last three years accident data this segment of East SR 265 experienced no crashes. Therefore it can be concluded that this section of East SR 265 is not an area of concern in terms of crash statistics and no accidents can be attributed to the sub-standard superelevation transition.

#### COST EFFECTIVE ANALYSIS

Since there were no accidents identified within the region of interest as being attributed to the superelevation transition, there is no benefit to improving the superelevation transition. Therefore, the benefit to cost ratio is 0. Since the benefit of the cost ratio is less than 1, improvement to the superelevation transition would not be economically prudent.

#### ANCILLARY IMPACTS

There are no ancillary impacts with this design exception.

#### <u>SAFETY</u>

The impact of modifying S/E transition by changing the distribution of the runoff length on the curve is thought to be negligible. Since there were no accidents due to the nonstandard superelevation transition, there will not be a decrease in safety due to not improving the superelevation transition.

#### **REMEDIAL ACTIONS**

Since there were no accidents due to the inadequate superelevation transition, there are no remedial actions will be required.

**OTHER FACTORS** The purpose of the work in the exception area is pavement reconstruction. \*\* The purpose of the work on SR 265 is pavement reconstruction. The proposed design provides the best design possible without extending the work on S.R. 265, matches the existing conditions and does not require reconstruction of the bridge over the railroad structure beyond the project limits. If the bridge structure is to be modified, minimal environmental impact would be involved. No right-of-way will be required, however extensive coordination with the railroad would be needed.

.



## **BURGESS & NIPLE**

Curve LA-WB-2 BN PN	45006	
LA-WB Designed By:	JMM Date:	8/14/2009
Checked By:	KSP Date:	1/14/2010

## Design Tables e<sub>max</sub> = 8%

AASHTO Exhibit 3-15 As of 8/14/09			
Design Speed (mph)	f <sub>max</sub>	R <sub>min</sub>	
15	0.32	38	
20	0.27	76	
25	0.23	134	
30	0.2	214	
35	0.18	314	
40	0.16	444	
45	0.15	587	
50	0.14	758	
55	0.13	960	
60	0.12	1200	
65	0.11	1480	
70	0.10	1810	
75	0.09	2210	
80	0.08	2670	

	AASHTO Exhibit 3-14 As of 8/14/09		
	Design Speed (mph)	Running Speed (V <sub>R</sub> )	
	15	15	
	20	20	
	25	24	
	30	28	
	35	32	
	40	36	
	45	40	
	50	44	
	55	48	
	60	52	
	65	55	
	70	58	
	75	61	
i	80	64	

## Superelevation Rate Calculations e<sub>max</sub> = 8%

Design Speed V <sub>D</sub> (mph)	70
Radius (ft) R <sub>design</sub>	3777.72

f <sub>max</sub> =	0.1	AASHTO Exhibit 3-15		
R <sub>min</sub> =	1810	AASHTO Exhibit 3-15		
V <sub>R</sub> =	58	AASHTO Exhibit 3-14		
R <sub>PI</sub> =	2803.33	AASHTO Equation 3-13		
H <sub>PI</sub> =	0.0365	AASHTO Equation 3-14		
S <sub>1</sub> =	0.0179	AASHTO Equation 3-15		
S <sub>2</sub> =	0.0566	AASHTO Equation 3-16		
MO =	0.0140	AASHTO Equation 3-18		
1/R <sub>design</sub> =	0.0003			
1/R <sub>Pi</sub> =	0.0004			

## If 1/R<sub>design</sub> <= 1/R<sub>PI</sub> use f<sub>1</sub>; If 1/R<sub>design</sub>>=1/R<sub>PI</sub> use f<sub>2</sub>

f <sub>1</sub>	0.0348	AASHTO Equation 3-21
f <sub>2</sub>	0.0370	AASHTO Equation 3-23

$(.01e+f)_{D} = V_{d}^{2}/15R_{design}$	0.0865
$e = V_d^2 / 15 R_{design} - f_1 \text{ or } f_2$	5.2%

**e =** 5.2%

#### SUPERELEVATION CALCULATIONS

**BURGESS & NIPLE** 

Curve LA-WB-2-IN	BN PN	45006		
Line A - WB	Designed By:	JMM	Date:	5/5/2009
- 이상, 방상, 영상, 영상, 영상, 영상, 영상, 영상, 영상, 영상, 영상, 영	Checked By:	KSP	Date:	1/14/2010

Curve LA	WB-2-IN				
PC Station	415+11.56	Length (ft)	1256.04	w(Rotation Width) ft	12.00
PI Station	421+45.43	Emax	0.08	G	0.40
PT Station	427+67.6	S (Normal slope)	0.02	Runoff L=w*e*n*bw/G	240.00
Design Speed (mph)	70	n(number of lanes)	2.00	Runout T=S*L/e	92.31
Radius (ft)	3777.72	bw Value	0.75	Rate ft/ft/ft	0.000215191

Superelevation Rate	Portion of SE Runoff on	Tangent	Use
	% Runoff on Curve (PC)	20.00%	20.00%
See Superelevation Calculation Spreadsheet	% Runoff on Tangent	80.00%	80.00%
· ·	% Runoff on Curve (PT)	20.00%	
e = 5.2%	% Runoff on Tangent	80.00%	

Calculated statior	ns using 20/80		Modified stations	using alternative pe	ercentage
Normal Crown	PC-0.80*L-T=	412+27.25	Normal Crown	PC-%*L-T=	412+27.25
Half Flat	PC-0.80*L=	413+19.56	Half Flat	PC-%*L=	413+19.56
Full Cross	PC-0.80*L+T=	414+11.87	Full Cross	PC-%*L+T=	414+11.87
80% Super	PC=	415+11.56	% Super	PC=	415+11.56
Super	PC+0.20*L=	415+59.56	Super	PC+%*L=	415+59.56

	Station	Lt. Shid.	Cross Slope Left	Cross Slope Right	Rt. Shid.
Normal Crown	412+27.25		-2.00%	-2.00%	
Half Flat	413+19.56		0.00%	-2.00%	
Full Cross	414+11.87		2.00%	-2.00%	
PC	415+11.56		4.16%	-4.16%	
Super	415+59.56		5.20%	-5.20%	

Reasons for using alternative percentages

Additional Comments

#### SUPERELEVATION CALCULATIONS

#### **BURGESS & NIPLE**

Curve LA-WB-2-OUT	BN PN	45006		
Line A - WB	Designed By:	JMM	Date:	10/6/2009
	Checked By:	KSP	Date:	1/14/2010

Curve LA-V					
PC Station	415+11.56	Length (ft)	1256.04	w(Rotation Width) ft	12.00
PI Station	421+45.43	Emax	0.08	G	0.40
PT Station	427+67.6	S (Normal slope)	0.02	*Runoff L=w*e*n*bw/G	800.00
Design Speed (mph)	70	n(number of lanes)	1.00	* Runout T=S*L/e	307.69
Radius (ft)	3777.72	bw Value	1.00	Rate ft/ft/ft	6.45572E-05

Superelevation Rate	Portion of SE Runoff on	Tangent	Use	
	% Runoff on Curve (PC)	20.00%		
See Superelevation Calculation Spreadsheet	% Runoff on Tangent	80.00%		
	% Runoff on Curve (PT)	20.00%	32.00%	
e = 5.2%	% Runoff on Tangent	80.00%	68.00%	

Calculated station	Calculated stations using 20/80			Modified stations using alternative percentage			
Super	PT-0.20*L=	426+07.6	Super	PT-%*L=	425+11.6		
80% Super	PT=	427+67.6	% Super	PT=	427+67.6		
Full Cross	PT+.80*L-T=	430+99.91	Full Cross	PT+%*L-T=	430+03.91		

	Station	Lt. Shid.	Cross Slope Left	Cross Slope Right	Rt. Shld.
	2 <b></b>			g province and a second s	
Super	425+11.6		5.20%	-5.20%	
т	427+67.6		3.54%	-3.54%	
Match Existing	427+55.0		3.62%	-3.62%	

Transition Distribution modified to match existing cross slope of 3.62% at station 427+55

## Additional Comments

\* Transition runoff and runout modified to match existing rate of rotation.



## **BURGESS & NIPLE**

Curve LA-EB-3 BN PN	45006	
LA-EB Designed By:	JMM Date:	8/14/2009
Checked By:	KSP Date:	1/14/2010

## Design Tables e<sub>max</sub> = 8%

AASHTO Exhibit 3-15 As of 8/14/09					
Design Speed (mph)	f <sub>max</sub>	R <sub>min</sub>			
15	0.32	38			
20	0.27	76			
25	0.23	134			
30	0.2	214			
35	0.18	314			
40	0.16	444			
45	0.15	587			
50	0.14	758			
55	0.13	960			
60	0.12	1200			
65	0.11	1480			
70	0.10	1810			
75	0.09	2210			
80	0.08	2670			

AASHTO Exhibit 3-14 As of 8/14/09				
Design Speed (mph)	Running Speed ( $V_R$ )			
15	15			
20	20			
25	24			
30	28			
35	32			
40	36			
45	40			
50	44			
55	48			
60	52			
65	55			
70	58			
75	61			
80	64			

## Superelevation Rate Calculations e<sub>max</sub> = 8%

Design Speed V <sub>D</sub> (mph)	70
Radius (ft) R <sub>design</sub>	3819.42

f <sub>max</sub> =	0.1	AASHTO Exhibit 3-15
R <sub>min</sub> =	1810	AASHTO Exhibit 3-15
V <sub>R</sub> =	58	AASHTO Exhibit 3-14
R <sub>Pl</sub> =	2803.33	AASHTO Equation 3-13
H <sub>PI</sub> =	0.0365	AASHTO Equation 3-14
S <sub>1</sub> =	0.0179	AASHTO Equation 3-15
S <sub>2</sub> =	0.0566	AASHTO Equation 3-16
MO =	0.0140	AASHTO Equation 3-18
1/R <sub>design</sub> =	0.0003	
1/R <sub>PI</sub> =	0.0004	

## If $1/R_{design} \le 1/R_{Pl}$ use $f_1$ ; If $1/R_{design} \ge 1/R_{Pl}$ use $f_2$

f <sub>1</sub>	0.0344	AASHTO Equation 3-21
f <sub>2</sub>	0.0367	AASHTO Equation 3-23

$(.01e+f)_{D} = V_{d}^{2}/15R_{design}$	0.0855
$e = V_d^2 / 15 R_{design} - f_1 \text{ or } f_2$	5.1%

e =	5.1%

#### SUPERELEVATION CALCULATIONS

#### **BURGESS & NIPLE**

Curve LA-EB-3-IN	BN PN	45006		
Line A - EB	Designed By:	JMM	Date:	10/6/2009
	Checked By:	KSP	Date:	1/14/2010

Curve LA	-EB-2-IN				
PC Station	414+62.32	Length (ft)	1270.00	w(Rotation Width) ft	12.00
PI Station	421+03.24	Emax	0.08	G	0.40
PT Station	427+32.32	S (Normal slope)	0.02	Runoff L=w*e*n*bw/G	165.00
Design Speed (mph)	70	n(number of lanes)	1.00	Runout T=S*L/e	64.71
Radius (ft)	3819.42	bw Value	1.00	Rate ft/ft/ft	0.000309091

Superelevation Rate	Portion of SE Runoff on Tangent		Use	
	% Runoff on Curve (PC)	20.00%	20.00%	
See Superelevation Calculation Spreadsheet	% Runoff on Tangent	80.00%	80.00%	
	% Runoff on Curve (PT)	20.00%		
e = 5.1%	% Runoff on Tangent	80.00%		

Calculated stations using 20/80			Modified stations using alternative percentage		
Normal Crown	PC-0.80*L-T=	412+65.61	Normal Crown	PC-%*L-T=	412+65.61
Half Flat	PC-0.80*L=	413+30.32	Half Flat	PC-%*L=	413+30.32
Full Cross	PC-0.80*L+T=	413+95.03	Full Cross	PC-%*L+T=	413+95.03
80% Super	PC=	414+62.32	% Super	PC=	414+62.32
Super	PC+0.20*L=	414+95.32	Super	PC+%*L=	414+95.32

	Station	Lt. Shid.	Cross Slope Left	Cross Slope Right	Rt. Shld.
Normal Crown	412+65.61		-2.00%	-2.00%	
Half Flat	413+30.32		0.00%	-2.00%	
Full Cross	413+95.03		2.00%	-2.00%	
PC	414+62.32		4.08%	-4.08%	
Super	414+95.32		5.10%	-5.10%	

Reasons for using alternative percentages

Additional Comments

#### SUPERELEVATION CALCULATIONS

**BURGESS & NIPLE** 

BN PN	45006		
Designed By:	JMM	Date:	10/6/2009
Checked By:	KSP	Date:	1/14/2010
	Designed By:	Designed By: JMM	Designed By: JMM Date:

Curve LA-	EB-2-OUT				
PC Station	414+62.32	Length (ft)	1270.00	w(Rotation Width) ft	12.00
PI Station	421+03.24	Emax	0.08	G	0.40
PT Station	427+32.32	S (Normal slope)	0.02	*Runoff L=w*e*n*bw/G	772.73
Design Speed (mph)	70	n(number of lanes)	2.00	* Runout T=S*L/e	303.03
Radius (ft)	3819.42	bw Value	0.75	Rate ft/ft/ft	6.59998E-05

Superelevation Rate	Portion of SE Runoff on	Use	
	% Runoff on Curve (PC)	20.00%	
See Superelevation Calculation Spreadsheet	% Runoff on Tangent	80.00%	
	% Runoff on Curve (PT)	20.00%	0.00%
e = 5.1%	% Runoff on Tangent	80.00%	100.00%

Calculated stations using 20/80			Modified stations using alternative percentage			
Super		425+77.77	Super	PT-%*L=	427+32.32	
Super			· · · · ·			
80% Super	PT=	427+32.32	% Super	PT=	427+32.32	
Full Cross	PT+.80*L-T=	430+47.47	Full Cross	PT+%*L-T=	432+02.02	


	Station	Lt. Shid.	Cross Slope Left	Cross Slope Right	Rt. Shid.
Super	427+32.32		5.10%	-5.10%	
PT	427+32.32		5.10%	-5.10%	
Match Existing	428+63.		4.24%	-4.24%	
					Textures of the second s
Reasons for using	a alternative no	reentegee			

#### Additional Comments

\* Transition runoff and runout modified to match existing rate of rotation.

\* LEVEL ONE DESIGN EXCEPTION REQUIRED FOR TRANSITION DISTRIBUTION [SEE "MEMO TO REVIEWER]

# APPENDIX

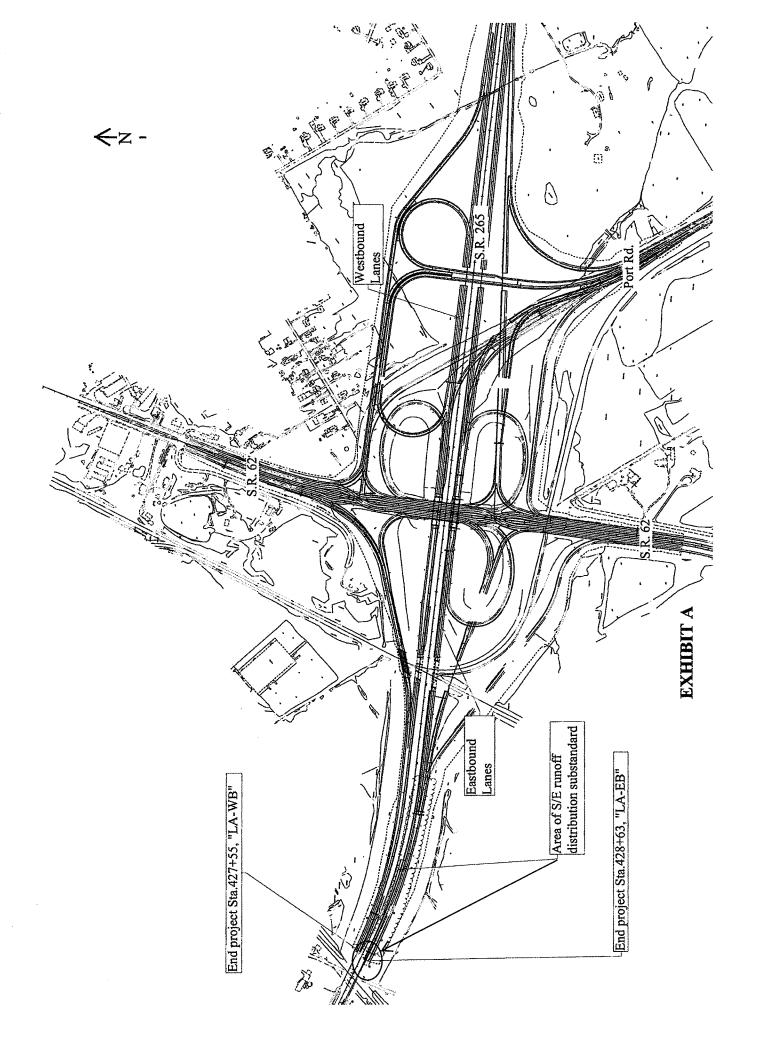

v	Number of Lanes Rotated				
(mph)	1	1.5	2 or 2.5	3 or 3.5	
15 - 45	80%	85%	90%	90%	
50 - 70	70%	75%	80%	85%	

## PORTION OF SUPERELEVATION RUNOFF ON TANGENT, %

Figure 43-3F

# EXHIBIT B

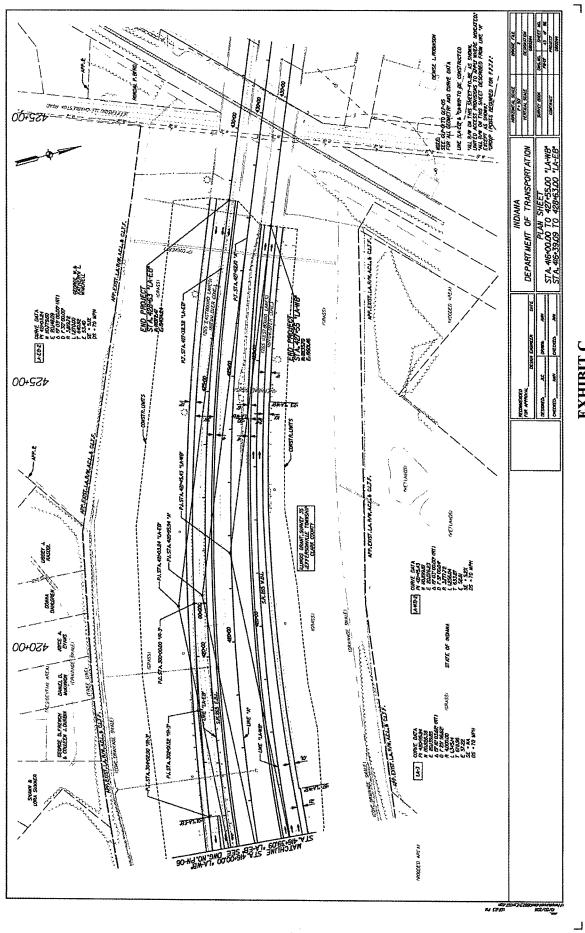



EXHIBIT C

L

Г

A state of the sta									The second s										RFIEV	DETAIL	<b>```</b> * * * *	
Tana and Annual								2		T	n										8	
						NC RI.		.E							14. WQ							
				40 ADA		DE PANEM	12 10	E PAVOUR	Li Din h	K-DMH			6 H. L				1					
						SB 0	L-s a Principa	2001-20	SKO-	00- 100- 01-1-10-		40 V	COL PARTY		1	25				00	+995	
					J/	8	\$		1. S						Ĥ				10247306			
					1390 1										-				LAKE SOL	60	+gge	
															<b>)</b> :++	3) 		675 X.			177	
					V	<b>\</b>							Ĩ		<u></u>							
														1		1.92.45		16 64		00	++95	
															949	7 \$ <del>9</del> 7	57595 	YIS GO	0.1			
			<u>ec:01+64</u>	- W15		- CUIS		012			1400-			<b>}</b>						60	+£95	
: : :						<u> </u>													RIIOR	atani Bilan Lang		
							1	$\frac{1}{1}$											TICK TRANST		+795	
												1	1						SUPERIEV TO			
					- p	<b> </b>	$\left  \right $												200. 30			
	•												1							00	+195	T
1	1		96 11 1095	·								[]						1				
								12 TES	162.019	(1) (Z 5		<b>1</b> 6/								00	+095	
								<u>\$1</u>			1	/	¥.03				-655	aş				
		 			1 1 1	BECHN 13		100	55150		ļ			_				2005			+655	-
										1/							• [3] • [1]	No Ga				+
					1.1.1 1.11.1.1				$\mathbb{N}$	1/								38				
							ALC: NO	5	W		) Lig							VIS		00	+822	-
			1. 11:11	11.11.11		10000	4 7 20	SAVAS	AND.			Bit freedor									   	-
				1111111			00100	A Perfect		-		ð								0	+ZSS	-
ŀ							4					101:111	1111111		11111	11.1114						

.

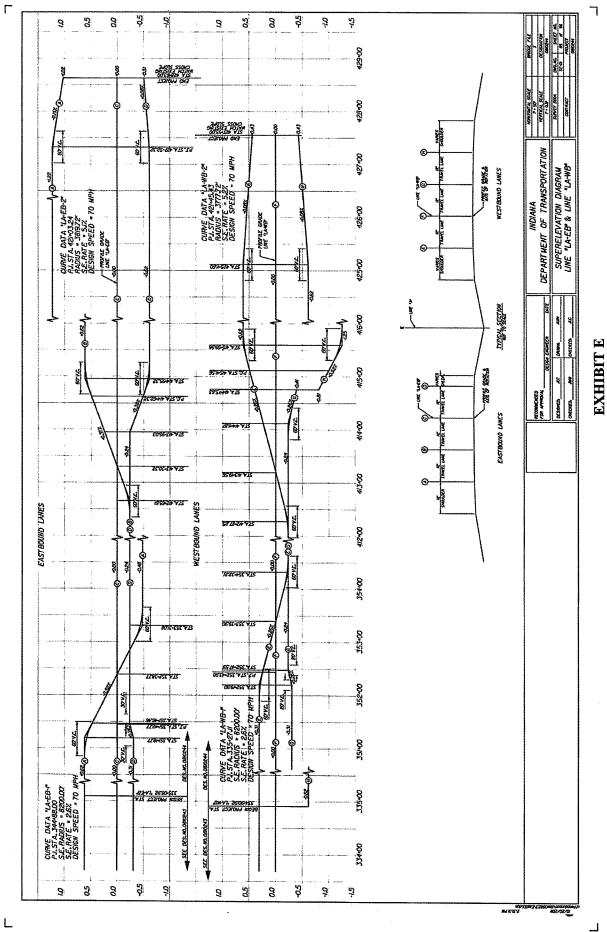

## THE EAST END CROSSING

## (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

## PUBLIC-PRIVATE AGREEMENT

## BOOK 2 TECHNICAL PROVISIONS

## ATTACHMENT 09-03 LEVEL ONE DESIGN EXCEPTION – WB SR 265 SHOULDER

INDIANA FINANCE AUTHORITY THE EAST END CROSSING (This page intentionally blank.)

INDIANA FINANCE AUTHORITY THE EAST END CROSSING JULY 31, 2012 BOOK 2 - TECHNICAL PROVISIONS ATTACHMENT 09-3 ADDENDUM 5 – OCTOBER 4, 2012

## LEVEL ONE DESIGN EXCEPTION REQUEST

June 7, 2012

#### MEMORANDUM

file

TO:	John Wright, PE Director, Highway Design 🛛 Bridges,	
THRU: <del>Jim Ud</del>	<del>e, PE</del> Nathan Frey Nill-Ley Director, Seymour District Production Divis	ion
THRU: Kevin	Hetrick, PE INDOT Project Manager	
THRU: Jim Hi	Iton, CTS Deputy Project Manager Hilton	<sup>2</sup> Digitally stored by James M.
THRU: James	M. Johnson, Beam, Longest, and Neff, LLC Project Reviewer	James M. Dricer-James M. Johnson, Dricer-James M. Johnson, Dricer-James M. Johnson, Delean, Longest and Neff, UC our Transportation, "eus Date 2012/86/87/14/34/47
FROM: Burges	s & Niple, Inc.	-04'00'
	Development of Preliminary Road Plans and	Level 1 Analysis (attached)
SUBJECT:	Design Exception Request for SW: Shoulder	Width
	Des. No.: 0201297	
	Route No. or Road Name: SR 265	
	PE Project No.: 0201297	
	Structure No.: I265-9-2620 & I265-9-2620J	

Transmitted, herewith, is a Design Exception request for the above referenced project. The documentation has been reviewed for compliance with the Design Exception requirements included in *Indiana Design Manual* Section 40-8.0. Based on the analysis of the substandard Level One design features, we believe that the design exception is justified and we therefore recommend approval.

	Concur	Director, Highway Design Date 7/23/12 Director of Bridges
N P	FHWA Approv	ved: Date 7-25-/2
	INDOT	Design Exception Database Information
		Des. No.: 0201297
		Request Date: June 7, 2012
		Approved M Rejected
		Commitment Made: Yes 🗌 No 🗹
	cc:	John Wright, PE, Director, Highway Design 🛛 Bridges 🗌

## SUMMARY

#### **Project Description**

The Ohio River Bridges East End Project - SR 265 is divided into three main sections: the Kentucky approach, the main bridge spanning the Ohio River, and the Indiana approach. The project is located in eastern Clark County Indiana, south of the Indiana Army Ammunition Plant and north of the Town of Utica. It begins approximately six tenths (0.6) of a mile west of the existing interchange of SR 265 and SR 62 and extends across new terrain to the Ohio River.

#### **Design Feature**

#### Shoulder Width

The Indiana Design Manual Figure 53-1, Geometric Design Criteria for Freeway (New Construction or Complete Reconstruction) states the mainline right shoulder width should be 12 ft wide where the number of trucks exceeds 250 DDHV.

SR 265 truck volumes within the area of the interchange are 374 DHV, eastbound and 349 DHV, westbound. The existing westbound bridge has an existing 10 ft outside (right) shoulder.

Therefore, the Level 1 Design Exception Request is for retaining the existing shoulder width on the bridge.

#### **Construction Costs**

The additional construction cost (2012 cost) associated with modifying the bridges to meet shoulder width criteria is estimated as \$900,000.00.

This cost was developed by Beam, Longest and Neff, as a verification of the cost in the original Level 1 Exception documentation, attached.

#### **Additional Information**

Additional supporting data for the Level 1 Design Exception Request is in the original documentation developed by Burgess & Niple, Inc; attached.

## DESIGN EXCEPTION REQUEST SHOULDER WIDTH S. R. 265 DES No. 0810243

## **PROJECT DESCRIPTION**

Interstate 265 (I-265) encircles Louisville, Kentucky and the surrounding communities in northern Kentucky and southern Indiana. Portions of I-265 have not been built to date due to a lack of demand and funding. One such section is the stretch from the intersection with State Road 62 (SR 62) extending over the Ohio River to the intersection with Interstate 71 (I-71) in Worthington, KY. The I-265 East End Extension is divided into three main sections: the Kentucky approach, the main bridge spanning the Ohio River, and the Indiana approach. The project is located in eastern Clark County Indiana, south of the Indiana Army Ammunition Plant and north of the Town of Utica. It begins approximately six tenths (0.6) of a mile west of the existing interchange of SR 265 and SR 62 and extends across new terrain to the Ohio River near River Mile 595. The project is located in the Jeffersonville Quadrangle. The Project Design Criteria is New Construction (Freeway) and the Functional Classification is a Freeway. The new roadway is part of National highway System (NHS) but not currently on the national Truck network. Once this connection is completed FHWA will be adopting S.R. 265 into the interstate system as I-265.

## **DESIGN FEATURE**

The feature that does not meet the Level One Design criteria for a Freeway is the shoulder width.

The proposed typical roadway section consists of two 12-ft travel lanes in each direction with a 4-foot wide left shoulder and 10-ft and/or 12-ft wide right shoulders. The right shoulder width requirement for 4R Freeway construction is 10 ft paved (IDM Figure 53-1). However, the design requirement increases the shoulder width to 12 ft when the Directional Design Hourly Volume (DDHV) for truck is greater than 250 trucks. The DDHV for truck on the eastbound is greater than 250 trucks, therefore the right shoulder width of the eastbound S. R. 265 will use 12 ft shoulder width up to ramp IR-7. The right shoulder width of the S. R. 265 westbound lanes west of the Port Road exit ramp (IR-7) and S.R. 62 entrance ramp (IR-1), will use 10 ft since the DDHV for truck traffic for this stretch is less than the 250 DDHV.

The right shoulder width of the S. R. 265 westbound lanes west of the S.R. 62 entrance ramp (IR-1) will require 12 ft due to the DDHV for truck of 348 vehicles (see Exhibit A).

The width of the existing bridge over CSX Railroad and road approach near the end of project consists of two 12-ft travel lanes with a 10-ft right shoulder for both westbound and eastbound lanes. However, the existing eastbound lanes have a wider right shoulder width, which would be able to accommodate the proposed 12 ft wide shoulder without widening the bridge.

The current proposed shoulder width of the S.R. 265 westbound lanes west of entrance ramp (IR-1) and the existing bridge approach consists of 10 ft wide right shoulder to match the existing shoulder width at the bridge approach as well as the shoulder from Ramp IR-1.

The scope of this project is to tie into the existing two traffic lanes and shoulder width at S.R. 265 westbound lanes over Charleston Pike and railroad. The 12' wide shoulder would require widening the existing shoulder by 2 ft. The additional 2' would yield additional fill construction. The existing high fill slopes in this area will need to be undercut and stabilized (bench) to accommodate the 2'

width of added fill material. This will require additional earthworks that are otherwise not necessary and will result in minimal benefit to safety.

## **CONSTRUCTION COSTS**

The additional cost associated with construction of the additional 2 foot shoulder width and associated structure widening is approximately **\$176,000.00** 

Revised construction cost estimate = \$900,000 \*

## PROJECT DESIGN

Project Design Criteria: New Construction (Freeway) Functional Classification: Principal Arterial Rural/Urban: Urban Terrain: Level Design Speed: 70 mph Posted Design Speed: 55 mph Access Control: Full Number of Lanes and Width: 2 & 3 – 12 ft lanes in each direction Shoulders (width and Material): 11' Usable - 10 ft paved and 1' aggregate & 13' Usable - 12 ft paved and 1' aggregate Maximum Right of Way Width: 155'-180' ft - Existing Typical Right of Way Width: 155'-180' ft Existing Structure Clear Roadway Width: N/A Clear Zone: 30' Side Slopes: 2:1 max (outside CZ) 3:1 Typical (2:1 Max) \*\*

## TRAFFIC DATA

AADT (1999):	13,530	VPD
AADT (2030):	29,700	VPD
DHV (2030):	3,700	VPH
Comm. Veh.:	13%	DHV
	16%	AADT

#### CRASH ANALYSIS

According to the last three years accident data this segment of West SR 265 experienced no crashes. Therefore it can be concluded that this section of west SR 265 is not an area of concern in terms of crash statistics and no accidents can be attributed to the sub-standard shoulder.

#### **COST EFFECTIVE ANALYSIS**

Since there were no accidents identified within the region of interest as being attributed to the shoulder width, there is no benefit to improving the width of the shoulder. Therefore, the benefit to cost ratio is 0. Since the benefit to the cost ratio is less than 1, improvement to the shoulder width would not be economically prudent.

#### ANCILLARY IMPACTS

There are no ancillary impacts with this design exception.

#### **SAFETY**

The impact of reducing of shoulder by 2 feet is thought to be negligible. Since there were no accidents due to the inadequate shoulder width, there will not be a decrease in safety due to not improving the shoulder width.

\* Revised by Reviewer, 5/02/12

\*\* Revised by Reviewer, 6/07/12


## **REMEDIAL ACTIONS**

Since there were no accidents due to the inadequate shoulder width, there are no remedial actions will be required.

OTHER FACTORS The purpose of the work in the exception area is pavement reconstruction. \*\*

The purpose of the work on SR 265 is pavement reconstruction. The proposed design provides the best design possible without extending the work on SR 265 and matches the existing conditions and does not require the shoulder to be widened.

# APPENDIX

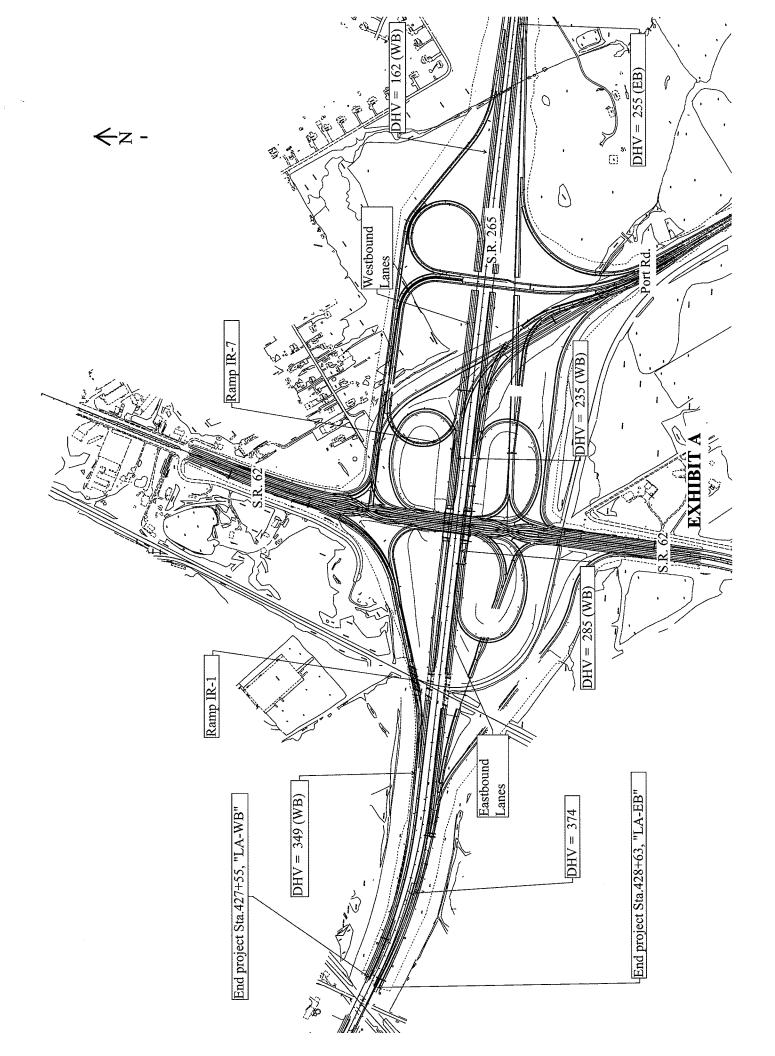

[	Design E	Element	Manual Section	Rural	Urban
	Design Forecast F	Period	40-2.02	20 Years	20 Years
5.5	*Design Speed, m	ph	40-3.0	70	50-70 (1)
Design Controls	Access Control		40-5.0	Full Control	Full Control
μõ	Level of Service		40-2.0	Desirable: B Minimum: C	Desirable: 8 Minimum: C (2)
	Travel Lane	*Width	45-1.01	12 ft	12 ft
	( ravei Lane	Surface Type(3)	Chp. 52	Asphalt / Concrete	Asphalt / Concrete
		*Right Width(4)	45-1.02	Usable: 11 ft Paved: 10 ft	Usable: 11 ft Paved: 10 ft
	Shoulder	*Left Width(5)	40-1.02	2 Ln: D 8 ft, M 4 ft Paved; 3 Ln: 10 ft Paved	2 Lanes: 4 ft Paved 3 Lanes: 10 ft Paved
		Surface Type(3)	Chp. 52	Asphalt / Concrete	Asphalt / Concrete
ŧ		*Travel Lane (6)	45-1.01	2%	2%
eme	Cross Slope	Shoulder (6A)	45-1.02	Paved Width ≤ 4 ft: 2% Paved Width > 4 ft: 4%	Paved Width ≤ 4 ft: 2% Paved Width > 4 ft: 4%
Ξ	A	*Lane Width	45 4 00	12 ft	12 ft
5	Auxiliary Lane	*Shoulder Width	45-1.03	Right: 10 ft (7) Left: 4 ft	Right: 10 ft (7) Left: 4 ft
Cross-Section Elements	Median Width	Depressed	45-2.0	Desirable: 100 ft Minimum: 54.5 ft	Desirable: 60 ft Minimum: 10 ft for 4 lanes, 54.5 ft for 6 lanes
တ်		Flush, with CMB		Desirable: 30.5 ft Minimum: 26.5 ft	Minimum: 26.5 ft
ĕ	Clear-Zone Width		49-2.0	(8)	(8)
0		Foreslope		6:1 (10)	6:1 (10)
1	<b>C L C L C L C L C L C L L C L L C L L C L L L C L L L L L L L L L L</b>	Cut Ditch Width	45-3.0	4 ft (11)	4 ft (11)
	Side Slopes (9)	Backslope		4:1 (12)	4:1 (12)
ŧ		FII	45-3.0	6:1 to Clear Zone; 3:1 max. to Toe	6:1 to Clear Zone; 3:1 max. to Toe
	Median Stopes		45-2.02	Desirable: 8:1 Maximum: 5:1	Desirable: 8:1 Maximum: 5:1
	New or	*Structural Capacity	Chp. 60	HL-93 (13)	HL-93 (13)
1	Reconstructed Bridge	*Clear-Roadway Width (14)	45-4.01	Full Paved Approach Width	Full Paved Approach Width
	Existing Bridge	*Structural Capacity	Chp. 72	HS-20	HS-20
Ś	to Remain in Place	*Clear-Roadway Width	45-4.01	Travelway Plus 10 ft Rt. & 4 ft Li. Shoulders	Travelway Plus 10 ft Rt. & 4 ft Lt. Shoulders
Bridges	*Vertical	New or Replaced Overpassing Bridge (15a)		16.5 ft	16.5 ft(15b)
<u> </u>	Clearance, Freeway Under	Existing Overpassing Bridge	44-4.0	16 ft	16 ft (15b)
	(15c)	Sign Truss / Pedestrian Bridge (15a)		New: 17.5 ft Existing: 17 ft	New: 17.5 ft Existing: 17 ft
	Vertical Clearance	, Freeway over Railroad (16)	Chp. 69	23 ft	23 ft

\* Controlling design criterion.

## GEOMETRIC DESIGN CRITERIA FOR FREEWAY (New Construction or Complete Reconstruction)

Figure 53-1

**EXHIBIT B** 

	Design Element		Manuai Section	Rural		Urt	pan	
<b>Г</b>	Design Speed			70 mph	50 mph	55 mph	60 mph	70 mph
	*Stopping Sight Distance		42-1.0	730 ft	425	495 ft	570 ft	730 ft
\$	Decision Sight Distance	(17)	42-2.0	780 ft	910	1030 ft	1150 ft	1410 ft
Elements	*Minimum Radius, e=8%		43-2.0	1640 ft	750	1000 ft	1290 ft	1650 ft
Lei lei	*Superelevation Rate		43-3.0	e <sub>max</sub> =8% (18)		e <sub>max</sub> ={	3% (18)	
	*Horizontal Sight Distanc	e	43-4.0	(19)		(1	9)	
Aignment	*Vertical Curvature,	Crest	44-3.0	247	84	114	151	247
5	K-value	Sag	44-3.0	181	96	115	136	181
₹	this income (20)	Level		3%	4%	3.5%	3%	3%
	*Maximum Grade (20)	Rolling	44-1.02	4%	5%	4.5%	4%	4%
	Minimum Grade		44-1.03	Desirable: 0.5% Minimum: 0.0%		Desirable: 0.5%	Minimum: 0.0%	

\* Controlling design criterion: A deviation from such is a design exception, and is subject to approval. See Section 40-8.0.

These criteria apply to a route either on or off the National Highway System, regardless of funding source.

GEOMETRIC DESIGN CRITERIA FOR FREEWAY (New Construction or Complete Reconstruction)

Figure 53-1 (continued)

**EXHIBIT B** 

#### GEOMETRIC DESIGN CRITERIA FOR FREEWAY (New Construction or Complete Reconstruction)

#### Footnotes to Figure 53-1

- (1) Design Speed. A 50 mph design speed may be considered in a restricted urban area.
- (2) Level of Service. A minimum Level of Service of D may be used on an urban reconstruction project.
- (3) Surface Type. The pavement-type selection will be determined by the INDOT Office of Pavement Engineering.
- (4) Shoulder Width, Right. The following will apply.
  - a. The shoulder is paved to the front face of guardrail. The desirable guardrail offset is 2 ft from the effective usable-shoulder width. See Section 49-5.0 for more information.
  - b. Where the number of trucks exceeds 250 DDHV, a 12-ft width should be used. If the 12-ft width is used, the usable-shoulder width will be 13 ft.
  - c. Usable-shoulder width is defined as the distance from the edge of the travel lane to the shoulder break point.
- (5) Shoulder Width, Left. The following will apply.
  - a. The usable-shoulder width is equal to the paved-shoulder width. The desirable guardrail offset is 2 ft from the usable-shoulder width. See Section 49-5.0 for more information.
  - b. Where there are 3 or more lanes in one direction and the volume of trucks exceed 250 DDHV, a 12-ft width should be used.
  - c. For a left shoulder of 4 ft or wider, the usable-shoulder width will be 1 ft more than the paved-shoulder width.
- (6) Cross Slope, Travel Lane. Cross slopes of 1.5% are acceptable on an existing bridge to remain in place.
- (6A) Cross Slope, Shoulder. See Figure 45-1A(1) or Figure 45-1A(2) for more-specific information.
- (7) Auxiliary-Lane Shoulder Width, Right. On a reconstruction project, a 6-ft width may be used.
- (8) <u>Clear-Zone Width</u>. This will vary according to design speed, traffic volume, side slopes, and horizontal curvature. See Section 49-2.0.
- (9) <u>Side Slopes.</u> Value is for new construction. See Sections 45-3.0 and 45-8.0 for more information. For a reconstruction project, see Section 49-3.0.
- (10) Foreslope. See Sections 49-2.0 and 49-3.0 for the lateral extent of the foreslope in a ditch section.

## **EXHIBIT B**

## THE EAST END CROSSING

## (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

## **PUBLIC-PRIVATE AGREEMENT**

## BOOK 2 TECHNICAL PROVISIONS

## ATTACHMENT 09-04 LEVEL TWO DESIGN EXCEPTION – SALEM ROAD ISD

(This page intentionally blank.)

## LEVEL TWO DESIGN EXCEPTION REQUEST

April 5, 2012 REV. April 25, 2012

#### MEMORANDUM

	John Wright JW	5/23/12	
TO:	voini (fright		amilaaa
	INDOT Manager, Roadway	2012 05 22	ervices
THRU:	Susan Gilbert Awan E. Silbert	10:26:21 -04'00'	
	INDOT Sr. Road Design Eng	gineer Team Leader	
TIDII	<b>W ' II</b> - ( <b>'</b> - <b>1</b>		
THRU:	Kevin Hetrick INDOT Project Manager	indito	
	ind of those manager a		
THRU:	Jim Hilton, CTS Jim	Dig sally signed by Sin Witton Dit on-sime Hann, on-CTSCEC, or, mail-follower-based collected	
	Deputy Project ManagerHilto	Ome 2012/025125319-04107	Digitally signed by James M.
THRU:	James M. Johnson, Beam, Lo	ongest, and Neff, LLC	James M. Johnson DN: cn=James M. Johnson, o=Beam, Longest and Neff,
111100	Project Reviewer	511 <b>5</b> 050, and 1 (011, 220	Johnson LLC, ou=Transportation, email=jjohnson@b-I-n.com, c=US
			Date: 2012.04 25 10:59:21 -04'00'
FROM:	American Structurepoint, Inc		
	Development of Preliminary ISD Analysis (attached)	Koad Plans and	
	1515 7 marysis (atached)		
SUBJECT:	Design Exception Request for	or Intersection Sight Dis	tance
	Des. No.:	0201297	
	Route No. or Road Name:	LSIORB Project	
		Section 6	
		SR 265 and Salem Roa	
		Structure No.: 265-10-	9604

Transmitted, herewith, is a Design Exception request for the above referenced project. The documentation has been reviewed for compliance with the Design Exception requirements included in *Indiana Design Manual* Section 40-8.0. Based on the analysis of the substandard Level Two design feature, we believe that the design exception is justified and we therefore recommend approval.

Please note the original submittal has been revised to add corrective notes to Page 6; per comments received from INDOT.

#### **Project Description**

The proposed design consists of the construction of a new diamond interchange at SR 265 and Salem Road. Work will consist of new pavement construction. Salem Road will be constructed as an overpass to SR 265.

#### **Design Feature**

#### Eye Offset Location for Intersection Sight Distance

In accordance with Section 46-10.03(01) in the Indiana Design Manual, the assumed offset location of the eye is 18.0 ft behind the edge of the travel lane for a new or reconstruction project, or 14.5 ft for a 3R project.

Intersection Sight Distance for left turns from Ramp "SWR" and from Ramp "NER" onto Salem Road is not provided when the eye location is placed at the 4R criteria of 18.0 ft. The restriction is due to the horizontal sight distance restriction created by the bridge barrier and approach rail. The right-of-way provided in the area of the interchange results in the ramp junctions with Salem Road being placed fairly close to the overpass bridge structure.

To provide the 4R Criteria eye offset of 18.0 feet, the proposed bridge would need to be widened to provide a 12 foot shoulder on one side and a 14 foot shoulder on the other side.

Placement of the eye location at the 3R criteria of 14.5 ft provides the required Intersection Sight Distance.

Due to increased construction cost, a Level 2 design exception for Intersection Sight Distance is proposed.

# **D: Intersection Sight Distance**

IN20050774 SR 265 Ohio Bridges Des.No. 0810242

#### AMERICAN STRUCTUREPOINT, INC. Intersection Sight Distance

BY: DATE: CHK: DATE: SHEET\_\_\_of\_\_\_ JOB NO.2005.0774 Salem Road

#### 5. Intersection Sight Distance (ISD)

#### **General Notes:**

Design Speed () = See Design Criteria under Roadway Design Calculations.

Eye Location (4R Project) = 18 feet behind the edge of travel lane

Height of Eye = 3.5 feet for passenger car

Height of Eye = 7.6 feet for single unit or combination truck (IDM Section 46-10.0)

Height of Object = 3.5 feet

ISD Formula and Figure are from Indiana Design Manual (IDM) Chapter 46 and Figure 46-10G and 46-10H

 $ISD = 1.47(V_{major})(t_g + t_{af})$ 

V<sub>major</sub> - Design speed of major road

te - Time gap for minor road vehicle to enter major road

t<sub>af</sub> - Time Adjustment Factor for Additional Lanes:

Passenger Car - 0.5 s (each additional lane to be crossed by a turning vehicle)

Truck - 0.7 s (each additional lane to be crossed by a turning vehicle)

t<sub>af</sub> - Time Adjustment Factor for Center Curb Width:

Proportionally based on the width of the center curb to the width of a standard 12' lane. Passenger Car - 0.5 s for 12' Truck - 0.7 s for 12'

**Restricted Movement:** 

None - Turning right, turning left, and crossing a major road are permitted. LT & RT only - Only left turn and right turn are allowed.

RT Only - Only right turn is permitted.

#### ISD Check:

LT - Looking right before turning left onto a major road.

RT - Looking left before turning right onto a major road.

RT2 - Looking left before turning right onto the TWLTL of the major road.

CrossA - Looking right before crossing a major road.

CrossB - Looking Left before crossing a major road.

LT MAJ - Looking forward before turning left from the major road.

LT MIN - Looking forward before turning left from the minor road.

#### AMERICAN STRUCTUREPOINT, INC. Intersection Sight Distance

BY: DATE: CHK: DATE: SHEET\_\_\_of\_\_\_ JOB NO.2005.0774 Salem Road

#### 5. Intersection Sight Distance (ISD)

#### Stop-Controlled Intersection (Chapter 46-10.03):

Movements for turning right, turning left, and crossing a major road will be checked for ISD based on Restricted Movement. The controlling scenario will be drawn on to plan sheets for analysis.

#### Left-Turn from the Major Road (Chapter 46-10.04):

The IDM states, "If stopping sight distance has been provided continously along the major road and if sight distance for stop control or yield control has been provided for each minor-road approach, sight distance will generally be adequate for left turns from the major roadway" and " the availability of sight distance for left turns from a divided highway should be checked because of the possibility of sight obstructions in the median". The proposed median shall maintain an adequate obstruction free sight triangle for this and other required intersection manuvers. Therefore, Left-Turns from the Major Road will only be checked at signalized intersections where protected left and right turn movements for the minor roadway exist.

#### Signalized Intersection (Chapter 46-10.05):

Movement for right turns will be checked for both the minor and major roadways to accommodate the possibility of unprotected manuvers.

#### **Graphical Checks:**

All sight triangles will be checked using the Single Unit Truck Intersection Sight Distance, however; the height of eye will be for that of the Passanger Car. This situation will yeild a worst case cenario. If this case provides adequate sight distance then the Intersection Sight Distance for both the Single Unit Truck and Passanger Car will be adequate. The vehicle is positioned behind the stop bar to provide an ideal situation. If this is not possible, the vehicle is then moved so the eye is located 18' from the edge of travel way.

SHEET 7 of / JOB NO.2005.0774 Salem Road

AMERICAN STRUCTUREPOINT, INC. Intersection Sight Distance

5. Intersection Sight Distance (ISD)

BY: ARAM DATE Y/2-2/11 CHKSS, DATE: 07(07111

		Appros	Approach Information					ł		Passenger Car			ŝ	Single Unit Truck	×			_
Minor (turning from)	Major (turning to)	Type	Restricted Movement	ISD Check	Design Speed (mph)	Add'l Lane Crossed (Each)	Center Curb Width (ft)	ۍ ټړ	() <sup>2</sup>	Calculated ISD (ft)	Design ISD (ff)	t <sub>3</sub> (s)	t <sub>ar</sub> (s)	Calculated ISD (ft)	Design ISD (ft)	Design ISD (ft)	IS ISD OK?	
								T	t									_
				RT	45	D	0	8.5	ī	430.0	430	8.5	1	562.3	585	585	Yes	
Dame NCO	Salem Rd.	Stop	Mana	LT	45	1	80	7.5	0.8	551.3	555	9.5	1.2	705.6	710	710		Yes (a)
USA ALIAN	Line "LS-1"	Controlled	alion	CrossA	45	0	0	6.5	0.0	430.0	430	8.5	0.0	562.3	565	565	Yes	4
				CrossB	45		8	6.5	0.8	485.1	490	8.5	1.2	639.5	840	640	488	(q) oN
																		L
			4	RT	45	0	0	6.5	1	430.0	430	8.5	t	562.3	565	565	Yes	
Domn CIMP	Salem Rd.	Stop	Nimme	17	45	1	80	7.5	0.8	551.3	555	9.5	1.2	705.6	710	710	- PRO-	Yes (a)
WAAD durby	Line "LS-1"	Controlled	MOLE	CrossA	45	0	0	6.5	0.0	430.0	430	8.5	0.0	562.3	565	565	Yes	L
				CrossB	45	Ŧ	80	6.5	0.8	485.1	490	8.5	1.2	639.5	640	640	1	(q) 0N
				RT	35	0	0	6.5	ī	334.4	335	8.5	1	437.3	440	440	Yes	_
Colore Do	Dated D.d	Stop	Kinne	LT	35	0	0	7.5	0.0	385.9	390	9.5	0.0	438.8	490	490	Yes	_
כמובוון צחי	1010140	Controlled	AUINA	CrossA	35	0	0	8.5	0.0	334.4	335	8,5	0.0	437.3	440	44D	Yes	_
				CrossB	35	0	0	6.5	0.0	334.4	335	8.5	0.0	437.3	440	440	Yes	_
																		_

Note: Center Curb Width Includes 2' Curb Offset

REVIEWER NOTES:

(a) ISD is OK with eye at 18.0 ft. offset

(b) ISD is not met with eye at 18.0 ft. offset ISD is OK with eye at 14.5 ft. offset

See graphical layouts, Pages 9 to 20



7260 Shadeland Station, Indianapolis, Indiana 46256 TEL 317.547.5580 FAX 317.543.0270

www.structurepoint.com

## MEMORANDUM

DATE:December 14, 2009TO:Josh CookFROM:Will LyonRE:SR265 and Salem Road - ISD IssueCC:Scott Sondles, Tom Bolte, Ed Spahr, Clint Sparks, Chris Ogg, Hatem Mekky

Upon closer review, American Structurepoint has discovered an Intersection Sight Distance Issue when stopped on Ramps "SER" and "NWR" and making the left turn movement. Structurepoint has identified 3 options below to resolve the situation but we recommend using Option 1.

## Option 1

- Utilize a 14.5ft offset of the eye to edge of travel way (AASHTO Minimum Offset and Indiana Design Manual 3R Minimum Offset) – 14.5ft is also the anticipated stop bar location with an 8ft shoulder plus 6.5ft to eye location
  - o Impacts
    - Will have to lower Salem Road profile
    - Will have to flare guardrail on end of bridge
    - Requires Level II Design Exception (Due to not using 18' offset to the eye location which is the 4R criteria)
  - o Benefits to Option
    - Does not impact ramp profiles
    - Do not have to change bridge beam type; we can utilize a more cost effective structure type
    - Do not have to change bridge width to a wider, more expensive bridge with 12+ feet shoulders
    - Does not impact R/W
    - Requires minimum amount of plan adjustments
    - Most cost effective

## Option 2

• Utilize 18ft offset of the eye to edge of travel way (Indiana Design Manual 4R Minimum Offset)

Page 1 of 2

## o Impacts

- Will have to lower Salem Road profile; more than what we will have to do in Option 1
- Will impact all ramp profiles
- Will have to flare guardrail on end of bridge
- Will have to change bridge beam type to a more costly alternative
- Will have to widen bridge shoulders to 12+ feet
  - On one side of the bridge the shoulder would have to be 14' which is typically not accepted by INDOT
- Adds additional costs to bridge; approximately \$250,000 in bridge costs alone
- o Benefits
  - Achieves required Intersection Sight Distance according to Indiana Design Manual 4R criteria


## Option 3


• Do nothing and submit a Level II Design Exception.


Yours truly,


William S. Toyon


William S. Lyon, PE

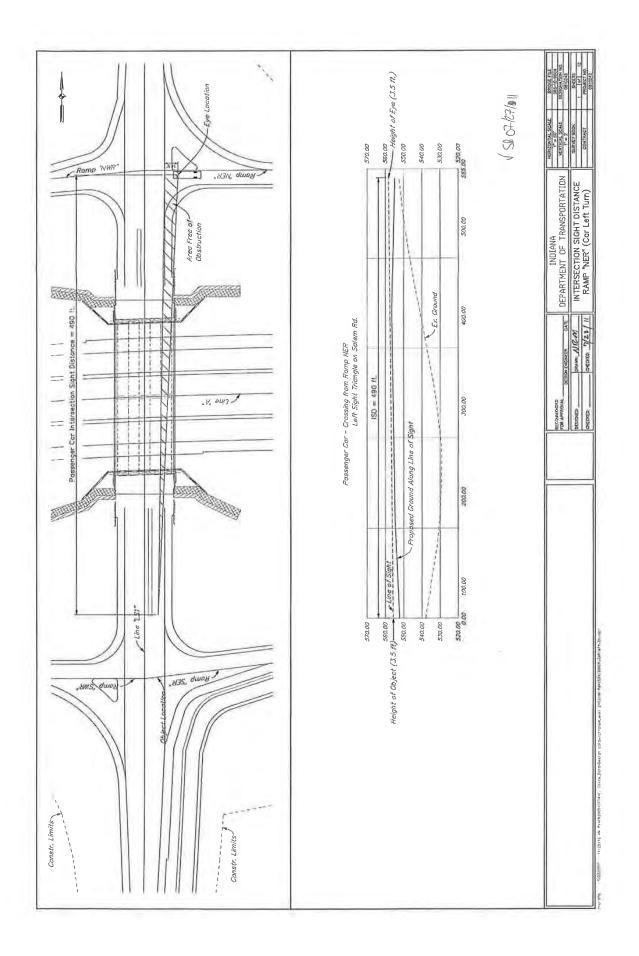


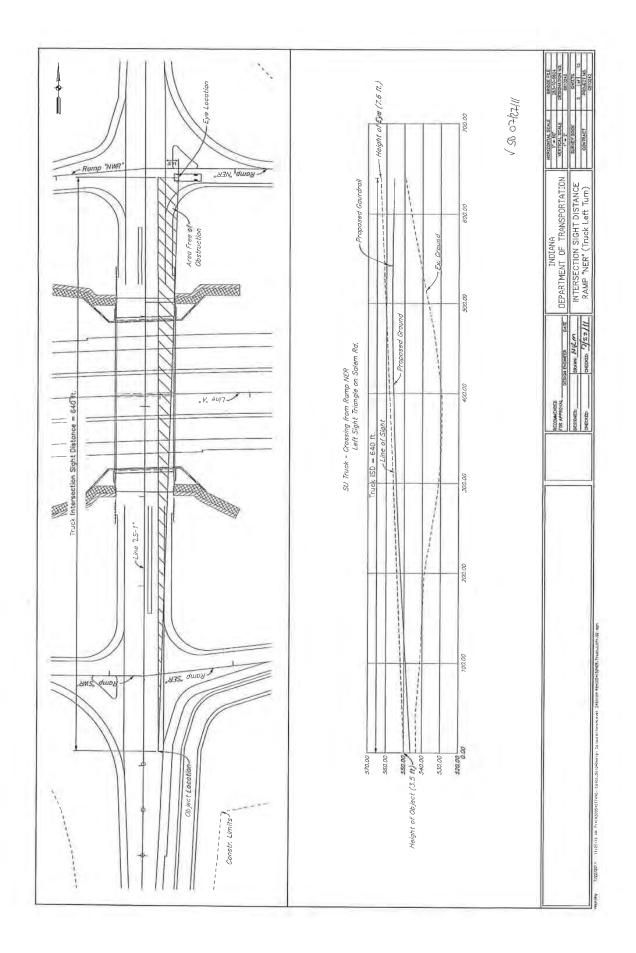


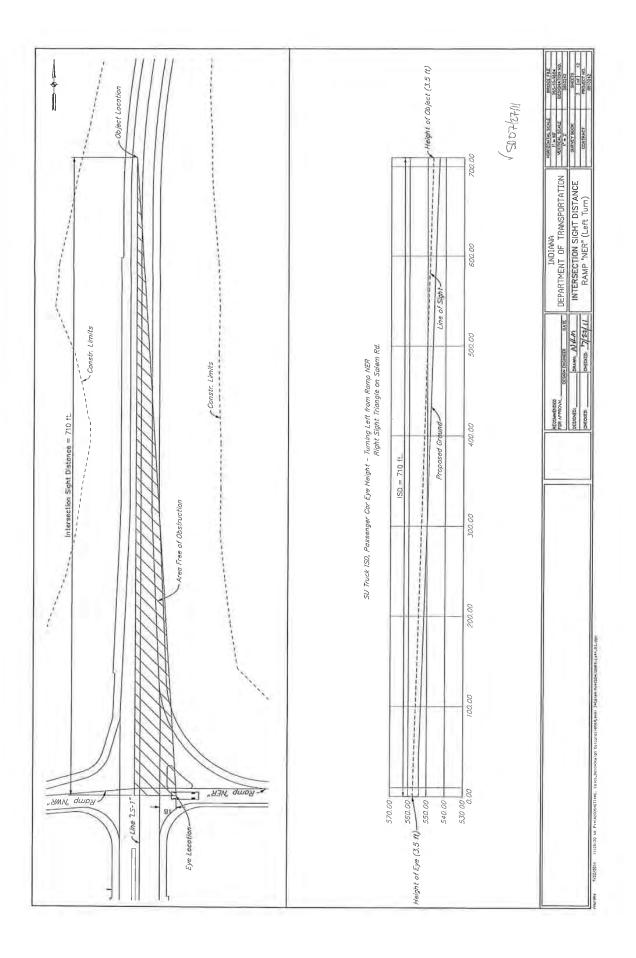


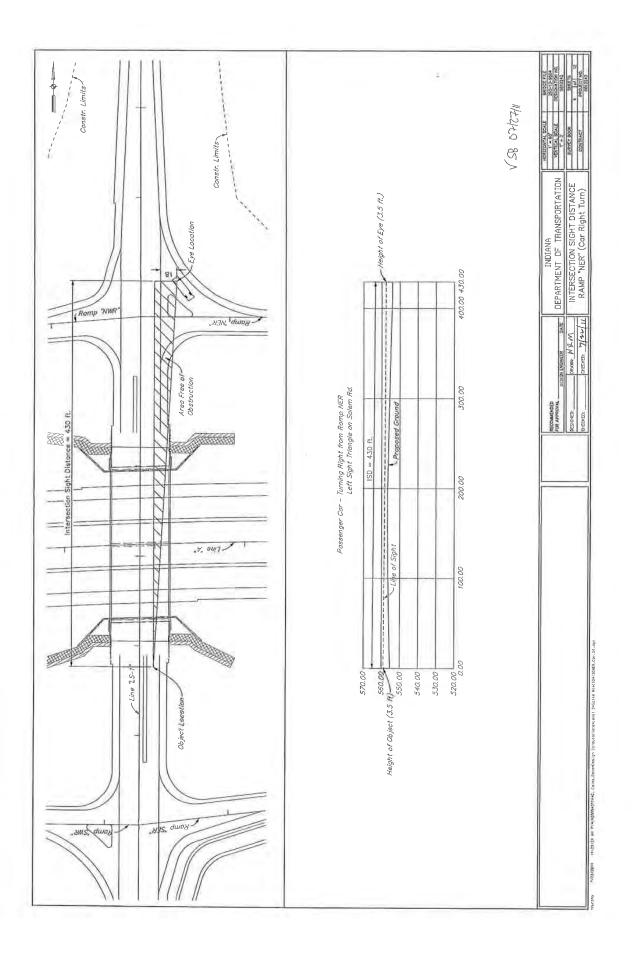


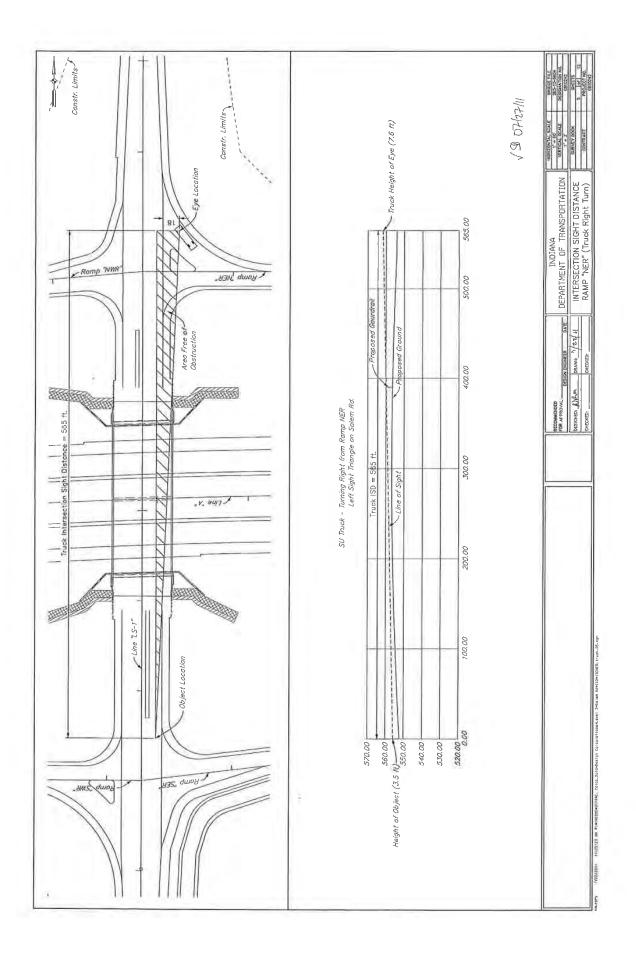


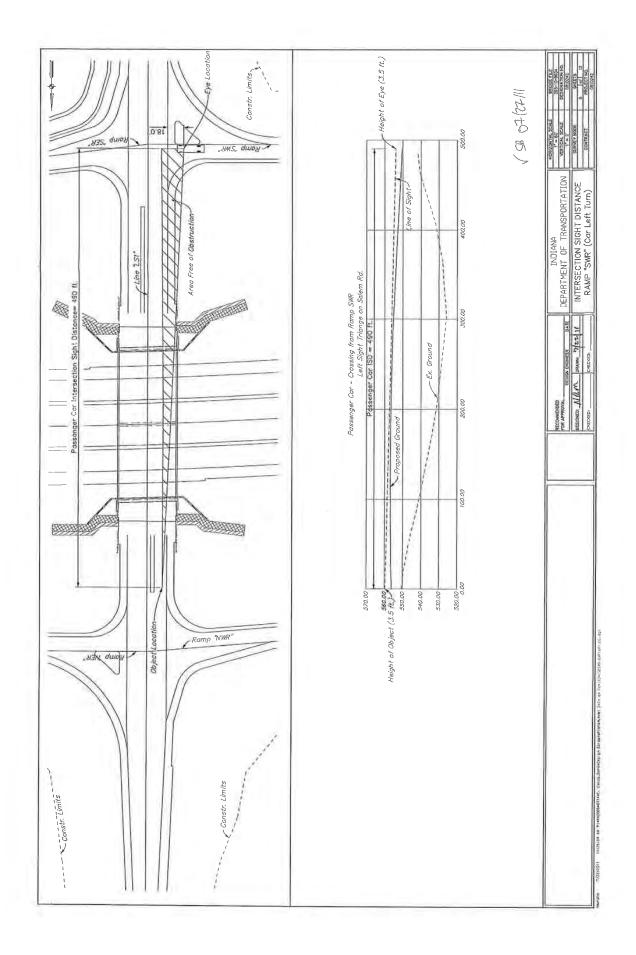


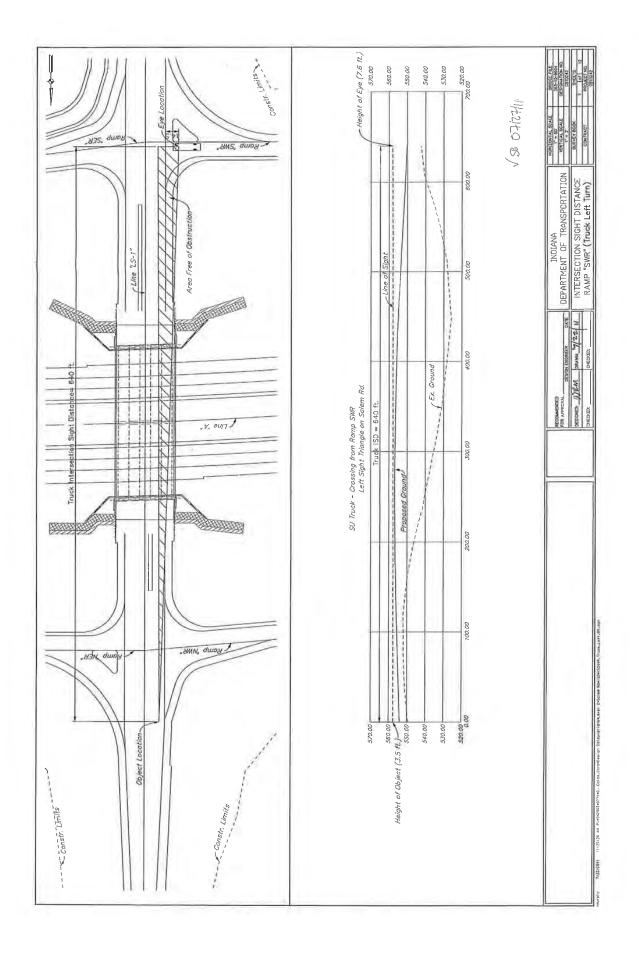


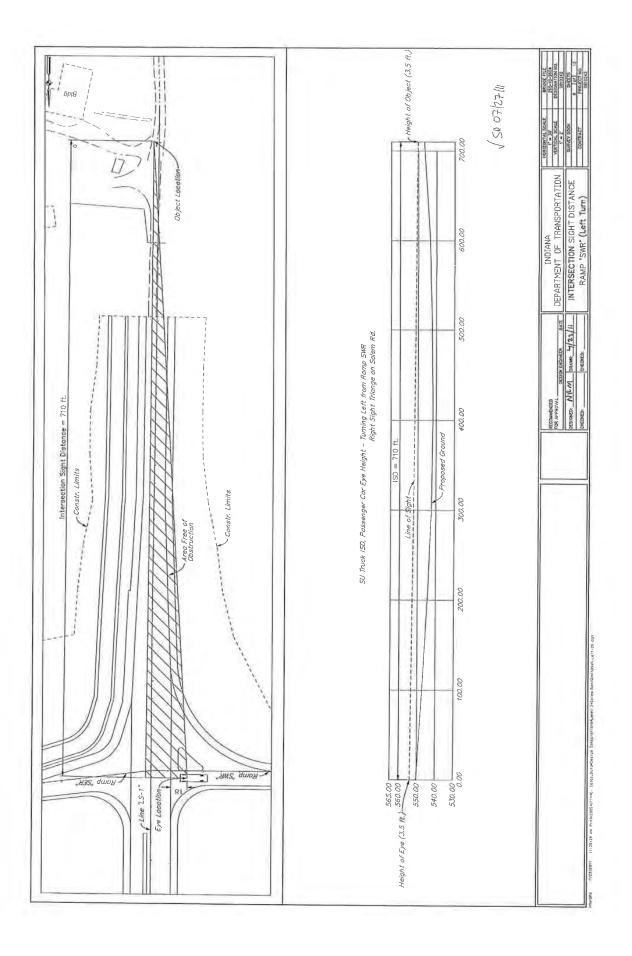

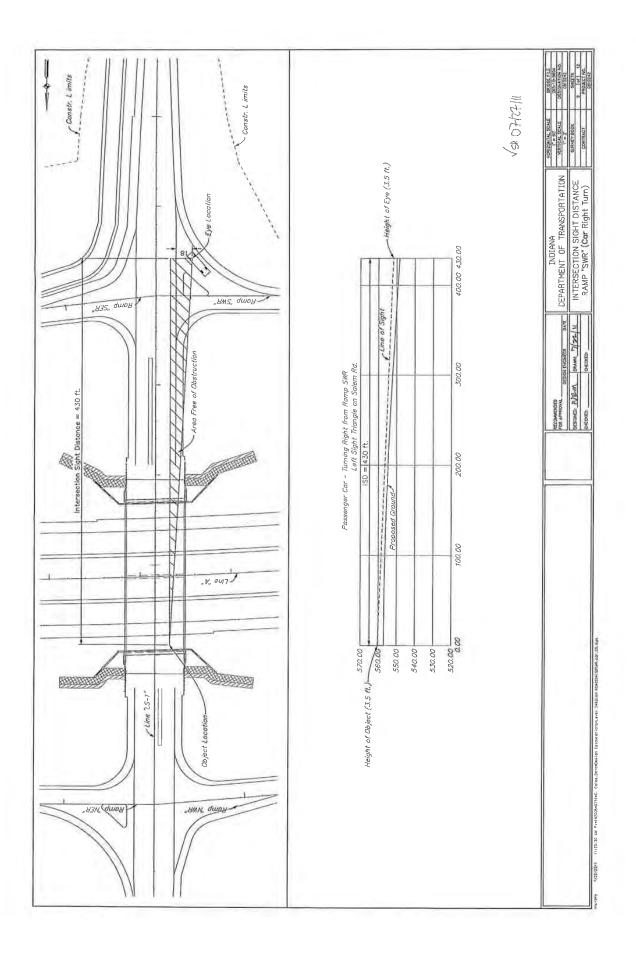

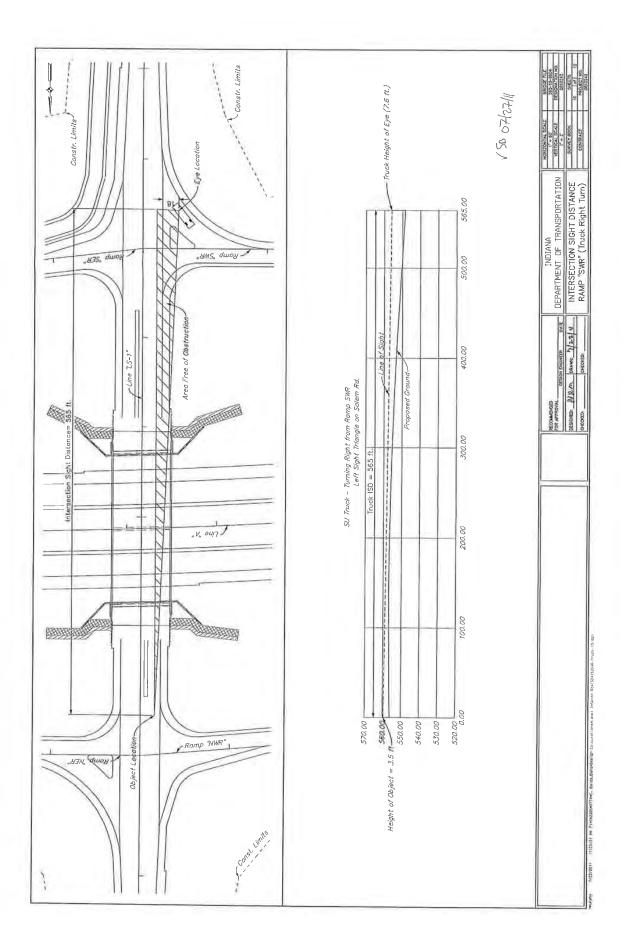

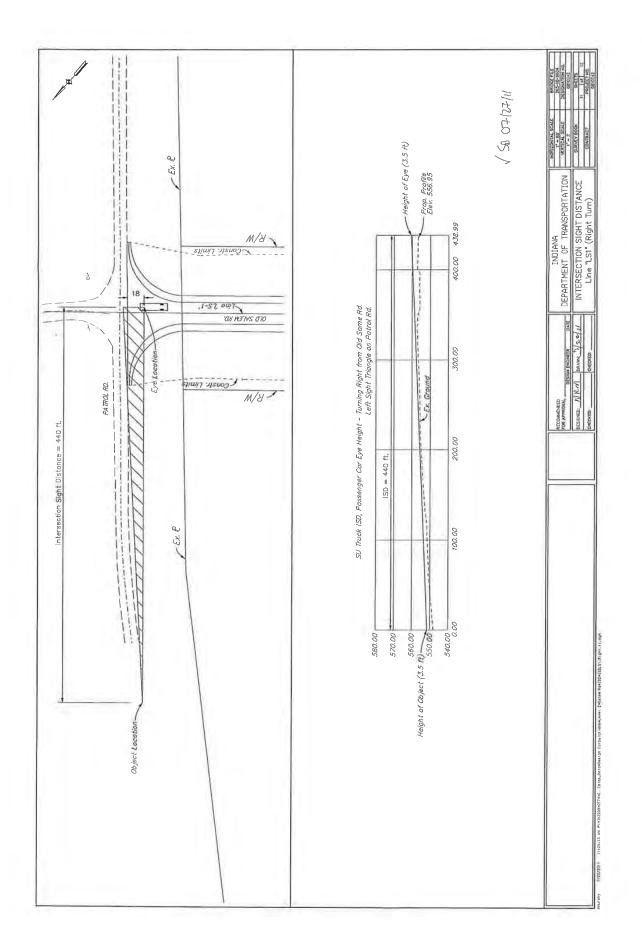

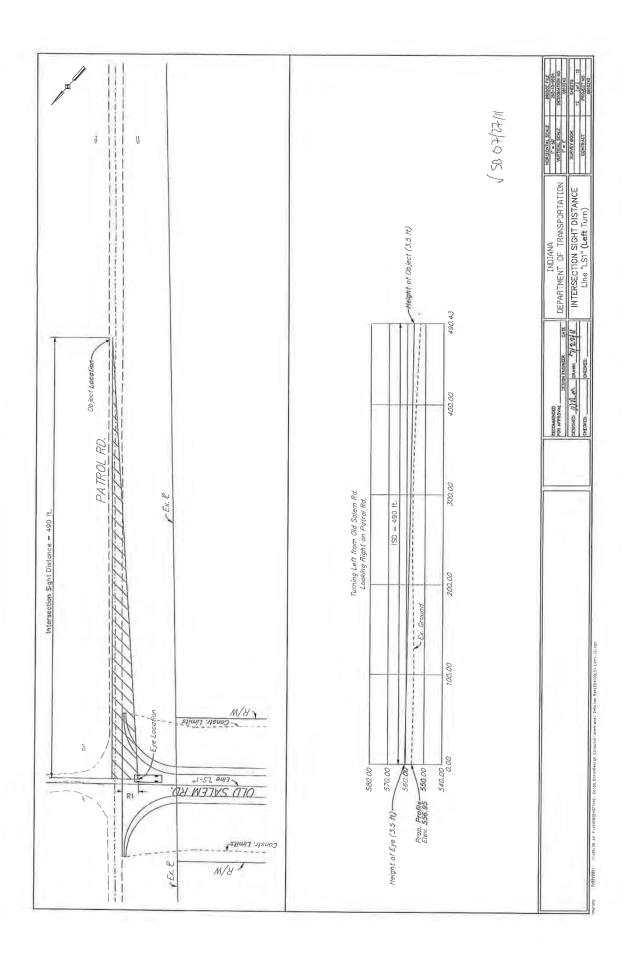

X

## THE EAST END CROSSING

## (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

## PUBLIC-PRIVATE AGREEMENT


BOOK 2 TECHNICAL PROVISIONS

## ATTACHMENT 14-1 OVERHEAD SIGN STRUCTURES STANDARD DRAWINGS

(This page intentionally blank.)

	INDEX		
HEET NO.	SUBJECT	INDIANA DEPARTMENT	
	BOX TRUSS STRUCTURE DETAIL DRAWINGS		
1	PLAN AND ELEVATION	OF TRANSPORTATION	
2	TABLE OF DIMENSIONS - SPANS 34' THRU 85'	RED LANA	
3	TABLE OF DIMENSIONS - SPANS 86' THRU 130'		
4	TRUSS SCHEDULE		
5	ISOMETRIC VIEWS	E TRANSF	
6	CONNECTIONS AND WELD DETAILS		
7	ALUMINUM CHORD DETAILS	SIGN BOX TRUSS & CANTILEVER STRUCTURE	
8	END SUPPORT DETAILS	DETAIL DRAWINGS	
-10	TRUSS CONNECTION DETAILS	DETAIL DRAWINGS	
11	STEEL END SUPPORT HANDHOLE DETAILS		
2-13	STEEL END SUPPORT BASE DETAILS		
L-15	INTERIOR WALKWAY GRATING PLAN & DETAILS		
16	FOUNDATION AT 33" CONCRETE BARRIER WALL		
7	FOUNDATION AT 45" CONCRETE BARRIER WALL		
8	FOUNDATION AT 36" MEDIAN OR SHOULDER	ENTER THE FETTER THE REAL AND A DECEMBER OF THE PETTER AND A DECEMBER AND A	
19	SPREAD FOOTING QUANTITIES		
	CANTILEVER STRUCTURE DETAIL DRAWINGS		
1	QUADRI-CHORD ARM - PLAN AND ELEVATION		
2	DOUBLE MAST ARM - PLAN AND ELEVATION		
3	TABLE OF DIMENSIONS		
4	ARM DETAILS		
-6	QUADRI-CHORD DETAILS		
7	MAST ARM DETAILS		
8	BASE PLATE AND ANCHOR BOLT DETAILS	HYHAN BUELT TAA	
9	HANDHOLE DETAILS	THE FRANCE AND A LAND	
10	COLUMN DETAILS		
-13	FOUNDATION AT 33" CONCRETE BARRIER WALL		
-16	FOUNDATION AT 45" CONCRETE BARRIER WALL	ATT STATEMAN	
-19	DRILLED SHAFT FOUNDATION		
		ASH-ACTIVALED .	
		PLANS APPROVED BY:	
			INDIANA DEPARTMENT OF TRANSPORTATION
		ATTACT ATTACT A	
		Ero A a	
		사실 방법에 가장 방법에 있는 것 같아요. 이 것은 것에서는 것 같아요. 것은 것이 있는 것이 가지 않는 것 같아요. 것은 것은 것은 것이 있는 것이 있는 것이 있는 것이 있는 것이 있는 것이 있는 같이 같아요. 같아요. 같아요. 같아요. 같아요. 같아요. 같아요. 같아요.	
			INDIANA DEPARTMENT OF TRANSPORTATIO
			STANDARD SPECIFICATIONS DATED 2010 TO BE USED WITH THESE PLANS
		STATE OF CALL DECKNEPP. DRAWN:	SHEETS of
		TOTAL ENTRY CHECKED:	or

\_\_\_\_\_

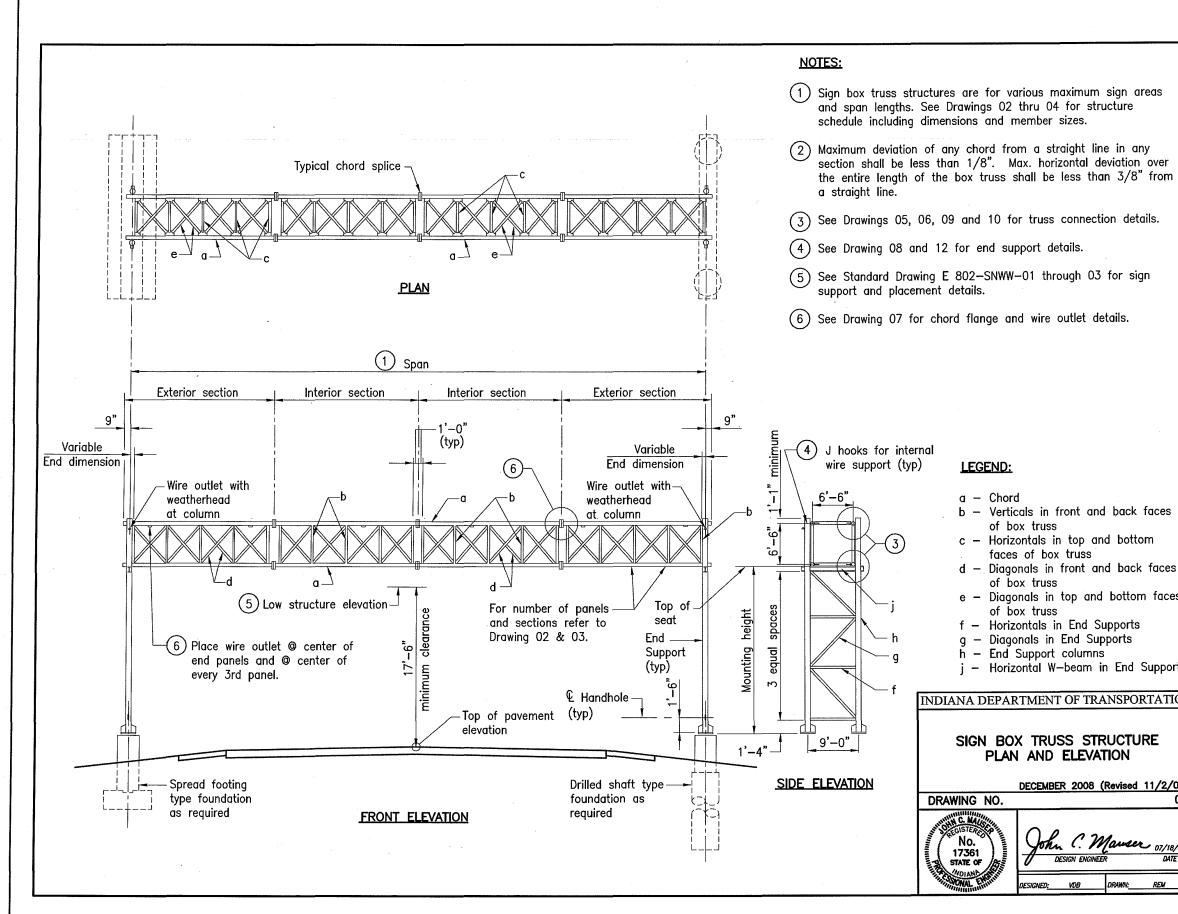

f bo oriza iago iago iago oriza iago nd S	als in fi ontals in of box nals in ox truss nals in ox truss ontals in nals in Support	ront and top an truss front an top and End Sup columns -beam ir	d botto d back bottom ipports ports	m faces faces
	Th (17) IT		NCDOD	
PAR	IMENT	OF TRA	INSPOR	TATION
LAN	AND	SS STR ELEVAT	TION	RE <u>11/2/09)</u> 01
<u> </u>				
	John	. C. W	Jauser	• 07/18/08 DATE
р.	DESIGNED;	VDB	DRAWN:	REM

		DIMENSIO	NS FO	R SIGN	BOX TRU	SSES (34	4' thru 85	·')	
SPAN			TERIOR SE				INTERIOR		
SPAN-TRUSS	NO. OF	NO. OF PANELS		PANEL	SECTION	NO. OF	NO. OF PANELS		SECTION
LENGTH, (FT)	SECTIONS	PER SECTION	END DIMEN.	LENGTH	LENGTH	SECTIONS	PER SECTION		LENGTH
34	1	6	6"	5'-6"	35'-6"	0			
35	1	6	6"	5'-8"	36'-6"	0			
36	2	3	6"	5'-6"	18'-9"	0			
37	2	3	6"	5'-8"	19'-3"	0			
38	2	3	6"	5'-10"	19'-9"	0			
39	2	3	6"	6'	20'-3"	0			
40	2	3	6"	6'-2"	20'-9"	0			
41 42	2	3	6"	6'-4"	21'-3"	0			
42	2	3	6"	6'-6"	21'-9"	0			
45	2	4	6" 6"	5'-1 1/2"	22'-3" 22'-9"	0			
45	2	_		5'-3"		-			
45	2	4	6" 6"		23'-3"	0			
40	2		6"	5'-4 1/2"	23'-9"	0			
47	2	4	6" C"	5'-6"	24'-3"	0			·
40	2	4	6"	5'-7 1/2" 5'-9"	24'-9"	0			
49 50	2	4	6" 0"		25'-3"	0			
			6"	5'-10 1/2"	25'-9"	0			
51 52	2	4	6"	6'	26'-3"	0			
	_	4	6"	6'-1 1/2"	26'-9"	0			
53	2	4	6" 0"	6'-3"	27'-3"	0	-		
54	2	4	6"	6'-4 1/2"	27'-9"	0			
55	2	4	6"	6'-6"	28'-3"	0			
56	2	5	5 1/4"	5'-3 3/4"	28'-9"	0			
57	2	5	6 1/4"	5'-4 3/4"	29'-3"	0			
58	2	5	6"	5'-6"	29'-9"	0			
59	2	5	5 3/4"	5'-7 1/4"	30'-3"	0			
60	2	5	5 1/2"	5'- 8 1/2"	30'-9"	0			
61	2	5	6 1/2"	5'-9 1/2"	31'-3"	0			
62	2	5	6 1/4"	5'-10 3/4"	31'-9"	0			
63	2	5	6"	6'	32'-3"	0	-		
64	2	5	5 3/4"	6'-1 1/4"	32'-9"	0			
65	2	5	5 1/2"	6'-2 1/2"	33'-3"	0			
66	2	5	5 1/4"	6'-3 3/4"	33'-9"	0			
67	2	5	5"	6'-5"	34'-3"	0			
68	2	5	6"	6'-6"	34'-9"	0			
69	2	. 4	6"	5'-4"	23'-7"	1	4	5'-4"	23'-4'
70	2	4	6"	5'-5"	23'-11"	1	4	5'–5"	23'-8'
71	2	4	6"	5'-6"	24'-3"	1	4	5'-6"	24'
72	2	4	6"	5'-7"	24'-7"	1	4	5'-7"	24'-4'
73	2	4	6"	5'-8"	24'-11"	1	4	5'-8"	24'-8'
74	2	4	6"	5"-9"	25'-3"	1	4	5"-9"	25'
75	2	4	6"	5'-10"	25'-7"	1	4	5'-10"	25'-4'
76 77	2	4	<u>6"</u>	5'-11"	25'-11"	1	4	5'-11"	25'-8'
77	2	4	6" 6"	6'	26'-3"	1	4	6'	26'
78	2	4	6"	6'-1 "	26'-7"	1	4	6'-1 "	26'-4'
80	2	4	6"	6'-2"	26'-11"	1	4	6'-2"	26'-8'
81	2	4	6" 6"	6'-3"	27'-3"	1	4	6'-3"	27'
82	2	4	6" 6"	6'-4" 6'-5"	27'-7" 27'-11"	1	4	6'-4"	27'-4' 27'-8'
83	2	4 4	6"	6-5 6'-6"	27-11 28'-3"	1	4	6'-5" 6'-6"	<u>27 –8</u> 28'
84	2	5	5 3/4"	5'-7 3/4"	<u>28 - 3</u> 30'-5 1/2"	1	4	5'-7 3/4"	28 24'-7'
85	2	5	<u> </u>	5'-8 1/2"	30-5 172	1	4	5'-8 1/2"	24-10

## NOTES:


- All panels on a truss shall be the same length is 5'-0" and the maximum is
- 2. A single interior unit shall have an e maintain the pattern of the vertical of
- Use minimum number of sections for section length at 35'-6".
- 4. See Drawing 03 for required camber.

INDIANA DI SIGN TA




same li is 6'—6	ength. The mini 6".	imum par	nel			
even r diagor	number of pane nals.	els to				
or eacl	h truss. Keep t	the maxin	num			
r.						
			,			
					•	
ע א משו	RTMENT OF T	ο α τις τος	<u> </u>			
	K TRUSS ST					
TABLE	E OF DIMEN	SIONS				
3	NS 34' thru DECEMBER 2008	(Revised 1				
110			02	$\left  \right $		
	John C.	Manan				
A A A A A A A A A A A A A A A A A A A	John C. DESIGN ENGL	NEER	07/18/08 DATE			
Contraction of the second	DESIGNED <u>:</u> VDB	DRAWN:	REM			

SPAN	T	DIMENSION	<u>NS</u> FOF		BOX TRUS	323 (00	thru 130	SECTIONS		
SPAN-TRUSS	NO. OF	NO. OF PANELS	VARIABLE	PANEL	SECTION	NO. OF	NO. OF PANELS		SECTION	
LENGTH, (FT)		PER SECTION	END DIMEN.	LENGTH	LENGTH	SECTIONS	PER SECTION		LENGTH	
86	2	5	5 1/2"	5'-9 1/2"	31'-2"	1	4	· · · · · ·	25'-2"	•
87	2	5	6 1/4"	5'-10 1/4"	31'-6 1/2"	1	4		25'-5"	
88 89	2	5	7" 6"	<u>5'-11"</u> 6'	31'-11" 32'-3"	1	4	5'-11" 6'	25'-8" 26'	
90	2	5	5"	6'-1"	32'-7"	1	4		26'-4"	- E
91	2	5	5 3/4"	6'-1 3/4"	32'-11 1/2"	1	4		26'-7"	
92	2	5	6 1/2"	6'-2 1/2"	33'-4"	1	4		6'-10"	
93	2	5	5 1/2"	6'-3 1/2"	33'-8"	1	4		27'-2"	
94	2	5	6 1/4"	6'-4 1/4"	34'-1/2"	1	4	6'-4 1/4"	27'-5"	
95	2	5	5 1/4"	6'-5 1/4"	34'-4 1/2"	1	4	6'-5 1/4"	27'-9"	
96	2	5	6"	6'-6"	34'-9"	1 .	4	6'-6"	28'	/
97	2	4	6"	5'-7 1/2"	24'-9"	2	4		24'-6"	
98	2	4	6"	5'-8 1/4"	25'	2	4	/	24'-9"	
99	2	4	6"	5'-9"	25'-3"	2	4	5'-9"	25'	Ext. Sec.
100	2	4	6"	5'-9 3/4"	25'-6"	2	4	· · · · · · · · · · · · · · · · · · ·	25'-3"	
101	2	4	6"	5'-10 1/2"	25'-9"	2	4		25'-6"	CAMBE
102	2	4	6"	5'-11 1/4"	26'	2	4		25'-9"	
103 104	2	4	<u>6"</u>	6'	26'-3"	2	4	6'	<u>26'</u> 26'-3"	
104	2	4	6" 6"	6'-3/4"	26'-6" 26'-9"	2	4	· · · · · ·	26'-6"	
105	2	4	6"	6'-1 1/2"	26 -9	2	4	<i>'</i>	26'-9"	
100	2	4	6"	<u>6'-2 1/4"</u> <u>6'-3"</u>	27'-3"	2	4	6'-2 1/4" 6'-3"	27'	74
107	2	4	0 6"	6'-3 3/4"	27'-5"	2	4		27'-3"	N
109	2	4	6"	6'-4 1/2"	27'-9"	2	4		27'-6"	FL C
110	2	4	6"	6'-5 1/4"	28'	2	4	· · ·	27'-9"	Ext. Sec.
111	2	4	6"	6'-6"	28'-3"	2	4	6'-6"	28'	
112	2	5	6"	5'-3"	28'-6"	2	5		28'-3"	
113	2	5	7"	5'-3 1/2"	28'-9 1/2"	2	5	5'-3 1/2" 28	-5 1/2"	•
114	2	5	5 1/2"	5'-4 1/4"	28'-11 3/4"	2	5	5'-4 1/4" 28	-9 1/4"	
115	.2	5	6 1/2"	5'-4 3/4"	29'-3 1/4"	2	5	5'-4 3/4" 28'	-11 3/4"	
116	2	5	5"	5'-5 1/2"	29'-5 1/2"	2	5		-3 1/2"	
117	2	5	6"	5'-6"	29'-9"	2	5		29'-6"	
118	2	5	5"	5'-6 1/2"	29'-10 1/2"	2	5	5'-6 1/2" 29		
119	2	5	5 1/2"	5'-7 1/4"	30'-2 3/4"	2	5	5'-7 1/4" 3		
120	2	5	6 1/2"	5'-7 3/4"	30'-6 1/4"	2	5	5'-7 3/4" 30		
121	2	5	5"	5'-8 1/2"	30'-8 1/2"	2	5	5'-8 1/2" 30		
122	2	5	6 <b>"</b>	5'-9"	31'	2	5		50'-9"	
123	2	5	7"	5'-9 1/2"	,	2	5 5	5'-9 1/2" 30'		
124 125	2	5	5 1/2"	5'-10 1/4"		2	5	5'-10 1/4" 31 5'-10 3/4" 31		
125	2	5	6 1/2" 5"	5'-10 3/4"	31'-9 1/4" 31' -11 1/2"	2	5	5-10 3/4 31		
120	2	5	5 6"	6'		2	5	6'	32'	
127	2	5	б 7"	6'-1/2"	32'-3" 32'-6 1/2"	2	5		-2 1/2"	
129	2	5	5 1/2"	6'-1 1/4"	32'-8''	2	5	6'-1 1/4" 32		
130	2	5	6 1/2"	6'-1 3/4"	33'-1/4"	2	5	6'-1 3/4" 32		
		-	- 1/2		'/'		-			

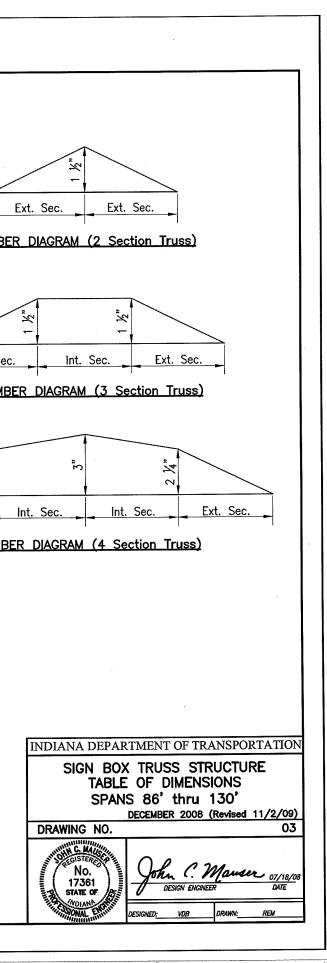

									SIGN BO	<u>X TRUSS</u>	SCHEDUL	E								
MAX				TRUSS MEMBERS							END SUPPORT MEMBERS									
RUSS TYPE	MAX SIGN AREA	MAX. SPAN	Mounting Height	CHO	ORD	VER	TICAL	HORIZ	ONTAL		TICAL ONAL		ONTAL ONAL	HORIZ	ONTAL	DIAG	ONAL	COL	UMN	W-BEAM
			H	DIA.	a THK		b THK	DIA.	C THK	DIA.	d THK	DIA.	e Thk	DIA.	f THK	DIA.	a I THK	DIA.	h I THK	<u> </u>
ŀ	SQ. FT.	FT.	FT.	IN.	IN.	DIA. IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	IN.	
A	500	130	28' - 6"	6.00	0.250	2.50	0.250	4.00	0.188	3.00	0.375	4.00	0.375	5.00	0.375	5.00	0.375	14.00	0.500	
в	700	100	28' - 6"	6.50	0.375	3.00	0.375	4.00	0.188	3.00	0.500	4.00	0.375	5.00	0.375	7.00	0.375	14.00	0.500	
С	700	130	28' - 6"	7.00	0.375	3.00	0.375	4.00	0.188	3.00	0.500	4.00	0.500	5.00	0.375	8.00	0.500	14.00	0.593	- W8x5
D	000	100	28' - 6"	7.00	0.375	3.00	0.375	4.00	0.188	3.00	0.500	4.00	0.500	5.00	0.375	8.00	0.500	18.00	0.500	1
Е	900	130	28' - 6"	7.00	0.500	3.00	0.375	4.00	0.25	3.00	0.500	4.00	0.500	5.00	0.375	8.00	0.593	18.00	0.562	5 <sub>W 10 x 6</sub>
					-			·.				· · ·		OTES: See Drav locations	vings 01 t	hru 03, a	nd 05 for	dimension		
					•								2.	See Drav	wings 12 å	k 13 for	base plate	and anch	ior bolt di	etails.
											-		3.	See Drav	wing 03 fo	r camber	diagram.			


- for Member "J". HSS 10"x10"x1/2" for truss Type "E" may be used as an alternate for Member "J". Drill 1/2" diameter hole in bottom flange each end of Member "J" for drainage.
- 6. Truss members to be aluminum, end support members to be steel. Steel pipe diameters shown in table are nominal pipe sizes.

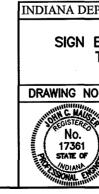


ΡA	RTN	<b>ÆNT</b>	OF TR	ANSP	ORTA	TION


## SIGN BOX TRUSS STRUCTURE TRUSS SCHEDULE


	DECEMBE	2008	(Revised	1/18/10)
).				04
	John	C.	Mare	207/18/08 DATE
in the second second	DESIGNED <u>:</u>	VDB	DRAWN:	REM

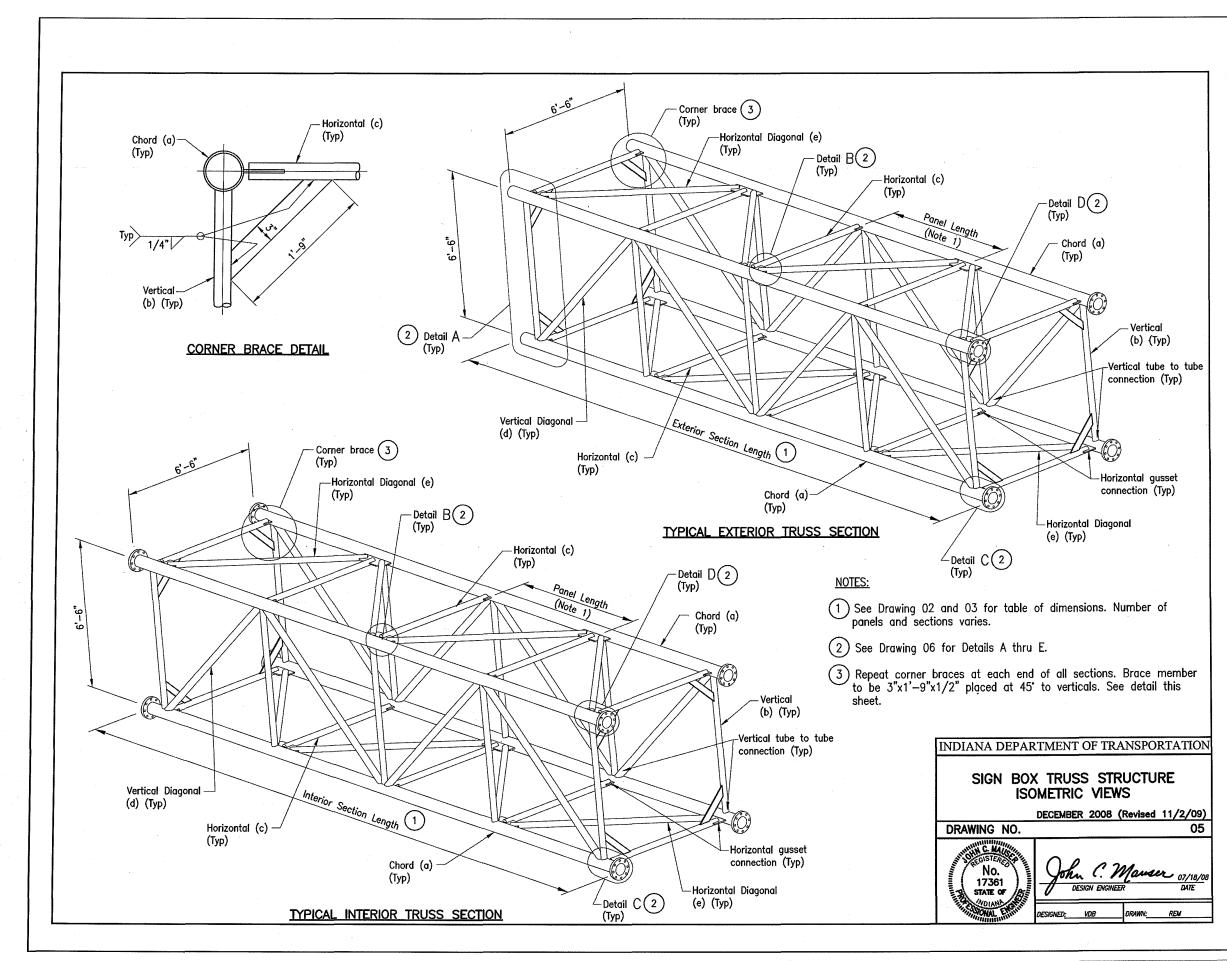


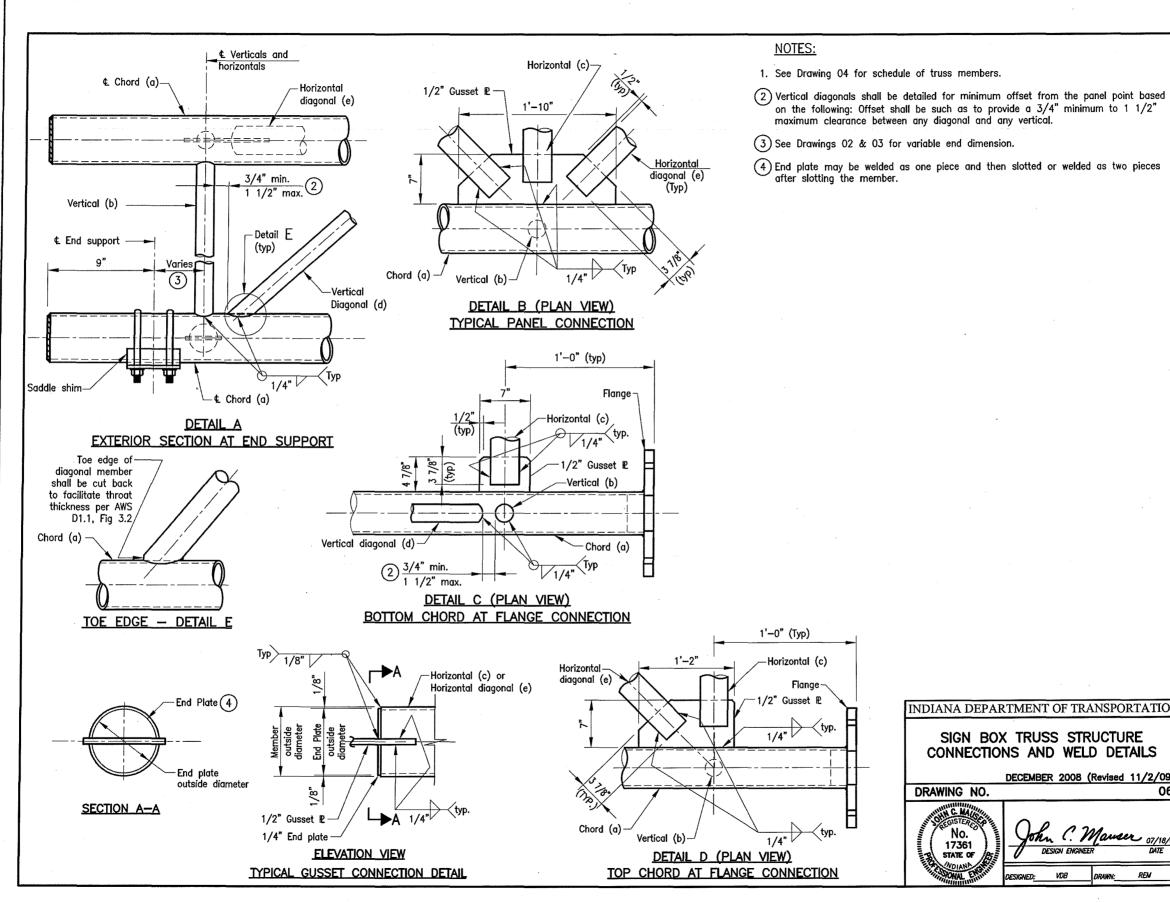



EPAR	TMENT OF TRA	ANSPO	RTATION
	( TRUSS STR NS AND WEL		
	DECEMBER 2008	Revised	11/2/09)
0.			06
and a second second	John C. V. DESIGN ENGINE	Mause	07/18/08 DATE
annu -	DESIGNED <u>:</u> VDB	DRAWN:	REM

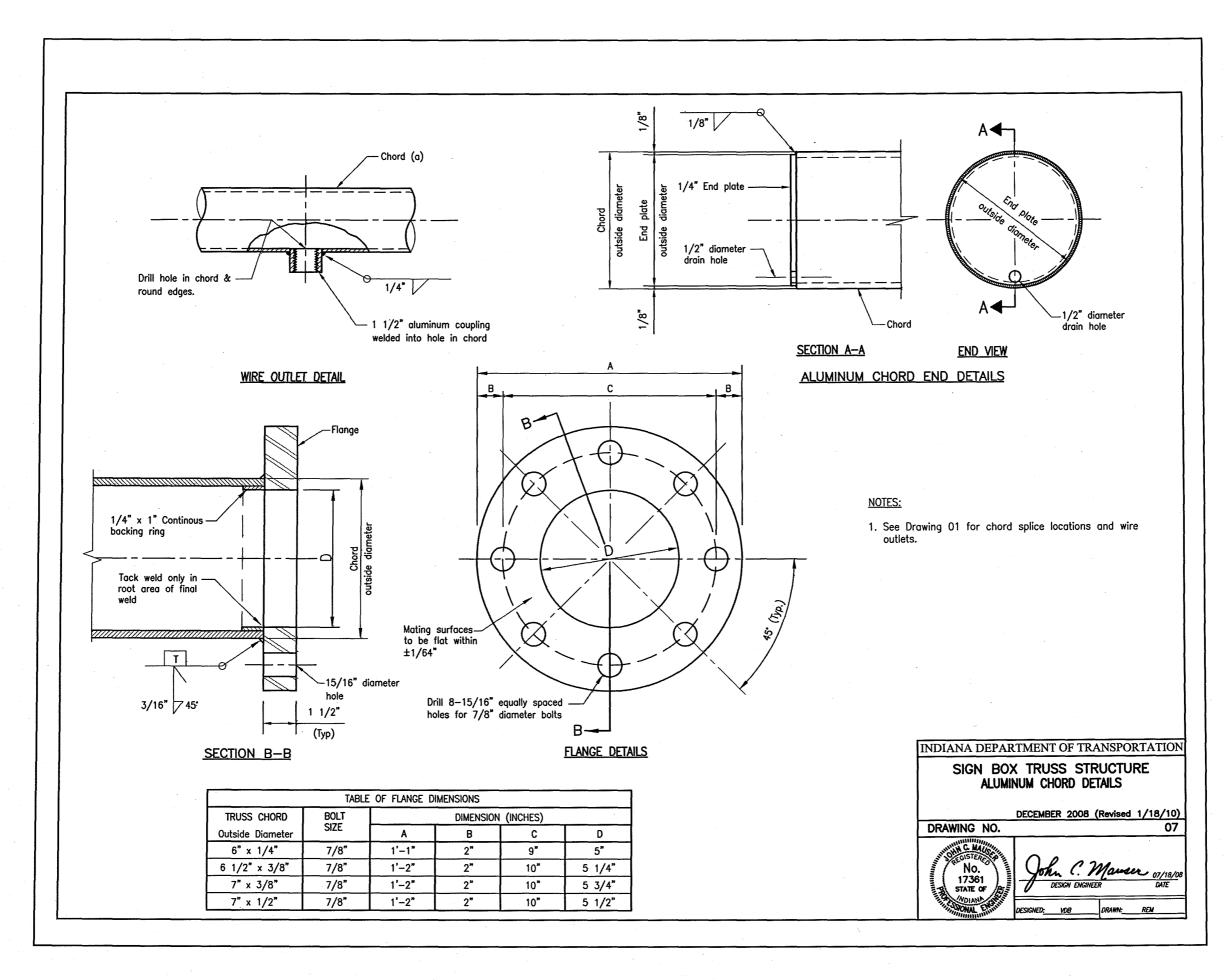


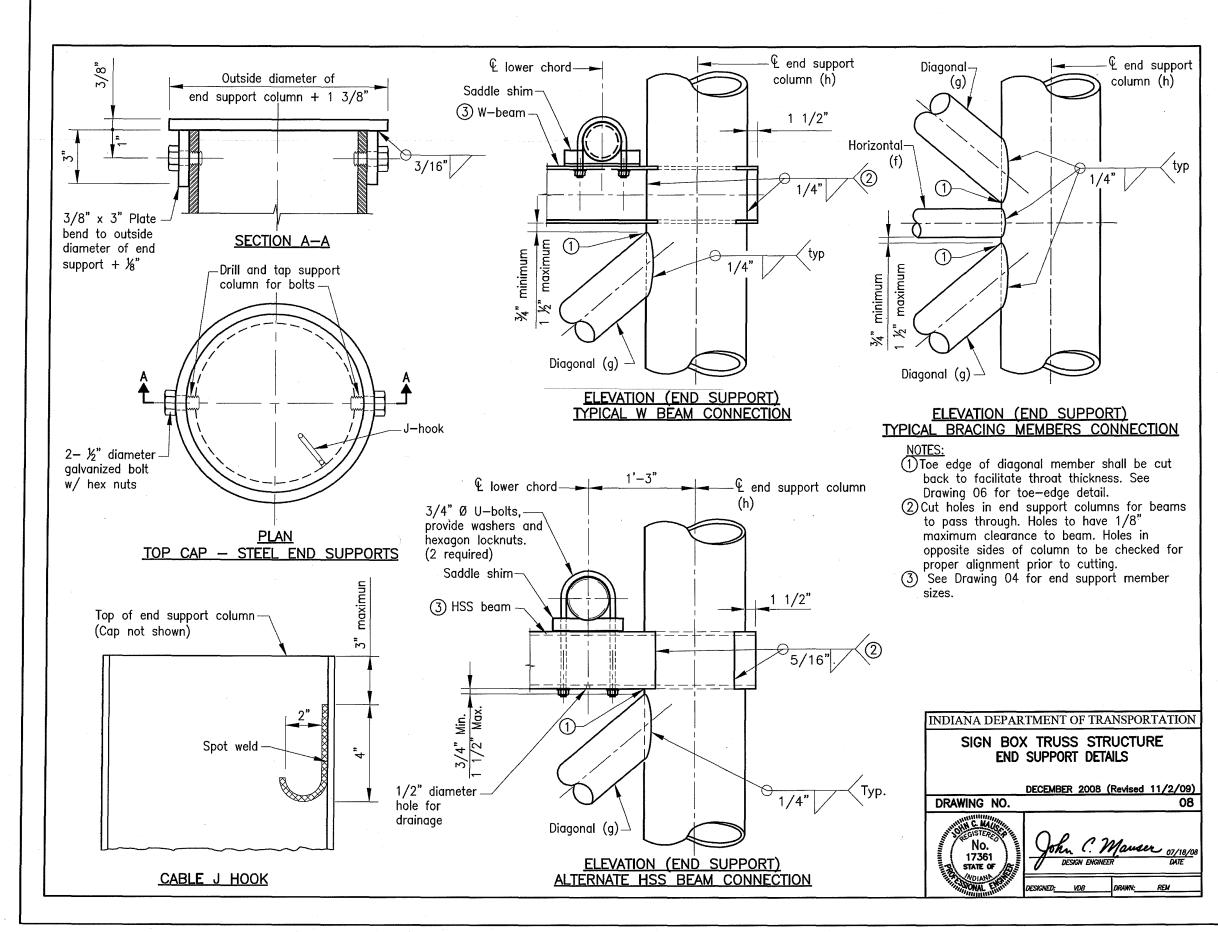


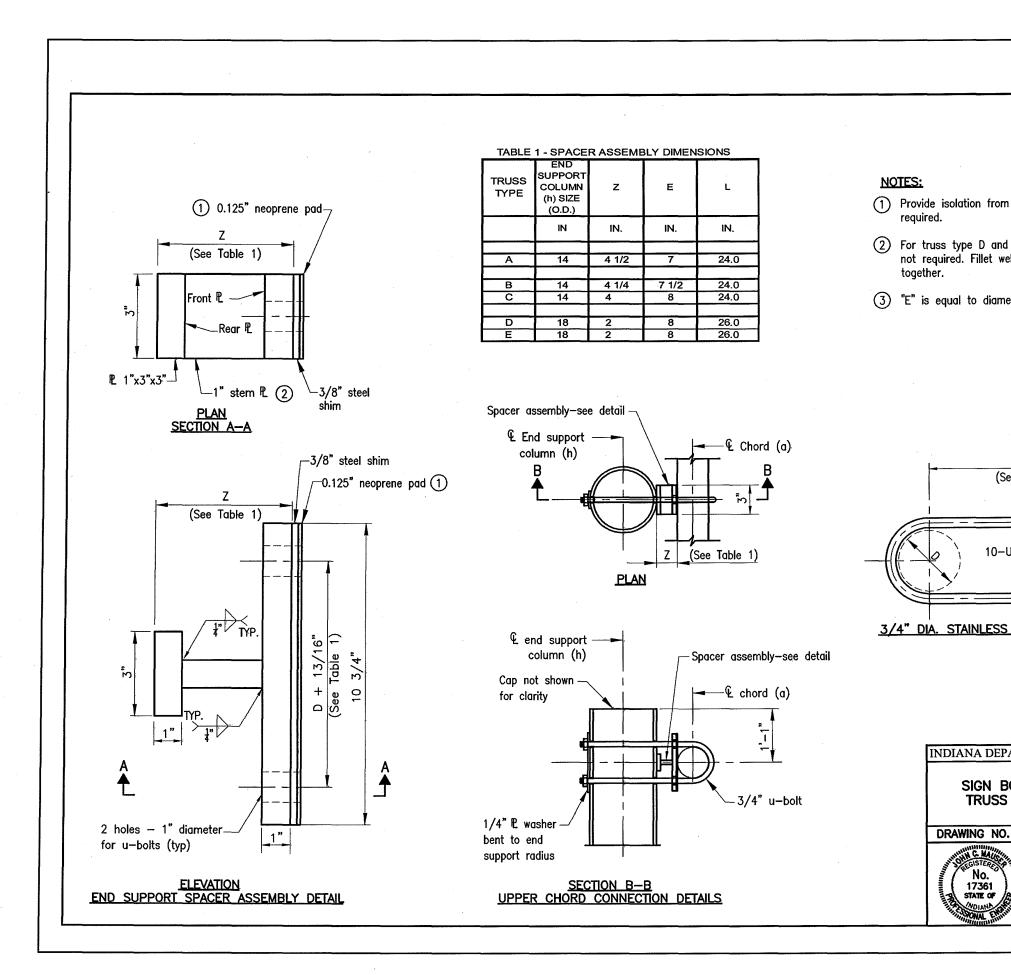

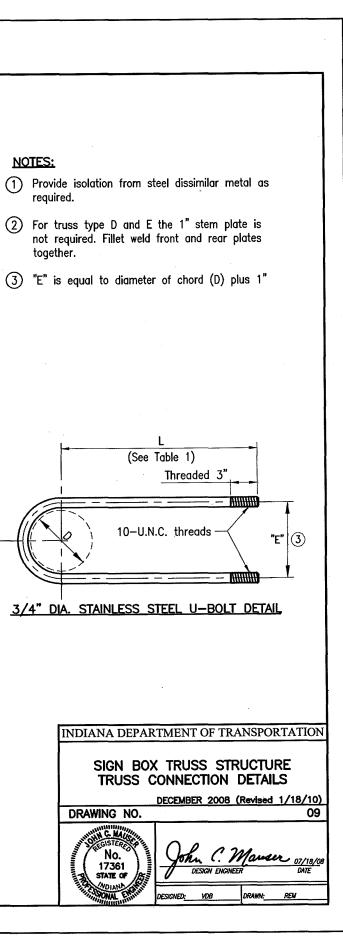

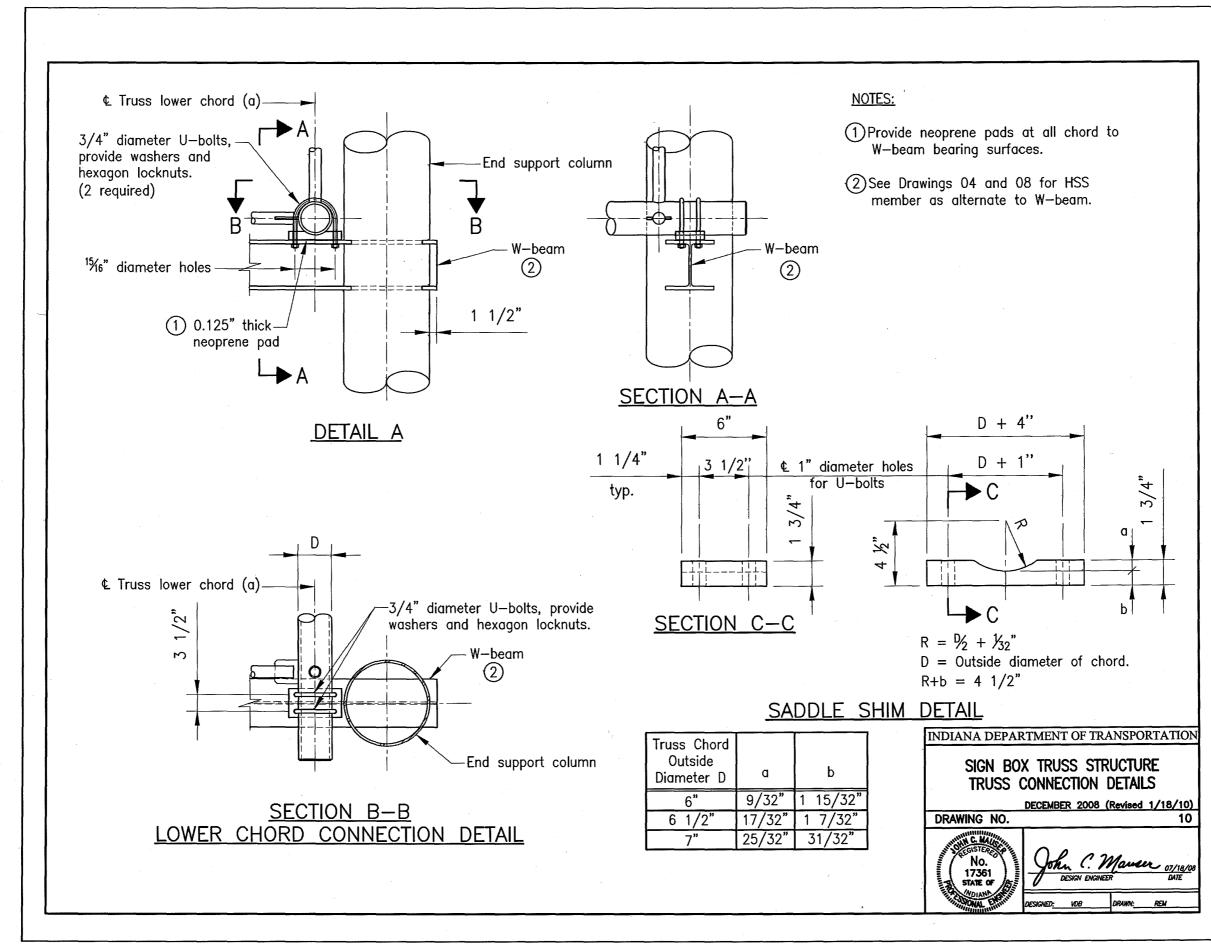

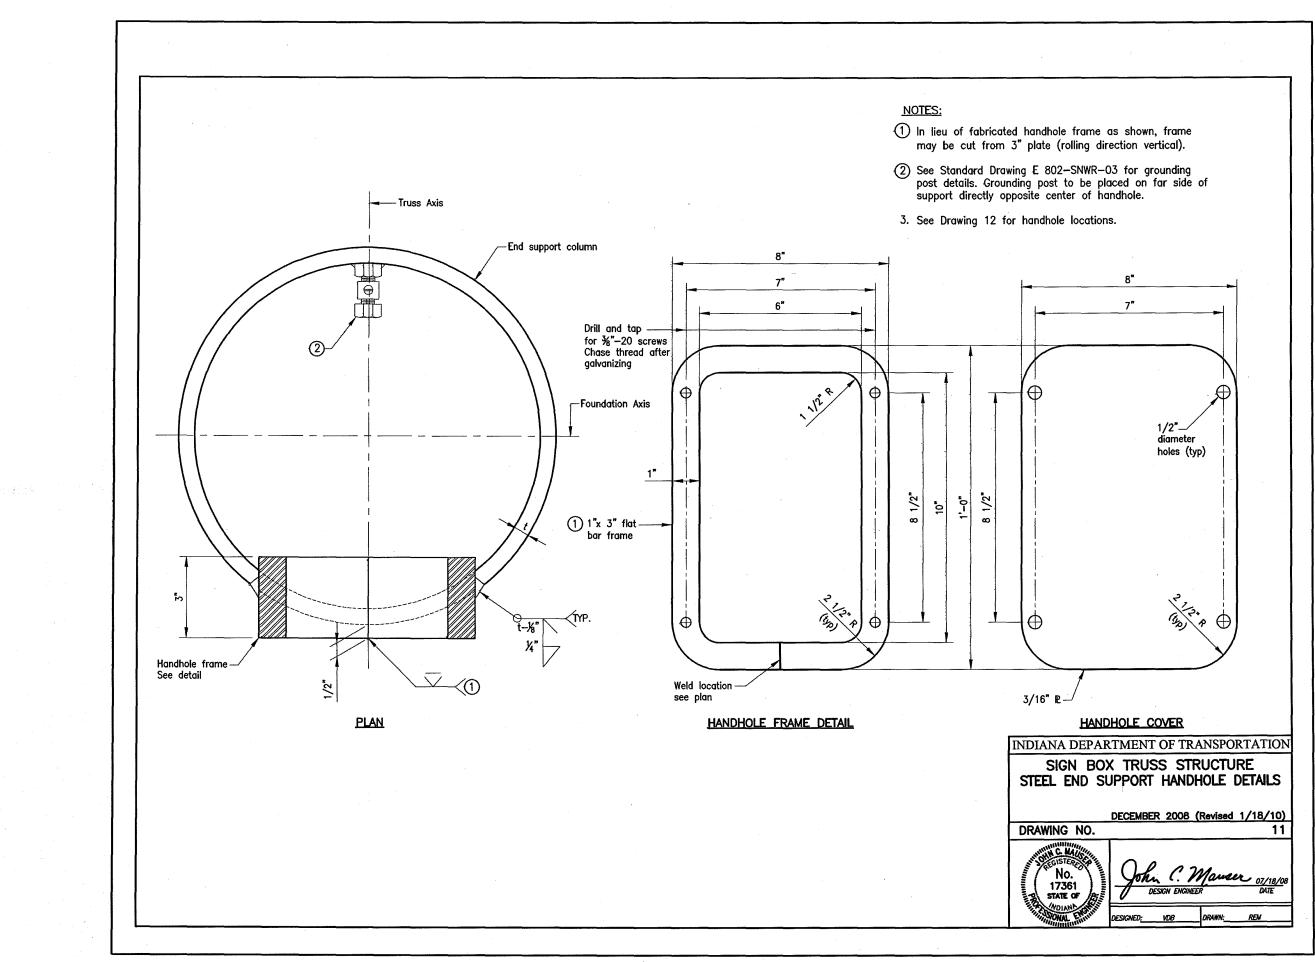

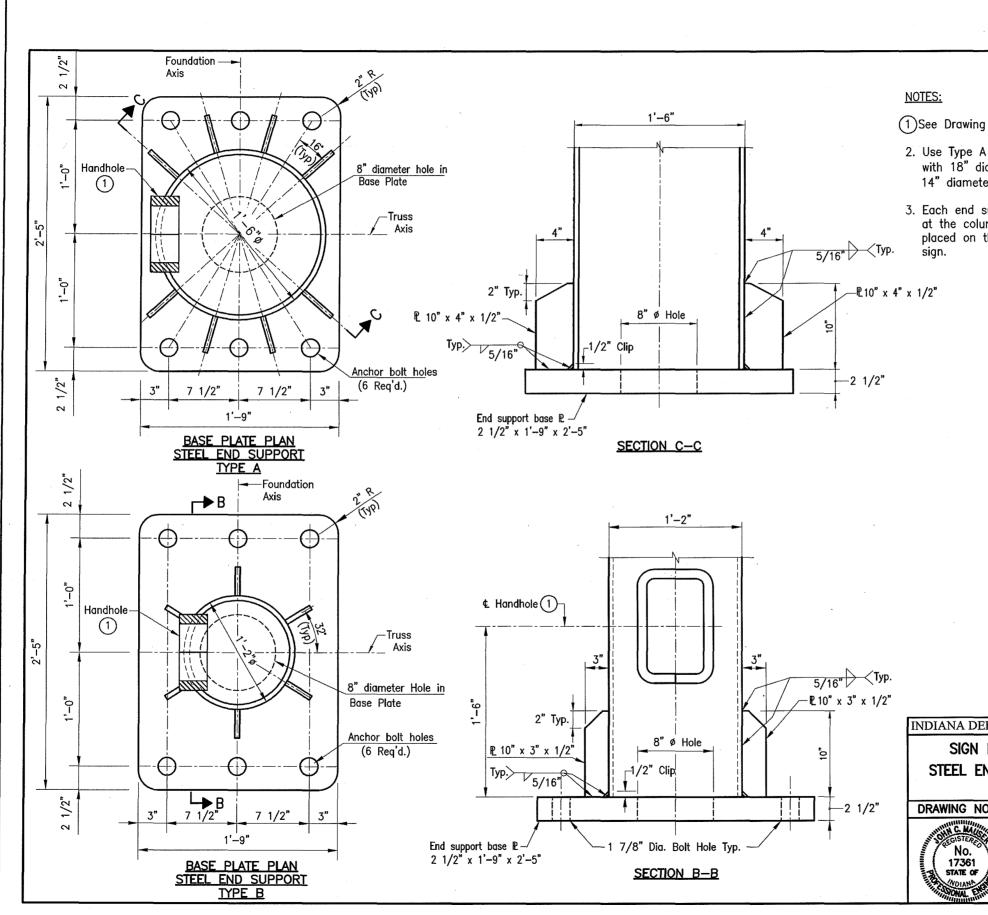

,	11	for	handhole	details
		101	nununoie	uetuns.


2. Use Type A Base Plate for End Supports with 18" diameter columns and Type B for 14" diameter columns.


3. Each end support shall have one handhole at the column base. Handhole shall be placed on the column adjacent to the

PA	ARTMENT	OF	TRANS	SPORT	ATION

BO	Х	TRUS	SS	STF	RUC	TUR	Ε	
ND	S	UPPO	RT	BA	SE	DE	FAILS	;
	DE	CEMBE	R 2	2008	(Rev	ised	11/2	/09)

0.		12
		er 07/18/08
	DESIGN ENGINEER	DATE
in the second second	DESIGNED <u>: VDB</u> DRAWN:	REM

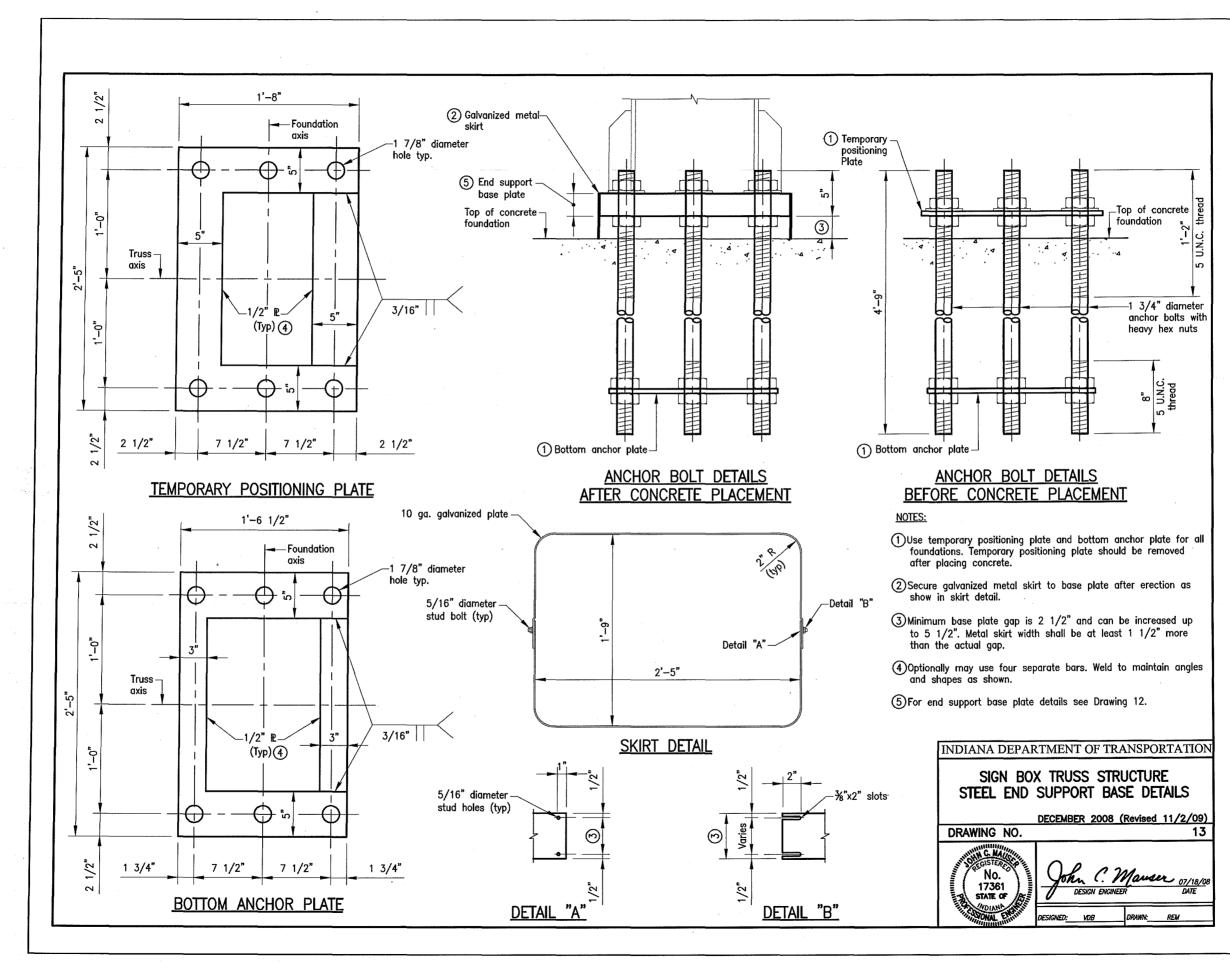


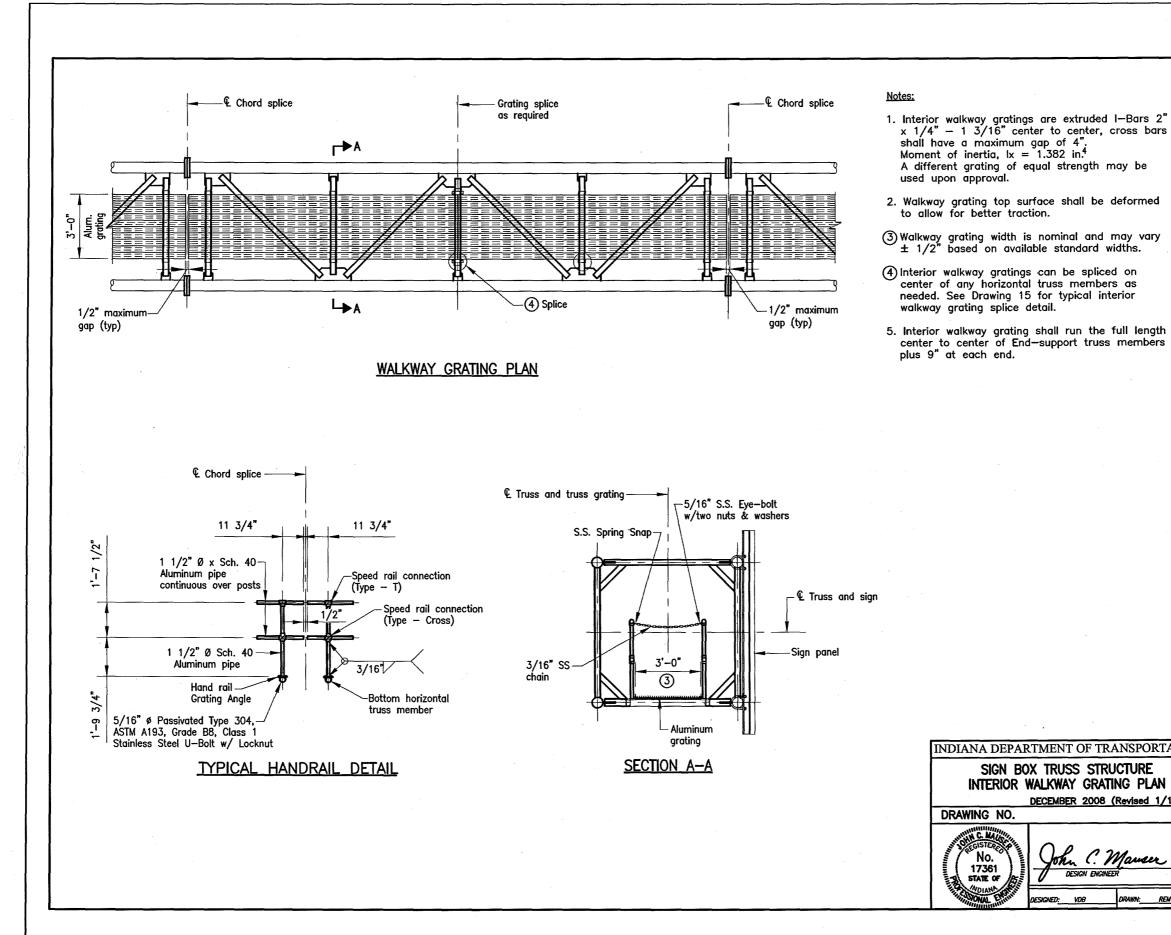


atings are extruded I—Bars 2	11
center to center, cross bars	5
ium gap of 4",	
$I_x = 1.382 \text{ in.}^4$	
of equal strength may be	


DR WALKWAY GRATING PLAN DECEMBER 2008 (Revised 1/18/10)	-
DR WALKWAY GRATING PLAN DECEMBER 2008 (Revised 1/18/10) 0. 14 John C. Mauser 07/18/08 DESIGN ENGINEER DATE	PARTMENT OF TRANSPORTATION
DECEMBER 2008 (Revised 1/18/10) 0. 14 John C. Mauser 07/18/08 DESIGN ENGINEER DATE	BOX TRUSS STRUCTURE
0. 14 John C. Mauser 07/18/08 DESIGN ENCINEER DATE	OR WALKWAY GRATING PLAN
John C. Mauser 07/18/08 DESIGN ENGINEER DATE	DECEMBER 2008 (Revised 1/18/10)
	0. 14


JULY 31, 2012 **BOOK 2 - TECHNICAL PROVISIONS** ATTACHMENT 14-1

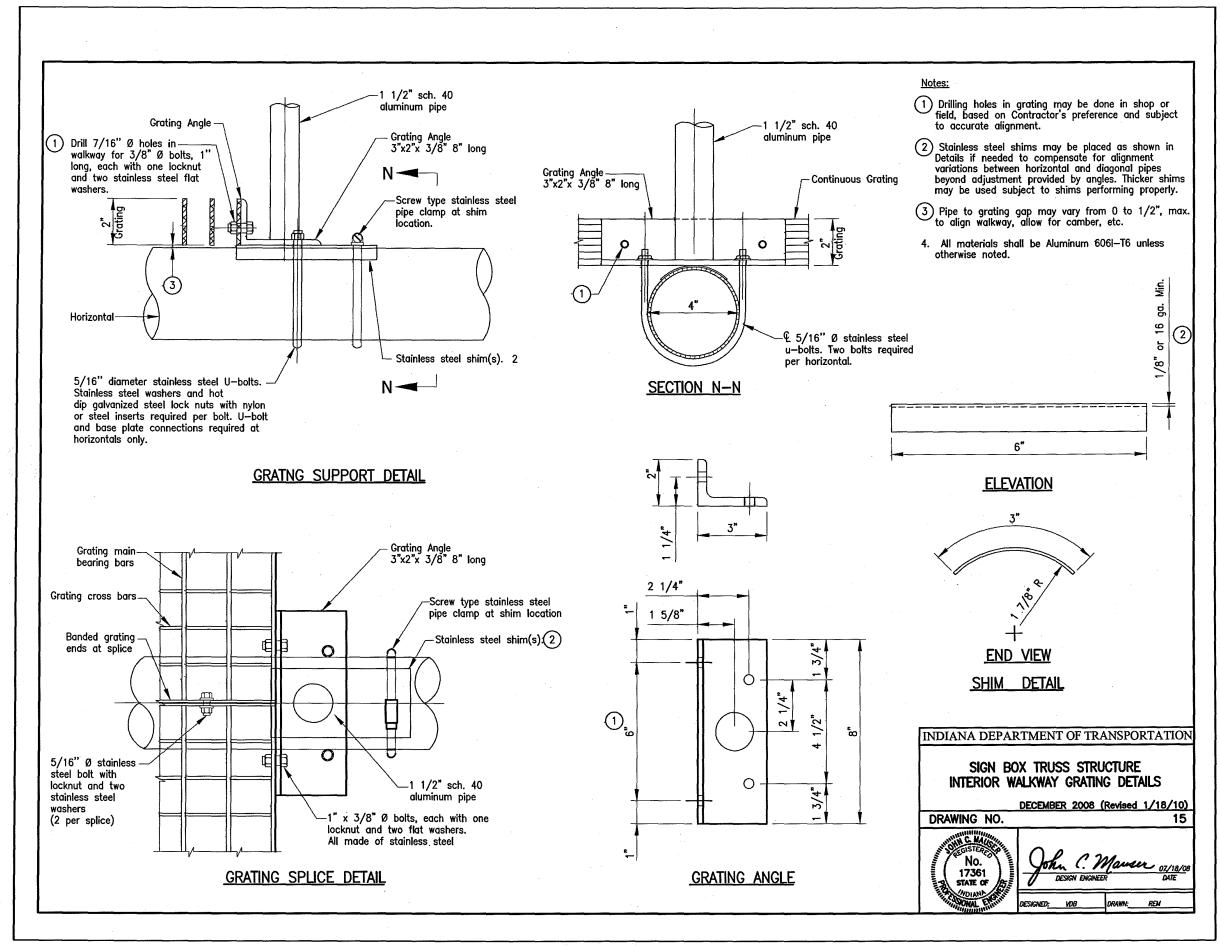

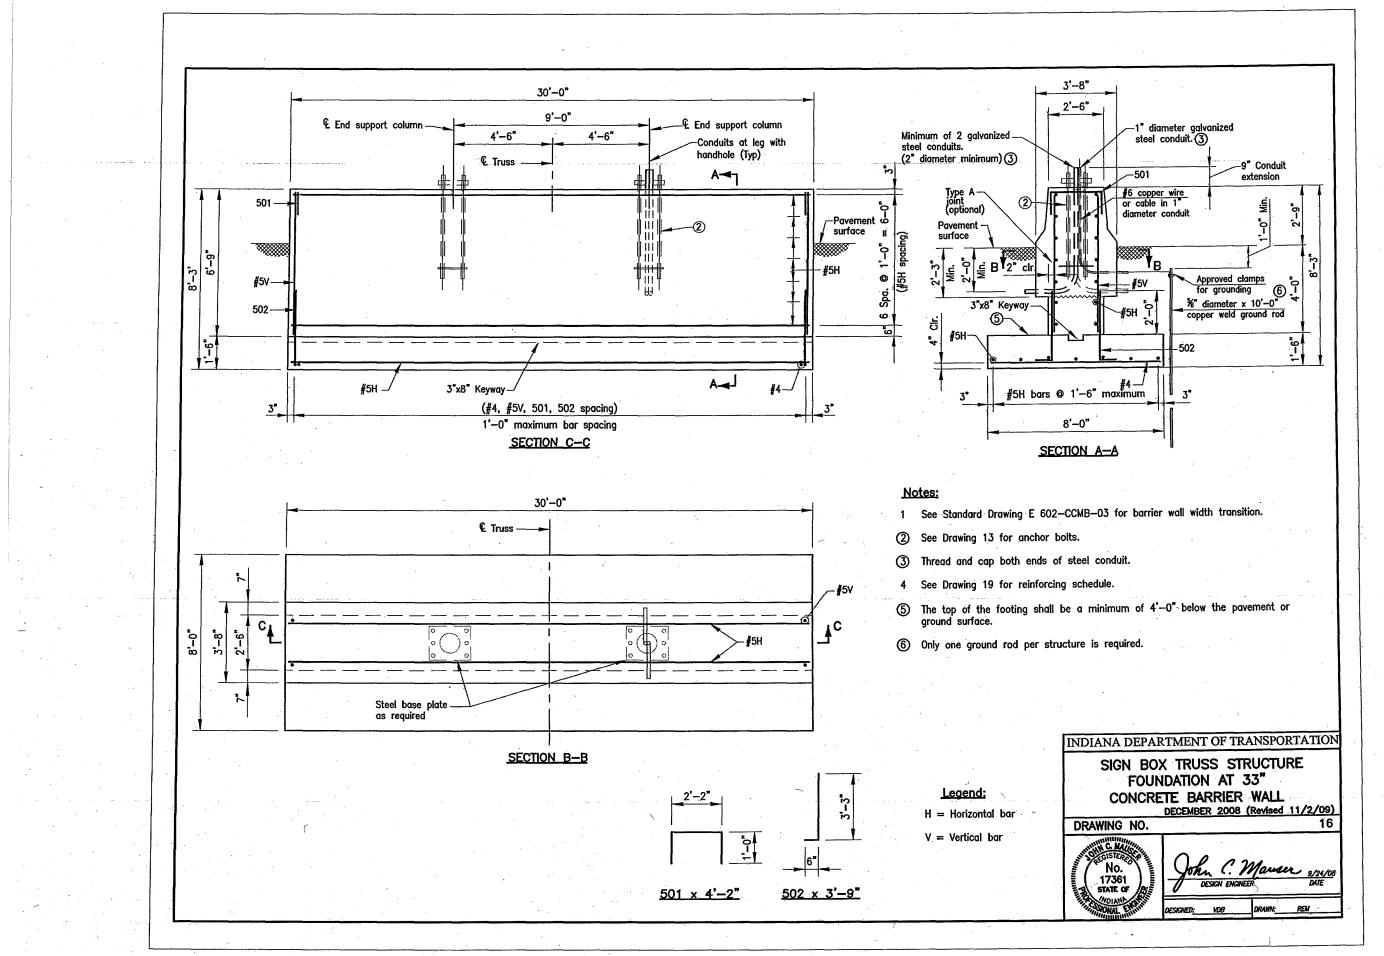

JULY 31, 2012 BOOK 2 - TECHNICAL PROVISIONS ATTACHMENT 14-1

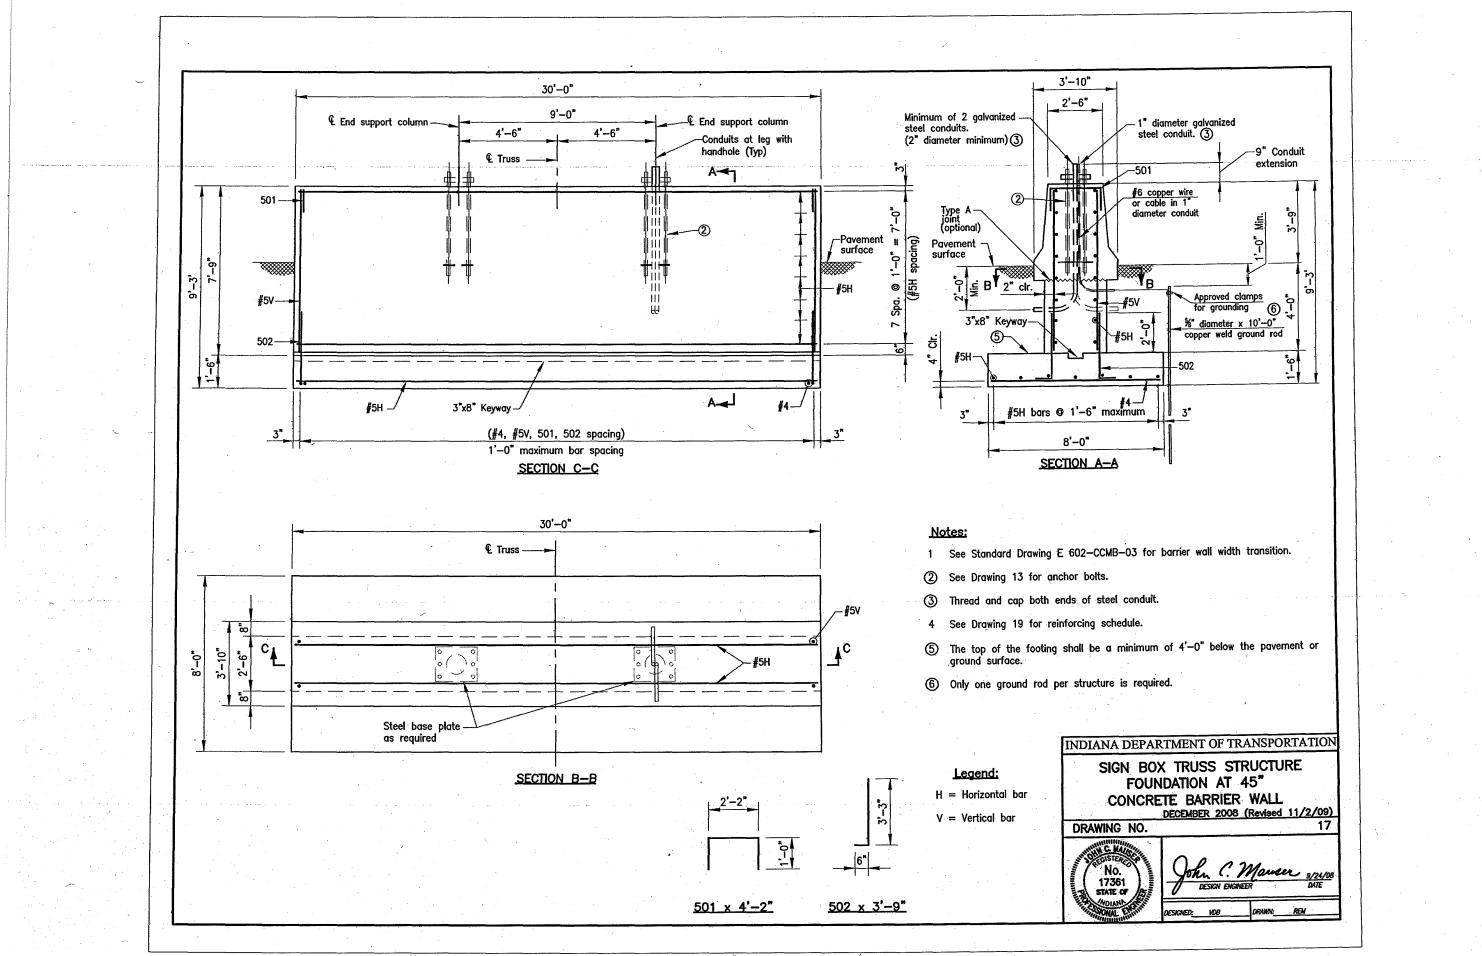


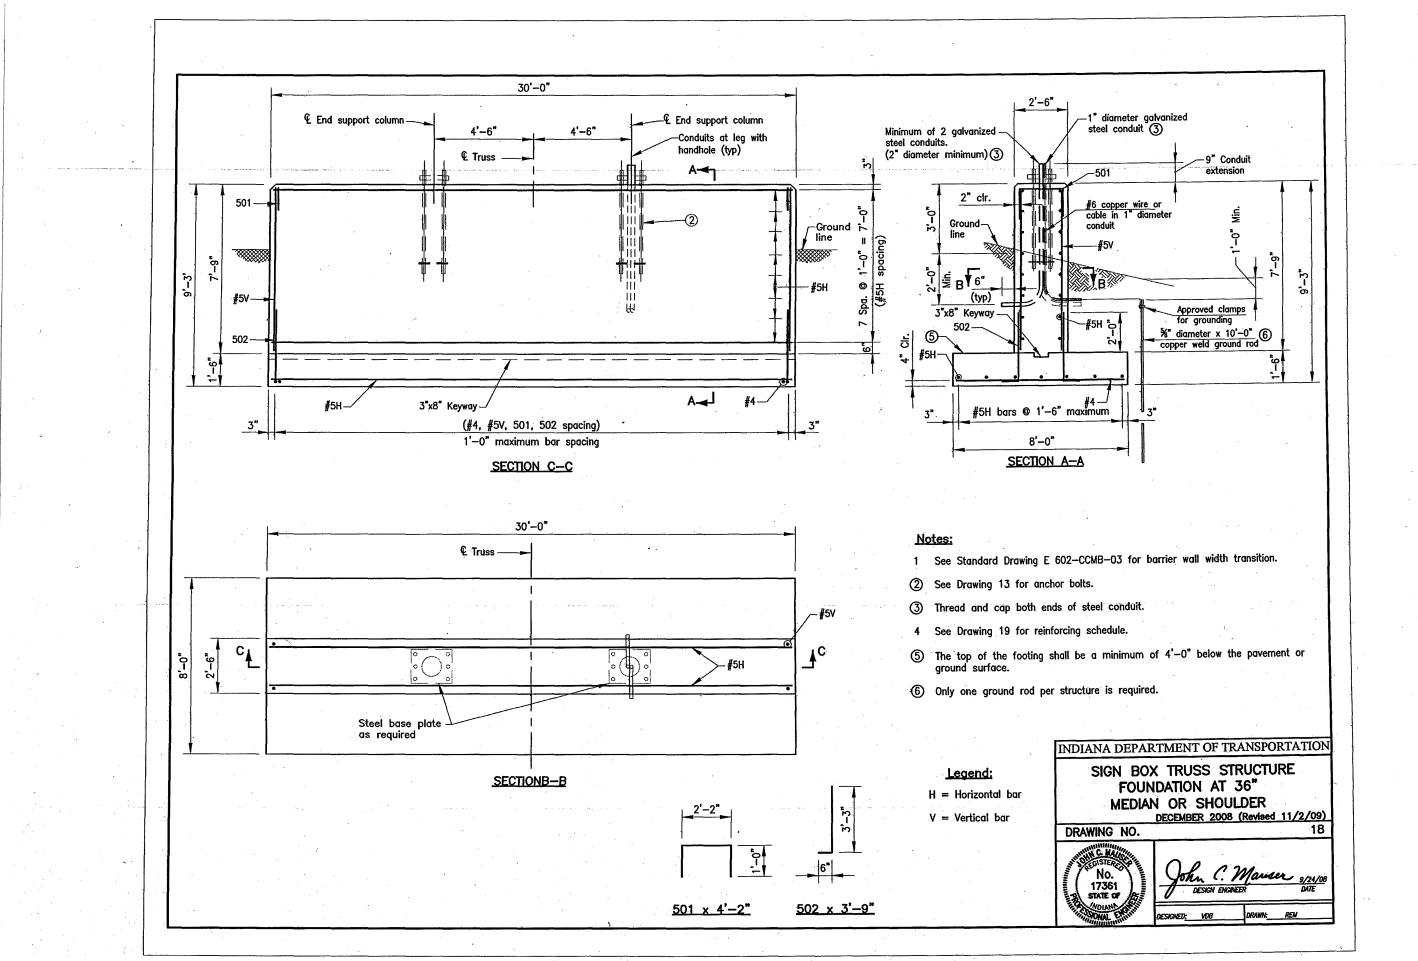


FOUNDATI	ON AT 33" CO	NCRETE BARR	IER WALL		
. El	POXY COATE	D REINFORCING	3		
SIZE &	NO. OF	LENGTH	WEIGHT		
MARK	BARS	(FT. & IN.)	(LBS.)		
#4	31	7'-8"			
TOTAL #4	······································	d	159		
501	31	4'-2"			
502	-				
#5V	·				
#5H	20	29 - 8 "			
TOTAL #5	1438				
TOTAL EPOXY COATED REINFORCING					
CONCRETE					
CONCRETE, CLASS "A" (CYS) 35.8					
	MISCELL	ANEOUS			
SURFACE SEAL (SYS) 27.6					

	·		_		
FOUNDATION AT 45" CONCRETE BARRIER WALL					
EPOXY COATED REINFORCING					
SIZE & NO. OF LENGTH WEIGHT					
MARK	BARS	(FT. & IN.)	(LBS.)		
#4	31	7'- 8"			
TOTAL #4			159		
501					
502					
#5V 62 7'-6"					
#5H 22 29'- 8"					
TOTAL #5	1565				
TOTAL EPO	1724				
CONCRETE					
CONCRETE,	37.6				
MISCELLANEOUS					
SURFACE SEAL (SYS) 34.3					


FOUNDATION AT 36" MEDIAN OR SHO					
EPOXY COATED REINFORCING					
SIZE & NO. OF LENGTH					
MARK	BARS	(FT. & IN.)	(		
	1				
#4	31	7'-8"			
TOTAL #4					
501 31 4'-2"					
502 62 4'-1"					
#5V 62 8'-1"					
#5H	24	29'- 8"			
TOTAL #5					
TOTAL EPOXY COATED REINFORCING					
CONCRETE					
CONCRETE, CLASS "A" (CYS)					
	MISCELL	ANEOUS			
SURFACE SI	EAL (SYS)				

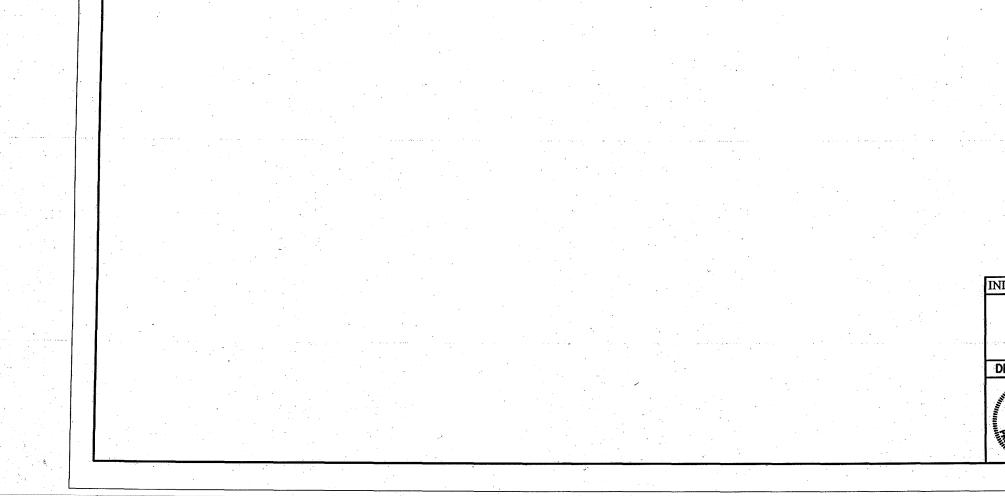


20

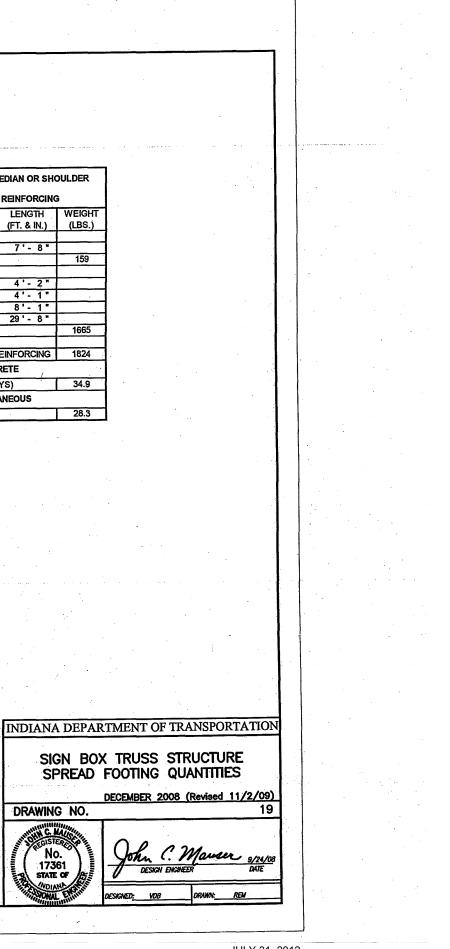

JULY 31, 2012 BOOK 2 - TECHNICAL PROVISIONS ATTACHMENT 14-1

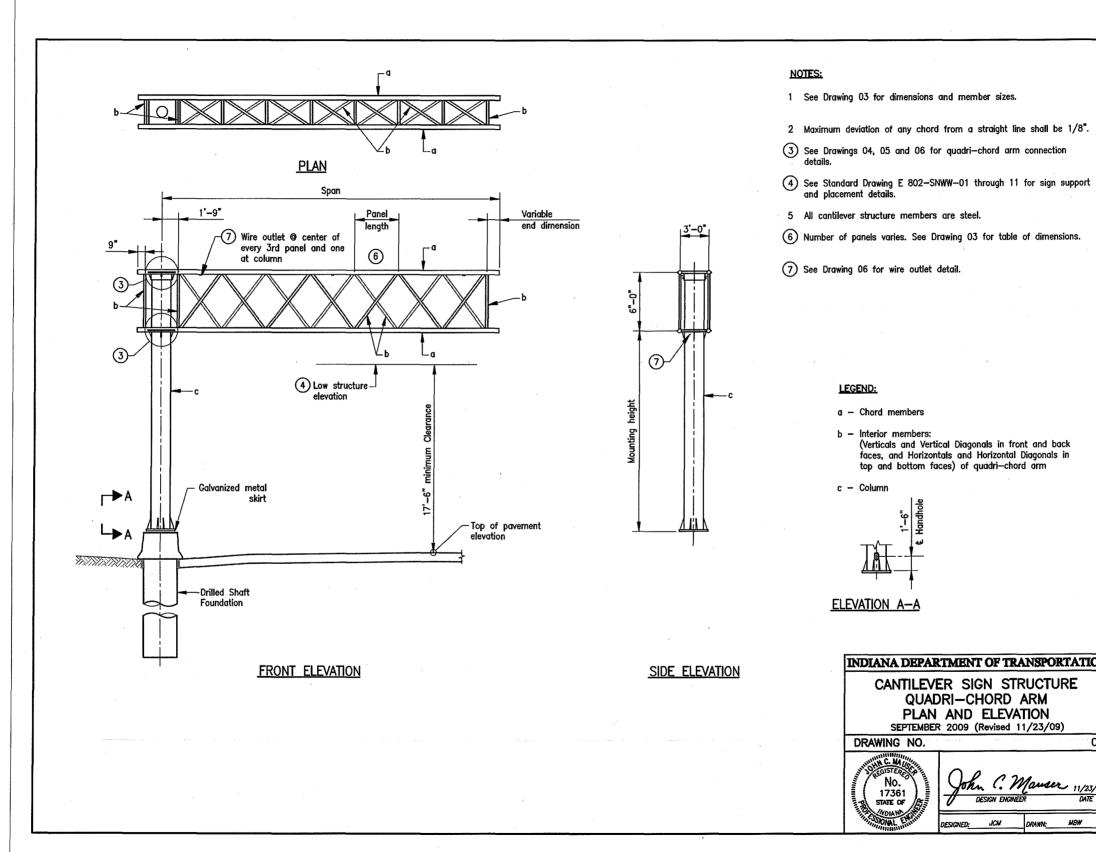

MENT OF TRANSPORTATION				
SIGN STRUCTURE				
009 (Revised 11/23/09)				
01				
John C. Mauser 11/23/09 DESKN ENGINEER DATE				
IGNED: JCM DRAWN: MBW				

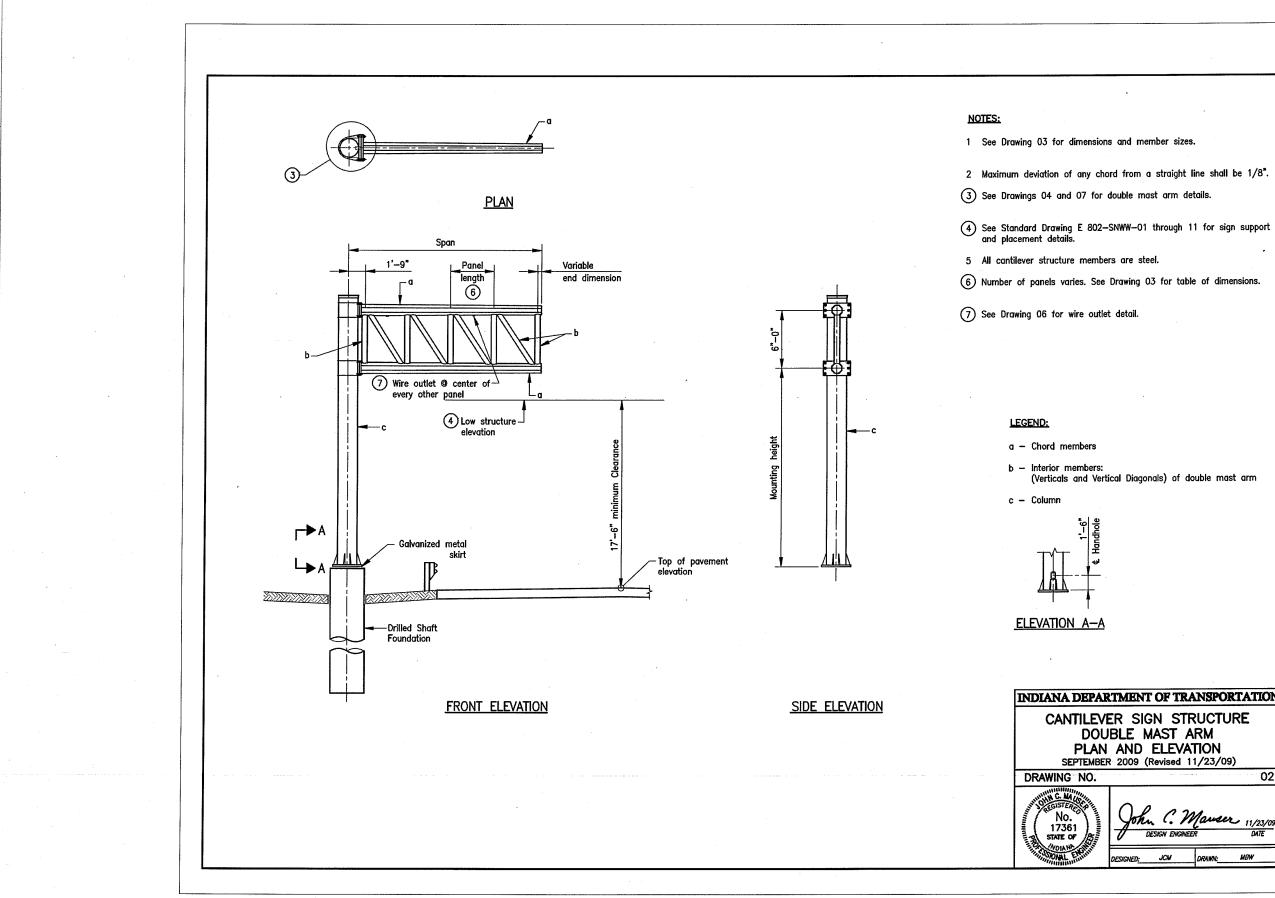

MENT OF TRANSPORTATION
SIGN STRUCTURE E MAST ARM ND ELEVATION 009 (Revised 11/23/09)
02
John C. Mauser 11/23/09 DESIGN ENGINEER DATE
IGNED <u>:</u> JCM DRAWN: MBW

-	SPAN (FT)	NO. OF PANELS	PANEL LENGTH (FT-IN)	VARIABLE END DIMENSION (FT-IN)
	10	2	4* - 0*	3*
	11	3	3' - 0"	3"
N N	12	3	3' - 3"	6*
×	13	3	3 - 6*	9"
5	14	3	4' - 0"	3"
2	15	3	4" - 3"	6"
	16	4	3'-6"	3"
DOUBLE MAST ARM	17	4	3' - 9"	3"
ă 🦳	18	4	4' - 0"	3*
	19	4	<b>4'</b> - 3*	3"
	20	4	4`~6"	3"
	21	. 6	3' - 9"	6"
	22	5	3 - 9"	1' - 6"
	23	5	4' - 0"	1' - 3"
_ <b>_</b>	24	5	4' - 3"	1' - 0"
ř –	25	5	<b>4</b> * - <b>6</b> **	9*
8	26	6	3' - 9"	1' - 9"
8	27	6	4' - 0"	1' - 3*
QUADRICHORD ARM	28	6	4 - 3"	9*
ž 🗌	29	6	4 - 3*	1" - 9"
<b>P</b>	30	6	4'- 6"	1'- 3"
3 🗆	31	7	4' - 0"	1' - 3*
·····	32	7	4' - 3"	6"
	33	7	4' - 3"	1' - 6"
	34	7	4' - 6"	9*
	35	7	4'-6"	1' - 9"


STR	MAX. MAX. SPAN SIGN		MAX. MOUNTING	CHORD ⑦		VERT. / HORIZ. / DIAG.		COLUMN		
TYPE	1. A. A. A.	AREA	HEIGHT	DIA.	WALL THK.	DIA.	WALL THK.	DIA.	WALL THK	
	FT.	SQ ET	FT.	<u>N.</u>	IN.	IN	IN.	IN.	<u>N.</u>	
*A	10	(180)		7.625	0.500	4.500	0.337	18.000	0.750	
<b>*</b> B	15	280	. 24 - 0*	10.750	0.593	5.563	0.500	20.000	0.812	
*C	20	380		14.000	0.593	6.625	0.719	24.000	0.968	
D	25			5.563	0.258	2.875	0.203	24.000	0.562	
É	30	300	24° 0″	5.563	0.258	2.875	0.203	24.000	0.562	
F	35	1		5.563	0.375	2.875	0.276	24.000	0.688	
G	25			5.563	0.375	2.875	0.276	24.000	0.968	
Ĥ	30	400	400	24° 0°	5,563	0.375	2.875	0.276	24.000	0.968
i	35		l l	5.563	0.375	2.875	0.276	24.000	0.968	

## NOTES:


- All panels on the quadri-chord and double m same length. The minimum panel length is 3
- 2. See Drawing 04 for additional details and rea
- 3. For base plate and anchor bolt details see
- See Drawings 11 thru 19 for drilled shaft fo
   All cantilever structure members are steel.
- 6. All member diameters shown are outside diar
- Double mast arm chord design is based on a inches per foot taper. Quadri-chord arm cho shapes with constant diameter.





## OCTAGON TUBULAR

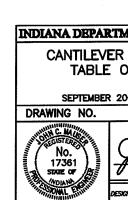



nast arm structures shall be the 5'—0" and the maximum is 4'—6".
quired camber.
Drawings 08.
oundation details.
meters.
octagonal tubular shape with 0.14 ord design is based on circular
$\mathbf{X}$
$\sim$
//
<u>SHAPE</u>
MENT OF TRANSPORTATION
SIGN STRUCTURE
009 (Revised 11/23/09) 03
John C. Mauser 11/23/09
DESIGN ENGINEER DATE
GNED <u>: JCM DRAWN: RBM</u>

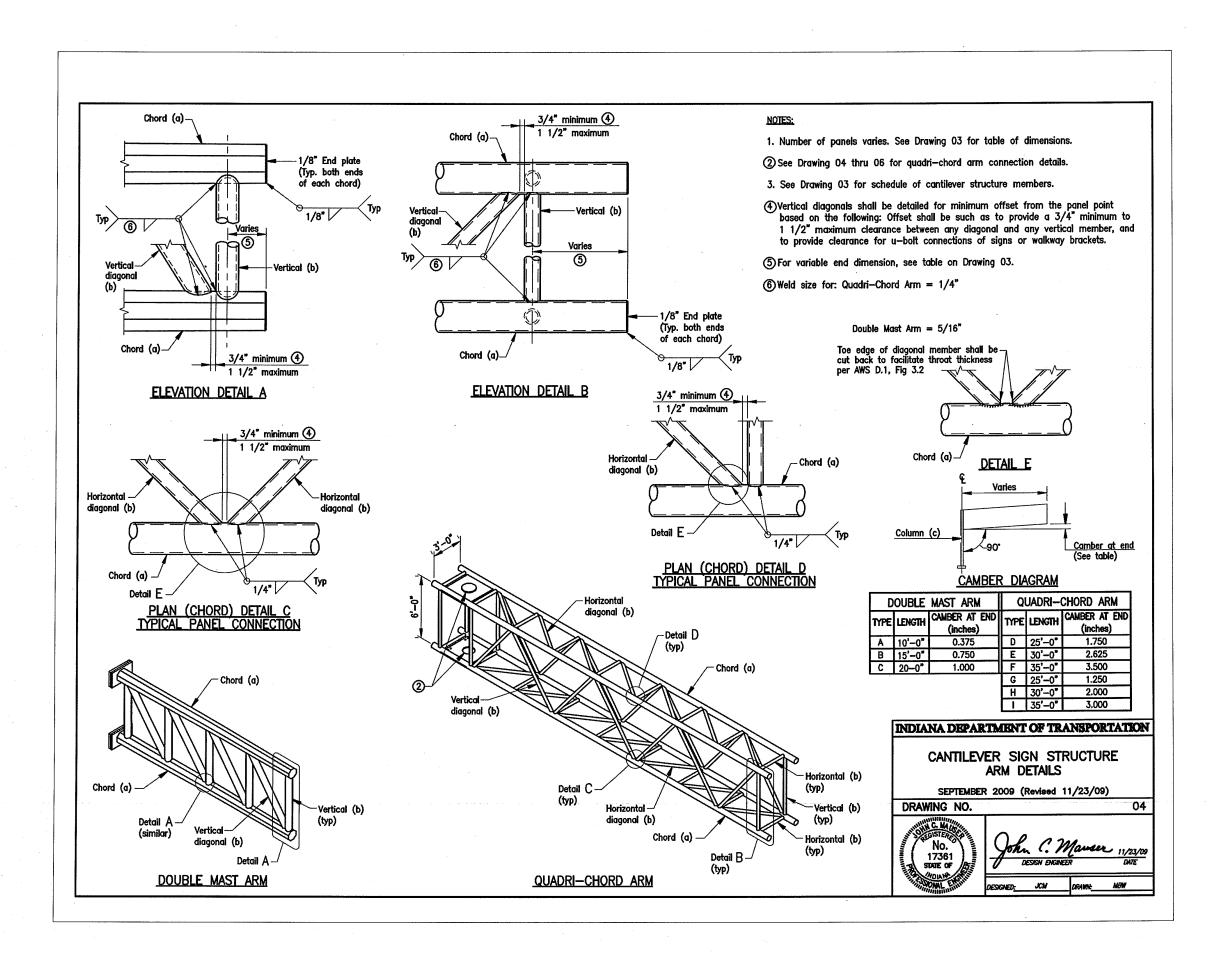

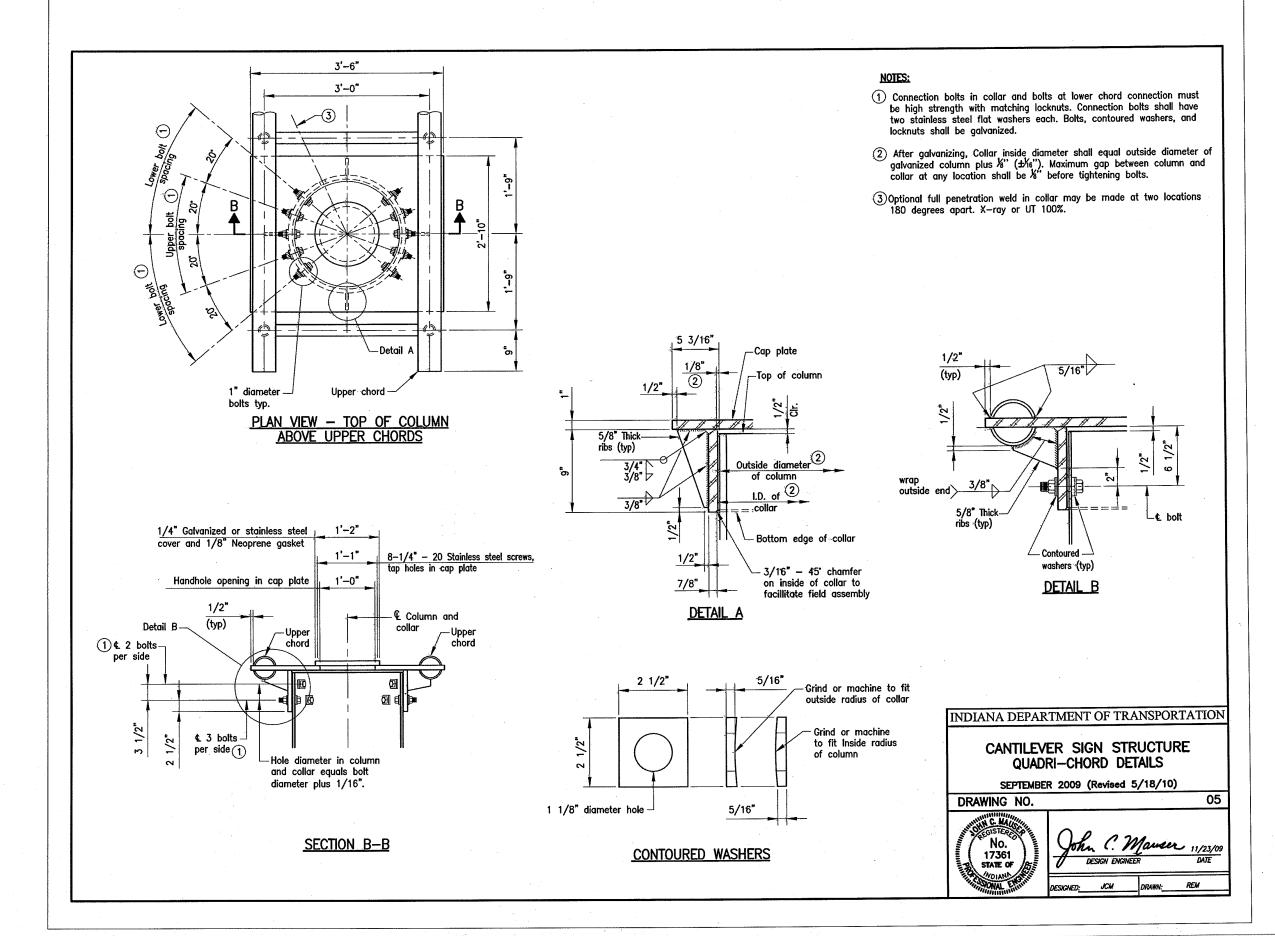


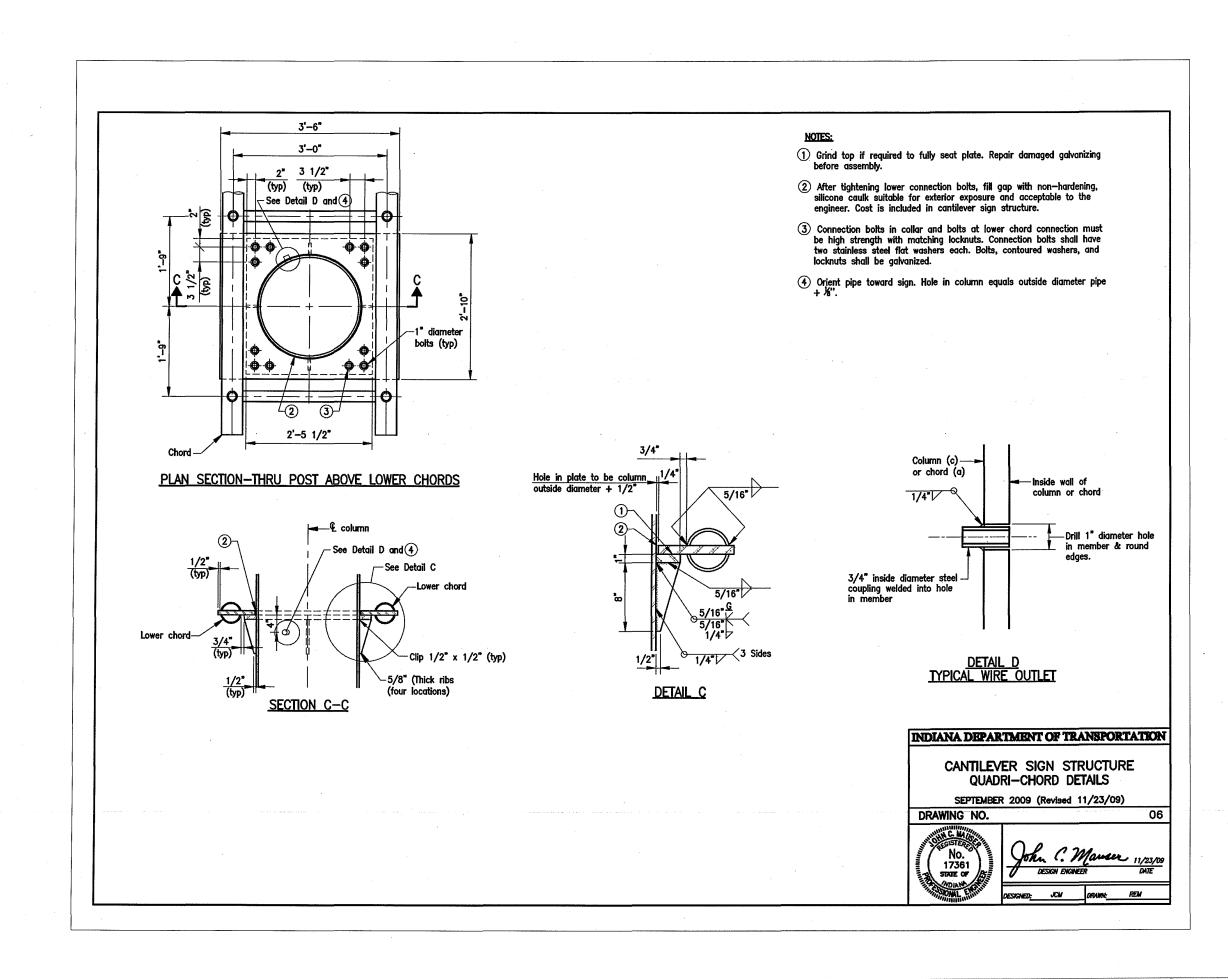


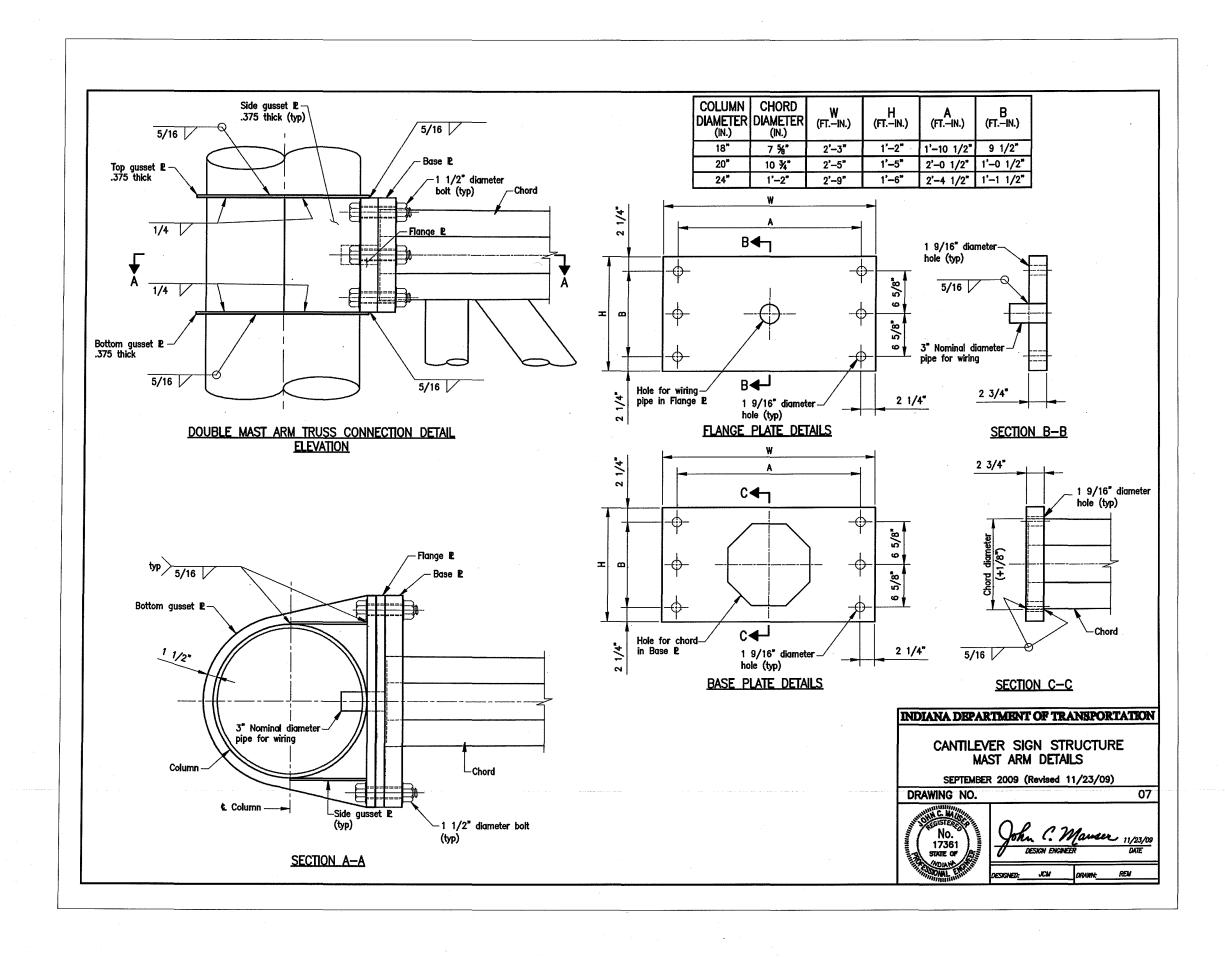


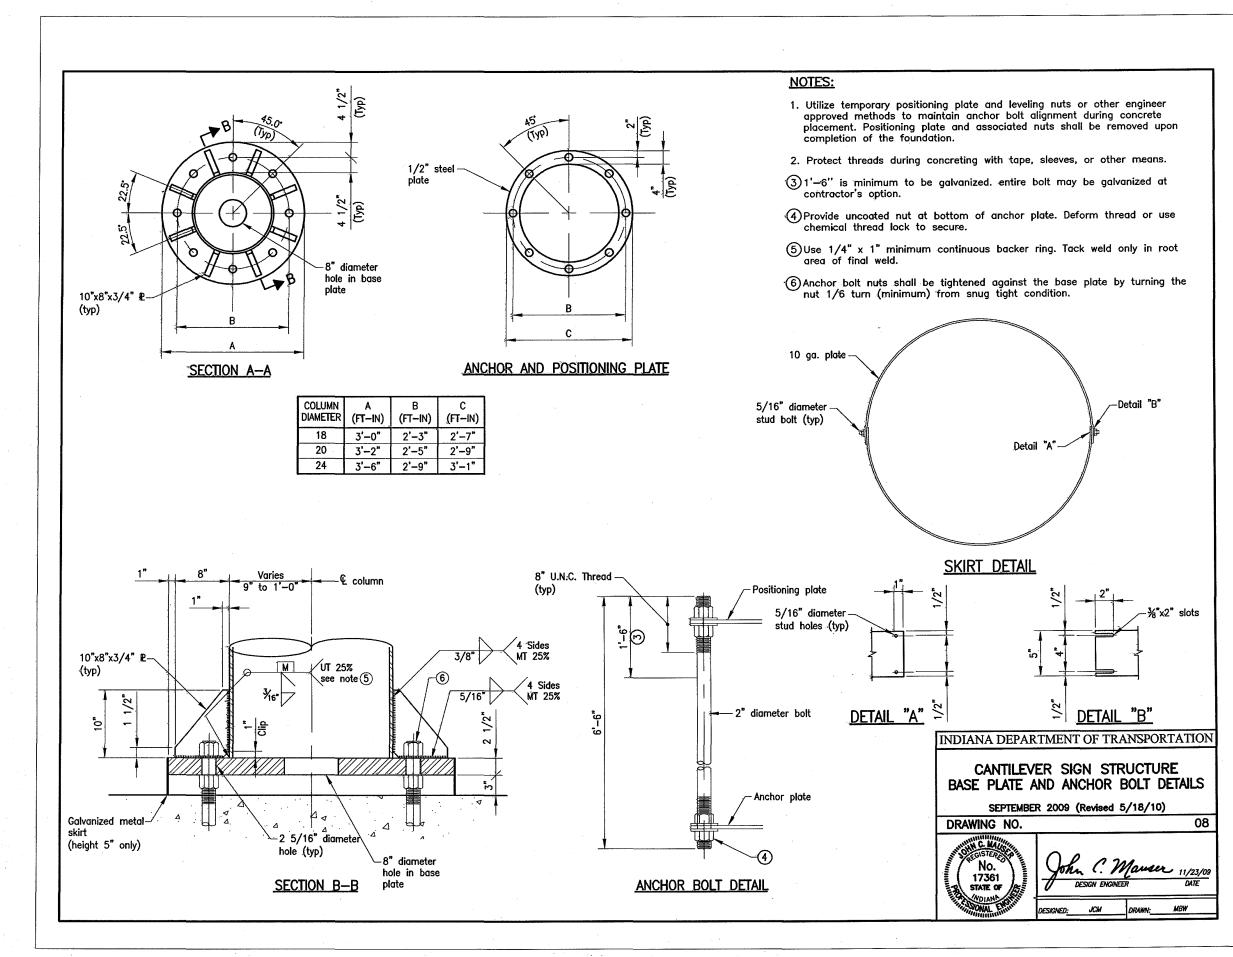


JULY 31, 2012 BOOK 2 - TECHNICAL PROVISIONS ATTACHMENT 14-1

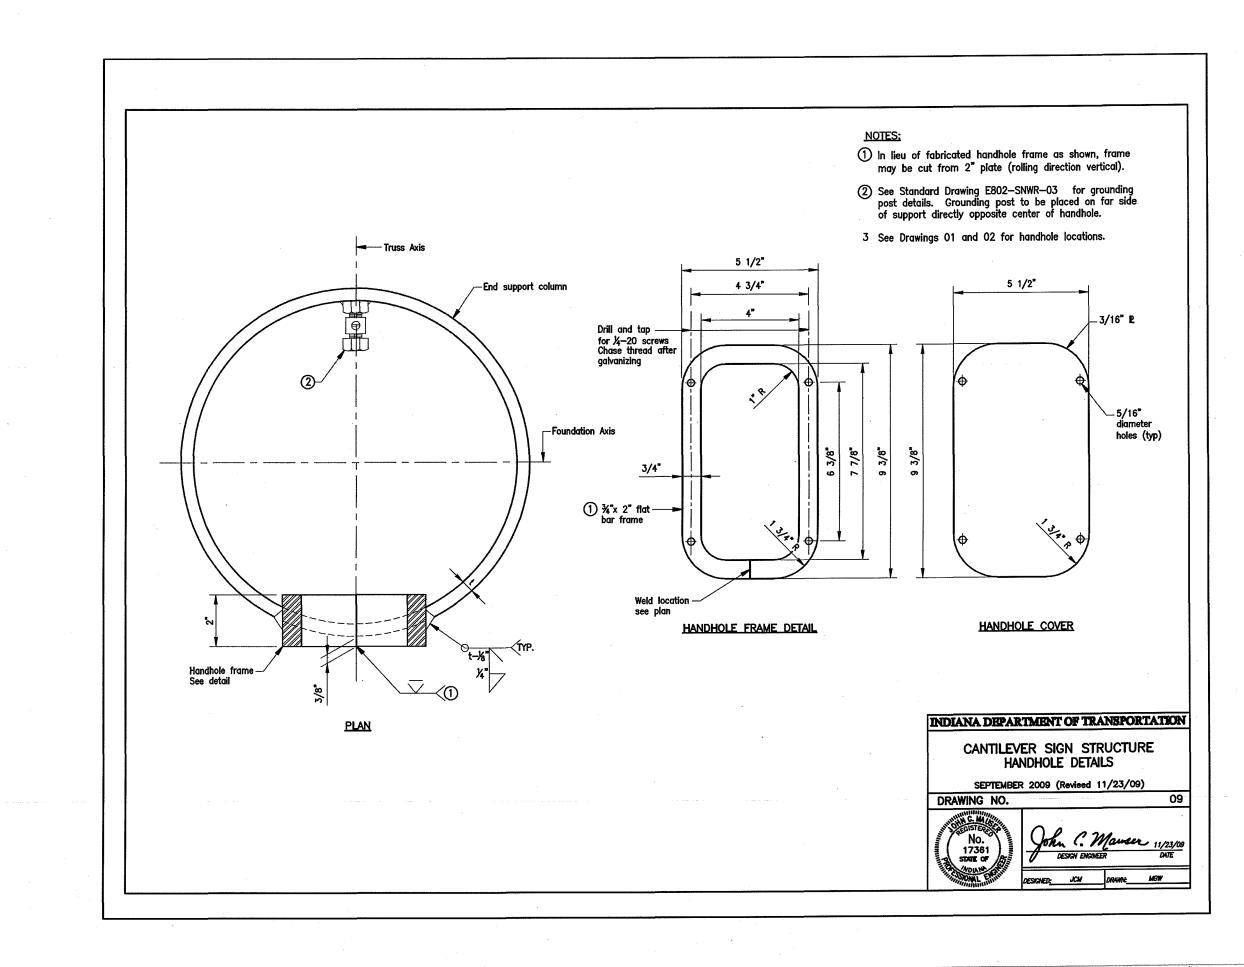

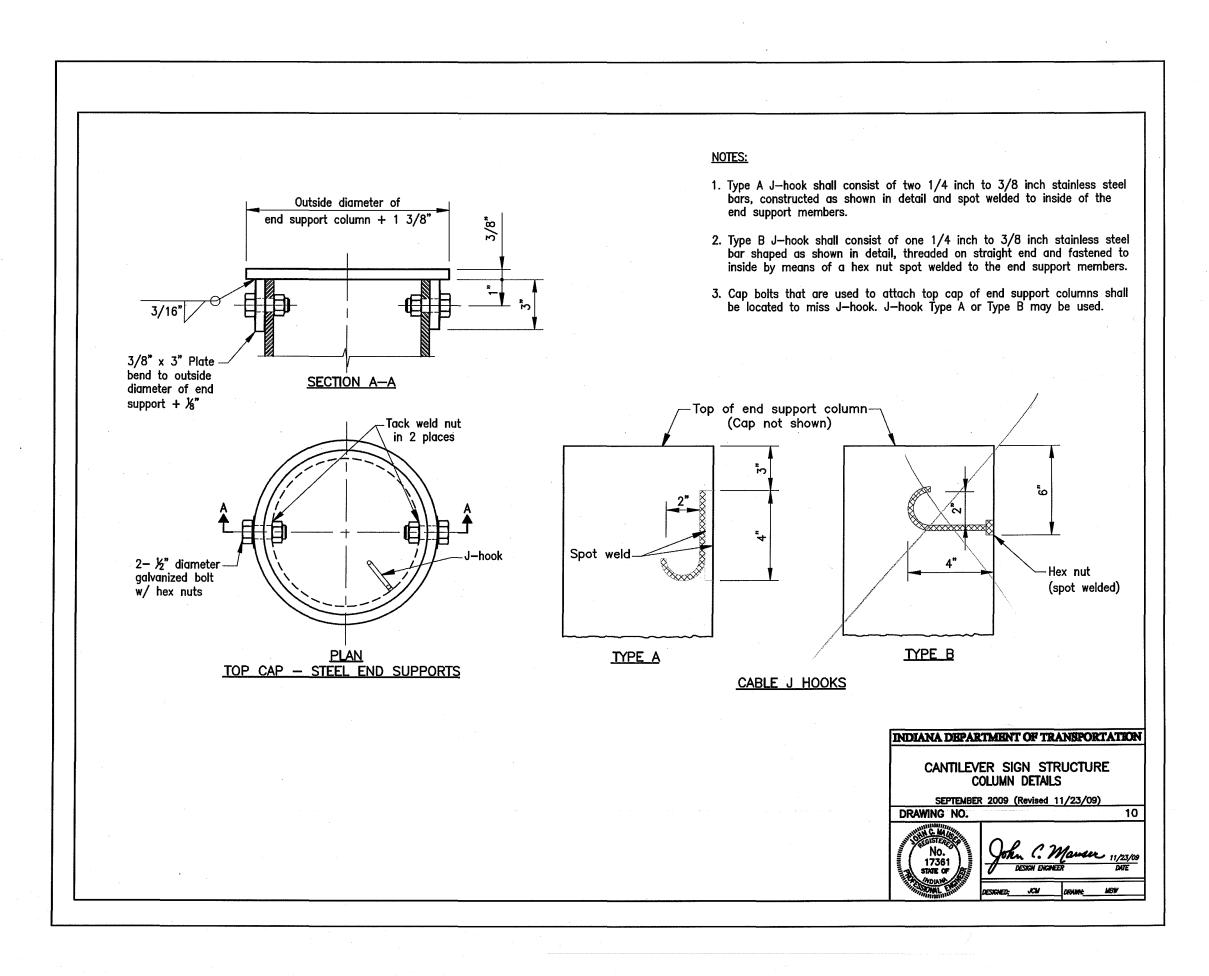


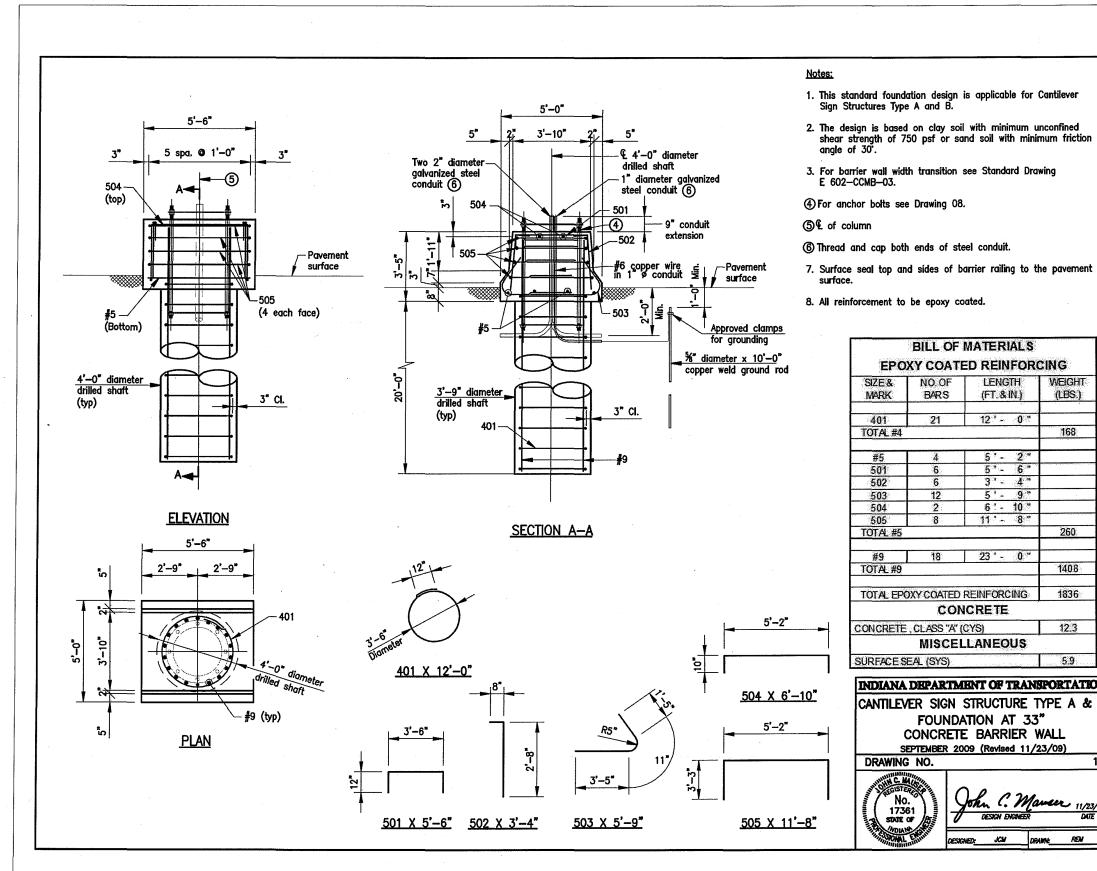


	94				
F MATERIALS					
TED REINFOI	RCING				
LENGTH	WEIGHT				
(FT.&IN.)	(LBS.)				
12 - 0 *					
· · · · · · · · · · · · · · · · · · ·	168				
5'- 2"					
5 * ~ 6 *					
3 - 4**					
5'- 9"					
6 * - 10 *					
11 - 8 *					
	260				
23 ' - 0 "					
23 - 0	1408				
	1400				
D REINFORCING	1836				
DICRETE	3030%				
(CYS)	12.3				
ELLANEOUS					
· · · · · · · · · · · · · · · · · · · ·	5,9				
MENT OF TRAI	NSPORTATION				
STRUCTURE	TYPE A & B				
DATION AT 3					
TE BARRIER					
2009 (Revised 11	/23/09) 11				
<b>.</b> .					
Ol cn	1				
John C. M. DESKH ENGHEER	ander 11/23/09				
U DESIGN ENGINEER	DATE				
ESIGNED: JCM	DRAINNE REM				

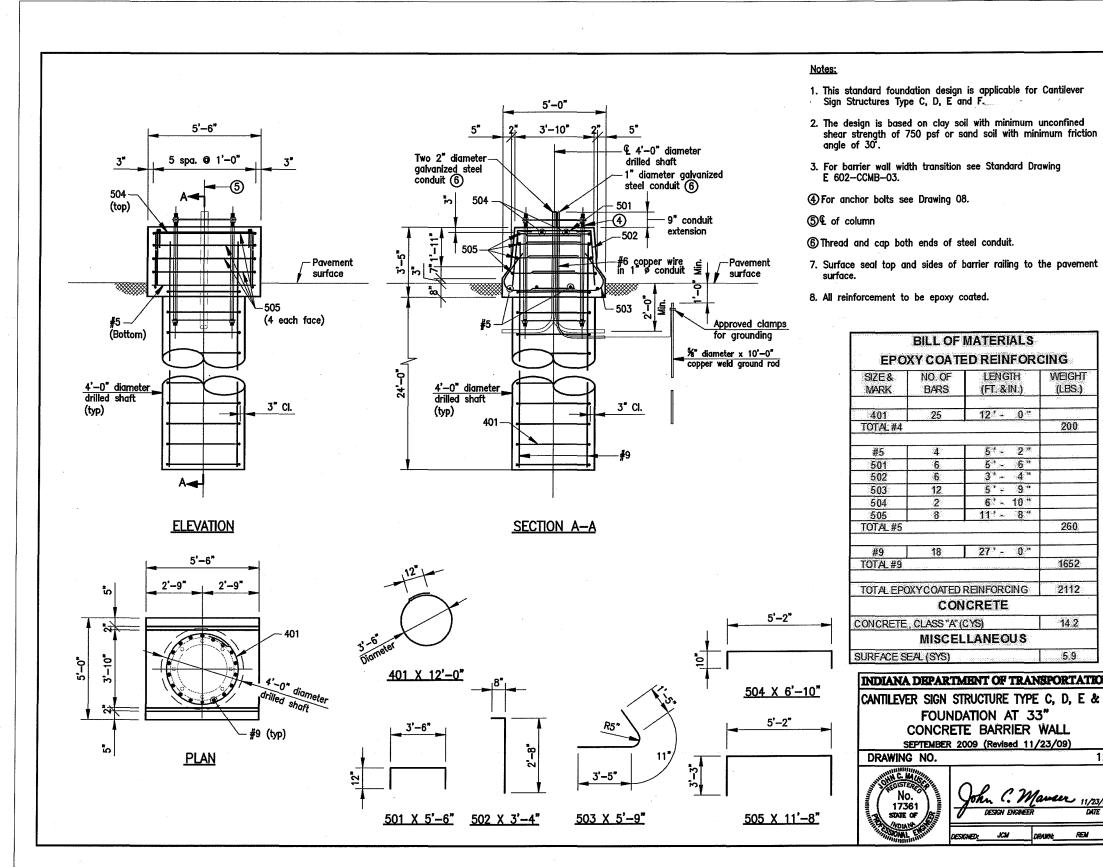


- MATERIAL O				
MATERIALS				
<b>TED REINFOR</b>	CING			
LENGTH	WEIGHT			
(FT, &IN.)	(LBS.)			
100 10				
12'- 0"	000			
	200			
5*- 2*				
5" - 6"				
3*- 4*				
5' - 9"				
6' - 10 "				
11 * ~ 8 *				
	260			
27'- 0"				
<u>  21 - U</u>	1652			
	- BODE			
REINFORCING	2112			
NCRETE				
	1.100			
'(CYS)	14.2			
LLANEOUS				
<u>n and the laberation of a</u>	5,9			
	TOTO TO A TROOM			
MENT OF TRAN				
STRUCTURE TYPE				
DATION AT 3				
TE BARRIER	ŴALL			
2009 (Revised 11,				
	12			
ne an	•			
John C. M	aner 11/23/09			
U DESIGN ENGINEER	DATE			
ESIGNED: JCM	WANNE REM			
	70 MT/ W			

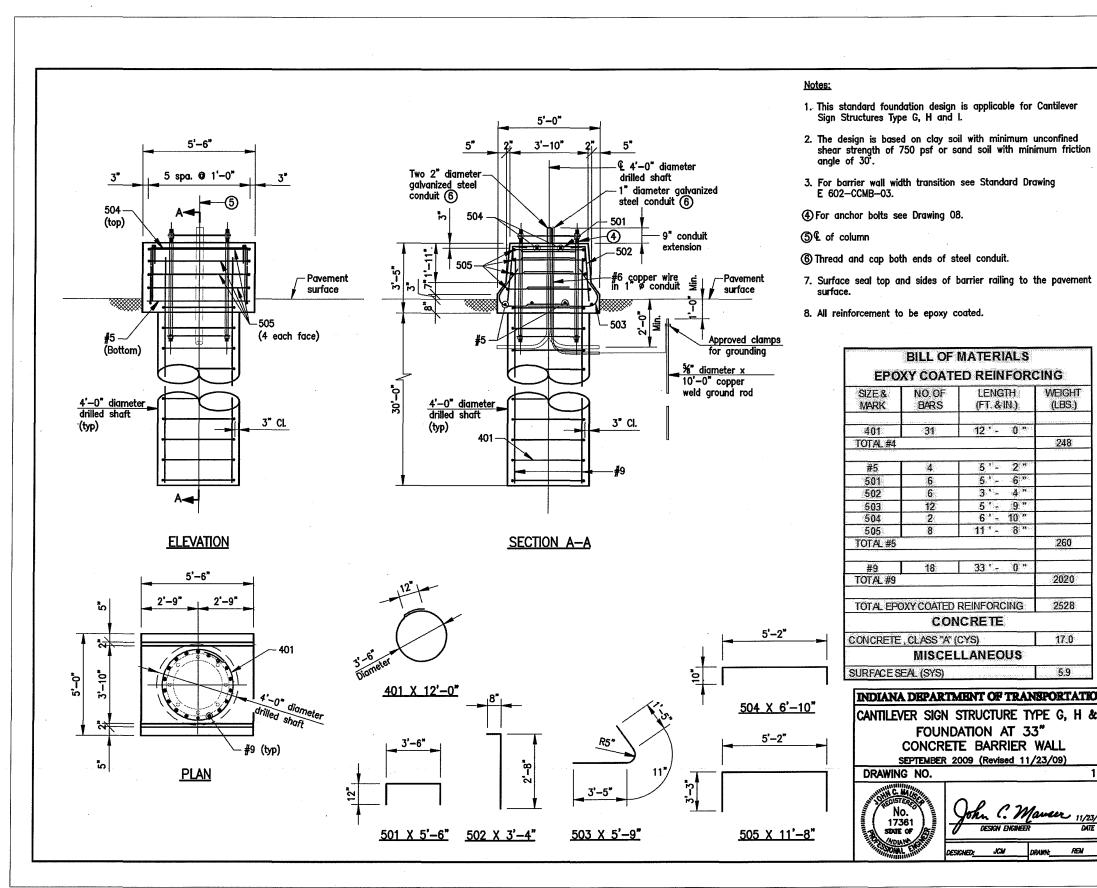

MATERIALS	
TED REINFOR	
LENGTH	WEIGHT
(FT.&IN.)	(LBS.)
12'- 0*	
	248
<u>5'-2*</u> <u>5'-6*</u>	
3*- 4*	
5'- 9"	
6'-10"	<u>.</u>
11'- 8"	
	260
33 * - 0 *	
	2020
DREINFORCING	2528
	2320
INCRETE	A
" (CYS)	17.0
LLANEOUS	
an a	5.9
MENT OF TRAN	SPORTATION
STRUCTURE TY	PE G, H & I
DATION AT 33	
TE BARRIER	
2009 (Revised 11/	
	13
OR and	
John C. M.	sucer 11/23/09
DESIGN ENGINEER	DATE
ESIGNED: JCM D	RAWA: REM
EDWARD UN	

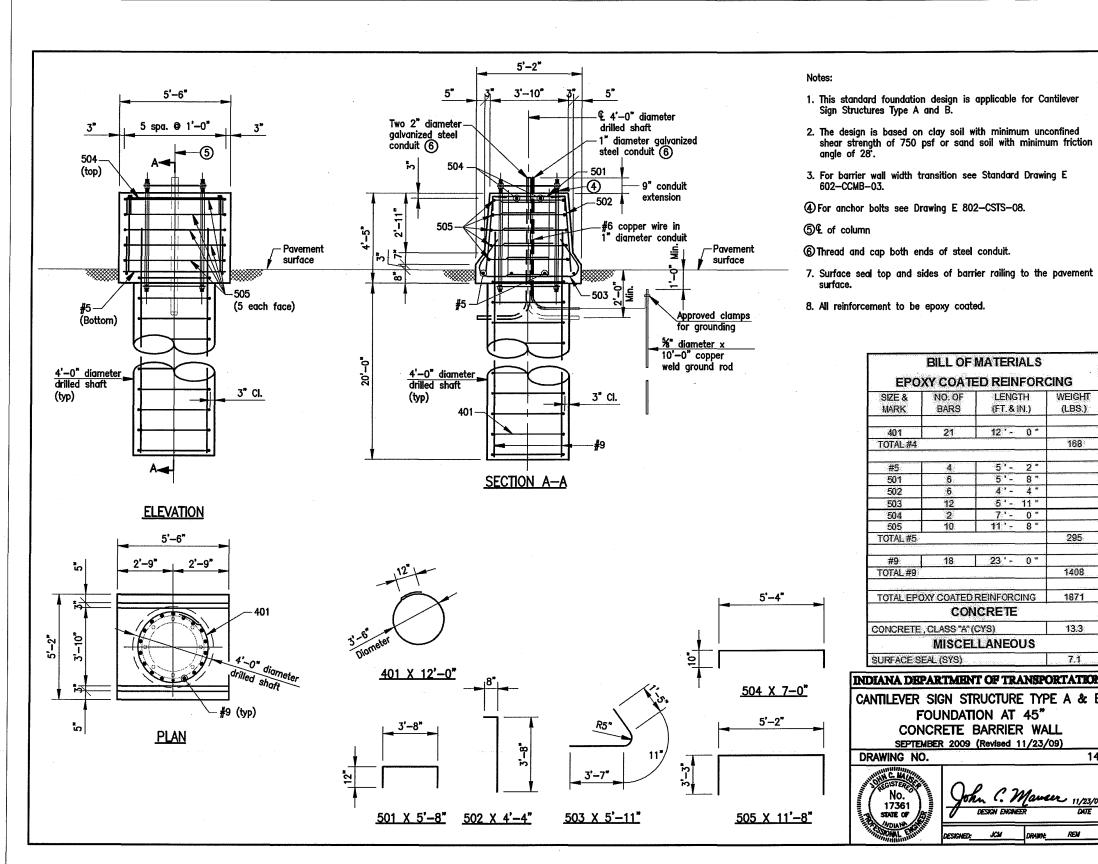


OFMATERIALS						
ΟΑΤΕ	ED REIN	FOR	CING	1000		
OF	LENGT	н	WEIGHT			
RS	(FT.&1)	1.)	(LBS.)	100		
1	12 -	0 *				
			168			
	5*-	2 *				
\$ }	5'-	8*		-		
о. 3		4 *				
, 2		<del>7</del> 11 *				
2	7	0 *		-		
0	11'-	8*				
	1		295			
8	23 ' -	0 *				
	····		1408			
·····	REINFORC	NG	1871			
CON	ICRETE					
S "A" (	CYS)		13.3			
	LANEO	JS				
YS)			7.1	-		
and a second						
MENT OF TRANSPORTATION						
I ST	RUCTURE	TYF	ΈA&	B		
				-		
DATION AT 45"						
TE BARRIER WALL						
2009 (Revised 11/23/09)						
14						
OP Pro						
John C. Mancer 11/23/09						
DESIGN ENGINEER DATE						
SIGNED:	JCM	DRAMA	REM			
		1				

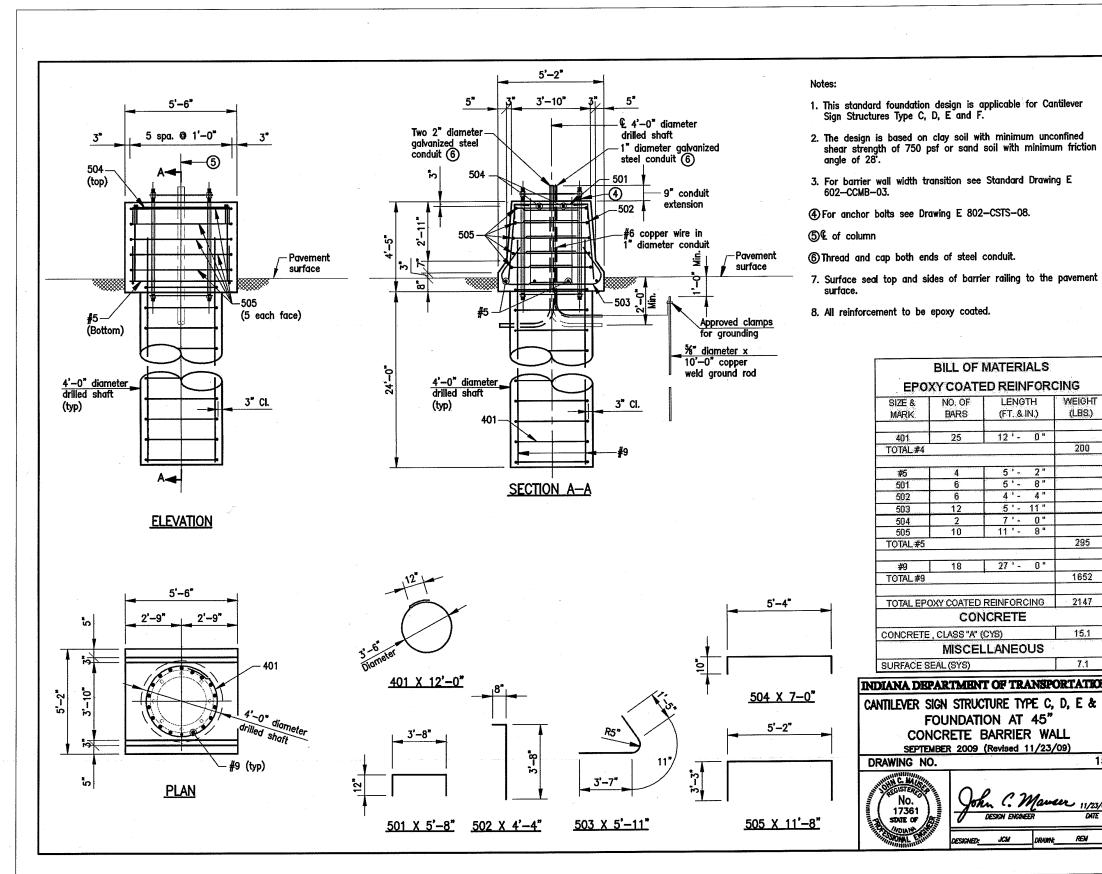


35

	5. S			7
OF MATERIALS				
OATED REINFORCING				
OF	LENGT	H	WEIGHT	
RS	(FT. & II	is	(LBS)	
S. 955.	••••••••	-		
25	12'-	0 *		1
······			200	
4	5'-	2 "		
6	6'-	8"		
6	4'-	4 "		
2	5'-	11 "		
2	7'-	0 "		]
0	11 ' -	8"		
			295	
8	27 ' -	0"		
			1652	
DATED	REINFORC	ING	2147	
	ICRETE			
55 "A" (			15.1	-
	LANEO	18		
SCLL SYS)			7.1	-
				_
MEN	<b>T OF TRA</b>	NSP	ORTATIO	N
			DEB	c
			D, E &	ľ
IDATI	ON AT	45″		
TE B	BARRIER	WA	LL	
	(Revised 1			
		1-1	. 1	5
$\sim$				
Joh	C2	Now	ur 11/23/	
Jon	n	Lun	11/23/0	99
0	Design enginee	ĸ	DATE	
ESIGNED:	JCM	DRAWN	REM	
CONNELS		Divisine.		_

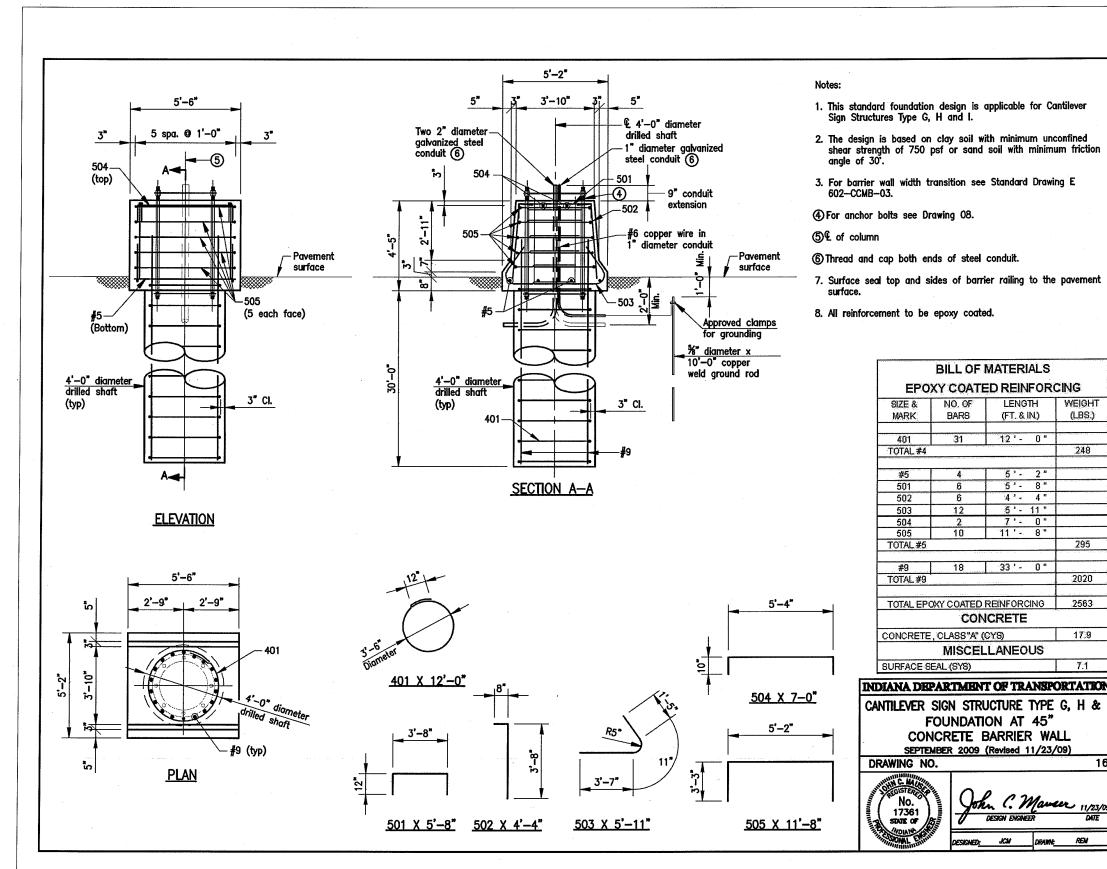


36


		1			
OF	OF MATERIALS				
DATED REINFORCING					
OF	LENGTH	WEIGHT			
RS	(FT. & IN.)	(LBS.)			
	<u>, , , , , , , , , , , , , , , , , , , </u>				
1	12'- 0"				
		248			
		THE COLOR AND A			
4	5'- 2"				
3	5'- 8"				
5	4'- 4"				
2	5'-11"				
2	7'- 0"	· · · · ·			
0	11'- 8"				
		295			
8	33'- 0"				
		2020			
	<u></u>				
ATED REINFORCING 2563					
CON	ICRETE				
S"A" (	CYS)	17:9			
	LANEOUS				
YS)		7.1			
MENT OF TRANSPORTATION					
STRUCTURE TYPE G, H & I DATION AT 45" TE BARRIER WALL 2009 (Revised 11/23/09)					
	······	16			
Joh	n C. Mam DESKN ENGINEER	Cer 11/23/09 DATE			
SIGNED:	JCM DRAWN	REM			

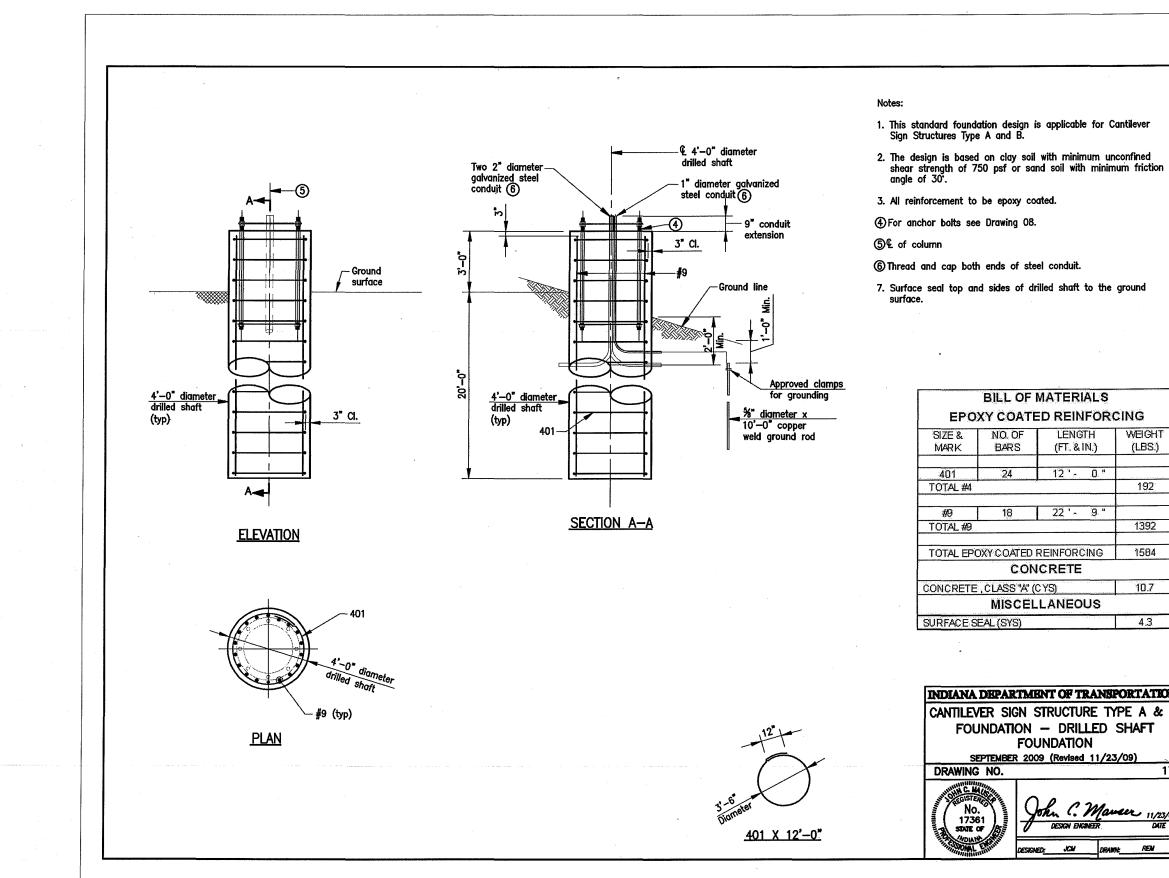

P. C. CONTRACTOR CONTRACTOR					
	F MATERIALS				
TED REINFORCING					
LENGTH	WEIGHT				
(FT. & IN.)	(LBS.)				
<u>_</u>	<u> </u>				
12 ' - 0 "					
	192				
22 - 9 "					
	1392				
DREINFORCING	1584				
ONCRETE					
4" (C YS)	10.7				
ELLANEOUS					
	4.3				
· · · ·					
MENT OF TRANS	PORTATION				
STRUCTURE T	PEA&B				
N - DRILLED	SHAFT				
OUNDATION					
2009 (Revised 11/23	5/09)				
	17				
$\cap$					
John C. Mar	er 11/23/09				
John C. Mar DESIGN ENGINEER	Her 11/23/09 DATE				
DESIGN ENGINEER	DATE				
John C. Mar DESIGN ENGINEER	DATE				

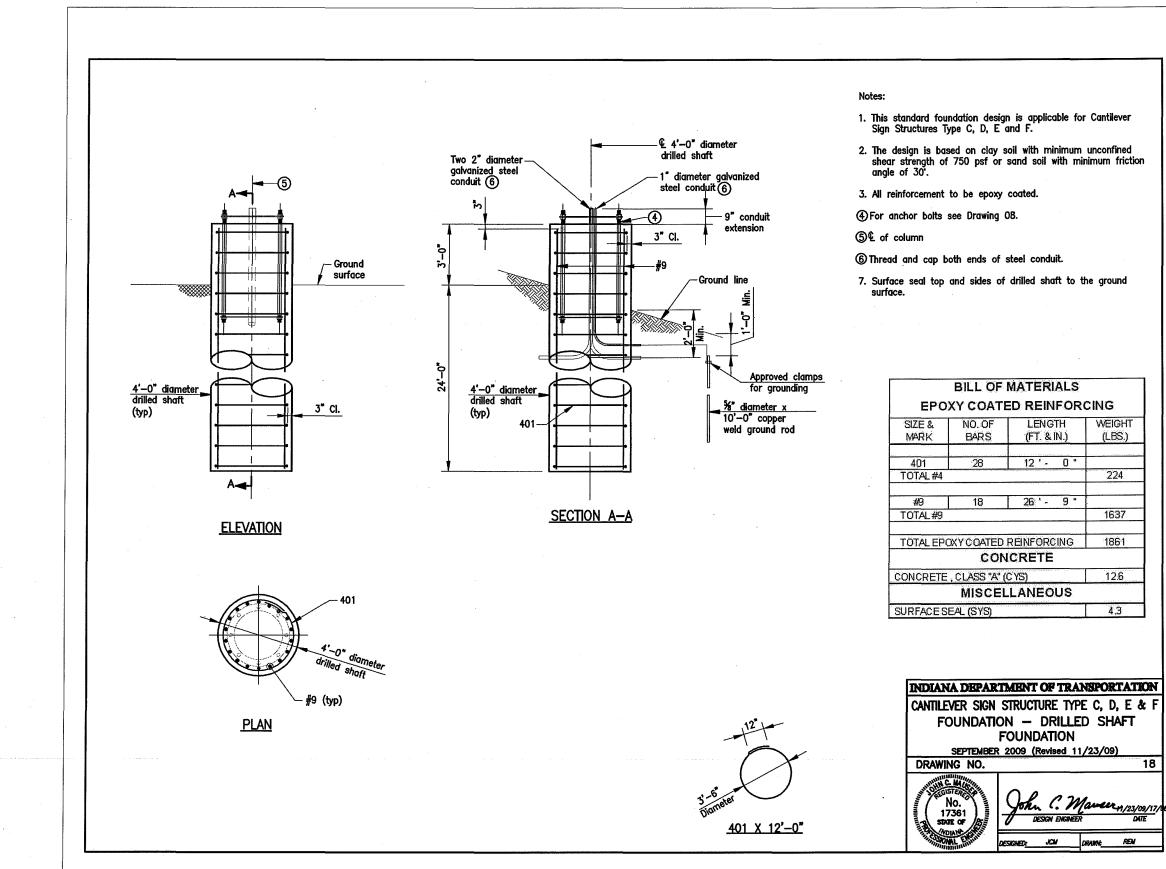

38

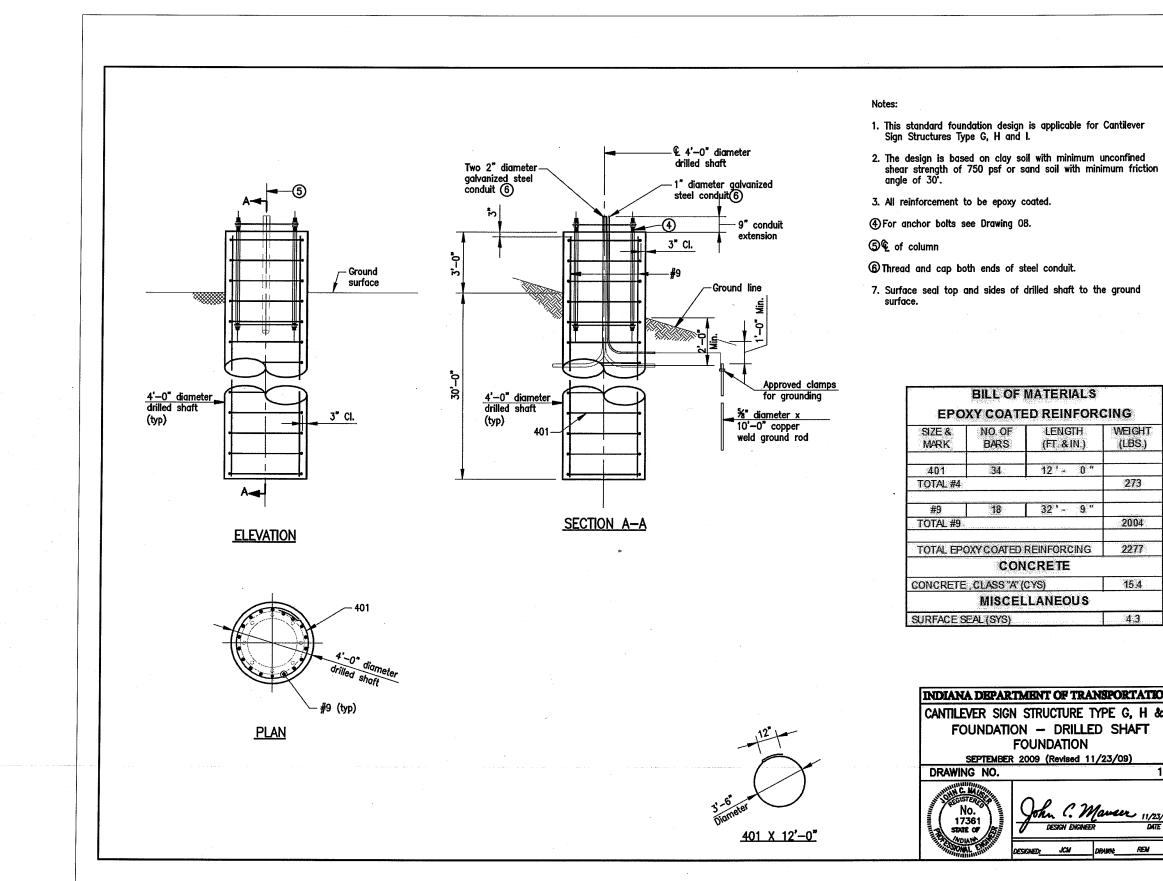

MATERIALS					
ED REINFOR	CING				
LENGTH (FT. & IN.)	WEIGHT (LBS.)				
12 * . 0 *					
	273				
32"- 9"					
	2004				
REINFORCING	2277				
NCRETE					
(CYS)	15.4				
LLANEOUS	43				
	4.2				
MENT OF TRAN	SPORTATION				
STRUCTURE TY	'PE G, H & I				
N - DRILLED	) SHAFT				
OUNDATION 2009 (Revised 11/	(23/09)				
	19				
$\sim$					
John C. Ma DESKN ENGINEER	2002er 11/23/09 DATE				
DESIGN ENGINEER	11/20/00				
DESIGN ENGINEER	DATE				

#### THE EAST END CROSSING

#### (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

#### BOOK 2 TECHNICAL PROVISIONS

#### ATTACHMENT 16-1 LSIORBP SECTION 4 TUNNEL GEOTECHNICAL BASELINE REPORT

(This page intentionally blank.)

INDIANA FINANCE AUTHORITY THE EAST END CROSSING JULY 31, 2012 BOOK 2 - TECHNICAL PROVISIONS ATTACHMENT 16-1 ADDENDUM 1 – AUGUST 17, 2012



delivered locally

# OHIO RIVER BRIDGES PROJECT

LSIORBP SECTION 4 Geotechnical Baseline Report

Submitted To: Mr. Jerry Leslie H.W. Lochner 1040 Monarch Street Suite 300 Lexington, KY 40513

Submitted By: Golder Associates Inc. 15851 South US 27, Suite 50 Lansing, MI 48906 USA



Distribution: One Hard Copy Electronic PDF

August 17, 2012

Project No. 113-88401 (Phase 3000 DOC0025 Rev 2)



Golder, Golder Associates and the GA globe design are trademarks of Golder Associates Corporation



i

## **Table of Contents**

1.0	INTRODUCTION	1
1.1	Purpose	1
1.2	Development and Application of GBR	1
1.3	Organization of the GBR	1
1.4	Disclaimer	2
2.0	ANTICIPATED GROUND CONDITIONS	3
2.1	Project	3
2.2	South Portals	3
2.3	North Portals	4
2.4	Northbound and Southbound Tunnels	4
2.	4.1 Tunnel Reaches and Lithologies	4
2.	.4.2 Rock Quality	6
	2.4.2.1 Baseline Intact Rock Properties	6
	2.4.2.2 Baseline Rock Mass Properties	7
2.	4.3 Major Discontinuities	10
2.	4.4 Groundwater Conditions	10
2.	.4.5 In-situ Stresses	
3.0	POTENTIAL SUBSURFACE HAZARDS AND ADVERSE GEOLOGIC FEATURES	11
3.1	Dissolution Features or Voids	11
3.2	Highly Weathered Zones, Fracture Zones and Zones of Poor Rock Quality	
3.3	Faults	
3.4	Groundwater Inflow	
3.5	Slaking or Expansion of Shale	
4.0	CONSTRUCTION CONSIDERATIONS	
4.1	Portal	
	1.1 Portal Excavations	
	1.2 Portal Excavation Support Systems	
4.2		-
4.	2.1 Method of Tunnel Excavation	
	4.2.1.1 Overview	
	4.2.1.2 Drill-and-Blast Method	
	4.2.1.3 Mechanical Excavators	
4.	.2.2 Tunneling Conditions by Reach	
	4.2.2.1 Tunnel Reach 1	
	4.2.2.2 Tunnel Reach 2	
	4.2.2.3 Tunnel Reach 3	
	4.2.2.4 Cross-Passages	18



August 2012	ii	Project No. 113-88401 DOC0025 Rev 2	
4.2.3 Initial Ground Support			

	4.2.5	
	4.2.4	Overbreak
5.0	LIM	ITATIONS



Augus	st 2012	iii	Project No. 113-88401 DOC0025 Rev 2
-------	---------	-----	--

### List of Tables

- Baseline Range for Intact Rock Properties Data Summary and Baseline Values of RQD and Fracture Spacing Table 1
- Table 2

## List of Figures

Figure 1	Site Location Map
Figure 2	Boring Location Map
Figure 3-10	Lithologic Profiles Sheets
Figure 11	GBR Envelope

#### **List of Appendices**

Appendix A Glossary

### **REVISION CONTROL**

Rev No.	Date	Description	Prepared by	Reviewed by	Approved by
0	July 6, 2012	Final Geotechnical Baseline Report	Kuantsai Lee	Mark Funkhouser	Darcy Cowan
1	July 30, 2012	Final Geotechnical Baseline Report	Kuantsai Lee	Mark Funkhouser	Darcy Cowan
2	August 17, 2012	Final Geotechnical Baseline Report	Kuantsai Lee	Mark Funkhouser	Darcy Cowan





#### 1.0 INTRODUCTION

#### 1.1 Purpose

The Geotechnical Baseline Report (GBR) establishes a contractual baseline for anticipated ground conditions that will be encountered during construction of the tunnel section of Louisville – Southern Indiana Ohio River Bridges Project Section 4 (the Project). The baseline conditions described in this GBR reflect the IFA's interpretation of anticipated subsurface conditions and ground behavior. It is essential that prospective Developers fully understand the technical concepts, terms, and descriptions used in defining the baseline conditions in this report.

#### **1.2** Development and Application of GBR

The GBR and the baseline conditions presented herein were developed using the geotechnical information and data gathered through geologic explorations, field and laboratory testing and other data; analyses; evaluations; professional opinions; and previous construction experiences in similar ground conditions. The baseline conditions apply and will be measured over the entire length of the tunnels in this Project, provided the tunnel is built within the GBR Envelope as shown in Figure 11

The GBR is neither a design guide nor a specification or recommendation of any particular construction means and methods. The Developer shall not rely on this GBR as the sole input for planning, designing, or performing the work, including selecting and designing the means, methods, equipment, techniques, sequences, and procedures of construction to be used. To fulfill this responsibility, it is advisable that the prospective Developer employs a geotechnical engineer and/or engineering geologist experienced in tunnel design and construction to review this GBR. The Developer will be deemed to have studied the geotechnical data published in the various reports and literature as referenced in this report, inspected the rock cores recovered from the borings, and to have planned and conducted additional investigations and analyses as necessary to gain a complete understanding of the anticipated ground conditions and behavior.

#### 1.3 Organization of the GBR

The GBR is organized into two parts. The first part defines the purpose, application, and limitations of the GBR and includes Section 1 (this section) and Section 5 (Limitations). The second part is the core of the GBR that describes the baseline conditions and includes Sections 2, 3, and 4.

The text of the GBR is supplemented by tables, figures, and an appendix. The tables are presented within the text. The figures and appendix follow the text.





#### 1.4 Disclaimer

The primary sources of data considered in the development of this GBR are the factual information collected primarily by other geotechnical engineers and presented in a number of Geotechnical Data Reports (GDRs). As the GDRs were prepared by different geotechnical engineers who may have followed different practices in describing the conditions of geologic materials and rock masses, it is possible that the same or similar conditions may be described differently by the different geotechnical engineers. Because the descriptions of the rock and rock mass in this GBR are derived from the GDRs, these descriptions may have inherited any inconsistency that may exist among the different GDRs. Any such inconsistency will not be considered or accepted as alternatives to the descriptions and conditions presented in this GBR. The glossary of technical terms presented in Appendix A of this GBR provides the final and definitive reference to the descriptions used in this GBR.

The development of this GBR has relied upon subsurface materials as characterized at specific sample locations from within the boreholes in the GDRs. At the same time, it was recognized that the samples represented only a small fraction of the rock mass affected by the planned construction. Thus, the baseline conditions presented in this GBR encompass and extend the data presented in the GDRs on the basis of professional judgment and other considerations. The GDRs are reference information only and may not be relied upon as baseline information for purposes of this GBR. As such, any difference between the data reported in the GDRs and the baseline conditions presented in this GBR will not be considered or accepted as the basis for changing the baseline conditions.





#### 2.0 ANTICIPATED GROUND CONDITIONS

#### 2.1 Project

The project is located in Louisville, Jefferson County, Kentucky, USA. The project location is shown on Figure 1. The Project layout, with boring locations is shown on Figure 2. Lithologic profiles of the Northbound and Southbound Tunnels are shown on Figure 3 through Figure 6, and Figure 7 through Figure 10 respectively. This GBR is applicable to excavations that fall within the limits shown on Figure 11 (the GBR envelope). As shown in Figure 11, the GBR envelope is defined in reference to the KY841 horizontal and vertical alignment as shown in the Reference Design.

#### 2.2 South Portals

Development of the South Portal will involve excavations down to approximately 90 feet below the ground surface. The excavation is anticipated to be made in the sequence of residual soil, Louisville Limestone, and Waldron Shale with the lowermost few feet in the Laurel Dolomite. The residual soil is expected to range from approximately 5 to 20 feet in thickness and consist of firm to hard, silty clay with traces of sand, iron oxide nodules, remnant rock (gravel to boulder size) and pinnacles of limestone at the top of rock contact. The rock units encountered below the overburden at the South Portal are closely bedded and jointed limestone and shale. Perched groundwater will be encountered at the overburden-limestone contact, located at approximately 5 to 20 feet below the existing ground surface.

The limestone at the South Portal site is completely to highly weathered and extremely weak to weak to a depth of approximately 5 to 10 feet below top of rock surface. Between a depth of about 10 feet and 15 feet, the rocks are moderately to slightly weathered and moderately strong to strong. Below 15 feet, the rock is slightly weathered to fresh and strong to very strong. The South Portal excavation will encounter pinnacled top of rock and karst voids on the face of the cut slope within the limestone. Another perched groundwater zone will be encountered at the base of the limestone – top of shale contact.

The shale near the base of the excavation is weak and intensely to moderately fractured. The shale will crumble and disintegrate when left to dry, and to soften or swell when exposed to free water (slake). The softened or crumbled material will fall out of the slope, creating overhang faces and collapses in the limestone above, as has been observed in highway cuts and quarry walls in the vicinity of the project site. Additional discussion of potential subsurface hazards and adverse geologic features is provided in Section 3.

The lower most few feet or less of the South Portal excavation will be in the Laurel Dolomite, which consists of fresh to slightly weathered, strong to very strong, jointed and bedded, fine grained dolomite.





#### 2.3 North Portals

Development of the North Portal will involve excavations down to about 70 feet below the ground surface. The North Portal is anticipated to be excavated through residual soil, Louisville Limestone, Waldron Shale, and Laurel Dolomite. The residual soil is expected to range from about 5 to 15 feet in thickness and consist of firm to hard, silty clay, with traces of sand, iron oxide nodules, remnant rock (gravel to boulders size pieces) and limestone pinnacles at the top of rock contact. The rock units below the overburden at the North Portal consist of closely bedded and jointed limestone, shale, and dolomite. Perched groundwater will be encountered at the overburden-limestone contact, located at about 5 to 15 feet below the existing ground surface.

The limestone at the North Portal site is completely to highly weathered and extremely weak to weak to a depth of about 2 feet below rock surface. Between a depth of about 2 feet and 10 feet, the rocks are moderately to slightly weathered and moderately strong to strong. Below 10 feet, the rocks are slightly weathered to fresh and strong to very strong. The North Portal excavation will encounter pinnacled top of rock and karst voids on the face of the cut slope within the limestone. A second perched groundwater zone will be encountered at the base of the limestone above the shale contact.

The shale at the base of the limestone is weak and intensely to moderately fractured. The shale will crumble and disintegrate when left to dry, and to soften or swell when exposed to free water (slake). The softened or crumbled material will fall out of the slope, creating overhang faces and collapses in the limestone above, as has been observed in highway cuts and quarry walls in the vicinity of the project site.

The dolomite at the lower part of the excavation is fresh to slightly weathered, strong to very strong, jointed and bedded, fine grained dolomite.

#### 2.4 Northbound and Southbound Tunnels

#### 2.4.1 Tunnel Reaches and Lithologies

The Northbound and the Southbound Tunnels will be excavated within the near horizontal sequence of the Louisville Limestone, the Waldron Shale, and the Laurel Dolomite where, as discussed in Section 2.2 above, the top of the Louisville limestone is pinnacled. The relative positions of the three rock formations within the excavation shift as the elevations of the tunnels drop from south to north. At the south end of the tunnels, the Louisville Limestone will be exposed on the upper excavation (above the springline), the Waldron Shale on the sidewalls, and the Laurel Dolomite on the invert of the excavation. At the north end of the tunnel, the Louisville Limestone no longer intersects the excavation (it is above the crown), the Waldron Shale will be exposed on the crown of the tunnel and the upper part of the roof arch, with the Laurel Dolomite forming the bulk of the excavation. As the Waldron Shale is generally the weakest and





the most heavily jointed of the three formations, its position within the excavation will have a major impact on the stability and the support requirement of the excavation.

In the following discussions and the remainder of this GBR, words rather than numbers are commonly used to describe the location where certain rock formations would appear at certain parts of the excavation (such as springline or crown) in recognition of the uncertainties associated with these locations. Such uncertainties arise from finding the intersection of two near-horizontal wavy lines and from the pinnacled contact at the top of the rock. In addition, these locations will not be known until excavation and may occur in more than one place because of the natural undulation of the contacts between rock formations. Finally, certain geometric features of the tunnel cross section, such as the location of the springline, may change from that envisioned currently as the Developer performs detailed tunnel design. Future changes to the locations of the springline or crown due to any of the reasons discussed above may lead to variations of the tunnel reaches.

Starting from the South Portal and heading north, the Northbound and the Southbound Tunnels have been divided into three reaches by considering (a) the relative positions where the three main rock formations (the Louisville Limestone, the Waldron Shale, and the Laurel Dolomite) are exposed in the tunnel excavation; and (b) the amount of anticipated rock cover above the tunnels. The three reaches are (all stations approximate):

- Reach 1 from the South Portal at Station 50+30 to approximately Station 55+00. At the beginning of Tunnel Reach 1, the Louisville Limestone is exposed in the arch above the springline. As the reach progresses north, the position of the Waldron Shale rises from the sidewall (between the springline and the invert) to the springline while the Laurel Dolomite follows in step and rises from the invert to the sidewalls.
- Reach 2 from the end of Reach 1 to approximately Station 61+00. At the beginning of Tunnel Reach 2 or shortly thereafter, the Waldron Shale rises above the springline and becomes exposed in the lower part of the arch. The Laurel Dolomite follows in step and rises from the sidewalls to the springline. The Louisville Limestone, while still exposed in the crown and the upper part of the arch, begins to move above and out of the excavation.
- Reach 3 from the end of Reach 2 to the North Portal at Station 69+85. 3. At the beginning of Tunnel Reach 3, as the Louisville Limestone continues its transition out of the excavation, the base of the Waldron Shale rises past the mid-height of the tunnel and occupies the bulk of the arch. The transition becomes complete somewhere between Station 61+00 and Station 65+00 where the crown and the upper arch of the excavation are located within the Waldron Shale (the transition could occur over an even longer distance because the contact between the limestone and the shale will not be horizontal or planar and because the projection also depends on the dimensions of the excavation). The Laurel Dolomite, still following in step, will rise and become exposed in the sidewalls and the lower part of the arch. As will be discussed in Section 2.4.2.2 below, the Louisville Limestone in Reach 3 is more closely jointed/bedded than the Louisville Limestone in Reaches 1 and 2.

While the Louisville Limestone may not be exposed in the crown or the arch of the excavation in some or most parts of Reach 3, it will have a direct and major impact on the



August 2012	6	Project No. 113-88401 DOC0025 Rev 2
-------------	---	--

stability of the roof of the excavation since, in places (particularly where the top of the rock is pinnacled), the relatively thin layer of jointed and fractured limestone will not be capable of forming or supporting the ground arch immediately above the excavation. Thus, even though the limestone may not be intentionally exposed for observation during the excavation of Tunnel Reach 3, its presence and potential impacts must be recognized in the planning and the installation of excavation support in this reach. This creates a unique challenge in the excavation and support of Tunnel Reach 3. The challenge will be further explored in Section 4.

As shown on Figure 2, interspersed within the three reaches are cross-passages (#1, #2, #3, and #4) that connect the North- and the Southbound Tunnels:

- Cross-Passage #1 is located near the north end of Reach 1 at approximate stations of 54+00 to 54+30
- Cross-Passage #2 is located within Reach 2 at approximate stations of 57+87 to 58+17
- Cross-Passages #3 and #4 are both located within Reach 3 at approximate stations of 61+75 to 62+05 and 65+62 to 65+92, respectively.

#### 2.4.2 Rock Quality

#### 2.4.2.1 Baseline Intact Rock Properties

Table 1 lists the baseline range for the intact rock properties. The measured minimum and maximum values are also provided in the same table for reference purposes. The baseline range corresponds to the range within which the values of the corresponding properties are expected to fall. As the number of tests for each rock property in each formation is limited (especially so when broken down into different reaches), and as the intra-reach difference in the intact rock property within each formation is statistically insignificant, the baseline range presented in Table 1 apply to all three reaches discussed in Section 2.4.1.





		Measured		Baseline Range	
		Min Max		From	То
Uniaxial	Shale	1,924	19,298	1,800	20,000
Compressive	Limestone	1,638	38,829	1,500	40,000
Strength, psi	Dolomite	975	28,640	800	30,000
	Shale	24	1,792	20	2,000
Point Load Index I <sub>50</sub> , psi	Limestone	130	1,871	20	2,000
	Dolomite	31	1,775	20	2,000
Brazilian Split	Shale	150	2,635	100	3,000
Tensile	Limestone	414	4,413	400	5,000
Strength, psi	Dolomite	651	2,996	600	4,000
Peak Slope	Shale	61	61	60	120
Index from Punch	Limestone	37	168	30	180
Penetration Test	Dolomite	96	165	80	200
CERCHAR	Shale	0.32	0.6	0.25	0.75
Abrasiveness Index	Limestone	0.7	2.5	0.5	2.5
	Dolomite	0.5	1.4	0.5	2.5
Slake Durability Index	Shale	15	99	10	99

#### Table 1 Baseline Range for Intact Rock Properties

#### 2.4.2.2 Baseline Rock Mass Properties

The measured Rock Quality Designation (RQD) indices and fracture frequency for the Louisville Limestone, the Waldron Shale, and the Laurel Dolomite are summarized in Table 2 for each of the three rock formations. Table 2 also presents the corresponding baseline ranges.



						Perce	entile				Bacolin	e Range
RQD	Formation	No.	Min	10%	20%	50%	80%	90%	95%	Max	From	To
Reach 1	Limestone	186	0	85	94	100	100	100	100	100		
	Shale	5	94			99				100	0	100
	Dolomite	13	93	99	100	100	100	100	100	100		
	Limestone	131	38	95	97	100	100	100	100	100		100
Reach 2	Shale	83	0	43	73	100	100	100	100	100	0	
	Dolomite	10	98			100				100		
	Limestone	59	18	59	71	90	98	100	100	100	0	100
Reach 3	Shale	247	0	19	48	93	100	100	100	100		
	Dolomite	86	57	96	98	100	100	100	100	100		
Fracture	Formation	No.	Min			Perce	entile			Max	Baselin	e Range
Spacing, ft		NO.	IVIIII	10%	20%	50%	80%	90%	95%	IVIAX	From	То
	Limestone	148	0.35	1.21	2.50	7.95	10	10	10	10.2		10
Reach 1	Shale	5	2.50			10				10		
	Dolomite	13	1.10	1.48	1.80	5	10	10	10	10		
Reach 2	Limestone	91	0.78	1.98	2.53	6	10	10	10	12	0.1	10
	Shale	51	0.42	1.43	2.50	10	10	10	10	10		
	Dolomite	10	1.46			3.70				10		
	Limestone	57	0.17	0.47	0.63	1	1.6667	3.5	5	5		
Reach 3	Shale	161	0.17	0.69	1.00	5	10	10	10	12	0.1	10

#### Table 2 Data Summary and Baseline Values of RQD and Fracture Spacing

(1) RQD and fracture spacing data shown are from measurements taken immediately following extraction of the core.

(2) Fracture spacing is calculated for each core run by dividing the length of the run by the number of fractures observed in the core run. For those core runs where no fracture was observed, the fracture spacing is conservatively assumed to equal the length of the core run.

The data are divided into the three tunnel reaches (Section 2.4.1) by selecting only the data from those boreholes (or the section of the near-horizontal boreholes) that fall within each tunnel reach. The objective was to compare the distributions of fracture frequency and RQD between different tunnel reaches, although the data were unevenly distributed among the different sources<sup>1</sup>. Despite the uncertainties associated with uneven data distributions discussed above, it appears that the Louisville Limestone is more closely jointed/bedded in Reach 3 than in the other two reaches. This observation is consistent with the expectation that, as the Louisville Limestone in Reach 3 is closer to the ground surface, it is more susceptible to the processes of weathering and degradation and therefore will be more closely jointed/bedded in this reach. For all other cases, the data did not depict noticeable differences among the different reaches.

<sup>&</sup>lt;sup>1</sup> For example, all limestone data on Reach 3 came from vertical boreholes since the horizontal boreholes did not intercept the Louisville Limestone on that reach. As another example, all dolomite data came from vertical boreholes where the data were concentrated in Reach 3 as the dolomite was located closer to the ground surface in that area.





Engineering rock mass classification using the Rock Mass Rating system (RMR'89), the Norwegian Geotechnical Institute Q system (NGI-Q, and a revised Q system (Q', whereby the joint water factor  $(J_w)$  and the stress reduction factor (SRF) are both set to 1 were assessed for the Louisville Limestone, Waldron Shale, and Laurel Dolomite, respectively. The assessment indicated that, among the three systems considered, RMR'89 had the advantage of being relatively simple to apply while capable of reflecting the variation of rock mass conditions along the different tunnel reaches. As such, RMR'89 is selected as the classification system of choice, and the primary quantifier for the purpose of establishing the Tunnel Reach baselines. Also for baseline purposes, the rock mass in each Tunnel Reach is divided into one of three classes; each class occupies a defined range of RMR'89 values.

The primary application of the rock mass classification system is to aid the selection of the initial excavation support system during tunnel design (which may also consider other design methods including numerical models for the selection of initial excavation support system) and construction. Because the excavation will encounter two or three rock formations in all three reaches, the baseline rock mass classes discussed below considered the rock formation(s) that will have the largest impact on the stability of the excavation will likely change in different tunnel sections, the baseline rock mass classes presented below weighed heavily or exclusively on the rock formation(s) that has the greatest impact.

In Tunnel Reach 1, the stability of the excavation is primarily influenced by the character of the Louisville Limestone exposed above the springline. For baseline purposes, 30% of the tunnel length in Reach 1 will have equivalent RMR values of 65 ('fair' to 'good') or higher, another 30% of the tunnel length will have equivalent RMR values of 40 to 65 ('fair'), and the remaining 40% of the tunnel length (which includes the section of the tunnel immediately inside the South Portal) will have equivalent RMR values of 40 ('poor' to 'fair') or less. The last category of 'poor' to 'fair' also cover certain karst features (Section 3.1) and weathered and fractured zones (Section 3.2).

In Tunnel Reach 2, the stability of the excavation will be influenced by both the Louisville Limestone at the crown and the upper arch and the Waldron Shale at the lower arch. The rock mass conditions of the Louisville Limestone is expected to carry a greater weight than the Waldron Shale on the southern sections of the reach, with the weights reversed (the conditions of the Waldron Shale would carry more weight) on the northern sections of the reach. For baseline purposes, 40% of the tunnel length in Reach 2 will have equivalent RMR values of 65 ('fair' to 'good') or higher, another 40% of the tunnel length will have equivalent RMR values of 40 to 65 ('fair'), and the remaining 20% of the tunnel length will have equivalent RMR values of 40 ('poor' to 'fair') or less. The last category of 'poor' to 'fair' also cover certain karst features (Section 3.1) and weathered and fractured zones (Section 3.2).





In Tunnel Reach 3, the stability of the excavation will be influenced by three factors: (a) the rock mass conditions of the Waldron Shale exposed in the crown and the upper arch; (b) the rock mass conditions of the Louisville Limestone that is located (but intentionally unexposed) above the crown; and (c) the shallow ground cover. For baseline purposes, it is assumed that the entire Reach 3 (100%) will have equivalent RMR values of 30 ('poor') or less. Again, the last category of 'poor' also covers certain karst features (Section 3.1) and weathered and fractured zones (Section 3.2). The RMR value of 30 considered for the entire Reach 3 reflects the rock mass conditions of the Louisville Limestone and the Waldron Shale in the roof and the upper arch of the tunnel. It is noted that the majority of the tunnel section and all of the bench excavation in Reach 3 will be located in the Laurel Dolomite with typical RMR values of 70 or higher.

#### 2.4.3 Major Discontinuities

The major rock discontinuities that will be encountered in the tunnel include a system of near-horizontal bedding partings and sub-vertical joints. In general, as discussed in Section 2.4.2.2 above, the bedding partings are well developed. Also, the discontinuities appeared to be more closely spaced in the Louisville Limestone and the Waldron Shale than the underlying Laurel Dolomite. Table 2 presents the baseline fracture spacing.

The discontinuities in the Louisville Limestone and the Waldron Shale vary from smooth, planar to rough and undulating, with varying surface conditions from stained to clay fillings. Apertures range from tight to cavernous. The discontinuities in the Laurel Dolomite vary from irregular, planar to smooth and undulating, with varying surface conditions from stained to clay coated.

Fractured and/or weathered zones have been observed in the boreholes drilled during the geotechnical investigation. Where observed, the fractures and weathered material tend to occur along the major discontinuities discussed above. Fractured and weathered zones are discussed in Section 3.2 below.

#### 2.4.4 Groundwater Conditions

Groundwater levels of locally perched conditions vary greatly across the site and fluctuate between the dry and the wet seasons. The perched water table, where it exists, generally coincided with the soil-rock contact. The hydraulic conductivity of the rock mass is fairly low, on the order of  $1 \times 10^{-6}$  cm/s or less, while higher hydraulic conductivity, on the order of  $1 \times 10^{-3}$  cm/s or more, will occur along the rock discontinuities and vertical solutioning features. The baseline values of groundwater inflow are provided in Section 3.4.

#### 2.4.5 In-situ Stresses

No in-situ stress measurement has been conducted in the geotechnical investigations for the Tunnel. The baseline value for the ratio of maximum horizontal stress to vertical stress is in the range of 0.5 to 1.0.





# 3.0 POTENTIAL SUBSURFACE HAZARDS AND ADVERSE GEOLOGIC FEATURES

#### 3.1 Dissolution Features or Voids

The area above the tunnel contains numerous karst features including sinkholes, sinking streams, springs, enlarged joints by solutioning, pinnacled top of rock, and solution channels at the base of the Louisville Limestone just above the limestone shale contact. However, none of the three horizontal holes drilled approximately along the crown of the Northbound Tunnel, the Southbound Tunnel, and the pillar encountered significant vertical dissolution features within the (relatively short) section of the borehole that traversed the Louisville Limestone.

While no vertical dissolution feature greater than a few inches in thickness was encountered in the three horizontal boreholes, it is anticipated that, because of the large excavated area and because a large portion of each horizontal borehole was located in the less solution-prone Waldron Shale, the tunnel excavation will encounter four types of karst features in the Louisville Limestone at and above the contact with the Waldron Shale:

- Minor Dissolution Features: Planar or linear dissolution features with an aperture of 6 inches or less, to be encountered throughout the excavation.
- Dissolution Features: Planar or linear dissolution features with an aperture of 6 inches to 2 feet, to be encountered throughout the excavation.
- Voids: Filled or open, near equi-dimensional karst features with a diameter of 5 feet or less, to be encountered throughout the excavation.
- Cavities: Filled or open, near equi-dimensional karst features with a diameter greater than 5 feet but less than 30 feet, or have a void space of more than 100 cubic yards outside the tunnel excavation envelope and affects the tunnels. For baseline purposes, it is assumed that one (1) such Cavity will be encountered during excavation.

The dimension of aperture discussed above is measured perpendicular to the linear or planar feature at a minimum of 4 locations and averaged. The dimensions of diameter discussed above is measured across the cavity at a minimum of 4 varied orientations and averaged. The four types of karst features are separate and distinct from the solution features for the portal face area discussed in Section 4.1.2; the voids in the portal faces and in the tunnels are characterized and baselined separately.

It is anticipated that the first three types of karst features (Minor Dissolution Features, Dissolution Features, and Voids) will be encountered throughout the excavation where the Louisville Limestone is exposed. The tunnel sections encountering such features will be automatically classified as 'poor' to 'fair' rock mass in Reaches 1 and 2, and 'poor' rock mass in Reach 3.

In Tunnel Reaches 1 and 2, depending on the location and dimensions of the features and voids and the method used to probe for these features, these features and voids may or may not be detected ahead of



August 2012	12	Project No. 113-88401 DOC0025 Rev 2
-------------	----	--

the tunnel excavation. When encountered, the dissolution features and voids will result in groundwater or mud inflow (Section 3.4), rockfalls, roof collapse, and apparent overbreak that must be filled.

In Tunnel Reach 3, it is expected that numerous dissolution features and voids exist within the Louisville Limestone above the tunnel and therefore remain undetected during tunnel excavation. When encountered, if individual heading spans or advances and their associated support length and types are not appropriate, and if ground support is not installed in the same shift, the dissolution features and voids will lead to flush groundwater inflows, inrush of infilling materials (when present), and possible collapse of the tunnel that would result in costly repairs and long delays.

#### 3.2 Highly Weathered Zones, Fracture Zones and Zones of Poor Rock Quality

Because of the large tunnel cross section, it is anticipated that the excavations will encounter many weathered and fractured zones. Thick (greater than 5 feet) weathered and fractured zones containing clay along the horizontal partings encountered under shallow ground cover may lead to roof falls and possibly collapse of the excavation. The tunnel sections encountering weathered and fractured zones with thickness of 5 feet or more (measured as described above) will be automatically classified as 'poor' to 'fair' rock mass in Reaches 1 and 2, and 'poor' rock mass in Reach 3.

#### 3.3 Faults

For baseline purpose, faults are defined as thick (over 20 feet in apparent thickness as measured along the tunnel axis) zones of crushed and/or sheared rock, gravel, sand, clay or other materials that bear no resemblance to the parent rock on both ends of the zone. No fault was observed in the three horizontal holes drilled along the crown of the pillar, the Southbound Tunnel, and the Northbound Tunnel. Faults, when encountered in the excavation, may lead to unstable heading, roof falls, and possibly collapse of the excavation. The baseline number of faults is one.

It is anticipated that zones 5- to 20-foot thick consisting of crushed and/or sheared rock, gravel, sand, clay or other materials that bear no resemblance to the parent rock on both ends of the zone will be encountered throughout the excavation. The tunnel sections encountering such features will be automatically classified as 'poor' to 'fair' rock mass in Reaches 1 and 2, and 'poor' rock mass in Reach 3.

#### 3.4 Groundwater Inflow

Groundwater inflow will occur when the excavation encounters water bearing discontinuities or solutioning features. Due to the likely connection with the ground surface, inflows along solutioning features can be expected to increase during wet weather periods. Inflows along solutioning features will also increase if washout of the infill material within the solution features occurs. For baseline purposes, it is anticipated that instantaneous (flush) inflows into the heading upon encountering water bearing discontinuities or solutioning features will not exceed 300 gallons per minute (gpm) in each occurrence. If measures are



August 2012	13	Project No. 113-88401 DOC0025 Rev 2
-------------	----	--

taken at the location of inflow to prevent washout of infilling materials, then the initial flow can be expected to decrease to 50 gpm within a week. However, the variation in flow may reflect the weather conditions (wet versus dry) more than the passage of time such that the decrease in inflow may not occur during the wet season.

The sustained flow at the portal will depend on the measure(s) taken at the newly excavated area(s) for controlling groundwater inflow. For baseline purposes, it is anticipated that the total sustained flow at the portal from each tunnel will not exceed 200 gpm. The baseline estimate of sustained flow at the portal assumes that measures will be taken at the newly excavated areas to seal off minor inflows and minimize larger inflow (by preventing washout of infilling materials).

#### 3.5 Slaking or Expansion of Shale

The Waldron Shale exposed in the outcrops on road cuts or quarry walls is commonly slaked or eroded and has produced overhanging sections of the Louisville Limestone above. Similarly, cores of Waldron Shale recovered in 'full sticks' were often observed to disintegrate into thin discs along the bedding partings when left to dry in the air for periods as short as a few days. Also, about 10% of the shale samples tested for slake durability produced slake durability index of 80 or less. Thus, unless sealed immediately with shotcrete, the shale exposed in the portal and tunnel excavations will disintegrate and crumble and will result in unstable excavation requiring additional support and overbreak requiring additional concrete or shotcrete fill.

Where shale exists in the tunnel crown and shoulders, initial support must be designed to account for slaking behavior of the shale.





14

#### 4.0 CONSTRUCTION CONSIDERATIONS

#### 4.1 Portal

#### 4.1.1 Portal Excavations

- Based on the assumption that the portal excavations will be performed by drill and blast, the following geotechnical factors will be of major concern. Drilling for blasting, particularly during drilling for the uppermost lift will encounter a highly irregular top of rock; pinnacled limestone, remnant rock, and solutioned and vuggy rock. Blast holes will encounter solutioned, vuggy, and karstic rock.
- 2. At the portal face, the final rock face must be excavated in –a manner to allow immediate ground support after excavation.
- 3. The portal excavations will encounter near horizontally bedded layers of variable strength rock. Blasting will cause overbreak along the limits of the excavation particularly in those areas where weaker layers are adjacent to stronger layers, or where weak or more closely jointed rock layers are encountered. The overbreak will increase the requirement for spot rock support.
- 4. At the south portal, the presence of the relatively hard and thick bedded Laurel Dolomite in the lower foot or two of the excavation immediately below the relatively weaker and thinner bedded Waldron Shale will require careful assessment of subdrilling requirements.

#### 4.1.2 Portal Excavation Support Systems

Portal support will consist of support elements furnished and installed and maintained to guard the stability of the excavation faces, reduce the amount of loosening and relaxation of the rock mass to be tunneled in, and reduce the potential for degradation of the Waldron Shale as it is exposed. While drilling for blasting may be performed in lifts of greater heights depending on other requirements, the excavation lifts may be limited to allow support installation.

In the south portal, the Waldron Shale will be exposed in the lower approximate 12 feet of the excavation (except for the very bottom as noted above), while the bulk of the excavation will occur in Louisville Limestone. For baseline purposes, 5% of the portal face area at the south portal is assumed to have exposed solution features that require stabilization. The required stabilization does not include any special measures at the pinnacled top of rock. In the north portal, there is 10 feet to 20 feet of Louisville Limestone above approximately 10 feet of Waldron Shale just above mid-height of the portal face, and then the lower approximate 30 feet of the portal excavation will be in Laurel Dolomite. For baseline purposes, 2% of the portal face area at the north portal is assumed to have exposed solution features that required stabilization does not include any treatment at the pinnacled top of rock. The solution features baselined above are not part of the subsurface dissolution features or voids discussed in Section 6.1; the voids in the portal faces and in the tunnels are characterized and baselined separately.





#### 4.2 Tunnel

#### 4.2.1 Method of Tunnel Excavation

#### <u>4.2.1.1</u> <u>Overview</u>

The behavior of the ground described in the following sections is based on the assumption of tunnel excavation by heading and bench with multiple headings. It is expected that the excavation can be conducted using drill-and-blast or roadheader. It is also possible that a combination of roadheaders and drill-and-blast will be used for different parts of the excavation. Some considerations for the use of these excavation methods for this project are discussed below.

#### 4.2.1.2 Drill-and-Blast Method

When choosing drill-and-blast excavation, it is the Developer's responsibility to develop appropriate blasting design and excavation procedures to reduce overbreak, to prevent excessive loosening, damage, or degradation of the rock mass bordering the excavation, and to address the following project-specific conditions:

- 1. The project performance specifications include requirements for blasting. These requirements include monitoring at specified locations and limits on peak particle velocity and airblast.
- 2. The large excavated area and the requirement to install ground support immediately after excavation will likely limit each advance for much of the tunneling length.
- 3. The excavation will encounter near horizontally bedded rock layers of variable strength. The blasting will cause significant overbreak along the perimeter of the excavation particularly in those areas where heading intersects weak rock layers. The overbreak along the perimeter will increase the requirement for ground support as well as the volume of shotcrete or concrete needed to form a smooth perimeter for the installation of waterproof liner and the final lining. The overbreak on the excavation face will produce overhanging conditions in the competent rock unit above the weak unit where the overbreak occurs; the overhang, in turn, will lead to block falls and unstable face that must be stabilized with thorough scaling and possibly the installation of ground support before proceeding with the next round of drill and blast.

#### 4.2.1.3 Mechanical Excavators

#### 4.2.1.3.1 Roadheader

Roadheader or other mechanical excavation techniques, if used, must address the following factors in the selection of the excavation system including the cutter head, cutting speed, and cutter head power:

- Variable rock strength with local presence of very strong rock
- Variable joint spacing where, as discussed in Section 2.4.2.2, approximately half of the bedding partings and joints encountered during the geotechnical investigation are spaced at 5 feet or more.
- Local presence of abrasive rock with CAI of 3 or more.





- Presence of horizontally bedded, alternating layers of strong and weak rock with the tendency of overcutting in the weak layers.
- Face instability and fall of rock blocks undermined by the overcutting of weak rock layer.
- Sporadic presence of chert nodules/layers.

To aid in the estimation of the performance of a roadheader, selected rock samples have been tested for punch penetration response, Cerchar Abrasiveness Index (CAI), uniaxial compressive strength, and Brazilian split tensile strength. Thin sections with mineralogical composition have also been performed on select samples. Some of the test results are summarized in Section 2.4.2.1.

#### 4.2.1.3.2 TBM

Due to the dimension and the shape of the excavation, TBM is not feasible and therefore not considered in this GBR.

#### 4.2.2 Tunneling Conditions by Reach

For baseline purposes, the tunnel has been divided into three reaches (Section 2.4.1) of Reach 1, Reach 2, and Reach 3. A general discussion of the lithology and the anticipated ground conditions in each reach is presented in Section 2.4.1.

#### 4.2.2.1 Tunnel Reach 1

Tunnel Reach 1 extends from the South Portal to approximately Station 55+00. As the ground arch above the tunnel is not fully developed in the initial section of the tunnel inside the portal (approximately 1.5 to 2 times the excavated diameter of the heading), this initial section will have a very short or no standup time and may collapse if support is not installed before or immediately after the excavation, and if the support does not provide sufficient support pressure needed to provide a stable opening in the absence of a ground arch. For the rest of Tunnel Reach 1, the upper part of the excavation will be made within the Louisville Limestone with the Waldron Shale exposed at the invert and the sidewalls near the north end of Reach 1. In places, the Louisville Limestone is fractured and thinly bedded and prone to overbreak along the excavated perimeter, particularly at the roof of the excavation. The excavation will also encounter weathered and fractured zones that vary in thickness from several to tens of feet.

The excavation in Louisville Limestone will encounter karst features or dissolution features and voids. If encountered, the karst features will lead to flush groundwater inflow, inrush of infilling material, or collapse of the excavation.

The Waldron Shale at the invert will crumble and disintegrate if left unprotected to dry and soften or swell (slake) if exposed to free water and changes in humidity. Selected sections of the Waldron Shale that are weaker or more heavily jointed may require protection in the same shift when they are exposed to prevent the shale from adversely affecting the trafficability of the excavation and from undercutting the sidewalls.



	August 2012	17	Project DOC002	No. 25 Rev	113-88401 2
--	-------------	----	-------------------	---------------	----------------

#### 4.2.2.2 Tunnel Reach 2

Tunnel Reach 2 extends from approximately Station 55+00 to Station 61+00. The excavation will encounter the vertical sequence of Louisville Limestone, the Waldron Shale, and the Laurel Dolomite. The excavation will also encounter weathered and fractured zones that vary in thickness from several to tens of feet.

Over the majority of the length of this reach, the Louisville Limestone will be exposed in the roof and the upper walls, the Waldron Shale will be exposed on the lower walls, and the Laurel Dolomite in the invert and the lower walls. The upper part of the excavation in this reach will therefore be conducted under 'mixed face' conditions with two and, in some places, three different formations exposed at the face of the excavation. As discussed in Section 4.2.2.1 above, the Louisville Limestone is susceptible to overbreak and roof falls in places where it is fractured and/or thinly bedded. In addition, the Louisville Limestone may contain karst features that, if encountered, would lead to flush groundwater inflow, inrush of infill material, or collapse of the excavation.

The Waldron Shale, being the weakest of the three formations and sandwiched between the two stronger formations of Louisville Limestone and Laurel Dolomite, will crumble, disintegrate, or swell if left unprotected. In addition, the limestone-shale contact is anticipated to be weak in places such that blocks of shale in the upper, overhang portion of the arch could part along the contact and fall. This would create significant overbreak if the fall occurred during blasting or cutting; this would also lead to unstable tunnel faces or sections unless the shale is supported in the same shift when it is exposed in the excavation. It is the Developer's responsibility to use appropriate blasting design or cutting procedures and timely installation of ground support to reduce the overbreak and maintain a stable excavation.

As the excavation continues its descent toward the northern end of Reach 2, the part of the Louisville Limestone exposed in the upper excavation will begin to thin out and may completely disappear in places. In places where the Louisville Limestone is located above the roof of the tunnel, the weak limestone-shale contact will be left holding the thin veneer or slab of shale at the roof of the tunnel before ground support is installed. In places where the contact is too weak to hold the thin slab of shale at the roof, or where the ground support is not installed in time, the shale slab at the roof will fall. The block fall, if not mitigated immediately, will lead to additional rock fall as the limestone blocks above the roof lose support and fall. Again, controlled blasting or cutting procedure and timely installation of ground support are essential to reduce overbreak and control roof falls. Regardless of the timing of support, limiting the unsupported span width and advance length will be vital to limiting overbreak, limiting rock falls, and maintaining tunnel stability.

The stability of the excavation will depend on geologic features such as the presence of karst features or the location and the conditions of the limestone-shale contact (amongst other features). These features, if



August 2012	18	Project No. 113-88401 DOC0025 Rev 2
-------------	----	--

not identified before they are exposed in the excavation, could result in roof fall, inflow of groundwater or mud, or collapse of the excavation.

#### 4.2.2.3 Tunnel Reach 3

Tunnel Reach 3 extends from Station 61+00 to the North Portal. The upper part of the excavation will be excavated in Louisville Limestone (on the southern section of the reach only), the Waldron Shale, and the Laurel Dolomite. The lower part of the excavation will be excavated exclusively in the Laurel Dolomite. The excavation will also encounter weathered and fractured zones that vary in thickness from several to tens of feet.

At the start of Reach 3, the Louisville Limestone will either disappear above the excavation or just touch the roof of the excavation. As the limestone-shale contact will follow an undulated profile, it is also expected that the Louisville Limestone will reappear at the roof from place to place. Once the Louisville Limestone recesses above the excavation, the roof of the excavation will contain a thin veneer or slab of Waldron Shale. In places where the shale is fractured or where the limestone-shale contact is weak or contains solutioning features, and where support is not installed either before excavation or immediately after excavation, the shale slab will fall. The roof fall, if not mitigated immediately as is necessary, will continue as the limestone above the contact begins to fall until a stable natural arch is restored. In places where the Louisville Limestone above the shale is heavily fractured or contains solution features, the process may continue until the whole section collapses unless appropriate excavation techniques and support timing are used.

It has been noted in Section 2 that the Louisville Limestone in Reach 3 appeared to be more heavily fractured than those in Reaches 1 and 2. One possible explanation for the poor rock mass quality is the shallow depth where the weathering process is more severe and the karst development more advanced. Because the Louisville Limestone may not be exposed (or may have only limited exposure) in the excavation, the presence of fractured or solutioning zones may not be known ahead of the excavation. As the ground arch cannot be developed in the fractured or solutioning zones, these zones, if encountered and if the section was not supported ahead of or in the same shift as the excavation, will lead to the collapse of the excavation.

#### 4.2.2.4 Cross-Passages

There are cross-passages connecting the Northbound and the Southbound Tunnels. In comparison with the main excavation, the cross-passages are relatively small excavations that will mostly be made within the more competent Laurel Dolomite. The intersections between the cross-passages and the main tunnel contain protruding corners and are therefore susceptible to block or wedge fall during excavation. In addition, the excavation of the cross-passages will increase the effective span of the main tunnel



August 2012	19	Project No. 113-88401 DOC0025 Rev 2
-------------	----	--

intersecting the passage. In these areas, the main excavation will require additional ground support in preparation for the increased span after the excavation of the cross-passages.

#### 4.2.3 Initial Ground Support

It is the Developer's responsibility to take into account ground conditions and select and design the initial ground support to meet the following requirements:

- 1. Can be integrated into the excavation cycle and can be installed before or immediately after the excavation.
- 2. Provide sufficient flexibility to accommodate field changes initiated by the changing rock mass conditions observed in the probeholes or exposed in the excavation.
- 3. Compatible with the planned excavation sequence.
- 4. In Reach 3 where the ground arch may not exist or may only be partially formed because of the combination of low ground cover and fractured/solutioning limestone above the tunnel, provide sufficient support pressure to form a stable opening.
- 5. Be designed to guard against the most likely failure mode of block fallout as discussed in detail below.
- 6. Rock bolts, if used to support the roof and the upper arch, must be designed and installed to locate the anchor zone in the more competent Louisville Limestone above the limestone-shale contact.

In all reaches, unstable rock blocks will exist in the roof or the upper arch. Such blocks are typically bounded by ubiquitous bedding partings and other sub-horizontal discontinuity surfaces and, upon intersecting near-vertical adversely oriented discontinuities, will be prone to fallout in one of the following forms:

- Slab fallout that occurs during blasting or scaling caused by the tendency for rocks to break back to the sub-horizontal discontinuities
- Progressive failure by gradually loosening and fallout of small blocks of rock. This failure mode is more likely to occur in the Waldron Shale than the other two formations especially if initial support is not installed immediately after the tunnel is excavated.
- Block failure in the sidewalls if the Waldron Shale is left unprotected and allowed to crumble, disintegrate, or swell and undermine the Louisville Limestone above.

In all reaches, rockbolt anchorage will be affected by the karst and solutioned nature of the Louisville Limestone, and by the soft or slaking behavior of the Waldron Shale. The baseline rockbolt rejection and replacement rate due to inadequate anchorage is 15%.

The selection of initial ground support in the field is commonly guided by applying one of the established rock mass classification systems based on the conditions exposed in the excavation. However, as discussed in Section 2, the conditions anticipated in this project may be outside said database because of the unique project combination of large tunnel span, shallow ground cover, karst features and mixed-face conditions with the weaker Waldron Shale sandwiched between the two stronger formations of Louisville





Limestone and Laurel Dolomite. Because of the unique project conditions and because of the anticipated need to install the initial ground support before or immediately after the excavation, a simple classification system that can be quickly implemented and easily checked and confirmed in the field would be preferable to a sophisticated system. The Geomechanics Classification (RMR 1989) appears to capture the major rock mass characteristics affecting the stability of the excavation while remaining relatively simple and straightforward and therefore would serve as a suitable candidate as a primary tool for the purpose of selecting the initial ground support in the field. Considerable judgment, however, is still required in the application of the rock mass classification in a mixed-face tunnel to ensure that the rating weighs more heavily or exclusively to the rock formation, and rock mass features that will have the greatest impact on the stability of the opening.

#### 4.2.4 Overbreak

Overbreak refers to the loss or removal of rock material outside the B-Line. The amount of overbreak depends on several factors; foremost among them are the following:

- Spacing between and strength of the rock discontinuities.
- Effects of blasting on the rock located beyond the B-Line.
- Distance between the working face and the roof support, and
- Length of time which elapses between the removal of the natural support of the roof and installation of the artificial support.

Overbreak is expected over the majority of the tunnel and especially in Reach 3 where the thin veneer or slab of shale above the roof is prone to break away from the weak limestone-shale contact and fall during blasting or cutting, during scaling, or if the initial ground support is not installed in time. The application of good workmanship and the use of proper controlled blasting and other excavation procedures will reduce but will not eliminate the overbreak. The Contractor's choice of excavation method and excavation technique will influence the amount of overbreak. Spaces created by dissolution features or voids of the first three types discussed in Section 3.1 outside the B-Line will be measured as part of overbreak. Space left by cavities of the fourth type discussed in Section 3.1 will not be measured as overbreak. The maximum allowable overbreak area, measured as the average cross sectional area of the area bounded by the B-Line and the excavated perimeter from overbreak areas assume good workmanship, controlled blasting (where drill-and-blast is used), pre-support, or prompt installation of initial ground support with each round of advance. As such, the maximum overbreak quantities presented above represent the maximum allowable that the Developer is permitted.





#### 5.0 LIMITATIONS

The GBR is a contractual document establishing a baseline for bidding and for comparison with actual subsurface conditions encountered during construction. The GBR is not intended to specify ground conditions, or more importantly ground behavior, to the extent that the Developer is relieved of any and all responsibility of making their own interpretation of the ground conditions and behavior as different behavior than described herein may occur depending upon the means and methods, as well as workmanship, adopted by the Developer which are the responsibility of the Developer.

The GBR is not a representation of the actual subsurface conditions that will be encountered during construction. Rather, the GBR simply provides a baseline mutually accepted by the Owner and the Developer for defining potential changes in subsurface conditions. Not all changes will lead to additional payments to the Developer or credit to the Owner; as this process will be governed by other terms and conditions in the Contract Documents.

#### **GOLDER ASSOCIATES INC.**

nater

Kuantsai Lee, Ph.D., P.E., G.E. Principal

KL/MF/bh

R Jukhow

Mark Funkhouser, P.E. Principal




At Golder Associates we strive to be the most respected global group of companies specializing in ground engineering and environmental services. Employee owned since our formation in 1960, we have created a unique culture with pride in ownership, resulting in long-term organizational stability. Golder professionals take the time to build an understanding of client needs and of the specific environments in which they operate. We continue to expand our technical capabilities and have experienced steady growth with employees now operating from offices located throughout Africa, Asia, Australasia, Europe, North America and South America.


+ 27 11 254 4800 Asia + 852 2562 3658 Australasia + 61 3 8862 3500 + 356 21 42 30 20 Europe North America + 1 800 275 3281 South America + 55 21 3095 9500


solutions@golder.com www.golder.com

**Golder Associates Inc.** 15851 South US 27, Suite 50 Lansing, MI 48906 USA



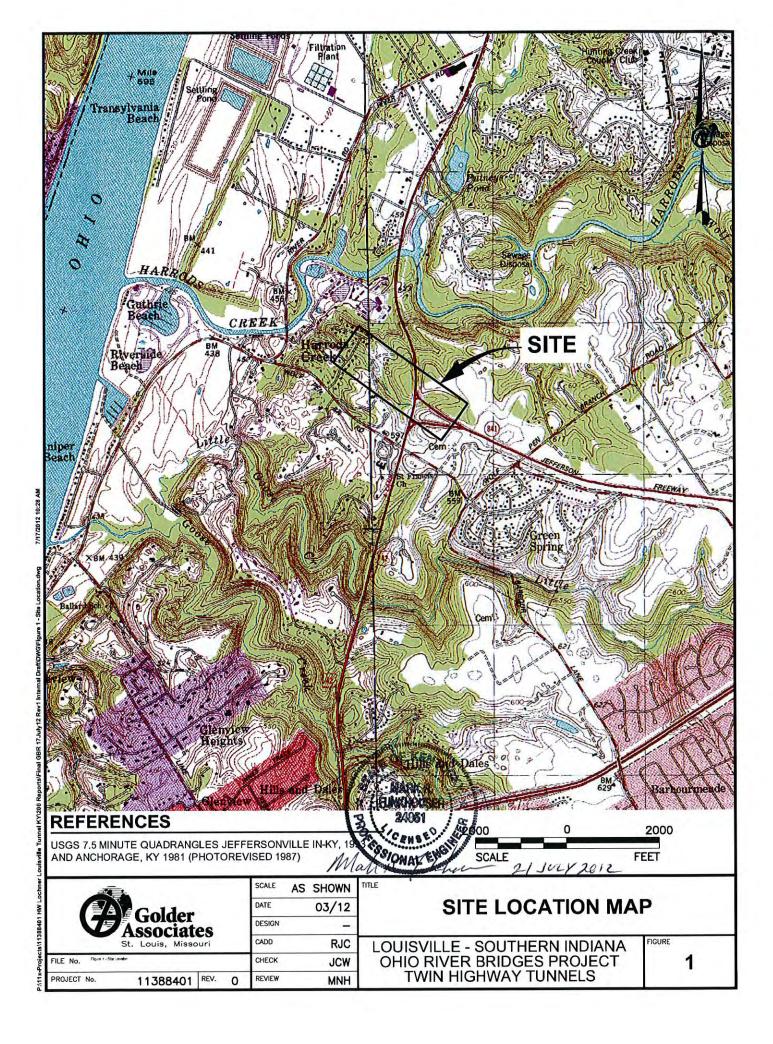


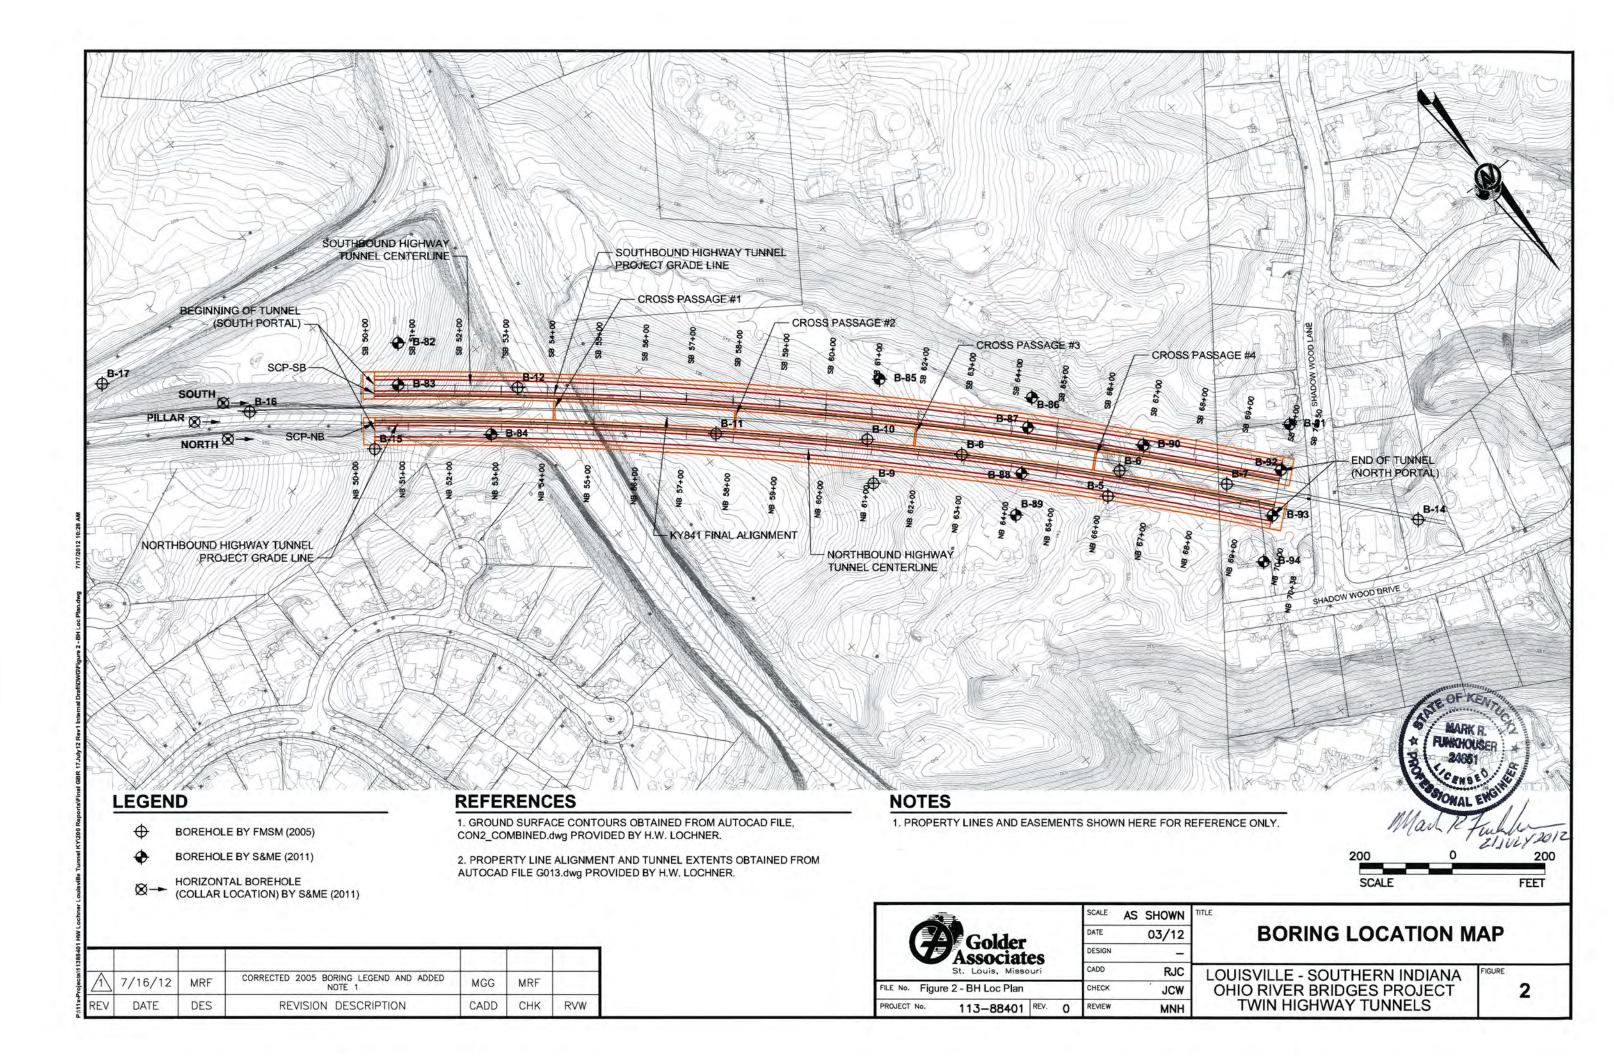

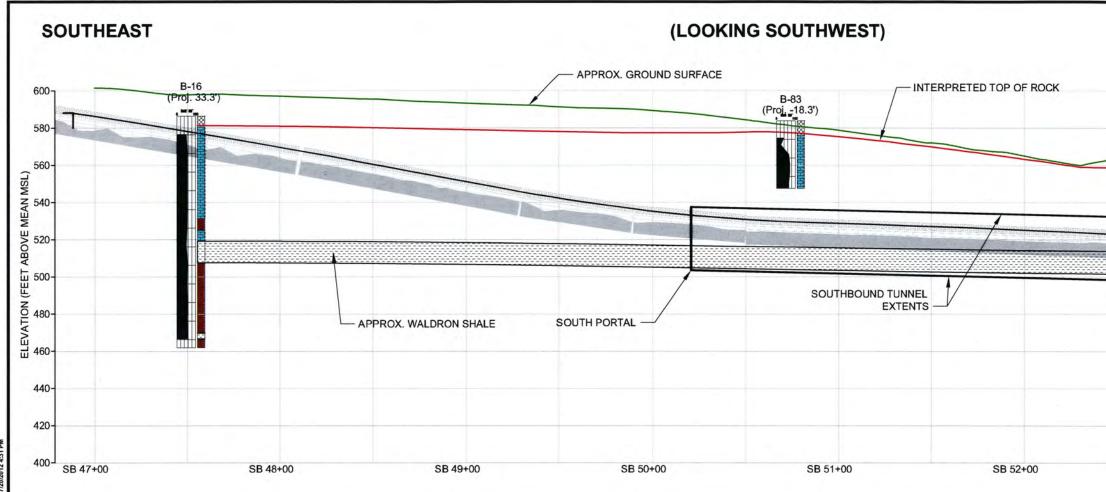

....

REV

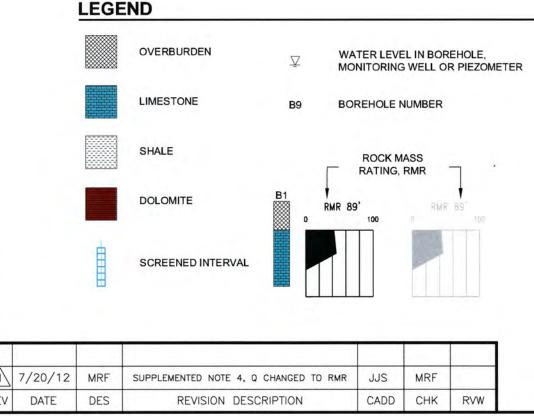

#### NOTES

1. GROUND SURFACE ELEVATION ALONG NORTH TUNNEL CENTERLINE, OBTAINED FROM AUTOCAD FILE, CON2\_COMBINED\_DEFAULT.dwg PROVIDED BY H.W. LOCHNER.

2. TUNNEL GEOMETRY OBTAINED FROM AUTOCAD FILE, HIGHWAY TUNNEL PROFILE 1to1-DEFAULT.dwg PROVIDED BY H.W. LOCHNER.


3. TOP OF ROCK INTERPOLATED BETWEEN BOREHOLES THEN ADJUSTED BASED ON GROUND SURFACE ELEVATION AND BY THE RESISTIVELY PROFILES GENERATED BY SM&E. TOP OF ROCK IS PINNACLED AND WILL VARY ON THE ORDER OF 10 ft. VERTICALLY OVER A FEW FEET HORIZONTALLY.


4. SHADED BOREHOLE INFORMATION IS OBTAINED FROM THE SOUTH HORIZONTAL BOREHOLE. THE HORIZONTAL BOREHOLE ELEVATION SHOWN HERE AS A SOLID LINE WITHIN THE SHADED BOREHOLE GRAPHIC TAKES PRECEDENCE OVER OTHER HORIZONTAL BOREHOLE ELEVATION DATA. THE HORIZONTAL BOREHOLE ELEVATION DATA IN THE 2011 SME GDR LOGS IS INCORRECT.


5. THE GEOLOGIC PROFILE AS DEPICTED ILLUSTRATES INTERPRETATION OF THE CONDITIONS AT THE SITE BASED ON THE CONDITIONS AT THE BORING LOCATION, GEOPHYSICAL SURVEY RESULTS, PUBLISHED GEOLOGIC INFORMATION AND JUDGMENT USING ACCEPTED GEOLOGIC, ENGINEERING AND HYDROLOGIC PRINCIPLES. CONDITIONS BETWEEN THE BORING LOCATION MAY VARY SUBSTANTIALLY FROM THOSE SHOWN ON THIS PROFILE. SPECIFIC DATA AT THE BORING LOCATION AND GEOPHYSICAL SURVEY RESULTS ARE PROVIDED IN THE GBR/GDR'S.

50		0	50
SC	ALE		FEET
NO	VERTICAL	EXAGGERATION	


-			SCALE	AS SHOWN
	Golder		DATE	03/12
	Associat	29	DESIGN	PJJ
	St. Louis, Misso		CADD	PJJ
FILE No. Figure	- 3-10 - Lithologic Profiles		CHECK	JCW
PROJECT No.	113-88401	REV. O	REVIEW	MNH

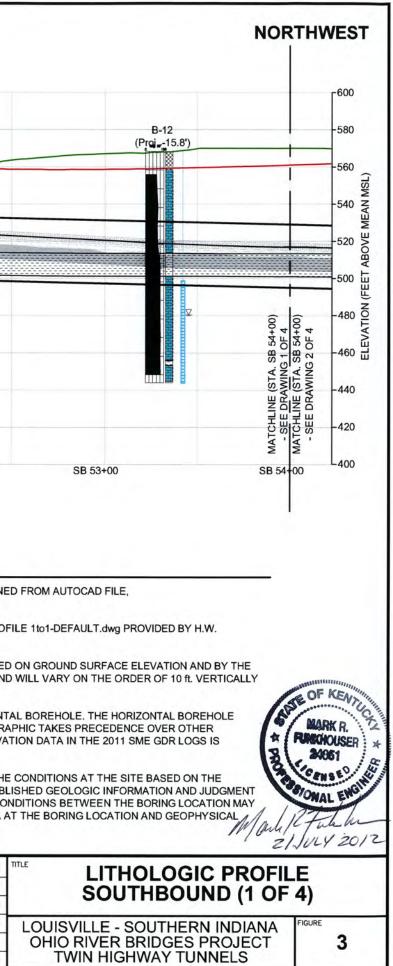

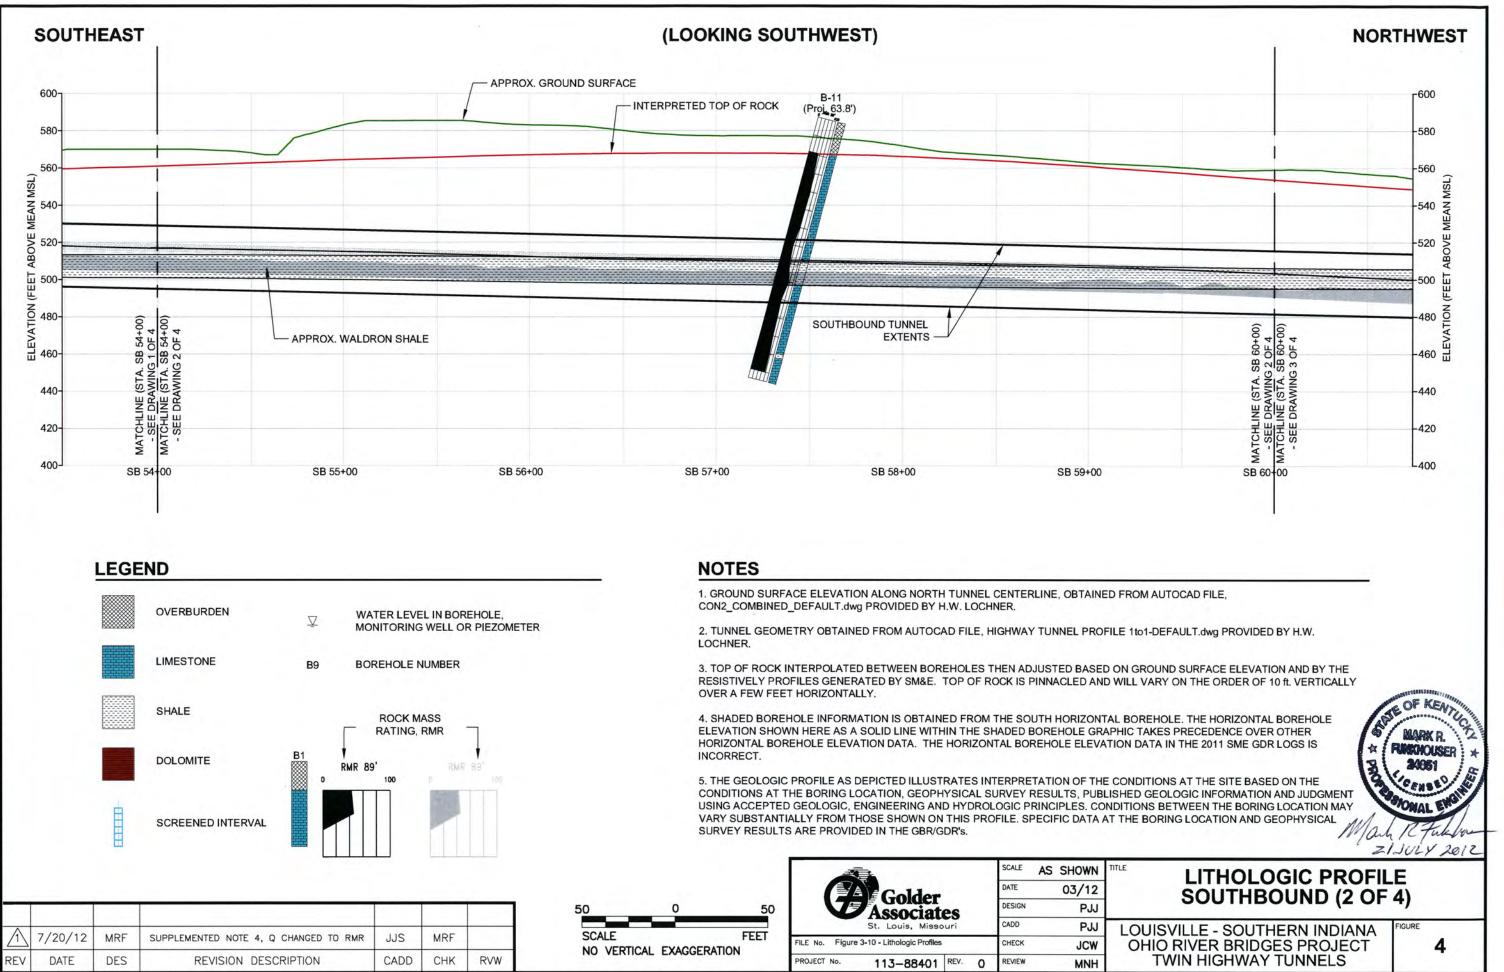


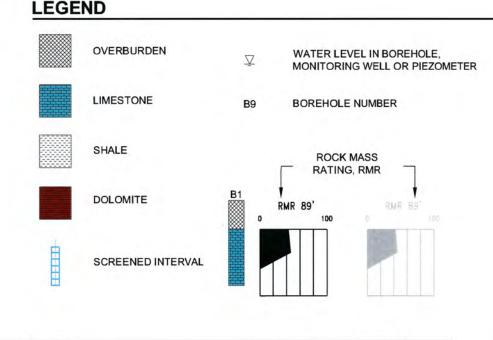



$\overline{\mathbb{A}}$	7/20/12	MRF	SUPPLEMENTED NOTE 4, Q CHANGED TO RMR	JJS	MRF	
REV	DATE	DES	REVISION DESCRIPTION	CADD	СНК	RVW

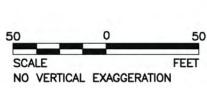


	SCALE	AS SHOWN
Golder	DATE	03/12
Associates	DESIGN	PJJ
St. Louis, Missouri	CADD	PJJ
FILE No. Figure 3-10 - Lithologic Profiles	CHECK	JCW
PROJECT No. 113-88401 REV. 0	REVIEW	MNH

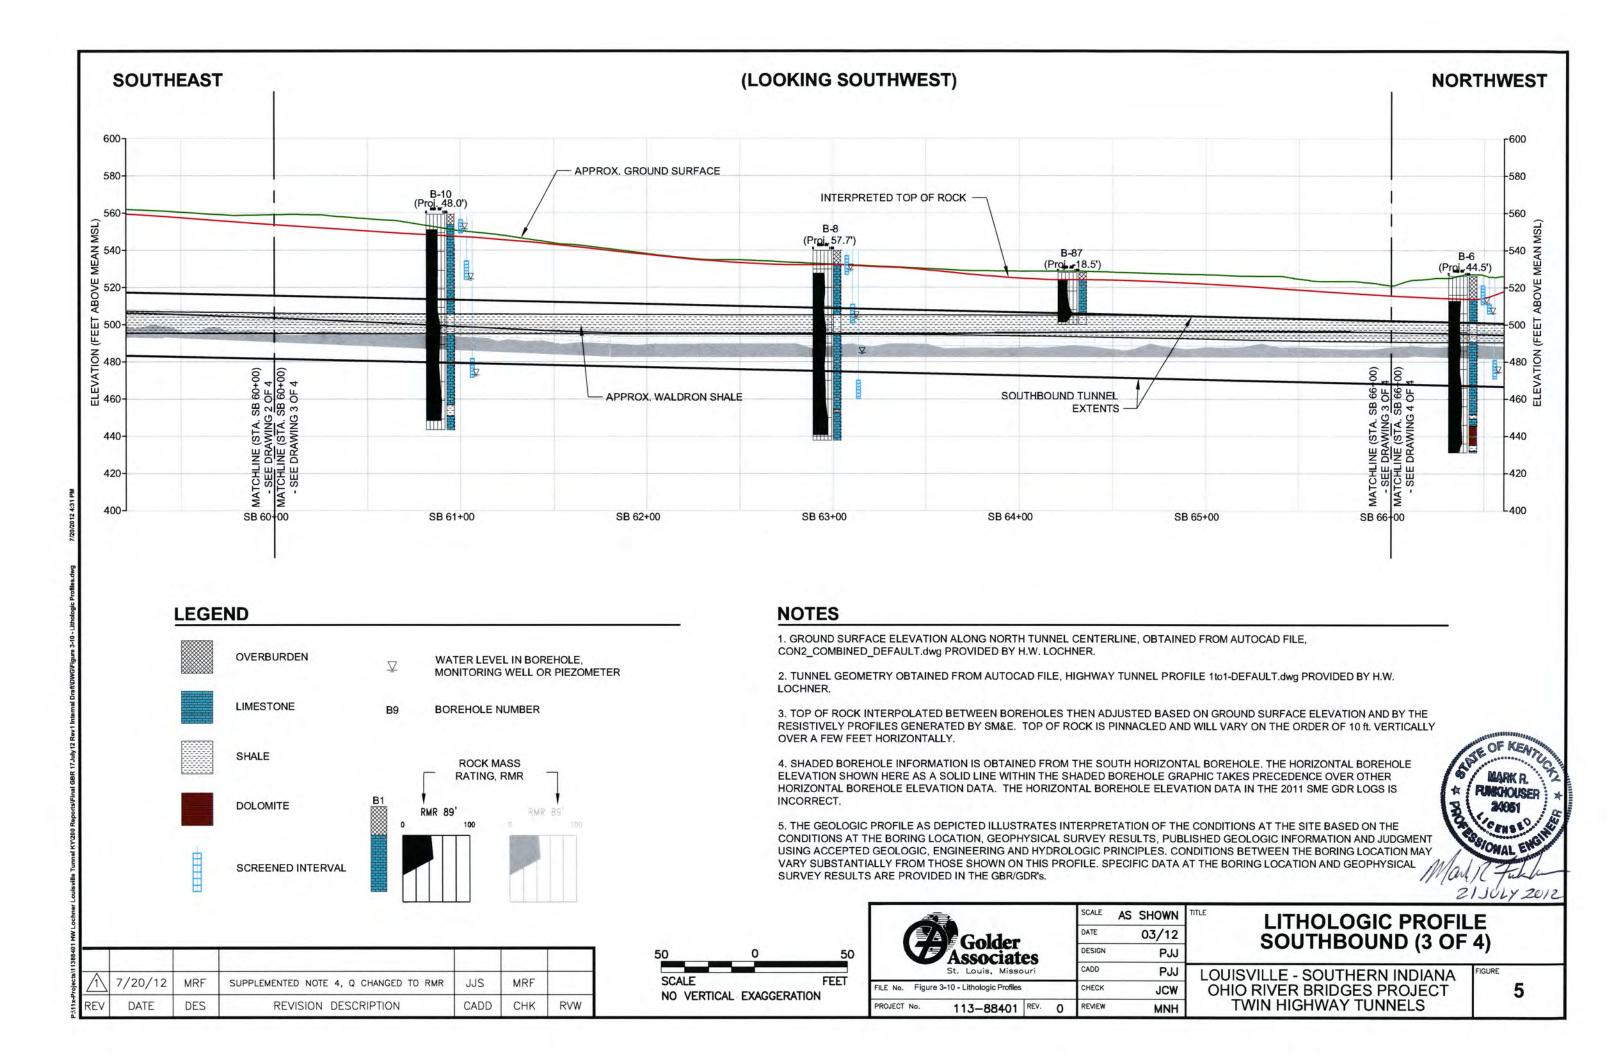

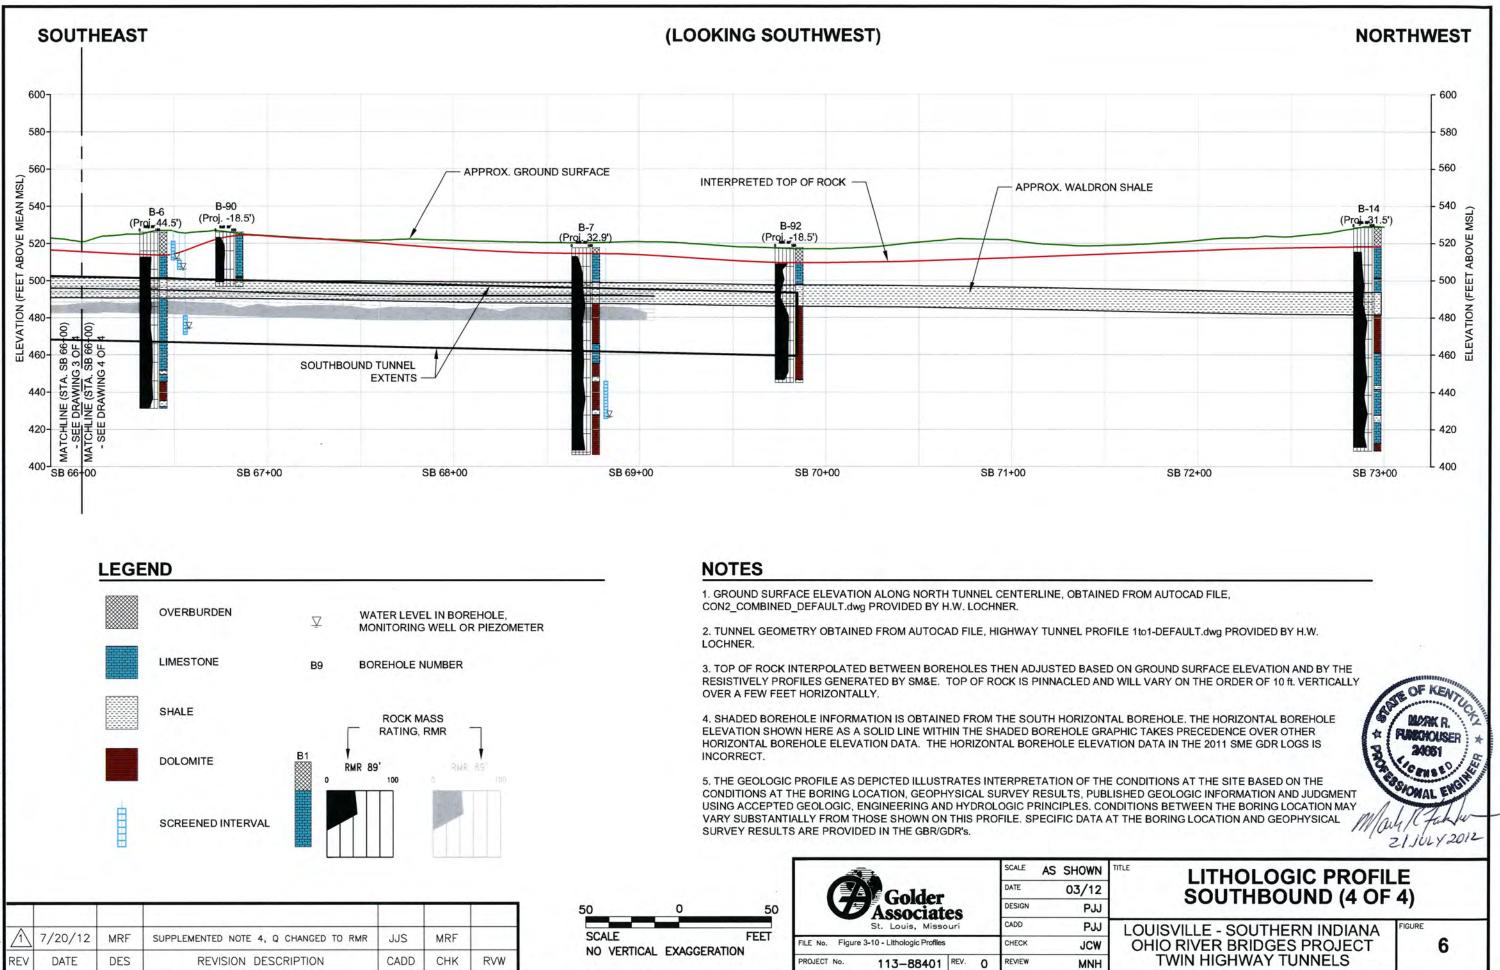


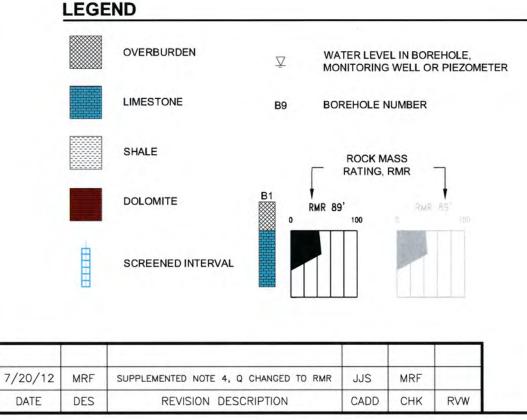

-			SCALE	AS SHOWN
Golder			DATE	03/12
	Associates			PJJ
	St. Louis, Misso		CADD	PJJ
FILE No. Figure	FILE No. Figure 3-10 - Lithologic Profiles		CHECK	JCW
PROJECT No.	113-88401	REV. O	REVIEW	MNH

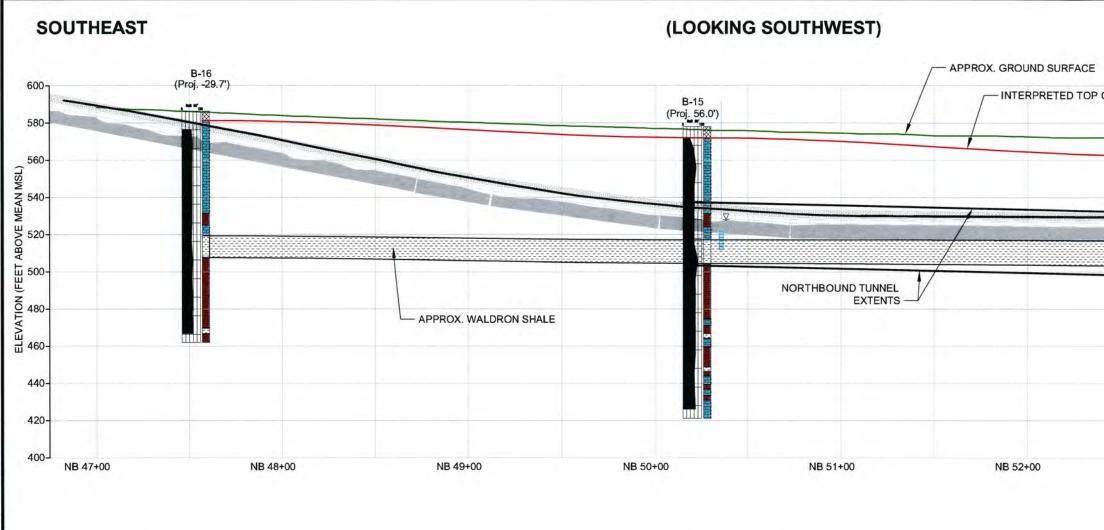

REN

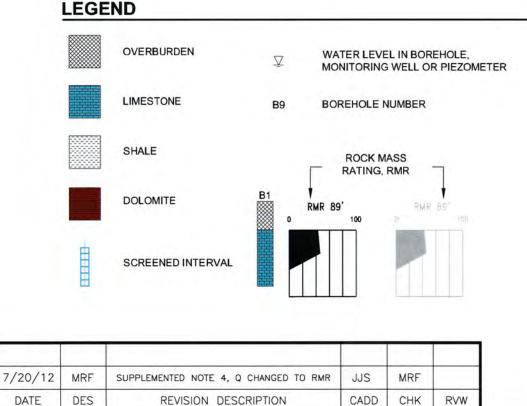

### NOTES


1. GROUND SURFACE ELEVATION ALONG NORTH TUNNEL CENTERLINE, OBTAI CON2\_COMBINED\_DEFAULT.dwg PROVIDED BY H.W. LOCHNER.

2. TUNNEL GEOMETRY OBTAINED FROM AUTOCAD FILE, HIGHWAY TUNNEL PR LOCHNER.

3. TOP OF ROCK INTERPOLATED BETWEEN BOREHOLES THEN ADJUSTED BAS RESISTIVELY PROFILES GENERATED BY SM&E. TOP OF ROCK IS PINNACLED A OVER A FEW FEET HORIZONTALLY.


4. SHADED BOREHOLE INFORMATION IS OBTAINED FROM THE NORTH HORIZON ELEVATION SHOWN HERE AS A SOLID LINE WITHIN THE SHADED BOREHOLE G HORIZONTAL BOREHOLE ELEVATION DATA. THE HORIZONTAL BOREHOLE ELE INCORRECT.

5. THE GEOLOGIC PROFILE AS DEPICTED ILLUSTRATES INTERPRETATION OF T CONDITIONS AT THE BORING LOCATION, GEOPHYSICAL SURVEY RESULTS, PL USING ACCEPTED GEOLOGIC, ENGINEERING AND HYDROLOGIC PRINCIPLES. C VARY SUBSTANTIALLY FROM THOSE SHOWN ON THIS PROFILE. SPECIFIC DATA SURVEY RESULTS ARE PROVIDED IN THE GBR/GDR's.

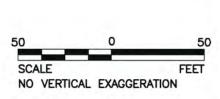


	SCALE	AS SHOWN
Golder	DATE	03/12
Associates	DESIGN	PJJ
St. Louis, Missouri	CADD	PJJ
FILE No. Figure 3-10 - Lithologic Profiles	CHECK	JCW
PROJECT No. 113-88401 REV. 0	REVIEW	MNH


NOR	THWEST
FROCK	Г <sup>600</sup>
B-84	-580
(Proj. 23.5')	
	-560 (Tsj
	-540 N N N N N N N N N N N N N N N N N N N
	-540 E WEAN WS
	N (FE
54+00) 57 4	64+00) F 4 VATIO
A. NB VG 1 O	A NG 2 NG
LE (ST	MATCHLINE (STA. NB 54+00 - SEE DRAWING 2 OF 4 097 70 77 70 77 70 77 70 74 70 70 74 70 70 74 70 70 70 70 70 70 70 70 70 70 70 70 70
CHLIN	
TAM	
NB 53+00 NB 54	00
WILL VARY ON THE ORDER OF 10 ft. VERTICALLY	BOF KENT
APHIC TAKES PRECEDENCE OVER OTHER	MARK R RUNSCHOUSER * 24061
LISHED GEOLOGIC INFORMATION AND JUDGMENT NDITIONS BETWEEN THE BORING LOCATION MAY AT THE BORING LOCATION AND GEOPHYSICAL	MIGachan IJULY 2012
דוד ב	
LITHOLOGIC PROFIL	
	FIGURE
OHIO RIVER BRIDGES PROJECT TWIN HIGHWAY TUNNELS	7
	ED FROM AUTOCAD FILE, FILE 1101-DEFAULT.dwg PROVIDED BY H.W. DON GROUND SURFACE ELEVATION AND BY THE DOWNLOWN ON THE ORDER OF 10 ft. VERTICALLY ALBOREHOLE. THE HORIZONTAL BOREHOLE ADDITIONS SURFACE ELEVATION AND BY THE DOWNLOWN ON THE ORDER OF 10 ft. VERTICALLY ALBOREHOLE. THE HORIZONTAL BOREHOLE SHED GEOLOGIC IN STREE BASED ON THE ISHED SETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS BETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS AT THE SITE BASED ON THE ISHED SETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS AT THE SITE BASED ON THE ISHED SETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS BETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS BETWEEN THE BORING LOCATION AND JUDGMENT NUTTIONS BETWEEN THE BORING LOCATION AND JUDGMENT NUTIONS AT THE SITE BASED ON THE ISHED SETWEEN THE BORING LOCATION AND JUDGMENT NUTIONS BETWEEN THE BORING LOCATION AND JUD

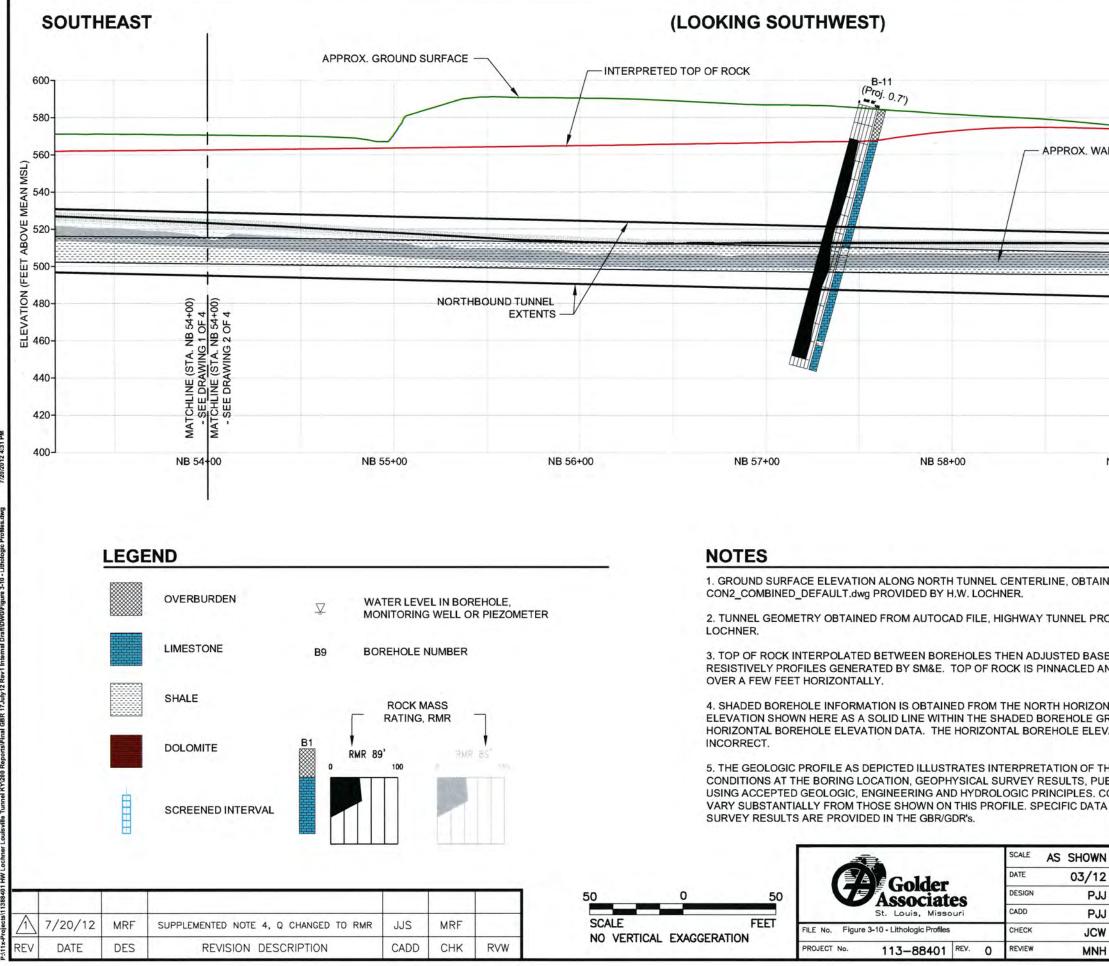



ww i zechnar i susisvilla Turmal KYY200 Reports)Final GBR 17July12 Rev1 Internal DraftDWG/Figure ;

		NOR	THWEST
			۲ <sup>600</sup>
			-580
DRON SHALE			-560
			540 N
		-	MEA
	an a		-520 NOR
		1	-500 []
		(0	480 NOILE
	MATCHLINE (STA. NB 60+00) - SEE DRAWING 2 OF 4	MATCHLINE (STA. NB 60+00 - SEE DRAWING 3 OF 4	-460 H
	STA. N WING	CHLINE (STA, NB 60 SEE DRAWING 3 OF	-440
	E DRA	E DRA	-420
	AATCH	AATCH - SE	400
_			
ED FROM AUTOCAD	FILE,		
	FILE, dwg PROVIDED BY H.W.		
FILE 1to1-DEFAULT. D ON GROUND SURI	dwg PROVIDED BY H.W. FACE ELEVATION AND I	BY THE	OF KEAL
FILE 1to1-DEFAULT. D ON GROUND SURI D WILL VARY ON TH	dwg PROVIDED BY H.W. FACE ELEVATION AND I IE ORDER OF 10 ft. VER	BY THE TICALLY	OF KENTUC
FILE 1to1-DEFAULT. D ON GROUND SURI D WILL VARY ON TH TAL BOREHOLE. TH APHIC TAKES PREC	dwg PROVIDED BY H.W. FACE ELEVATION AND I	BY THE TICALLY	NARK R. WICHOUSER + 24051
FILE 1to1-DEFAULT. D ON GROUND SUR D WILL VARY ON TH TAL BOREHOLE. TH APHIC TAKES PREC ITION DATA IN THE E CONDITIONS AT T	dwg PROVIDED BY H.W. FACE ELEVATION AND I IE ORDER OF 10 ft. VER E HORIZONTAL BOREH EDENCE OVER OTHER	BY THE ITICALLY OLE	MARK R. NARK R. 24051 Sonal Engine
FILE 1to1-DEFAULT. D ON GROUND SUR D WILL VARY ON TH TAL BOREHOLE. TH APHIC TAKES PREC ATION DATA IN THE E CONDITIONS AT T LISHED GEOLOGIC ONDITIONS BETWEE	dwg PROVIDED BY H.W. FACE ELEVATION AND I IE ORDER OF 10 ft. VER E HORIZONTAL BOREH EDENCE OVER OTHER 2011 SME GDR LOGS IS	BY THE TICALLY	24061
D ON GROUND SUR D WILL VARY ON TH TAL BOREHOLE. TH APHIC TAKES PREC ATION DATA IN THE E CONDITIONS AT T LISHED GEOLOGIC ONDITIONS BETWEE AT THE BORING LOC	dwg PROVIDED BY H.W. FACE ELEVATION AND I IE ORDER OF 10 ft. VER E HORIZONTAL BOREH EDENCE OVER OTHER 2011 SME GDR LOGS IS HE SITE BASED ON THI INFORMATION AND JUE IN THE BORING LOCATI CATION AND GEOPHYS	BY THE TICALLY OLE	24061 Sonal Engine MR Jul
FILE 1to1-DEFAULT. D ON GROUND SURI D WILL VARY ON TH TAL BOREHOLE. TH APHIC TAKES PREC ATION DATA IN THE E CONDITIONS AT T LISHED GEOLOGIC NDITIONS BETWEE AT THE BORING LOC	dwg PROVIDED BY H.W. FACE ELEVATION AND I IE ORDER OF 10 ft. VER E HORIZONTAL BOREH EDENCE OVER OTHER 2011 SME GDR LOGS IS THE SITE BASED ON THI INFORMATION AND JUE IN THE BORING LOCATI CATION AND GEOPHYS	BY THE ITICALLY OLE B DGMENT ON MAY ICAL	24061 Sonal Engine MR Jul

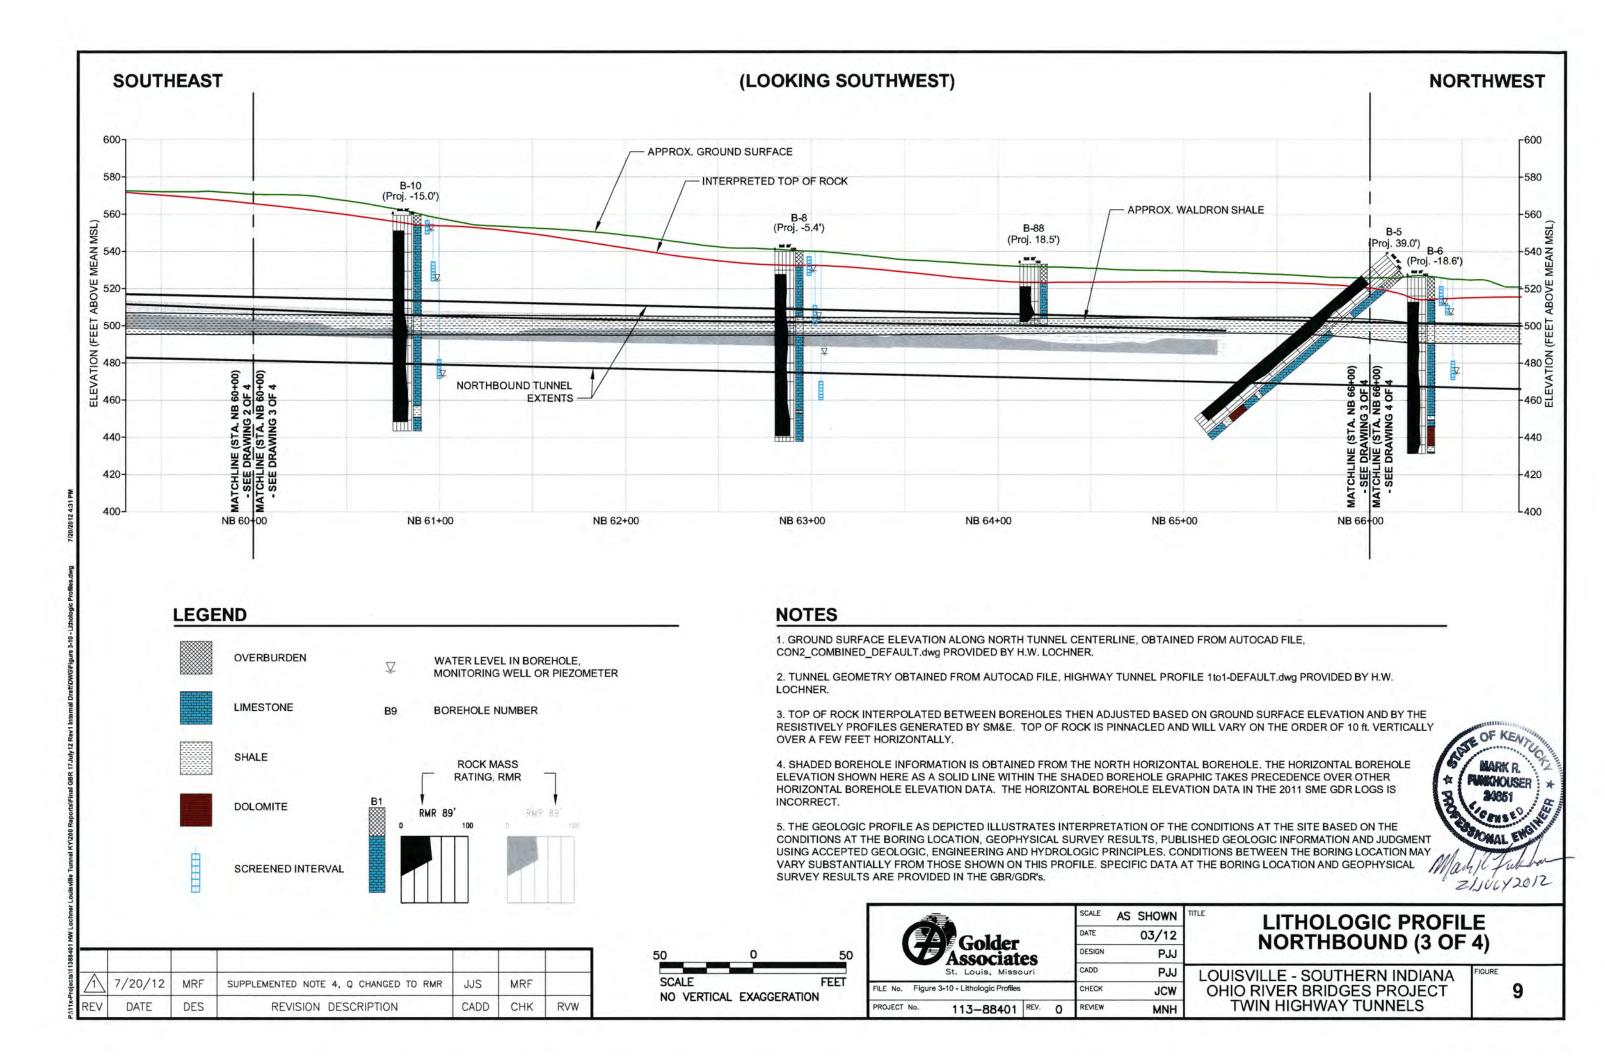


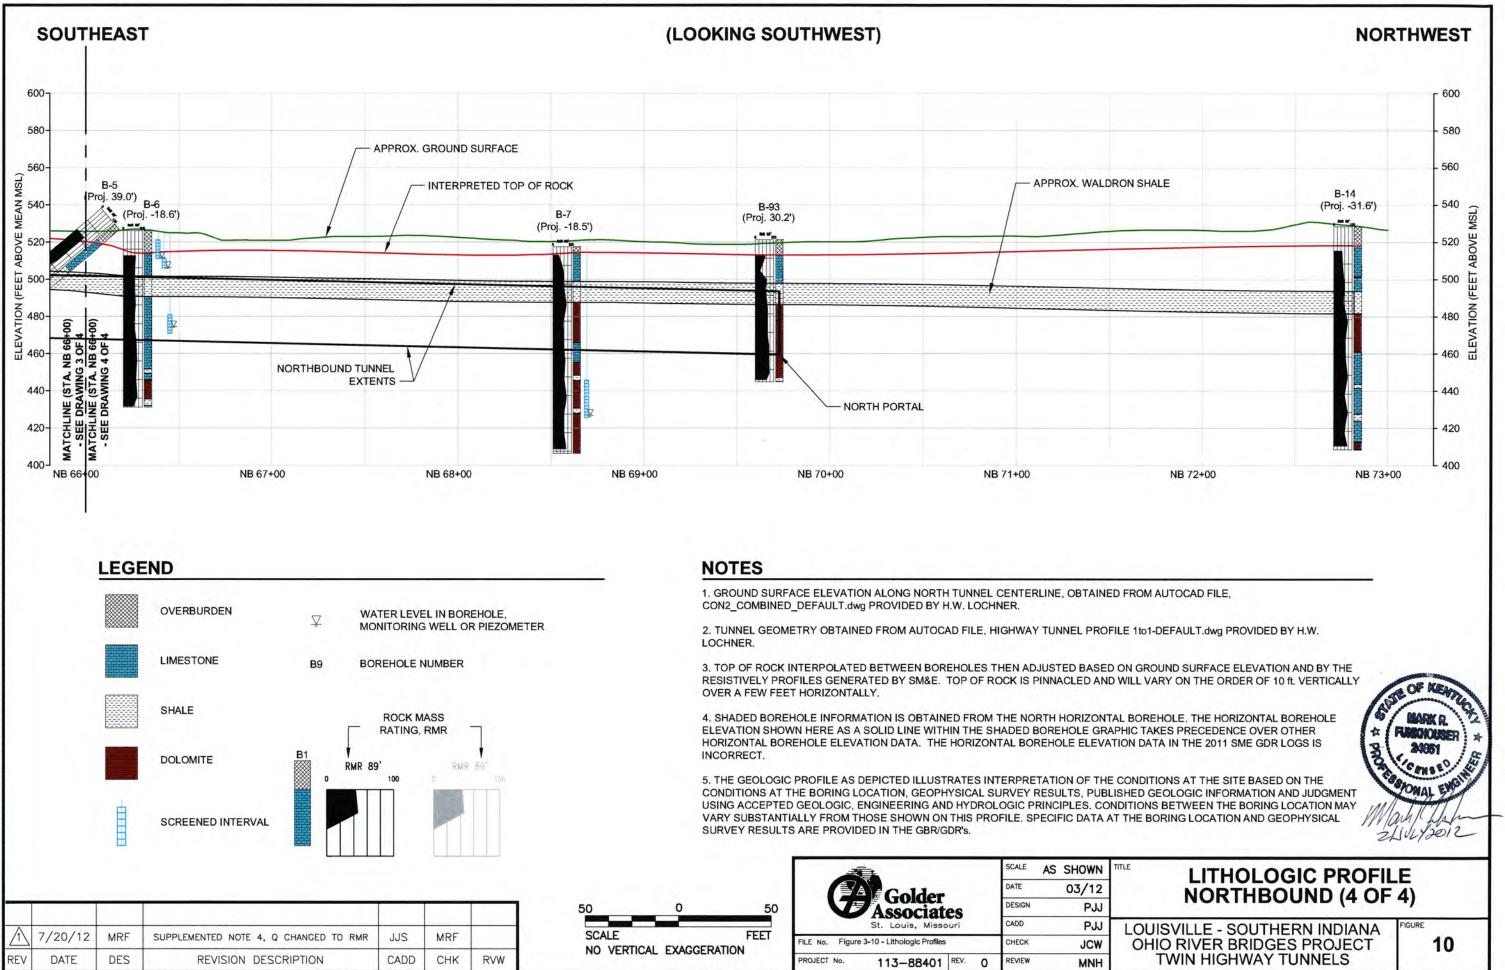

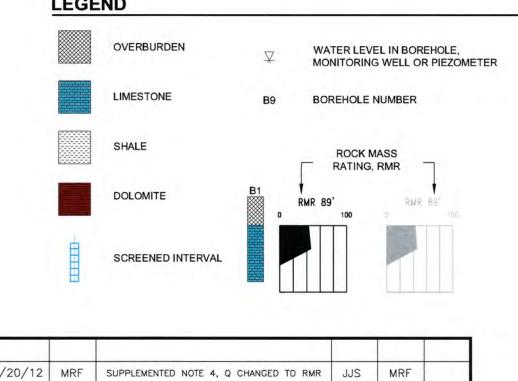

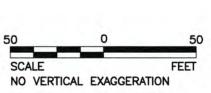

	SCALE	AS SHOWN
Golder	DATE	03/12
Associates	DESIGN	PJJ
St. Louis, Missouri	CADD	PJJ
FILE No. Figure 3-10 - Lithologic Profiles	CHECK	JCW
PROJECT No. 113-88401 REV. 0	REVIEW	MNH

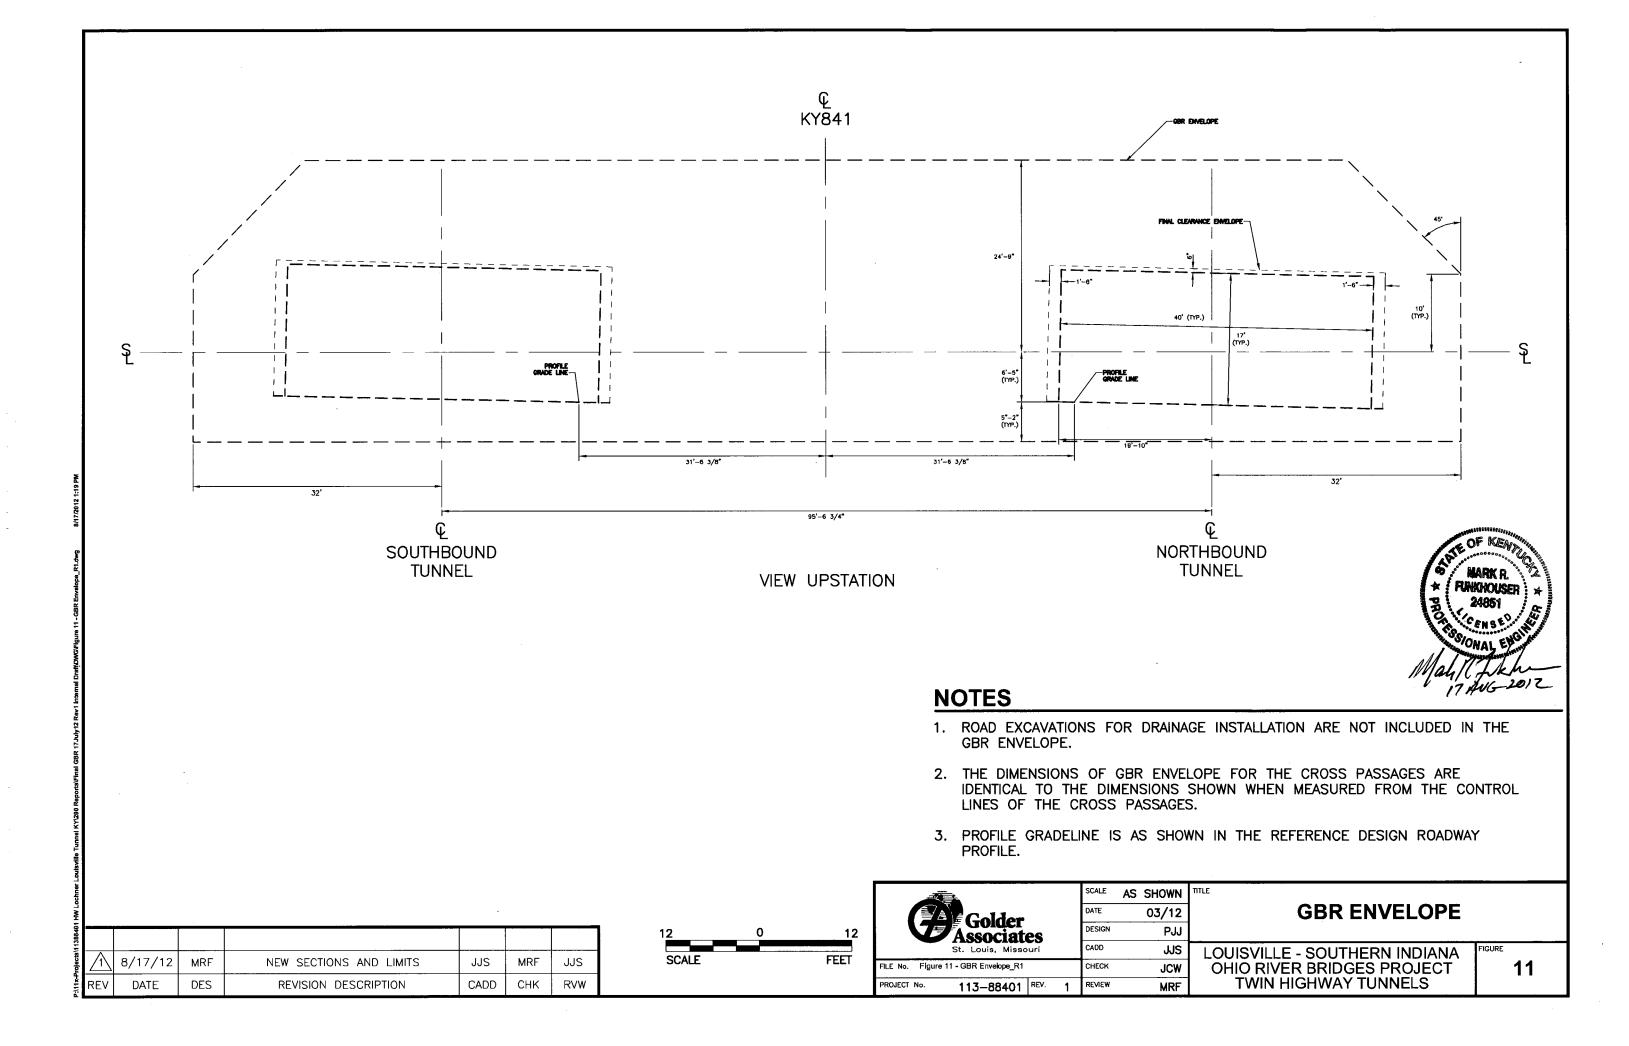

Appendix A

Glossary

## APPENDIX A

# GLOSSARY

This appendix presents the descriptive terms commonly used in describing the ground conditions and the physical characteristics of rock. The descriptions are presented in seven tables as follows:

Table A-1:Descriptive Terms for Soil and Rock Grain SizeTable A-2:Descriptive Terms for Strength of Rock MaterialTable A-3:Descriptive Terms for Joint RoughnessTable A-4:Descriptive Terms for Apertures of Rock DiscontinuityTable A-5:Descriptive Terms for Weathering of the Rock MassTable A-5:Descriptive Terms for Weathering of the Rock MassTable A-6:Descriptive Terms for Fracturing of Rock Mass

Table A-7: Descriptive Terms for Rock Mass Conditions and Excavation Behavior

Description	Diameter (mm)
Boulders	200 - 600
Cobbles	60 – 200
Coarse gravel	20 – 60
Medium gravel	6 – 20
Fine gravel	2-6
Coarse sand	0.6 – 2
Medium sand	0.2 - 0.6
Fine sand	0.06 - 0.2
Silt, clay	<0.06

Table A-1: Descriptive Terms for Soil and Rock Grain Size

Description	Field Identification	Approx. rang compressiv		
		MPa	psi	
Extremely weak	Indented by thumbnail	0.25-1.0	40-145	
Very weak	Crumbles under firm blows with point of geological hammer, can be peeled by a pocket knife	1.0-5.0	145-700	
Weak	Can be peeled by a pocket knife with difficulty, shallow indentations made by firm blow with point of geological hammer	5.0-25	700-3,600	
Medium strong	Cannot be scraped or peeled with a pocket knife specimen, can be fractured with single firm blow of geological hammer	25-50	3,600-7,000	
Strong rock	Specimen requires more than one blow of geological hammer to fracture it	50-100	7,000- 15,000	
Very strong	Specimen requires many blows of geological hammer to fracture it	100-250	15,000- 35,000	
Extremely strong	Specimen can only be chipped with geological hammer	>250	>35,000	

Table A-2: Descriptive Terms for Strength of Rock Material

Description	Key <sup>1</sup>
Rough (or irregular), stepped	I
Smooth, stepped	Ш
Slickensided, stepped	III
Rough (or irregular), undulating	IV
Smooth, undulating	V
Slickensided, undulating	VI
Rough (or irregular), planar	VII
Smooth, planar	VIII
Slickensided, planar	IX

 Keys refer to typical profiles shown on Table 17 of Brown, E.T., "Rock Characterization Testing and Monitoring. ISRM Suggested Methods." Oxford: Pergamon Press. 1981

Description	Aperture (inch)	Category	
Very tight	0.004		
Tight	0.004-0.01	"Closed" features	
Partly open	0.01-0.02		
Open	0.02-0.1		
Moderately wide	0.1-1/4	"Gapped" feature	
Wide	>1/4		
Very wide	1⁄4-4		
Extremely wide	4-40	"Open" features	
Cavernous	>40		

Table A-4: Descriptive Terms for Apertures of Rock Discontinuity

Table A-5:	Descriptive	Terms for	Weathering	of the Rock Mass
------------	-------------	-----------	------------	------------------

Term	Description
Fresh	No visible sign of rock material weathering: perhaps slight discoloration on major discontinuity surfaces.
Slightly weathered	Discoloration indicates weathering of rock material and discontinuity surfaces. All the rock material may be discolored by weathering and may be somewhat weaker externally than in its fresh condition.
Moderately weathered	Less than half of the rock material is decomposed and/or disintegrated to a soil. Fresh or discolored rock is present either as a continuous framework or as corestones.
Highly weathered	More than half of the rock material is decomposed and or disintegrated to a soil. Fresh or discolored rock is present either as a discontinuous framework or as corestones.
Completely weathered	All rock material is decomposed and/or disintegrated to soil. The original mass structure is still largely intact.
Residual soil	All rock material is converted to soil. The mass structure and material fabric are destroyed. There is a large change in volume, but the soil has not been significantly transported.

Description	Size Range	e of Pieces	Remarks	
Decemption	From To			
Crushed	~0.5 microns	0.1 ft	Contains clay	
Intensely fractured	0.05 ft	0.1 ft	Contains no clay	
Closely fractured	0.1 ft	0.5 ft		
Moderately fractured	0.5 ft	1.0 ft		
Little fractured	1.0 ft	3.0 ft		
Massive	3.0 ft an	id larger		

Table A-6:	<b>Descriptive Terms for Fracturing of Rock Mass</b>
------------	--

# Table A-7: Descriptive Terms for Rock Mass Conditions and Excavation Behavior (After Bieniwski, 1989)

Term	RMR	Typical Excavation Support for 10m Span Rock Tunnels			
Very good	81 – 100	Generally no support required except for spot bolting			
Good	61 – 80	Locally, bolts in crown 3m long, spaced 2.5m with occasional wire mesh, 50mm shotcrete in crown where required.			
Fair	41 – 60	Systematic bolts 4m long, spaced 1.5-2m in crown and walls with wire mesh in crown. 50-100mm shotcrete in crown and 30mm shotcrete in sides.			
Poor	21 – 40	Systematic bolts 4-5m long, spaced 1-1.5m in crown and walls with wire mesh in crown. 100-150mm shotcrete in crown and 100mm shotcrete in sides. Light and medium ribs spaced 1.5m where required.			
Very poor	< 20	Systematic bolts 5-6m long, spaced 1-1.5m in crown and walls with wire mesh in crown. Bolt invert. 150-200mm shotcrete in crown, 150mm shotcrete in sides, and 50mm on face. Medium to heavy ribs spaced 0.75m with steel lagging and forepoling if required. Close invert.			

## THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

BOOK 2 TECHNICAL PROVISIONS

ATTACHMENT 18-1 UTILITY ADJUSTMENT TYPE MATRIX

> JULY 31, 2012 BOOK 2 – TECHNICAL PROVISIONS ATTACHMENT 18-1 ADDENDUM 3 – SEPTEMBER 10, 2012

(This page intentionally blank.)

		East End	Crossing - Ut	ility Adjustme	nt Types		·
Section 6 (Indiana) Utility Company	hive pood	Station 24450	salenhoad	Brook sund Boulder	et une she shut	500000000000000000000000000000000000000	Stell Portood
AT&T - Indiana	Type 1 (April 2013)	n/a	n/a	Туре 2	Туре 2	n/a	Type 2
ATT - Long Distance	n/a	n/a	n/a	n/a	n/a	n/a	n/a
City of Jeffersonville Wastewater	No Conflict	n/a	Private project (Dec. 2013)	Туре 2	n/a	n/a	to be abandoned
Clark Co. REMC	n/a	n/a	No Conflict	Туре 3	Туре 1	Туре 3	No Conflcit
Duke Energy	Type 1 (April 2013)	n/a	No Conflict	Туре 3	n/a	Туре 3	Type 1 and Type 3
Indiana American Water	n/a	n/a	n/a	n/a	n/a	n/a	Туре 2
Level 3 Communications	n/a	n/a	n/a	n/a	Туре 2	n/a	Туре 2
Insight Communications, IN	Type 1 (April 2013)	n/a	n/a	Туре 2	Туре 2	n/a	No Conflcit
Vectren - distribution		n/a	n/a	Type 1 (Crystal Springs) and Type 3		n/a	n/a
Vectren -							
transmission	n/a	Туре 3	No Conflict	n/a	n/a	n/a	n/a
Watson Rural Water Company	No Conflict	Type 2	No Conflict	Type 2	Туре 2	n/a	SR 62: Type 2 Port Road: Type 1 design and order materials (April 2013) and Type 2 Construct
Section 4 (Kentucky) Utility Company	Springsbe Road	Weiter Bart Road	USAL	Statement Statement	siver post	Transforming the second	John Hallowin Beach Road
	Type 1 bet eabiliet						
AT&T - Kentucky	(June 2013) and Type 3 Relocate	Туре 3	Туре 1	Type 1 (April 2013)	Type 1 (April 2013)	Type 1 (April 2013)	Type 1 (April 2013)
Insight Communications, KY	Type 2	Туре 2	No Conflict	Type 1 (April 2013)		n/a	Type 1 (April 2013)
Level 3			<u> </u>	+- <u>·</u> ·	·····	<u> </u>	<u>+</u>
Communications	n/a	n/a Type 1 (April 2013)	No Conflict	n/a	n/a	n/a	n/a
Louisville Gas and Electric - gas	n/a	and Type 3 (KY 841 crossing)	No Conflict	Type 1 (April 2013)	No conflict Protection Req'd	n/a	n/a
Louisville Gas and Electric - electric	Type 1 order poles and Type 3 Construct	Type 1 (April 2013) and Type 3 (KY 841 crossing)	Туре 1	Type 1 (April 2013)	Type 1 (April 2013)	Type 1 (April 2013)	Type 1 (April 2013)
Louisville Water Company			No Conflict	Туре 2	Туре 2	Type 2 (lagoon)	
Metropolitan Sewer District	No Conflict	Type 1 (Sept. 2013)	No Conflict	Type 2	No conflict	n/a	No Conflict

# Attachment 18-1 East End Crossing - Utility Adjustment Type

n/a = no facilities in the area

No Conflict = facilities in the area, but appear to be clear of construction

= modified since version 4

Type 1 Utility Adjustments – The Utility Owner performs design and construction of the Utility Adjustment and is reimbursed by IFA. The completion schedules are shown in parenthesis .

Type 2 Utility Adjustments – The Utility Owner performs preliminary Utility Adjustment design. Developer performs final Utility Adjustment design and the Utility Adjustment Work using a Contractor(s) acceptable to the Utility Owner.

<u>Type 3 Utility Adjustments</u> – The Utility Owner performs the final design and Utility Adjustment work under the Utility Agreement negotiated by the Developer and is reimbursed by the Developer.

NOTE: The Type descriptions above are abbreviated. For full definition and terms of contract, see TP Section 18-1 and the PPA Exhibit 1

#### THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

BOOK 2 TECHNICAL PROVISIONS

> ATTACHMENT 21-1 ROW STATUS

> > JULY 31, 2012 BOOK 2 – TECHNICAL PROVISIONS ATTACHMENT 21-1 ADDENDUM 3 – SEPTEMBER 10, 2012

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

(This page intentionally blank.)

ROW Acquisition Status Summary (as of July 27, 2012).

East End Crossing	Number of Parcels Required	Number of Parcels Acquired	Number of Parcels to be Acquired
Section 4 - KY Approach	106	93	13
Section 6 - IN Approach	42	21	21

#### ROW Acquisition Status Summary (As of July 27, 2012)

#### ROW Acquisition Status Kentucky Approach – Section 4 (As of July 27, 2012)

Parcel No.	Owner	Anticipated Date	Demolition Complete		Right-Of-Way Agreements based on Right-Of-Way Negotiations
NO.		Available <sup>1</sup>	Complete	Reference	Item
3	Arun and Neera Ummat	6/27/2011	N/A		
4	Spring Farm Pointe. LLC c/o R. Stephen Canfield	12/31/2012	N/A	Contract for Easement	<ul> <li>There will be no construction equipment of any type on the easement located to the North of the existing 12' wooden fence.</li> <li>Any damage to fence or landscaping in the easement will be promptly repaired/restored at the expense of the contractor.</li> </ul>
				Other:	Do Not Remove Wooden Plank Fence.
5	R.F., Jr and Laverne McMahan Estate - c/o Joseph Cohen	7/15/2012	N/A	N/A	N/A
6	David K. Tinnell and Etta Tinnell	12/31/2012	N/A	Contract for Easement	Developer shall provide and install a temporary fence designed to contain livestock during the construction and remove the fence after Developer has completed construction of permanent fence.
7	Ken and Rosemary Dawson	12/21/2010	N/A	Wolf Pen	Developer shall not remove landscaping on the

Parcel No.	Owner	Anticipated Date	Demolition Complete		Right-Of-Way Agreements based on Right-Of-Way Negotiations
NO.		Available <sup>1</sup>	Complete	Reference	Item
9	Franco R. and Kimberly Rea	12/27/2010	N/A	Woods	property owners' side of the existing stockade
10	Richard K. and Evelyn Kay Rowe	2/23/2011	N/A		fence during fence removal and noise/safety wall construction. KY 841 Sta. 56+44.5 to Sta. 78+15
11	Vickie Foley	1/24/2011	N/A		Rt.
12	Donald and Robyn Roberts	3/28/2011	N/A		
13	Bruce N. and Vivian E. White	12/17/2010	N/A		
14	Cheryl R. Hancock	12/20/2010	N/A		
15	Vijay V. Kannan	11/23/2011	N/A		
16	R. Kevin Majzoub	9/15/2011	N/A		
17	Richard A. and Hilary B. Catapano	2/24/2011	N/A		
18	Mohammad and Saira Malik	3/1/2011	N/A		
19	Martin and Janice Dunbar	3/1/2011	N/A		
20	Anthony J. and Christy M. Yates	2/28/2011	N/A		
21	Julie M. Welter	2/18/2011	N/A		
22	Kenneth W. and Susan M. McMillan	12/21/2010	N/A		
23	James Lee and Linda Money	12/28/2010	N/A		
24	Avinash and Madhu Goel	1/21/2011	N/A		
25	Stephen T. and Margaret A. Marrillia	3/1/2011	N/A		
26	John G. and Erica Rinehimer	3/1/2011	N/A		
27	John and Sharon Shapanus	1/12/2011	N/A		
28	John T. and Bridget M. Cannon	2/9/2011	N/A		
29	Ryan W. and Sara C. Davis	3/1/2011	N/A		
30	Dwayne Elisco Sr. and Julianna Able	7/5/2011	N/A	N/A	N/A
31	August James and Margaret Anne Pisa	3/1/2011	N/A	Other	Developer shall not remove wooden fence.
32	Joy Ann Adams	8/18/2011	N/A	N/A	N/A
33	Wolf Pen Woods Comm Assoc.,	3/7/2011	N/A	Other	• For the formal entrance and trees adjacent to the

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

Parcel No.	Owner Date Complete		Demolition Complete	based on Right-Of-way Negotiations		
110.		Available <sup>1</sup>	Complete	Reference	Item	
	Inc.				entrance and parallel to Wolf Pen Branch Road, Developer shall not disturb formal entrance wall and 2 <sup>nd</sup> row of trees.	
37	Donald F. and Zita M. Coffey	3/7/2011	N/A	Contract for Easement	• The driveway at 7200 Springdale Rd. that is impacted with the construction of Springdale Rd. shall be replaced with concrete to the limits of the easement.	
38	Donald L. and Paula A. Embry	6/15/2011	N/A	N/A	N/A	
39	Samuel and Marlene O. Gordon	4/29/2011	In IR-35204	N/A	N/A	
40	Stephen P. and Margaret A. Hanson	8/31/2011	N/A	N/A	N/A	
41	Michael J. Bodi and Diane D.	3/7/2011	N/A	N/A	N/A	
43	William H. Parrott, Jr. and Kassy A. Parrott	5/16/2011	N/A	N/A	N/A	
47	D. Scott and Denise A. McClinton	3/13/2012	N/A	Contract for Easement	• The said temporary easement is valid for a two year period beginning with the commencement of road construction adjacent to the property.	
48	Bridgepointe Swim and Tennis Club, Inc.	6/10/2011	N/A	MOU	<ul> <li>Any property that is disturbed within the proposed easements shall be restored to as good a condition or better than when the construction began. All areas of disturbance shall be graded and restored with clean dirt free of any rock and/or debris then sodded. As shown on the approved Right of Way plans, the private drive (pavement, curb and gutter, that accesses the Club's parking area) shall be reconstructed to match the grades of the proposed Wolf Pen Branch Road.</li> </ul>	
49	Carney Wolf Pen, LLC	3/31/2013	N/A	N/A	N/A	
50	The Harbor at Harrods Creek, Inc.	3/31/2013	In IR-35204	N/A	N/A	
51	David R. Jr. and Penny C. Deatrick	8/31/2012	N/A	N/A	N/A	
52	Gary D. and Renee M. Charman	7/5/2011	N/A	N/A	N/A	

Parcel No.	Owner	Anticipated Date	Demolition Complete	Right-Of-Way Agreements based on Right-Of-Way Negotiations		
		Available <sup>1</sup>	Complete	Reference	Item	
53	John C. and Donna A. Meyer	2/23/2012	N/A	Contract for Easement	<ul> <li>Owner shall be allowed to move woodpile of firewood and compost pile off parcel.</li> <li>Developer shall allow removal of items stored in playhouse.</li> </ul>	
54	Jerry Yu and Jing Juan Zheng	3/31/2013	N/A	N/A	N/A	
55	Dale A. and Susan L. McConkey	5/13/2011	N/A	N/A	N/A	
57	David W. Schwytzer and Andrea Kristofy	12/31/2012	N/A	N/A	N/A	
58	Saleem and Sara L. Seyal	3/31/2013	N/A	N/A	N/A	
59	Byron Judson, III and Kimberly Sue Grimes	5/13/2011	N/A	N/A	N/A	
60	Brent L. and Diana L. Nemec	3/31/2013	N/A	N/A	N/A	
66	Soterion Corporation	4/30/2012	Do Not Disturb	Other	<ul> <li>A Preservation Easement has been placed covering the entire property.</li> <li>A Permanent Easement has been placed covering the area of the tunnels.</li> </ul>	
				KYTC Rental Agreement	• KYTC has given the former owners permission to rent and occupy the residence.	
68	Margaret E. Keane	12/1/2009	Yes	N/Ă	N/A	
69	Robert N. and Ivy Barash Mann	6/18/2010	Yes	N/A	N/A	
70	Sandra Waterbury Hobbs (Married)	2/7/2011	Yes	N/A	N/A	
71	Joseph Michael and Penny Joyce Fleitz	3/31/2013	In IR-35204	N/A	N/A	
72	Kent Risen and Karen M. Deckard	5/13/2011	N/A	N/A	N/A	
73	Kay O. Harper (Married)	9/23/2010	Yes	N/A	N/A	
74	Mary Shaver and M. Samantha Shaver	11/22/2010	Yes	N/A	N/A	
75	Bruce G. and Deborah V. Thomas	4/5/2007	In Parcel 50	N/A	N/A	
76	John Eger, Jr. and Joan C. Eger & Christopher Eger	3/16/2009	In Parcel 50	N/A	N/A	

Parcel No.	Owner	Anticipated Date	Demolition Complete	Right-Of-Way Agreements based on Right-Of-Way Negotiations	
NO.		Available <sup>1</sup>	Complete	Reference	Item
77	Ralph H. Shawler Revocable Living Trust	5/1/2006	In Parcel 50	N/A	N/A
78	G. Scott Tallent and Paula L. Collins	5/21/2009	In Parcel 50	N/A	N/A
79	Jack D. Wood	11/13/2009	In Parcel 50	N/A	N/A
80	Thomas L. Forshee	4/5/2007	In Parcel 50	N/A	N/A
81	Adrienne Byer	8/27/2010	In Parcel 50	N/A	N/A
82	Wayne R. and Sherry D. Schneider	9/23/2010	In Parcel 50	N/A	N/A
83	Lewis Dan	8/27/2010	In Parcel 50	N/A	N/A
84	John K. Krull	8/30/2010	In Parcel 50	N/A	N/A
85	Janet Marie Drayer Trust	10/14/2010	Yes	N/A	N/A
86	Charles L., Jr. and Donna J. Davis	10/13/2010	Yes	N/A	N/A
87	Kent W. and Gwen H. Killion	12/17/2010	Yes	N/A	N/A
88	Henry T., Jr. and Elisabeth B. Riggs	10/27/2010	Yes	N/A	N/A
89	Elizabeth Ullmer Mendel	9/15/2008	Yes	N/A	N/A
90	Mary K. Pitchford	5/6/2011	Yes	N/A	N/A
95	Wilson McGruder	3/31/2013	N/A	N/A	N/A
97	Cathy Dumstorf, Shari Fox, Cindy Dumstorf & James Dumstorf	7/13/2011	N/A	N/A	N/A
98	Gary S. and Helen Kay Tronzo	7/26/2012	In IR-35204	N/A	N/A
100	David and Sue Baughman	7/31/2009	Do Not Disturb	N/A	N/A
101	Ian S. and Denise A. Kalina	8/27/2010	Yes	N/A	N/A
102	Allen and Madonna Gammel	3/1/2011	Yes	N/A	N/A
103	Regina H. Schmidt	6/17/2011	Yes	N/A	N/A
104	Robert G. Jacoby Trust & Pauline R. Jacoby Trust	8/10/2010	Yes	N/A	N/A
105	Kyle J. Broyles, III and David M. Hardesty	2/18/2011	Do Not Disturb	MOU	The said temporary easement is valid for a two year period beginning with the commencement of

Parcel No.	Owner	Anticipated Date	Demolition Complete		Right-Of-Way Agreements based on Right-Of-Way Negotiations
NO.		Available <sup>1</sup>	Complete	Reference	Item
					road construction adjacent to the property.
107	Frank L. and Ann H. Brooks	8/10/2010	Yes	N/A	N/A
108	Bruce M. Heiman and Jo Elaine Beaty	10/13/2010	Yes	N/A	N/A
110	Virginia Ruth Rauh	3/31/2013	N/A	N/A	N/A
112	Michael J. and E. Jean McCann	8/29/2007	Yes	N/A	N/A
113	Charles E. and Rita G. Smith	5/4/2011	N/A	N/A	N/A
114	Beverly Jean Stewart and Linda Gayle Stewart	7/7/2009	Yes	N/A	N/A
115	Ann M. Hughes Real Estate #1 LTD	3/31/2013	In IR-35204	N/A	N/A
117	J. Michael Fleitz	3/31/2013	N/A	N/A	N/A
118	Paul and Joan Y. Casi	3/31/2011	In IR-35204	N/A	N/A
119	Robert H. Rice, Sr. and Paula L. Rice	2/1/2012	N/A	N/A	N/A
120	James Donald and Shana Hunt Vandertoll	3/31/2013	N/A	N/A	N/A
121	Harrods Creek Land Management Association LTD.	3/31/2013	N/A	N/A	N/A
122	Pete and Amy Hanekamp	6/18/2009	In IR-35204	N/A	N/A
123	David M. and Rebecca H. Will	9/17/2009	In IR-35204	N/A	N/A
125	Jacqueline H. Evans	12/31/2012	In IR-35204	KYTC Rental Agreement	• KYTC has given the former owners permission to rent and occupy the residence until December 31, 2012.
126	Louis F. and Paulette L. Breit	3/27/2011	N/A	N/A	N/A
127	City of Louisville/Louisville Water Company	12/31/2012	N/A	N/A	N/A
128	Stan and Mary Beth Moore	8/31/2012	Do Not Disturb	N/A	N/A
129	Roger Lenkoff	9/20/2010	N/A	N/A	N/A
130	Robert T. and Margaret G. Liter	10/18/2010	Yes	N/A	N/A

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

Parcel No.	Owner	Anticipated Date	Demolition Complete	Right-Of-Way Agreements based on Right-Of-Way Negotiations		
NO.		Available <sup>1</sup>	Complete	Reference	Item	
131	John L. Long	11/8/2010	Yes	N/A	N/A	
132	Julie Vatter	9/29/2010	N/A	N/A	N/A	
133	Erwin F. Hartmann	9/16/2010	N/A	N/A	N/A	
136	James C. and Gloria Carpenter	9/16/2010	N/A	N/A	N/A	
Notes:		•				
Anticipat	ed date that the parcel will be made a	available for the D	evelopers use.			

Parcel No.	Owner	Anticipated Date	Demolition Complete		Right-Of-Way Agreements based on Right-Of-Way Negotiations
		Available <sup>1</sup>	Compione	Reference	Item
1	LPI Investors	2/1/2005	N/A		
2	Moore (Lime Kiln)	4/1/2013	In IR-35205		
3	Gilmore Construction Inc.	12/1/2008	In IR-35205		
5	Brown, Gregory	8/1/2008	In IR-35205		
6	Harlow, Forrest & Sandra	6/1/2013	In IR-35205		
7	Morrow, Dan & Sara	7/1/2010	In IR-35205		
8	Gilmore, Laura	12/1/2012	In IR-35205		8-29-12 ROE obtained
9	Duncan, Gary & Deborah	10/1/2009	In IR-35205		
10	Nethery, Garrie W. Jr.	8/1/2009	In IR-35205		
11	Case, Todd & Barbara	2/1/2010	In IR-35205		
12	Dwelly, Erik	6/1/2013	In IR-35205		
13	Dooley, James & Theresa	4/1/2013	In IR-35205		
14	Brookhollow Development	12/1/2008	N/A		
15	Meyer, Dennis	6/1/2013	N/A		
16	Beech, Annamarie	5/1/2010	In IR-35205		
17	Seebold, John & Corinne	7/1/2010	In IR-35205		
18	Chumbley, Kenneth	6/1/2013	N/A		
19	Fasenbyer, Larry L.	1/1/2004	N/A		
20	Mudoch, Steven & Terri	7/1/2009	In IR-35205		
21	Gilmore, Gary D.	12/1/2008	N/A		
22	Spellman, Kelle & Anthony	4/1/2013	In IR-35205		
23	Barrett Trust/ Goobrath	6/1/2013	N/A		
25	James, Mark & Jacqueline	11/1/2012	In IR-35205		
26	James, Lee & Linda	11/1/2012	N/A		
27	Myers, Richard M. Jr.	4/1/2013	N/A		
28	Cooper, Mary	4/1/2013	N/A		
29	Schaaf, Alfred & Romilda	12/1/2012	N/A		8-29-12 ROE obtained

Parcel No.	Owner	Anticipated Date	Demolition Complete		Right-Of-Way Agreements based on Right-Of-Way Negotiations
NO.		Available <sup>1</sup>	Complete	Reference	Item
30	Schlosser Partnership	12/1/2008	N/A		
31	Ward, Beverly	9/1/2010	In IR-35205		
32	Ward, Beverly & Ward, Pat	1/1/2013	In IR-35205	Amended MOA	Central Passage House is advertised for relocation of the building.
34	No Moore, Inc.	4/1/2013	N/A		
38	Bagwshaw, Edward & Bonny	6/1/2013	N/A		
39	Brothers, Thomas L. Jr.	6/1/2013	N/A		
42	Libs, Richard L. & Elizabeth	12/1/2012	N/A		
47	T.J. Mark LLC	11/15/2012	N/A		
48	Cooper, Tony Wayne Sr.	4/1/2013	N/A		8-29-12 ROE obtained
50	Hughes	6/1/2013	N/A		
56	Paradowski, Brian	4/1/2013	N/A		
57	Apple 5 LLC	4/1/2013	N/A		
58	Reschar, Jacky	6/1/2013	N/A		
60	Boulder Creek	6/1/2013	In IR-35205		
62	Bagshaw, Edward	6/1/2013	N/A		
Notes: 1. Antic	ipated date that the parcel will be made	de available for tl	he Developers ι	use.	

#### THE EAST END CROSSING

#### (LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

#### PUBLIC-PRIVATE AGREEMENT

#### BOOK 2 TECHNICAL PROVISIONS

#### ATTACHMENT 22-1 PERFORMANCE AND MEASUREMENT TABLE

(This page intentionally blank.)

## Table 22-1 Performance and Measurement Table

Ele	ement	Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element	r enormanoe requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*	Measurement Record	rarget
1)	ROA	DWAY							
	1.1	Obstructions and debris	Roadway and clear zone free from obstructions and debris	2 hrs	N/A	N/A	Visual Inspection	Number of obstructions and debris	Nil
-		Pavement - Rigid	All roadways have a smooth surface course (including bridge decks, covers, gratings, frames and boxes) with adequate skid resistance and free from Defects.	N/A	N/A	8 mo.	a) Cracks Automated condition distress survey.	Total number of slabs per lane mile with any combination of longitudinal, transverse, or corner breaks. Cracks greater than 0.50 inches wide with spalling up to 2 inches wide. Intersecting random cracks with a pattern that divides the slab into three or more segments. Unsealed cracks greater than 0.125 inches.	
				N/A	N/A	8 mo.	<b>b) Corner Breaks</b> Visual inspection.	Corner breaks with more than 0.50 inch drop off.	Nil
				24 hrs	28 days	8 mo.	<b>c) Localized deficiencies</b> Physical measurement.	Wheel path and non-wheel path, localized deficiencies such as spalling, pop outs, scaling greater than 2 inches wide, or to a depth of 0.5 inch, or greater than 6 inches long.	
				24 hrs	28 days	8 mo.	<b>d) Faulting</b> Automated condition distress survey.	Faulting that causes an elevation change across joints or cracks greater than 0.325 inches.	Nil
				7 days	28 days	8 mo.	e) Lane to Shoulder Drop-Off	Instances of edge drop-off	Nil

Element	t Category	]	Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Targe
Ref	Element	renormance Requirement	Hazard Perm.		Perm. Repair	Method*	Measurement Record	rarget
						Physical measurement.	greater than 1" for a continuous length of 18 feet or in aggregate more than 2 percent of total shoulder length. (Number)	
			N/A	N/A	8 mo.	f) Roadway Smoothness (excluding shoulders and gores) Measurement of International Roughness Index (IRI) shall meet the requirements in the FHWA Highway Performance Monitoring System (HPMS) Field Manual.	Meet Table 22-2 IRI Requirements	100%
			N/A	N/A	8 mo.	<b>g) Skid resistance</b> (excluding gores) ASTM E274 and a smooth tire in accordance with ASTM E524 at 40 MPH using a full scale smooth tire meeting the requirements of ASTM E 524. A minimum of 11 equally spaced tests shall be performed in each 0.25 mile segment of each lane and averaged to obtain the average test value for each 0.25 mile segment.	The average test value for any 0.25 mile segment of any lane less than 35, and any single test value less than 25.	Nil
1.2 cont		Road users warned of potential skidding hazards	24 hrs	7 days	N/A	Skid resistance (as above)	Instances where road users warned of potential skidding hazard where remedial action is identified.	100%
1.3	Pavement - Flexible	All roadways have a smooth surface course (including bridge decks, covers, gratings, frames and boxes) with adequate skid resistance and free from	N/A	N/A	8 mo.	a) Cracks Automated condition distress survey.	Cracks greater than 0.25 inches wide over a continuous length of 6 feet or greater. Unsealed cracks greater than 0.125 inches	
		resistance and free from Defects.	24 hrs	28 days	8 mo.	b) Potholes	0.125 inches. Potholes greater than 0.5	Nil
	I DIANA FINANCE /		271113	20 0033	2	,		

Elen	ement Category			Respo	onse to De	efects			
F	Ref	Element	Performance Requirement	Cate Hazard Mit.	gory 1 Perm. Remedy	Cat. 2 Perm. Repair	Inspection and Measurement Method*	Measurement Record*	Target
				WIIC.	Kemedy	Repair	Visual inspection.	square feet in area and 1 inch in depth.	
				N/A	N/A	8 mo.	<b>c) Shoving</b> Physical measurement.	Shoved areas exceeding 20 square feet.	Nil
				N/A	N/A	8 mo.	d) Rutting Automated condition distress survey. ASTM E950. Measurements of localized areas shall be carried out using a 6 foot straight edge in accordance with ASTM E1707.	Rutting depth exceeding 0. 25 inches average per lane-mile section, 0.375 inches average per 300 foot section and any instance greater than 0.500 inches	Nil
				24 hrs	28 days	8 mo.	e) Depression or Bump Physical measurement.	Depression or bump exceeding 0.5 inches for any area greater than 1 square foot.	Nil
								No single measurement shall exceed 1 inch.	Nil
				7 days	28 days	8 mo.	f) Lane to Shoulder Drop-Off Physical measurement.	Instances of edge drop-off greater than 1 inch for a continuous length of 18 feet or in aggregate more than 2 percent of total shoulder length. (Number)	Nil
				N/A	N/A	8 mo.	g) Roadway Smoothness (excluding shoulders and gores) Measurement of International Roughness Index (IRI) shall meet the requirements in the FHWA Highway Performance Monitoring System (HPMS) Field Manual.	Meet Table 22–2 IRI Requirements.	100%
				N/A	N/A	8 mo.	<b>h) Skid resistance</b> (excluding shoulders and gores) ASTM E274 and a smooth tire in	The average test value for any 0.25 mile segment of any lane less than 35, and any single test	Nil

Ele	ement	Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element		Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		1 901
							accordance with ASTM E524 at 40 MPH using a full scale smooth tire meeting the requirements of ASTM E 524. A minimum of 11 equally spaced tests shall be performed in each 0.25 mile segment of each lane and averaged to obtain the average test value for each 0.25 mile segment.	value less than 25.	
			Road users warned of potential skidding hazards	24hrs	7days	N/A	Skid resistance (as above)	Instances where road users warned of potential skidding hazard where remedial action is identified.	100%
	1.4	Reserved							
	1.5	Joints in concrete	Joints in concrete paving are sealed and watertight Longitudinal joint separation	24 hrs	28 days	8 mo.	Visual inspection of joints	Length of individual unsealed joints greater than 3-feet in any 12-foot length	Nil
							Measurement of joint width and level difference of two sides of joints	Joint width more than 1 inch or faulting more than 0.25 inches	Nil
	1.6	Curbs	Curbs are free of defects	7 days	28 days	8 mo.	Visual inspection	Length out of alignment (0.5 inch in 10 feet)	Nil
2)	DRA	INAGE							
	2.1	Pipes and Channels	Each element of the drainage system is maintained in its proper function by cleaning, clearing and/or emptying as appropriate from the point at which water drains from the travel way to the outfall or drainage way.	24 hrs	7 days	6 mo.	Visual inspection supplemented by CCTV where required to inspect buried pipe work	Length with less than 90% of cross section clear (feet)	Nil

Elemen	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element		Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		
2.2	Drainage treatment devices	Drainage treatment and balancing systems, flow and spillage control devices function correctly and their location and means of operation is recorded adequately to permit their correct operation in Emergency.	24 hrs	7 days	6 mo.	Visual inspection	Devices functioning correctly with means of operation displayed (Number)	100%
2.3	Travel Way	Water does not encroach on the travel way to the extent that such water would represent a hazard by virtue of its position and depth.	24 hrs	7 days	6 mo.	Visual inspection of water on surface	Instances of hazardous water build-up	Nil
2.4	Discharge systems	Surface water discharge systems perform their proper function and discharge to groundwater and waterways complies with the relevant legislation and permits.	24 hrs	7 days	6 mo.	Visual inspection and records	Non-compliances with Project Standards and regulations	Nil
2.5	Underdrains	Underdrain pipes and outlets in a fully functioning condition to maintain the design drainage flow.	24 hrs	7 days	6 mo.	Visual inspection.	Devices functioning correctly (number)	100%
2.6	Protected Species	Named species and habitats are protected.	24 hrs	28 days	6 mo.	Visual inspection	Compliance with the contract requirements	100%
3) STR	UCTURES	1				1	1	
3.1	Structures having an opening measured	Substructures and superstructures are free of: • undesirable vegetation	N/A	90 days	8 mo.	Inspection and assessment in accordance with the requirements of federal National Bridge Inspection Standards (NBIS) of	Records as required in the Department Bridge Inspection Manual	100%
	along the	<ul> <li>debris and bird droppings</li> </ul>	N/A	90 days	8 mo.	the Code of Federal Regulations,	All condition states to be one for	100%

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

Elemen	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2		t Measurement Record*	Target
Ref	Element	r enormance requirement	Hazard Mit.	Perm. Remedy	Perm. Repair			
	roadway of more than 20 feet between undercoping	<ul> <li>blocked drains, weep pipes manholes and chambers</li> <li>blocked drainage holes in structural components</li> </ul>	24 hrs 24 hr N/A	28 days 28 days 28 days	8 mo. 8 mo. 8 mo.	23 Highways – Part 650, the Department Bridge Inspection Manual, and the Federal Administration's Bridge Inspector's Reference Manual.	all structure components Longitudinal or transverse deck cracks greater than 0.1 inches for a continuous length of 4 feet or greater.	Nil
	s of abutments or springlines	<ul> <li>defects in joint sealants</li> <li>defects in pedestrian protection measure</li> </ul>	24 hrs	28 days	8 mo.		Spalling greater than 2 square feet.	Nil
	of arches or extreme ends of openings or multiple boxes	<ul> <li>scour damage</li> <li>corrosion of rebar</li> <li>deck and wearing surface defects</li> <li>Maintain substructure</li> </ul>	24 hrs N/A 24 hrs N/A	28 days N/A 28 days 28 days	8 mo. 8 mo. 8 mo. 8 mo.		Defects in protective coating greater than 3 square feet in any location or greater than 5% of overall coating area per structural member.	Nil
		settlement within specified requirements.				Physical measurement with straight edge.	Post-construction settlement of bridge piers and abutments: Less than 1-inch total settlement and less than 0.5 inch differential between adjacent piers or abutments.	Nil
							Differential settlement of bridge approach slabs: Less than 1-inch total settlement and less than 0.5 inch differential between end of approach slabs.	Nil

Elemer	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element		Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		0
		Maintain condition rating.	24 hrs	3 mo.	8 mo.	Inspection and assessment in accordance with the requirements of federal National Bridge Inspection Standards (NBIS) of the Code of Federal Regulations, 23 Highways – Part 650, the Department Bridge Inspection Manual, and the Federal Administration's Bridge Inspector's Reference Manual.	Maintain a condition rating no lower than 6 for any individual element for each structure. Maintain an overall condition rating no lower than 6 for each structure.	100%
3.2	East End Bridge	Bridge deck and wearing surface free of defects.	24 hrs	3 mo.	8 mo.	Visual inspection and physical measurement.	Longitudinal or transverse cracks. Spalling that extends into the structural deck. Spalling greater than 1 square foot.	Nil Nil Nil
3.3	Structure components	<ul> <li>i) Expansion joints are free of:</li> <li>dirt debris and vegetation</li> <li>defects in drainage systems</li> <li>loose nuts and bolts</li> <li>defects in gaskets</li> <li>ii) The deck drainage system is free of all obstructions and operates as intended.</li> </ul>	7 days 24 hrs	3 mo.	8 mo.	Inspection and assessment in accordance with the requirements of federal National Bridge Inspection Standards (NBIS) of the Code of Federal Regulations, 23 Highways – Part 650, the Department Bridge Inspection Manual, and the Federal Administration's Bridge Inspector's Reference Manual.	Records as required in the Department Bridge Inspection Manual Occurrences of condition rating below seven for any deck, superstructure or substructure All condition states to be one for all structure components	100% Nil 100%

Ele	ment	Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*	measurement Record	
			<ul> <li>iii) Parapets are free of:</li> <li>loose nuts or bolts</li> <li>blockages of hollow section drain holes</li> <li>graffiti</li> <li>vegetation</li> <li>accident damage</li> </ul>	24 hrs					
			iv) Railings and Parapets are functioning as intended.	24 hrs					
			<ul> <li>v) Bearings and bearing shelves are clean.</li> </ul>	7 days					
			vi) Bridge bearing are functioning within their original design parameters to ensure satisfactory performance. Additional advice contained in bearing manufacturers' instructions	7 days					
			vii) Barrier railings are maintained in a structurally sound manner to function as intended.	24 hrs					
		Non-bridge class culverts	<ul> <li>Non-bridge-class culverts are free of:</li> <li>Any combination of vegetation, debris or silt causing &gt;10% loss in</li> </ul>	24 hrs	28 days	6 mo.	Visual inspection	Number with vegetation, debris or silt > 10% of design opening not including the sump where applicable	Nil
			<ul> <li>causing &gt; 10% loss in cross-section of the structure</li> <li>defects in sealant to movement joints</li> <li>scour damage</li> </ul>					Number with defects in sealant and movement joints Number with scour damage	Nil Nil

Elemen	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element	r chormanee Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair			i ai got
3.5	Gantries and high masts	Sign signal gantries, high masts are structurally sound and free of: • loose nuts and bolts • defects in surface protection systems • graffiti *Hazard Mitigation response 48 hrs in inclement weather	24 hrs* 48 hrs 72 hrs	3 mo.	9 mo.	Visual inspection	Number with loose assemblies Number with defects in surface protection Number with graffiti	Nil Nil Nil
3.6	Load ratings	All structures maintain the design load capacity.	24 hrs	3 mo.	9 mo.	Inspection and assessment in accordance with the requirements of AASHTO's Guide Manual for Condition Evaluation and Load and Resistance Factor Rating (LRFR) of Highway Bridges, the TxDOT Bridge inspection Manual, and the Federal Administration's Bridge Inspector's Reference Manual.	Number of load restrictions for Indiana and/or Kentucky legal loads (including legally permitted vehicles)	Nil
3.7	Surface coating	Include a re-coating schedule in the MP.	N/A	N/A	1 year	Visual inspection of surface condition	Greater than 20% of surface area is rusted, flaking or has delaminated coating by visual inspection.	Nil
3.8	Structural assessment	Evaluate structural damage to structures and liaise with emergency services to assure safe working in clearing the Incident, safety for traffic and adequate structural capacity.	24 hrs	28 days	N/A	Inspections and surveys as required by incident	Incident reports showing compliance	100%

Eleme	nt Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair			
3.9	Graffiti	Graffiti is removed in a manner and using materials that restore the surface to a like appearance similar to adjoining surfaces.	N/A	3 mo.	N/A	All graffiti is considered a Category 1 Defect	Inspection records showing compliance	100%
3.10	Permit Load Analysis	Analyze and respond to permit load request.	N/A	N/A	7 days		Analyze and respond to Indiana Department of Revenue, Motor Carrier Services Division in 7 days.	100%
3.11	Structure Monitoring	Maintain the approved structure monitoring devices.	N/A	N/A	30 days		Monitoring records showing compliance.	100%
) PA	EMENT MAF	<b>KINGS, OBJECT MARKE</b>	RS, BAF	RIER M	ARKER	S AND DELINEATORS		•
4.1	Pavement markings & symbols	<ul> <li>Pavement markings and symbols are:</li> <li>clean and visible during the day and at night</li> <li>whole and complete and of the correct color, type,</li> </ul>	24 hrs	28 days	9 mo.	As specified in Standard Specification 808.07 and Indiana Test Method (ITM) 931. Physical measurement	90% of length meeting retained retro-reflectivity reading specified in Standard Specification 808.07 from May 1 to November 30	100%
		<ul> <li>width and length</li> <li>placed to meet the MUTCD</li> </ul>					Length with more than 5% loss of area of material at any point	Nil
		MOTOD					Length with spread more than 10% of specified dimensions	Nil
							Length performing its intended function and compliant with relevant regulations	100%
							Pavement symbols with 90% of	100%
							each symbol functioning as intended	

Elen	nent	Category		Respo	onse to De	fects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Targe
F	Ref	Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		
		& Markers	<ul> <li>are:</li> <li>clean and visible</li> <li>of the correct color and type</li> <li>legible and reflective</li> <li>straight and vertical</li> </ul>					delineators defective or missing	
5) G	BUAI	RDRAILS, S	SAFETY BARRIERS AND II	MPACT	ATTENU	ATORS	6		
5		Guard rails and safety	All guardrails, safety barriers, concrete barriers, etc.) are maintained free of	24 hrs	7 days	9 mo.	Visual inspection	Length of road restraint systems correctly installed	100%
			Defects. They are appropriately placed and					Length free from defects	100%
			correctly installed at the correct height and distance					Length at correct height	100%
			from roadway or obstacles.					Length at correct distance from roadway and obstacle	100%
6) T	RAF	FIC SIGNS							•
6	5.1	Regulatory Signs	i) Signs are clean, correctly located, clearly visible, legible, reflective, at the correct height and free from	2 hrs	7 days	9 mo.	a) Retroreflectivity Coefficient of retro reflectivity	Number of signs with reflectivity below the requirements of MUTCD	Nil
			structural and electrical defects				<b>b) Face damage</b> Visual inspection	Number of signs with face damage greater than 5% of area	Nil
			ii) Identification markers are provided, correctly located, visible, clean and legible				<b>c) Placement</b> Visual inspection	Signs placed in accordance with Project Standards including not twisted or leaning	100%
			iii) Sign mounting posts are vertical, structurally sound					Number of obsolete signs	Nil
			and rust free iv) All break-away sign				<b>d) Obsolete signs</b> Visual inspection	Sign information is of the correct size, location, type and wording	100%
			mounts are clear of silt or other debris that could				e) Sign Information Visual inspection	to meet its intended purpose	

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

Ele	emen	t Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element	r errormanoe Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		raiger
			<ul> <li>impede break-away features and shall have correct stub heights</li> <li>v) Obsolete and redundant signs are removed or replaced as appropriate</li> <li>vi) Visibility distances meet the stated requirements</li> <li>vii) Sign information is of the correct size, location, type and wording to meet its intended purpose and any statutory requirements</li> </ul>						
			<ul> <li>viii) All structures and elements of the signing system are kept clean and free from debris and have clear access provided.</li> <li>ix) All replacement and repair materials and equipment are in accordance with the</li> </ul>						
	6.2	Non- Regulatory Signs	Requirements of the MUTCD	7 days	28 days	9 mo.	Visual inspection	Number of damaged safety critical signs	Nil
7)	TRA	FFIC SIGNA	LS		•				
	7.1	General	<ul><li>i) Traffic Signals and their associated equipment are:</li><li>clean and visible</li></ul>	2 hrs	24 hrs	6 mo.	a) General condition Visual inspection	Signals are clean and visible	100%

Element	Denfermen en Dennimen en t	0.1.					
Element		Hazard Mit.	gory 1 Perm. Remedy	Cat. 2 Perm. Repair	Inspection and Measurement Method*	Measurement Record*	Targe
	<ul> <li>correctly aligned and operational</li> </ul>			liopan	<b>b) Damage</b> Visual inspection	Signals are undamaged	100%
	<ul><li>by accident or vandalism</li><li>correctly aligned and</li></ul>				<b>c) Signal timing</b> Timed measurements	Installations have correct signal timings	100%
	ii) Signal timing and operation is correct				d) Contingency plans Records Review	Full contingency plans are in place	100%
	iii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure						
Soundness	Traffic Signals are structurally and electrically sound	24 hrs	28 days	6 mo.	a) Structural soundness Visual inspection b) Electrical soundness Testing to meet NEC regulations	Inspection records showing safe installation and maintenance	100%
dentification marking	Signals have identification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legible	N/A	28 days	6 mo.	Visual inspection	Inspection records showing identification markers and other information are easily readable	100%
ΓING			•	•			
Roadway ₋ighting – General	i) Lighting is free from defects and provides acceptable uniform lighting	24 hrs	28 days	6 mo.	a) Mainline lights operable Night time inspection or automated logs	Less than 90% of lights functioning correctly at all times	Nil
	quality				b) Mainline lights out of	Instances of more than two consecutive lights not functioning	Nil
	dentification harking <b>ING</b> Roadway ighting – General	<ul> <li>correctly aligned and operational</li> <li>ii) Signal timing and operation is correct</li> <li>iii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure</li> <li>Soundness</li> <li>Traffic Signals are structurally and electrically sound</li> <li>Centification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legible</li> <li>ING</li> <li>Roadway ighting – Seneral</li> <li>i) Lighting is free from defects and provides acceptable uniform lighting</li> </ul>	by accident or vandalism • correctly aligned and operational ii) Signal timing and operation is correct iii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure Soundness Traffic Signals are structurally and electrically sound dentification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legible ING Roadway ighting – General i) Lighting is free from defects and provides acceptable uniform lighting quality ii) Lanterns are clean and	by accident or vandalism • correctly aligned and operational ii) Signal timing and operation is correct iii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure Soundness Traffic Signals are structurally and electrically sound dentification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legible ING Roadway ighting – Beneral beneral beneral by accident or vandalism • correctly aligned and • correctly located, clearly visible, clean and legible 24 hrs 28 days 28 days 29 days 20 d	by accident or vandalism • correctly aligned and operational ii) Signal timing and operation is correct iii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure Soundness Traffic Signals are structurally and electrically sound dentification harking index Signals have identification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legible INC Sound N/A 28 days 6 mo. 24 hrs 28 days 6 mo. 24 hrs 28 days 6 mo. 24 hrs 28 days 6 mo. 24 hrs 28 days 6 mo. 10 cm 10 cm	by accident or vandalism operationalby accident or vandalism operationalc) Signal timing Timed measurementsii) Signal timing and operation is correctiii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure24 hrs28 days6 mo.a) Structural soundnessSoundnessTraffic Signals are structurally and electrically sound24 hrs28 days6 mo.a) Structural soundnessInternative traffic control is provided during a period of failureN/A28 days6 mo.b) Electrical soundnessSoundnessSignals have identification markers and the telephone number for reporting faults are correctly located, clearly visible, clean and legibleN/A28 days6 mo.Visual inspectionINCILighting - isenerali) Lighting is free from defects and provides acceptable uniform lighting quality ii) Lanterns are clean and24 hrs28 days6 mo.a) Mainline lights operable Night time inspection or automated logs b) Mainline lights out of action	by accident or vandalism • correctly aligned and operationalby accident or vandalism • correctly aligned and operationalInstallations have correct signal timing Timed measurements d) Contingency plans Records ReviewInstallations have correct signal timingsii) Signal timing and operation is correctiii) Contingency plans are in place to rectify Category 1 defects not immediately repairable to assure alternative traffic control is provided during a period of failure28 days6 mo.a) Structural soundness Visual inspectionInspection records showing safe installation and maintenancesoundnessTraffic Signals are structurally and electrically sound24 hrs28 days6 mo.a) Structural soundness Visual inspectionInspection records showing safe installation and maintenancedentification marking wisible, clean and legibleN/A28 days6 mo.Visual inspectionInspection records showing installation and maintenanceINGtoadway ighting - ighting - ighting - ighting - ighting - ighting - ighting - ighting - ighting - ii) Lanterns are clean and24 hrs28 days6 mo.a) Mainline lights operable nightime inspection or aution and legibleLess than 90% of lights functioning correctly at all times instances of more than two consecutive lights not functioning

lement	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element	renormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*	Measurement Record	
		correctly positioned iii) Lighting units are free from accidental damage or vandalism iv) Columns are upright, correctly founded, visually acceptable and structurally sound				Night time inspection or automated logs		
8.2	Sign Lighting	Sign lighting is fully operational	24 hrs	28 days	6 mo.	Night time inspection or automated logs	Instances of more than one bulb per sign not working	Nil
8.3	Electrical Supply	Electricity supply, feeder pillars, cabinets, switches and fittings are electrically, mechanically and structurally sound and functioning	24 hrs	7 days	1 mo.	Testing to meet NEC regulations, visual inspection	Inspection records showing safe installation and maintenance	100%
8.5	High Mast Lighting	<ul><li>i) High mast luminaries</li><li>functioning on each pole</li><li>ii) All obstruction lights are</li></ul>	24 hrs	48 hrs	1 mo.	Yearly inspection and night time inspections or automated logs	Instances of two or more lamps not working per high mast pole Identification of other defects	Nil Nil
		present and working (if required) iii) Compartment door is secure with all bolts in place iv) All winch and safety equipment is correctly functioning and maintained without rusting or corrosion (for structural requirements refer to Element Category 3)						
8.6	Navigation	Navigation lights on East	24 hrs	48 hrs	28	Weekly visual inspection	No outages	100%

Ele	ment	t Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		Target
		Lighting	End Bridge operate as required by USCG regulations			days			
1	8.7	Obstruction Lighting	Obstruction lights on East End Bridge operate as required by FAA regulations	24 hrs	48 hrs	28 days	Weekly visual inspection	No outages	100%
9) F	FENC	ES, WALLS	AND SOUND ABATEMENT	<u> </u>		<u> </u>			
!	9.1	Design and Location	Fences and walls act as designed and serve the purpose for which they were intended	7 days	28 days	6 mo.	Visual Inspection	Inspection records showing compliance	100%
9	9.2	Reserved							
10)	) LAN	NDSCAPING	i	1	ł	1	ł	ł	. <b>.</b>
		Vegetated Areas – Except landscaped areas –	Vegetation is maintained so that: i) Height of grass and weeds is kept within the	7 days	14 days	28 days	<ul> <li>a) Urban areas</li> <li>Physical measurement of height of grass and weeds</li> <li>b) Rural areas</li> </ul>	Individual measurement areas to have 95% of height of grass and weeds between 5 inches and 18 inches	100%
		General	limits described for urban and rural areas. Mowing begins before vegetation reaches the maximum height.				Physical measurement of height of grass and weeds <b>c) Encroachment</b> Visual inspection of instances of	Individual measurement areas to have 95% of height of grass and weeds between 5 inches and 30 inches	100%
			ii) Spot mowing at intersections, ramps or				encroachment of vegetation d) Wildflowers	Occurrences of vegetation encroachment	Nil
			other areas maintains visibility of appurtenances and sight distance.				Visual Inspection with audit of process.	Adherence to vegetation management manuals	100%
			iii) Grass or vegetation does not encroach into or on				e) Sight lines Visual inspection	Instances of impairment of sight	Nil

Elem	ent	Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
R	ef	Element		Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		Jen gee
			paved shoulders, main lanes, sidewalks, islands, riprap, traffic barrier or curbs.					lines or sight distance to signs	
			<ul> <li>iv) A herbicide program is undertaken to control noxious weeds and to eliminate grass in pavement or walkways.</li> <li>v) A full width mowing cycle</li> </ul>						
			is completed after the first frost. vi) Wildflowers are preserved utilizing the						
10		Landscaped Areas	<ul> <li>aesthetic guidelines</li> <li>i) All landscaped areas are maintained to their originally constructed condition.</li> <li>Landscaped areas are maintained as designated in the Plans.</li> </ul>	3 days	7 days	28 days	Visual inspection	Inspection records showing compliance	100%
			ii) Mowing, litter pickup, plant maintenance, pruning, insect, disease and pest control, fertilization, mulching, bed maintenance, watering is undertaken as per MP.						
			iii) The height of grass and weeds is kept between 2 inches and 8 inches.						

Element	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair			Target
		Mowing begins before vegetation reaches 8 inches						
		Damaged or dead vegetation is replaced.	24 hrs	N/A	12 mo.	Visual inspection	Inspection records showing compliance	100%
10.4	Trees, shrubs and ornamentals	i) Trees, shrubs and ornamentals on the right of way, except in established no mow areas, are trimmed in accordance with Project Standards.	N/A	N/A	12 mo.	Visual inspection	Inspection records showing compliance	100%
		ii) Trees, shrubs and ornamentals are trimmed to insure they do not interfere with vehicles or sight distance, or inhibit the visibility of signs.	7 days	28 days	6 mo.			
		iii) Dead trees, shrubs, ornamentals and branches are removed. Potentially dangerous trees or limbs are removed.	7 days	28 days	6 mo.			
		iv) All invasive or noxious trees and vegetation are removed. Diseased trees or limbs are treated or removed by licensed contractors.	N/A	N/A	12 mo.			
		Damaged or dead vegetation is replaced.	N/A	N/A	12 mo.	Visual inspection	Inspection records showing compliance	100%
10.5	Wetlands	Wetlands are managed in accordance with the permit requirements	24 hrs	7 days	28 days	Visual inspection, assessment of permit issuers	Instances of permit requirements not met	Nil

Elen	nent	Category		Respo	onse to De	efects			
			Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Targe
	Ref	Element		Hazard Mit.	Remedy	Perm. Repair	Method*		
			, EMBANKMENTS AND C	1	1				
1'		Slope Failure	All structural or natural failures of the embankment and cut slopes of the Facility are repaired		28 days	6 mo.	Visual inspection by geotechnical specialist and further tests as recommended by the specialist	Recorded instances of slope failure	Nil
1	1.2	Slopes - General	Slopes are maintained in general conformance to the original graded cross- sections, the replacement of landscaping materials, reseeding and revegetation for erosion control purposes and removal and disposal of all eroded materials from the roadway and shoulders	24 hrs	28 days	6 mo.	Visual inspection	Inspection records showing compliance	100%
2) :	SNC	OW AND ICE	CONTROL						
12	2.1	Reserved							
12		Continuous plowing and deicing	Continuous plowing and deicing application to achieve a maximum circuit time of 2 hours.	2 hrs	N/A	N/A	Circuit time measurement.	Winter operations record.	100%
12	2.3	Reserved							
12	2.4	Reserved							
12	2.5	Snow accumulatio n	Snow accumulation adjacent to barrier walls removed concurrent with mainline pavement snow removal.	**	N/A	N/A	** Noncompliance is a Category 1 Defect.	Winter operations record.	100%
12		Lanes and ramps (as defined in <u>Section</u> 10.3.1)	Achieve bare pavement after end of the winter event.	2 hr	N/A	N/A	Visual inspection	Winter operations record.	100%

lement	t Category		Respo	onse to De	efects			
		Performance Requirement	Cate	gory 1	Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref	Element	renormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	r	medsurement record	
12.7	Shoulders/ Medians/ Crossovers	Plowed within eight hours of the end of winter event, up to 6 inch total accumulation winter event.	8 hr	N/A	N/A	Visual inspection	Winter operations record.	100%
		Plowed within 12 hours of the end of winter event, over 6 inch and up to 10 inch total accumulation winter event.	12 hr	N/A	N/A			
		Plowed within 16 hours of the end of winter event over 10 inch total accumulation winter event.	16 hr	N/A	N/A			
12.8	Hazards	Address any hazard immediately upon detection or being made aware.	1 hr	N/A	N/A		Winter operations record.	100%
		Address isolated slippery conditions 100% of the time.	1 hr	N/A	N/A	Visual inspection or being made aware.	Winter operations record.	100%
12.9	Reserved							
12.10	Salt storage	Salt stored in covered buildings at all times.	**	N/A	N/A	** Noncompliance is a Category 1 Defect.	Instances of uncovered salt storage.	Nil
12.11	Reserved							
12.12	Reporting requirements	All reporting requirements identified in <u>Section 22</u> are accurate, complete, and timely 100% of the time.	1 day	7 days	N/A	Audit.	Audit records.	100%

Elem	nent	Category		Response to Defects		efects			
			Performance Requirement	Category 1		Cat. 2	Inspection and Measurement	Measurement Record*	Target
Ref		Element	r enormance Requirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		
		Reserved							
13) I	INC	IDENT RESP	PONSE						
13	3.1	General	Respond to Incidents and emergencies in accordance with <u>Section 22.3.1.11</u> .	1 hr	N/A	N/A	Response times met for 90% of incidents measured on a 1 year rolling basis.	Inspection records showing compliance	100%
							No complaints from Emergency responders.		
1:		Hazardous Materials	For any hazardous materials spills, comply with the requirements of <u>Section</u> 22.1.7	1 hr	N/A	N/A	Developers O&M Safety Plan details the process and procedures in place and followed.	Inspection records showing compliance	100%
1:	3.3	Structural assessment	Evaluate structural damage to structures and liaise with emergency services to ensure safe working in clearing the incident	1 hr	N/A	N/A	Inspections and surveys as required by incident.	Incident reports showing compliance	100%
1:	3.4	Temporary and permanent remedy	Propose and implement temporary measures or permanent repairs to Defects arising from the Incident. Ensure the structural safety of any structures affected by the incident	24 hrs	28 days	N/A	Review and inspection of the incident site.	Inspection records showing compliance	100%
14) (	CUS	STOMER RE	SPONSE	-	-		-		
14	4.1	Response to inquiries	Timely and effective response to customer inquiries and complaints.	48 hrs	28 days	N/A	Contact the customer within 48 hours following initial customer inquiry.	Number of responses within specified times	100%
							All work resulting from customer requests is scheduled within 48 hours of customer contact.		

Ele	Element Category			Response to Defects		efects			
			Performance Requirement	Category 1		Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref Element		r enormance rrequirement	Hazard Mit.	Perm. Remedy	Perm. Repair	Method*		
							Follow-up contact with the customer within 72 hours of initial inquiry.		
							All customer concerns/requests are resolved to IFA's satisfaction within 2 weeks of the initial inquiry.		
	14.2	Customer contact line	Telephone line manned during business hours and 24 hour availability of messaging system. Faults to telephone line or message system rectified	24 hrs	28 days	N/A	Instances of line out of action or unmanned	Operations records showing non availability including complaints from public.	nil
15	) SW	EEPING ANI	D CLEANING					·	
	15.1	Sweeping	i) Keep all channels, hard shoulders, gore areas, ramps, intersections, islands and frontage roads swept clean,	7 days	28 days	6 mo.	Buildup of dirt, ice rock, debris, etc. on roadways and bridges not to accumulate greater than 24 inches wide or 0.50 inches deep	Inspection records showing compliance	100%
			ii) Clear and remove debris from traffic lanes, hard shoulders, verges and central reservations, footways and cycle ways						
			iii) Remove all sweepings without stockpiling in the right of way and dispose of at approved location.						
	15.2	Litter	i) Keep the right of way in a neat condition, remove litter regularly	N/A	28 days	N/A	No more than 20 pieces of litter per roadside mile shall be visible when traveling at highway speed.	Inspection records showing compliance	100%

Element Category		t Category		Response to Defects					
			Performance Requirement	Category 1		Cat. 2	Inspection and Measurement	Measurement Record*	Target
	Ref	Element		Hazard Mit.	Perm. Remedy	Perm. Repair	Method*	Measurement Necoru	Target
			ii) At a minimum pick up litter before mowing operations.						
16	5) EAS	ST END BRI	DGE SECURITY SYSTEM				·		
	16.1	Security System	Security system functions as intended by the ATVA.	1 hr	7 days	30 days	Automated logs	Inspection records showing compliance	100%
	16.2	Electrical Power	Normal electrical power supply system functions as intended by the ATVA.	1 hr	7 days	30 days	Automated logs	Inspection records showing compliance	100%
	16.3	Back-up Electrical Power	Back-up electrical power supply system functions as intended by the ATVA.	1 hr	7 days	30 days	Automated logs	Inspection records showing compliance	100%
	16.4	CCTV System	CCTV system functions as intended by the ATVA.	1 hr	7 days	30 days	Automated logs	Inspection records showing compliance	100%

Notes:

\* Items in these columns shall be reviewed annually by Developer as part of the MP to comply with Technical Provisions and/or Good Industry Practice.

"Hazard Mit." denotes Hazard Mitigation which is defined as an action taken to mitigate a danger to users.

"Perm. Remedy" denotes Permanent Remedy which is defined as an action taken to provide temporary remediation to eliminate a dangerous condition or level of service reduction until a permanent repair can be undertaken.

"Perm. Repair" denotes Permanent Repair which is defined as the action taken to restore the asset to full compliance with the Performance Requirements.

Pavement Smoothness for HMA and PCCP						
Design Speed (mph)	IRI (in./mile) (1 Mile Average)	IRI (in./mile) (300 ft Section)				
>55	120	160				
>45 ≤55	130	190				
>35 ≤45	140	190				
≤35	150	190				

# Table 22–2 IRI Requirements

# THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

BOOK 2 TECHNICAL PROVISIONS

ATTACHMENT 26-2 ADDITIONAL PROJECT STANDARDS (This page intentionally blank.)

#### SPECIAL NOTE FOR CONTRACT

Whenever the word "Contractor", as defined in 101.15 of the Standard Specifications, is used, it shall be interpreted to mean Developer.

#### OIL AND GAS WELL PLUGGING AND ABANDONMENT

The Standard Specifications are revised as follows:

SECTION 202, BEGIN LINE 30, INSERT AS FOLLOWS:

Cisterns, septic tanks, other tanks, basements, and cavities shall be backfilled in an approved manner. Those which cannot be backfilled satisfactorily shall be removed. If the backfill is within the limits of construction, it shall be completed in accordance with 203.23, unless otherwise directed. All abandoned wells shall be backfilled in accordance with the Indiana Code. All existing oil and gas wells shall be plugged and abandoned in accordance with the requirements of IC 14-37-8, 312 IAC 16-5-19 and all regulations set forth by the Indiana Department of Natural Resources Division of Oil and Gas. A copy of the driller's license shall be furnished to the Engineer prior to commencement of work.

# THE EAST END CROSSING

(LOUISVILLE-SOUTHERN INDIANA OHIO RIVER BRIDGES PROJECT)

PUBLIC-PRIVATE AGREEMENT

BOOK 2 TECHNICAL PROVISIONS

> ATTACHMENT 26-3 HIGHWAY LIGHTING

INDIANA FINANCE AUTHORITY THE EAST END CROSSING

INDIANA FINANCE AUTHORITY THE EAST END CROSSING (This page intentionally blank.)

# MODIFICATIONS TO THE INDOT DESIGN MANUAL, CHAPTER 78- HIGHWAY LIGHTING

For the East End Crossing the following changes shall be incorporated into the Indiana Design Manual:

#### 78-3.04 Luminaire

Developer may provide lighting based on technologies other than High Pressure Sodium. The Traffic Administration Manager, Technical Services Division may be contacted for additional information.

## 78-3.04(01) Light Source

- 3. Mercury Vapor (MV). New installations of Mercury Vapor lamps are prohibited by the Energy Policy Act of 2005.
- 5. Light Emitting Diode (LED). LEDs are arranged in clusters which are attached to a panel. Various designs utilize different LED types. Heat sinks are provided for heat dissipation to improve the luminaires service life. Light is directly emitted from the lens, so reflectors are not required, resulting in the light being delivered more efficiently than the HPS type and also resulting in less light pollution. LEDs are energy efficient, have a long life, and produce a "truer" color of light. Due to the manner in which light is emitted the arrays shall be carefully arrange to provide sufficient light distribution and yet be energy efficient.

LED retrofits are available for existing high mast luminaires. LED arrays are attached to a plate which is fit into the existing housing. Luminaire dimensions are needed for the design of the attachment. Properly arranged LED arrays can provide energy efficient, effective light distribution.

- 6. Plasma. Plasma lamps generate light by exciting gas with radio frequency power. They have no electrodes which reduces maintenance requirements. They are highly efficient and generate a truer color light than HPS.
- 7. Induction Lighting. Magnetic induction lamps also contain no electrodes resulting in an extended service life. The power used to generate light is transferred from outside the lamp to inside via electromagnetic fields. Induction lamps are also efficient light generators compared to HPS lamps.

## 78-5.0 DESIGN PROCEDURE

4. Select Equipment. In the preliminary design, Developer shall make initial assumptions regarding the equipment composition. This includes mounting height, pole setback distance, light source, mast-arm length, lamp wattage, etc. *Figure 78-5A, Lamp Data, provides information on lighting levels for various HPS, LPS, and Metal Halide lighting sources.* See Sections 78-3.0 and 78-6.03 for additional details on equipment selection. After selecting the luminaire equipment, the designer will also need to obtain the photometric data sheet from the manufacturer for the luminaire selected.

6. Luminaire Spacing. Developer shall use the illuminance methodology to determine the appropriate luminaire spacing. This step is conducted by the computer. For hand calculation, Equation 78-5.1 should be used. Sections 78-1.02 and 78-6.03 define the variables used in the equation.

Normally for tangent alignment where roadway width is constant, spacing will be uniform through the project limits. Where the East End Crossing ties into adjacent lighting systems consideration shall be given to matching the spacing.

8. Select Optimum Design. Developer shall try several alternatives even if *the first* design satisfies the criteria. There is often more than one satisfactory alternative. *Design Optimization should include an analysis for the purpose of minimizing service costs. The service cost is defined as:* 

Service Cost per Year = Annual Energy Cost + Annual Routine Luminaire Maintenance Costs + Estimated Cost of the Lighting System/Warranty Period

Where:

Annual Energy Costs are the total luminaire wattage of the system x hours per year operated x cost of electricity

Hours operated per year will be defined as 4380

Cost per KWhr can be estimated at \$0.08 (the electric provider or district may have a more location specific unit cost)

Maintenance Cost for HPS shall be based on re-lamping the entire system every 3 years. Currently lamp costs are estimated at \$30 per lamp- or \$10 per luminaire per year. Confer with manufacturer for routine maintenance costs of the alternative technology being considered.

Estimated Cost of the system shall include poles, foundations, wiring, conduit, handholes, service points as well as the luminaires. Recent bid history as obtained on INDOT website should be used. Cost of alternative technology luminaires should be obtained from the manufacturer

Warranty period will be a minimum of 5 years and as stipulated by the manufacturer.

9. Electric Design. Once the number, size, and location of the luminaires are determined, Developer shall determine the appropriate electric voltage drop for the system. Section 78-6.07 provides information on how to determine the voltage drop for the lighting system. *For alternatives to HPS luminaires, design current requirement (amperage) should be obtained from the manufacturer.* 

# 78-6.03(04) Light-Loss Factor (Maintenance Factor)

The efficiency of a luminaire is reduced over time. Developer shall estimate this reduction to properly estimate the light available at the end of the lamp-maintenance life. The maintenance factor *for HPS lighting* may range from 0.50 to 0.90, with the optimum range from 0.65 to 0.75. Figure 78-6A, INDOT Lighting Design Parameters, provides the factors used for designing a lighting system.

The maintenance factor is the product of the following.

1. Lamp Lumen Depreciation Factor (LLD). As the lamp progresses through its service life, the lumen output of the lamp decreases. The initial lamp lumen value is adjusted by means of a lumen depreciation factor to compensate for the anticipated lumen reduction. This ensures that a minimum level of illumination will be available at the end of the assumed lamp life, even though lamp lumen depreciation has occurred. This information should be provided by the manufacturer. For HPS a LLD factor of 0.90 should be used. For alternative technologies see manufacturer's recommendations to obtain the appropriate value.

# 78-6.07 Voltage Drop Determination

A highway-lighting distribution circuit consists of two 240-V circuits provided by a multiple conductor armored cable. Power supply to the lighting system is 240/480 V, single phase, 60-cycle alternating current. The lights are alternately connected to each side of the four-wire circuit. Ground rods are provided at each light standard. Voltage drop should not be over 10% to the last light in the circuit. Figure 78-6N provides the design amperages for typical HPS luminaires, *check with the manufacturer for alternative technologies*. Figure 78-6 O provides resistances for various wire types. Equation 78-6.1 should be used to determine the voltage drop between two adjacent luminaires.

(Equation 78-6.1)

Where:

E = voltage, or electric potential (volt) I = current (ampere/mile) R = resistance (ohm)

# UNIQUE SPECIAL PROVISION TO SECTION 807 - HIGHWAY ILLUMINATION

Beginning with line 526 the Standard Specifications are revised as follows:

### 807.13 Luminaire

Luminaire installation shall consist of the physical placing of the luminaire. Each installation shall include the furnishing and placing of the lamp *or Light Emitting Diode (LED) arrays* as designated. Luminaires shall be compatible with other lighting materials as specified in 920.01.

## (a) Roadway Luminaires

Each luminaire shall be leveled in both directions in the horizontal plane after the light standard has been erected and adjusted. Rotary adjustment of the mast arm and vertical adjustment of roadway luminaires to obtain an installed level position in both directions shall be accomplished by means of the bolted saddle arrangement used to attach the luminaires to the mast arm. Lamp socket positions may be shown on the plans by type of Illuminating Engineering Society of North American (IES) light pattern. The specified lamp socket position, *or comparable arrangement of LEDs*, shall be used to obtain the desired light pattern delivery. Proper connections shall be made to provide <del>ballast</del> operation at the voltage being supplied. Replacements needed because of faulty or incorrect voltage connections shall be made with no additional payment.

# (b) Sign Luminaires

Connections in which plain and galvanized steel are in contact shall be protected such that aluminum surfaces shall receive 1 coat of zinc chromate primer. Steel surfaces shall receive 1 coat of inorganic zinc primer followed by 1 coat of aluminum paint. All paint shall be permitted to dry before assembly. Conduit fittings, if required, shall be watertight. Required conduit shall be either rigid or flexible as necessary. Conduit shall not be clamped to a sign panel.

Sign luminaires shall be mounted on overhead sign structures on 2 metal channels located at the extremity of the sign walkway support brackets. The distance between lighting unit support channels shall be 7 in. (180 mm). These channels shall be located in such a manner that they readily receive the mounting bolts from the rear of the sign luminaire. The installation of the sign luminaire shall consist of the physical placement of the luminaire on the channels.

540

550

560 Sign luminaires shall be connected to a phase conductor and a neutral conductor. The luminaires shall be alternately connected to opposite phase conductors to balance the load. The connections in the base of the sign structure shall be in accordance with 807.06. Conductor splicing shall be in junction boxes, in-ground handholes, inside handholes of sign structures, and circuit breaker enclosures.

#### (c) Underpass Luminaires

Underpass luminaires shall be mounted on the vertical side surfaces of bridge bent structures or suspended by means of pendants supported by angle-iron struts or clips fastened to the structural beam members of the bridge. All parts of the pendent pipe assembly shall be hot-dipped galvanized after threads are cut. Silicone caulking compound shall be applied to the threads during assembly of the pendent. Underpass luminaires may require separately mounted ballasts which shall be installed in close proximity to the luminaires.

Underpass luminaires shall be connected to a phase conductor and a neutral conductor. The luminaires shall be alternately connected to opposite phase conductors to balance the load. Conductor splicing will only be allowed in junction boxes, in-ground handholes, and circuit breaker enclosures.

# 580 (d) High Mast Luminaires

The aiming of the luminaires shall be as shown on the plans. When the aiming process is being done the luminaire shall be oriented to conform to its raised position and the ring properly tethered to prevent rotation during the aiming adjustment. The long axis of the luminaire shall be parallel to the aiming direction indicated on the plans.

## (e) Performance Requirements

A manufacturer's warranty covering all components of the luminaire shall be provided stipulating that the manufacturer shall replace all failed luminaires due to any material defects with a luminaire that meets this specification.

590

570

As part of the final acceptance, the Department will field verify the light distribution pattern achieved meets the requirements given in the contract proposal. Luminaires not providing the required minimum lighting levels shall be modified or replaced with no additional payment. (This page intentionally blank.)

# UNIQUE SPECIAL PROVISION TO SECTION 920 – HIGHWAY ILLUMINATION MATERIALS

Beginning with line 510 the Standard Specifications are revised as follows:

# 510 (d) Luminaires

# 1. General Requirements

Lamps supplied for luminaires shall be electrically compatible with the luminaires. Luminaires shall include the lamp ballast *with the exceptions noted in 2b.* The ballast shall be integrally built in and of the constant wattage regulator type of sufficient size to operate the designated lamp at the required voltage. The ballast shall provide satisfactory lamp performance to  $20^{\circ}$ F (-7°C) with an input voltage variation of ± 10% of the rated operating voltage specified.

520 Luminaires shall include vandal shields when installed on an underpass or signs on bridge brackets and when otherwise specified. The vandal shield shall be made of a tough durable plastic, such as Lexan, mounted in a rugged galvanized steel or aluminum frame, and shall withstand severe impact without being damaged or allowing the refractor to be damaged. It shall be fastened securely to the luminaire so it cannot be removed from the outside and shall not interfere with the light distribution pattern. It shall protect the face of the refractor and if ventilation is necessary, the ventilating apertures shall be arranged so that they do not admit a probe of a diameter greater than 1/4 in. (6 mm).

#### 530

540

# 2. Roadway Lighting Luminaires

Roadway lighting luminaires shall have a precision-cast aluminum housing and refractor holder with weatherproof finish. They shall have a strong, easily operated, positive latch on the street side of the refractor holder and a hinge with a safety catch that prevents accidental unhinging on the house side of the refractor *or lens* holder. They shall include a slipfitter capable of adapting to a 2 in. (50 mm) mounting bracket; an easily detachable highly specular aluminum reflector; and an easily adjustable socket in both horizontal and vertical directions capable of producing lighting patterns to meet all the requirements of the American Standard Practice for Roadway Lighting as sponsored by the Illumination Engineering Society and as shown on the plans. They shall have a high impact, heat-resistant, glass, prismatic refractor; and *They shall* include gasketing that will completely seal out dust, moisture, and insects from the interior of the optical

assembly and retard the formation of an undesirable film from gaseous vapors on the interior of the optical assembly.

Luminaire weight shall not exceed 53 lbs and its projected area shall not exceed 2.4 sq ft. Luminaires shall be either High Pressure Sodium (HPS) or an alternative technology.

# a. High Pressure Sodium

HPS luminaires shall have a precision-cast aluminum refractor holder with weatherproof finish, an easily detachable highly specular aluminum reflector; and an easily adjustable socket in both horizontal and vertical directions capable of producing lighting patterns to meet all the requirements of the American Standard Practice for Roadway Lighting as sponsored by the Illumination Engineering Society and as shown on the plans.

# b. Alternative Technology

Luminaires that utilize technologies other than HPS shall be compatible with the lighting materials specified in this section. Luminaires, including surge protection devices (SPD) and other major components, shall be rated for a minimum operational life of 50,000 hours, shall operate in temperatures from -5°F to 115°F, and shall operate with an input voltage of  $\pm$  10% of the rated operating voltage supplied.

560

550

Drivers (power supply), LED arrays, and plasma emitters shall be replaceable without replacing the entire luminaire.

The SPD shall protect the luminaire from damage and failure for transient voltage and currents as defined in ANSI/IEEE, conform to UL 1449, or UL 1283 as appropriate for the components used in design, and be tested per the procedure in ANSI/IEEE definitions for standard and optional waveform for location category C-High.

570 Luminaires shall be adjustable in the horizontal and vertical directions to meet the specified Illumination Engineering Society light distribution pattern.

Refractors or lenses shall be made from high impact, heat-resistant, glass or UV inhibited high impact plastic.

A passive thermal management system to dissipate the heat generated by operation shall be provided- fans or other mechanical cooling systems shall not be used.

Plasma and LED luminaires shall exhibit a color temperature in the range of 3500K to 6500K. Ballast requirements as given in section 920.01(d)1 are not applicable to LED or plasma luminaires.

LEDs shall be connected so that the loss of one LED will not result in the loss of the entire luminaire. LED circuitry shall prevent flickering to the unaided eye at the voltage specified on the plans and the range indicated herein

## 3. Sign Luminaires

580

590

600

610

Luminaires shall be 250W mercury vapor unless otherwise specified. Sign luminaires shall have the same requirements as roadway luminaires plus a shield that blocks the view of the refractor from an approaching motorist. This shall be accomplished by the design of the housing or by a shield fabricated from sheet aluminum, approximately 0.05 in. (1.3 mm) thick, and of sufficient size to be fastened onto the horizontal edge of the refractor holder with self tapping screws and placed between the refractor and approaching traffic.

Aluminum and steel structural members for luminaire supports shall include aluminum conduit, conduit clamps, fittings, and stainless steel screws.

## 4. Underpass Luminaires

Underpass luminaires shall have the same requirements as roadway luminaires except they shall have vandal shields and the ballast shall meet the same requirements except it may be mounted separately near the luminaire as shown on the plans.

## 5. High Mast Luminaires

The luminaires shall be in accordance with the American Standard Practice for Roadway Lighting by the Illumination Engineering Society and shall produce lighting patterns as shown on the plans. The lamp in The high mast luminaire *lamps or light source* shall be supported at both ends with mechanical spring grips or other means to hold the lamp secure against vibration. The *Sockets* shall be mogul sized and porcelain enclosed. The luminaire housing shall be an enclosed aluminum unit with a reflector and-borsillicate glass refractor *or lens*. It shall include gasketing that will completely seal out dust, moisture, and insects from the interior of the optical assembly and retard the formation of an undesirable film from gaseous vapors on the optical assembly. *High pressure sodium luminaires shall have an aluminum reflector*. *High mast luminaires utilizing alternative technologies shall meet the requirements of 807.13(d)*.