



Pipeline Safety Division Investigation Report

Investigation regarding: **D. R. Watson Company**

UPPAC Database Record ID: 1268

Investigator: Rich Medcalf

Report Date: 5/29/2012

Damage Date: 9/24/2010 10:08:03 AM

Damage Address: 10511 Ballard Drive

City: Brownsburg

County: Hendricks

The Parties

Excavator: **D. R. Watson Company**

Contact: Andrew Gray

Address: 1966 Midwest Boulevard, Indianapolis, In 46214

Telephone: 317-271-1667

Facility Owner: Vectren

Contact: Darlene Kulhanek

Address: 1 N Main Street, Evansville, IN 47702

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Investigation regarding: D. R. Watson Company

UPPAC Database Record ID: 1268

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$239

Excavator Activities/Cause of damage information:

Excavator request locates: Yes Indiana 811 ticket Number: 1009220677

Type of Equipment: Probing Device

Type of work performed: Sewer (Sanitary/Storm)

Synopsis: Excavator damaged a 1” natural gas plastic service with probing rod during excavation to install sewer line.

Findings: Reported by Indiana 811; excavator’s response to initial notice was received on 2/18/2012. Excavator failed to expose gas service prior to excavation and did not maintain the required two (2) feet clearance, resulting in damage to the operator’s natural gas pipe.

Conclusion: Failure to maintain two (2) feet clearance with mechanized equipment.

Violation: IC 8-1-26-20(b) Failure to plan excavation to avoid damage or interference with underground facilities; Failure to maintain two (2) feet clearance with mechanized equipment.

D. R. Watson Company currently has 12 reports of damages in the record, between 8/27/2009 9:52:29 AM and 4/30/2012 12:33:15 PM.

NO

LOCATE

TICKET

PROVIDED



DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)
INDIANA UTILITY REGULATORY COMMISSION



Submitted to IURC-Pipeline Safety on: 02-24-2012

Who is submitting this information?

Name of person providing this information: Darlene Kulhanek

Business address (*number and street*): 1 Main Street

City, State, and ZIP code: Evansville, IN 47711

Telephone number (*area code*): 812-491-4227

Fax number (*area code*): 812-491-4504

E-mail address: dkulhanek@vectren.com

Excavator Information, if known

Full name: D R Watson Company

Business address (*number and street*): 1966 Midwest Blvd, Suite B

City, State, and ZIP code: Indianapolis, IN 46214

Telephone number (*area code*): 317-271-1667

Fax number (*area code*): 317-271-2799

E-mail address: Unknown

Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Probing Device

Type of work performed: Sewer (Sanitary/Storm)

Date and Location of Damage

Date of damage (*month, day, year*): 9-24-2010

County: Hendricks

City: Brownsburg

Street address (*number and street, city, state, and ZIP code*):
10523 Ballard Drive, Brownsburg, IN

Nearest intersection: Unknown

Right of way where damage occurred: Private - Land Owner

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? Yes

If yes, how many affected? 1

Time to restore service (*in hours*): 1

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$ 239.53

Affected Facility Information

What type of pipeline was damaged? Natural Gas

What was the affected facility? Service/Drop

What was the depth of the facility, in inches? _____

Notification, Locating, Marking

Did excavator request locates prior to commencing work? Yes

Enter Indiana 811 ticket number, if known: 1009220677

Was the locate request completed within two working days? Yes

If locates were performed, were they done so by a contractor or pipeline employee? Contract Locator

If a contractor locator, enter the company name, if known: USIC

Were facility marks visible in the area of excavation? Yes

Were facilities marked correctly? Yes

Type of markings used: Paint and Flags

If other, please specify: _____

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? Yes

Did the excavator notify Indiana 811 in the event of this damage? Yes

Did the excavator notify 911 in the event of a release of product? Unknown/Other

Description of Cause

Select from the list the most accurate cause for the damage: Other

Additional Comments

1" plastic service damaged by probe rod. Failure to maintain clearance. Appears 15' of the service lays directly on property line.

Service Order Status

Sunday, February 5, 2012

Enter Service Order Number:

4559370



Print Form

Print Labels

Banner Instance: CS03PROD CS01PROD CS02PROD
Order Number: N4559370 *** Needs Review ***
Order Type: LEAK
Order Status: Completed

Customer: 620791755 - KEEBLER BEN
Prem: 5820658 - 10523 BALLARD DR

Technician: 2256 - Godfrey, Gary

Order Dates and Times

Need Date: 9/24/2010 10:33:00 AM
Time Created: 9/24/2010 10:18:59 AM
Time Dispatched: 9/24/2010 10:18:59 AM
Time In Route: 9/24/2010 10:21:00 AM
Time On-Site: 9/24/2010 10:33:27 AM
Tech Complete: 9/24/2010 11:39:11 AM
Time Closed: 9/24/2010 11:39:11 AM

Events Performed/Completion Code

LKOT - CMP

Meter Information

Current Read Status

Old Meter: 1334 Inactive
New Meter:

Completion Notes

ADDITION IS "BRANCHES" MAP # 46-96 CREW IS ON SITE TO RE
 PAIR 1" PLASTIC SERVICE. TAGGED DOOR FOR RELIGHT. LEFT OK !
 "1334"

Request Notes

PER ANDREW GRAY/WITH DR WATSON CO PH 317 271 1667/HIT LINE/NOT SURE IF BLOWING ON SITE CONT CHAD BARK
 ER 317 557 4122/NOT ENTERING BUILDINGS/LOCS FOR 10511 BALLARD/CUST STATES DIGGING AT THIS ADDRESS/GAV
 E PRECAUTIONS

MDSI Event Dates and Times

Event	Date/Time	User
AsnAssignmentManualAck_evt	9/24/2010 10:19:30 AM	Godfrey, Gary
AsnAssignmentEnRoute_evt	9/24/2010 10:21:00 AM	Godfrey, Gary
AsnAssignmentOnSite_evt	9/24/2010 10:33:27 AM	Godfrey, Gary
OrdOrderComplete_evt	9/24/2010 11:39:11 AM	Godfrey, Gary

NOTE: The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.

Ticket Text

From: vwi.locate_d@veoliawaterna.com
Sent: Wednesday, September 22, 2010 9:54 AM
To: onecall7+indy-veolia@smptickets.com
Subject: SM&P WORKORDER

ID1500 00082 IUPPSa 09/22/2010 09:25:40 1009220677-00A NORM NEW GRID

NORMAL NOTICE

Ticket : 1009220677 Date: 09/22/2010 Time: 09:20 Oper: ANDREW.GRAY Chan:000

State: IN Cnty: HENDRICKS Twp: BROWN
Cityname: BROWNSBURG Inside: Y Near: N
Subdivision: THE BRANCHES Lot: 292

Address : 10511
Street : BALLARD DRIVE
Cross 1 : CO RT 650 Within 1/4 mile: Y
Location: ENTIRE FRONT AND BOTH SIDES OF PROPERTY ALONG WITH BOTH SIDES OF BALLARD
DRIVE ***Boring Where = BALLARD DRIVE
:

Grids : 3951B8620B 3951A8620B 3951B8620A 3951A8620A
Boundary: n 39.863224 s 39.859039 w -86.348923 e -86.341743

Work type : INSTALLING WATER AND SEWER
Done for : RYAN HOMES
Start date: 09/24/2010 Time: 09:45 Hours notice: 48/48 Priority: NORM
Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N
Duration : 3 DAYS Depth: 6 FEET

Company : DR WATSON COMPANY Type: CONT
Co addr : 1966 MIDWEST BOULEVARD
Co addr2: SUITE B
City : INDIANAPOLIS State: IN Zip: 46214
Caller : ANDREW GRAY Phone: (317)271-1667
Contact : ANDREW GRAY OFFICE Phone:
BestTime:
Mobile : (317)271-1667
Fax : (317)271-2799
Email : SALES@DRWATSONCO.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time Will you be white-lining the
dig site area? NO
:

Submitted date: 09/22/2010 Time: 09:20
Members: CV ID1451 ID1500 ID3463 ID4471 ID5555 ID9999 SBCIN SM

FACILITIES DAMAGE REPORT GAS

Vectren Corporation

Form 3112 (Rev. 10/04)

Indiana Gas

Sigeco

Vectren Energy Delivery of Ohio

Task No.: 103.0510

Capital / O&M (circle one)

FDS 0013282

TIME: 10:19 AM PM

DATE OF DAMAGE: 9,24,10

Cost Center No.: 5953

DAMAGE SITE ADDRESS: 10523 BALLARD DRIVE

LOT #: _____ CITY: BROWNSBURG INDIANA

FACILITIES DAMAGED

- MAIN
- SERVICE
- REGULATOR STATION
- FARM TAP
- RESIDENTIAL METER
- METER INDUSTRIAL/COMMERICAL
- OTHER

- SIZE(S)
- 0.50 INCH
 - 0.75 INCH
 - 1.00 INCH
 - 2.00 INCH
 - 4.00 INCH
 - 6.00 INCH
 - OTHER

TYPE OF MATERIAL

- PLASTIC
- STEEL
- CAST IRON
- OTHER

DAMAGE TYPE

- SEVERED
- NOT CUT
- PUNCTURE
- SIZE 1/2 X 1/2

PRESSURE

- 25 PSIG
- 40 PSIG
- 50 PSIG
- 60 PSIG
- 6 WC
- OTHER

PROTECTION IN PLACE

- RAIL
- POST
- NONE
- N/A

LEAK REPORT

616,555

DURATION OF ESCAPING GAS

MINUTES: _____ EFV ACTIVATED YES NO

DAMAGED BY

- CONTRACTOR
- MUNICIPALITY/UTILITY
- VEHICULAR ACCIDENT
- COMPANY CREW
- UNKNOWN
- PROPERTY OWNER/TENANT
- OTHER

TYPE OF CONSTRUCTION

- SEWER/DRAIN
- WATER
- ELECTRIC
- TELEPHONE
- CEMENT/PAVING
- TV CABLE
- FENCING
- FOOTERS
- OTHER

WORKING FOR

- CITY
- STATE
- PROPERTY OWNER
- OTHER

TYPE OF EQUIPMENT

- BACKHOE
- TRACKHOE
- PLOW
- TRENCHER
- BULLDOZER
- POSTHOLE DIGGERS
- BORE
- AUGER
- STAKE/SHOVEL
- OTHER PROBE ROD

DAMAGING PARTY

- DID NOT REQUEST LOCATES
- DID NOT HAND DIG
- USED EXPIRED LOCATES
- OTHER prob rod

NUMBER OF CUSTOMERS AFFECTED: 1

TOTAL HOURS SERVICE WAS OFF: 1-Hour

INVOICE: YES NO

DAMAGING PARTY

NAME: DR WATSON

ADDRESS: 1966 MIDWEST BLVD. SUITE "B"

CITY/STATE/ZIP: INDIANAPOLIS IN. 46214

PREPARED BY: GARY M GODFREY DATE: 9/24/10

VISUAL OBSERVATION AT DAMAGE SITE

- LOCATE NOT APPLICABLE (Above Ground Damage Only)
- FACILITIES PROPERLY MARKED
- MARKING METHODS: CONVENTIONAL OFFSET
- FLAGS PAINT STAKES WHISKERS
- LOCATE MARKINGS FADED: YES NO
- WRONG ADDRESS REQUESTED
- FACILITIES IMPROPERLY LOCATED
- QUALIFIED LOCATOR COULD NOT HAVE ACCURATELY LOCATED
- INACCURATE MAPS/CARDS
- BROKEN OR NO TRACER WIRE (PLASTIC)
- INSULATION PREVENTING ACCURATE LOCATE
- LOCATOR ERROR
- QUALIFIED LOCATOR COULD HAVE ACCURATELY LOCATED
- INCOMPLETE LOCATE
- MARKINGS OFF BY _____ (FEET/INCHES)
- INAPPROPRIATE SITE MARKINGS
- NO LOCATE PERFORMED
- FAILURE TO FOLLOW POLICY
- WRONG ADDRESS LOCATED

OBSERVATION BY: G. Godfrey

NAME OF LOCATOR: _____

- COPY OF MARKOUT REQUEST PROVIDED WITHIN 2 WORKING DAYS

NOTIFICATION AND OTHER DETAILS OF LOCATE

- LOCATE TICKET #: 1009241060
- DATE: 9/24/10 TIME: 10:19 AM PM
- REGULAR REQUEST EMERGENCY REQUEST
- LOCATE COMPANY NOTIFIED

CONTACT NAME: _____

TIME CALLED: _____ AM/PM

TIME LOCATOR ARRIVED AT SITE: 10:56 AM PM

COMPANY NOTIFIED OF LOCATE NEAR CRITICAL FACILITIES: YES NO

CONTRACTOR REPAIRS

- CONTRACTOR WORKING FOR VECTREN MADE REPAIRS AT OWN EXPENSE
- CONTRACTOR REPAIRED DAMAGE

NAME OF CONTRACTOR: _____

OF REGULAR HOURS: _____

OF OVERTIME HOURS: _____

CREW TYPE: _____

MATERIALS OR ROAD WORK

- METER WAS REPLACED _____ (STORES CODE)
- REGULATOR WAS REPLACED _____ (STORES CODE)
- TEMPORARY ASPHALT REPAIR _____ (SQ. FT.)
- PERMANENT ASPHALT REPAIR _____ (SQ. FT.)

PARTY TO INVOICE

NAME: _____

ADDRESS: SAME

CITY/STATE/ZIP: _____

REVIEWED BY FIELD SUPERVISOR: S Alexander DATE: 10-18-10

INCLUDE ANY OBSERVATIONS ON BACK OF FORM

4 Days BY

OCT 20 2010

9/24
10/21
EM
Slows
x led
P/L

Ticket Portal Production

Ticket Text Photos

Ticket Text

From: att-tickets@tickets.translore.com
 Sent: Friday, September 24, 2010 10:11 AM
 To: onecall7+in-att@smptickets.com
 Subject: ATT Translore - 1009240867

ATTIN Seq: 467 Transmitted: Fri Sep 24 09:11:15 CDT 2010

SBCIN 00466 IUPPSa 09/24/2010 10:08:04 1009240867-00A EMER DAMG GRID

DAMAGE SEE REMARKS

Ticket : 1009240867 Date: 09/24/2010 Time: 10:06 Oper: KFIFE Chan:017

State: IN Cnty: HENDRICKS Twp: BROWN
 Cityname: BROWNSBURG Inside: Y Near: N
 Subdivision: THE BRANCHES Lot: 292

Address : 10511
 Street : BALLARD DRIVE
 Cross 1 : CO RT 650 Within 1/4 mile: Y
 Location: ENTIRE FRONT AND BOTH SIDES OF PROPERTY ALONG WITH BOTH SIDES OF BALLARD DRIVE ***Boring Where = BALLARD DRIVE

Grids : 3951B8620B 3951A8620B 3951B8620A 3951A8620A
 Boundary: n 39.863224 s 39.859039 w -86.348923 e -86.341743

Work type : INSTALLING WATER AND SEWER
 Done for : RYAN HOMES
 Start date: 09/24/2010 Time: 10:06 Hours notice: 0/0 Priority: EMER
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: Y
 Duration : 3 DAYS Depth: 6 FEET

Company : DR WATSON COMPANY Type: CONT
 Co addr : 1966 MIDWEST BOULEVARD
 City : INDIANAPOLIS State: IN Zip: 46214
 Caller : ANDREW GRAY Phone: (317)271-1667
 Contact : ANDREW GRAY OFFICE Phone:
 BestTime:
 Mobile : (317)271-1667
 Fax : (317)271-2799
 Email : SALES@DRWATSONCO.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time PER ANDREW: A VECTREN GAS LINE WAS HIT ON THE SIDE OF THE PROPERTY - GAS IS NOT BLOWING - CREW IS ON SITE - CALLER WILL CALL VECTREN TO REPORT THE DAMAGED LINE

- PREVIOUS TICKET NUMBER 1009220677 - THANKS!

Will you be white-lining the dig site area? NO

Submitted date: 09/24/2010 Time: 10:06
 Members: CV ID1451 ID1500 ID3463 ID4471 ID5555 ID9999 SBCIN SM











1966 MIDWEST BLVD. SUITE B, INDIANAPOLIS, IN 46214
(317) 271-1667 FAX: (317) 271-2799

Utility Regulatory Commission

Case # 1268

In response to pipeline safety division cases I have received, we have filled out the Information request as completely as we could. I would like to state that we do call in all job locations with the proper notice as required.

We do lots in residential subdivisions so all locations are called in with addresses and lot numbers. We also describe the area to be located when calling these addresses in. Normally this is front and both sides of the property and if boring both sides of the street. Where exactly we are digging depends on a lot of different factors that we determine after we start digging. We do not white line for this reason.

We completed 990 homes in 2009, 1231 homes in 2010 and 1171 homes in 2012.

I only mention amount of homes we do to emphasize the amount of crossings we do in a year but I do understand the seriousness of these cuts and I am determined to eliminate as many if not all of these cuts if possible.

With that being said I held a meeting with all operators, helpers and my field supervisor. I have attached the topics discussed in this meeting with the information you requested.

Sincerely,

Chuck Watson

D.R. Watson Co., Inc

Information Request

Pipeline Safety Division Indiana Utility Regulatory Commission

Case No. 1268

The Pipeline Safety Division of the Indiana Utility Regulatory Commission requests any and all information you can provide regarding the following criteria:

The Parties:

Excavator Information:

Business Name: D.R. WATSON CO., INC.

Responsible Party Personal Name: CHUCK WATSON

Title (if any): V.P.

Address: 1966 M. O. WEST BLVD

City, State Zip: INDPLS IN

Preferred Telephone: 317-271-1667

Cell Phone Number: 317-557-5534

Email Address: CHUCK@DRWATSONCO.COM

Facility Information:

Business Name: VECTREN ENERGY

Responsible Party Personal Name:

Title (if any):

Address: 1239 RELIABLE PARKWAY

City, State, Zip: CHICAGO IL 60686

Preferred Telephone: 1-877-902-2934

Cell Phone Number:

Email Address:

Locator Service Information:

Business Name: USIC

Responsible Party Personal Name: BLAIR WAITERS

Title (if any): DISTRICT MANAGERS

Address: 13085 HAMILTON CROSSING BLVD

City, State Zip: CARMEL, IN.

Preferred Telephone: 317-513-3923 / 1812-459-2358

Cell Phone Number:

Email Address:

Other (Witness, Police, Fire, Other) Information:

Personal Contact: CHAD BARKER

Business/Organization Name:

Title (if any) OPERATOR

Address:

City, State, Zip:

Preferred Telephone:

Cell Phone Number: 317-557-5534

Email Address:

Utility Line Impact:

Location of Damage:

Address: 10511 BALLARD DRIVE

City, State Zip: Brownsburg IN

Nearest Intersection: 650 N. AND Raceway Road

Product Type (circle one):

Natural Gas

Liquid Pipeline

Unknown/Other

Facility Type (circle one):

Distribution

Gathering

Service/Drop

Transmission

Unknown/Other

Size (Diameter/etc.): 1" ?

Pressure (PSIG/Inches): _____

Interruption in Service: Yes / No

Number of Customers Affected: 1

Evacuation: Yes / No If yes, How Many Evacuated? 0

Repair Cost (if known): \$ 0 =

Cause of Damage Information:

Type of Equipment (circle one):

Auger
Backhoe/Trackhoe
Boring /Drilling
Directional Drilling
Explosives
Farm Equipment
Grader/Scraper
Hand Tools
Milling Equipment
Probing Device
Trencher
Vacuum Equipment
Unknown/Other

Type of Work Performed (circle one):

Agriculture
Cable TV
Curb/Sidewalk
Bldg. Construction
Bldg. Demolition
Drainage
Driveway
Electric
Engineering/Surveying
Fencing
Grading
Irrigation
Landscaping
Liquid Pipeline
Milling
Natural Gas
Pole
Public Transit Authority
Railroad Maintenance
Road Work
Sewer (Sanitary/Storm)
Site Development
Steam
Storm Drain/Culvert
Street Light
Telecommunications
Traffic Signal
Traffic Sign
Water
Waterway Improvement
Unknown/Other

Release of Product: Yes / No

Ignition and/or Fire: Yes No

Excavator Notify 811: Yes No

Locate Information:

Excavator Request Locate: Yes / No

Indiana 811 Locate Ticket Number: 1009220677

Locate Marks Visible: Yes / No

Locate Marks Correct: Yes / No

Excavator "White Lined": Yes No

Maps Used to Mark Facilities: Yes / No UNKNOWN

Was Locate Provided within Two (2) Working Days: Yes / No

Operator Employees On-site during Excavation: Yes / No

Incident Impact Information:

Number of Outpatient Treated: 0

Number of Inpatient Treated: 0

Number of Fatalities: 0

Fire Department Response: Yes / No

Police Department Response: Yes / No

Ambulance Response: Yes / No

Additional Information/Comments:

probed through gas service trying to locate.

YOUR PIPELINE SAFETY DIVISION CASE NO. 1268

YOUR FULL NAME: Chuck Watson

FULL NAME OF BUSINESS/ENTITY (if applicable): D.R. WATSON CO. INC.

YOUR BUSINESS TITLE (if applicable): VP

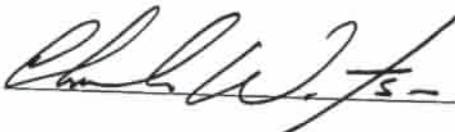
ADDRESS: 1966 MIDWEST BLVD

CITY: INDIANAPOLIS STATE: IN ZIP CODE: 46214

YOUR TELEPHONE NUMBER: (317) 271-1667 SECOND NO. (317) 557-5534

YOUR EMAIL ADDRESS: chuck@drwatsonco.com

TODAY'S DATE: 2-18-12

YOUR SIGNATURE:  TITLE (if any) V.P.

Please return your Narrative Statement and Answers to the above questions to:

**Pipeline Safety Division – Case No. 1268
Indiana Utility Regulatory Commission
101 West Washington Street, # 1500E
Indianapolis, IN 46204**

Or scan document(s) and Email to:

PipelineDamageCase@urc.in.gov

- 8/27/09 gas service our fault**
- 10/13/09 gas main our fault**
- 3/26/10 gas service our fault**
- 4/9/10 gas main our fault**
- 9/24/10 gas service our fault**
- 8/20/10 gas main not our fault**
- 8/28/11 gas service not our fault**
- 8/30/11 gas service not our fault**
- 9/6/11 gas main our fault**

That's four mains and 5 service lines

With a total paid out so far of \$ 9247.00

All of the above cuts have been and all future cuts will be turned in the Utility Regulatory Commission for review.

We could get fined up to \$10,000.00 per cut!

We have been fortunate not to have someone hurt or killed by these cuts.

Check lots first before digging. Look at locates if not located check date to be located on job card. If you see something that is not located call office and we will call it back in.

Check for possible gas power services that may have been added since the locator marked the lot.

We must hand dig and expose all services and mains before for digging around them with backhoes.

Stop well short of any locates and hand dig to expose before you are close to locates.

There is no reason to take a chance and dig right up to the two or three foot allowance on marks, Stop short and hand dig first.

Don't feel with probing rod and trust this. You must expose by hand digging before digging with backhoe.

Never use pipe pusher or directional bore without exposing lines.

If locates are off and you know it's there it's not ok to go ahead and take a chance or cut it. This is still a safety issue even if we don't have to pay.

Although the topic today is gas line safety these steps should be taken on all utilities.

Not only will we reduce the danger of these cuts we will can save thousands of dollars a year in cost.

Any questions or suggestions.

In attendance at today's meeting:

Chuck Watson

Chad Barker

Tim Deal

Josh Vernon

Jeff Chapman

Ben Brown

Mark Fry

Wes Vernon

Danny Patterson

Steve Brown

I have attended this meeting and understand the importance of hand digging first not only for our safety but for safety of those in the communities we work.

Sign here _____

Print Name _____

2/13/12