



Pipeline Safety Division Investigation Report

Investigation regarding: Sunesis Construction

UPPAC Database Record ID: 1273

Investigator: Howard Friend

Telephone: 317-232-2717

Report Date: 01/05/2012

Damage Date: 10/18/2010

Damage Address: 1230 N Main St

City: Rushville

County: Rush

The Parties

Excavator: **Sunesis Construction**

Contact: John D Wilson, General Counsel

Address: 2610 Crescentville Road, West Chester, Oh 45069

Telephone: (513) 326-6000

Facility Owner: Vectren

Contact: Darlene Kulhanek

Address: 1 N Main Street, Evansville, IN 47702

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Investigation regarding: Sunesis Construction

UPPAC Database Record ID: 1273

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$750

Excavator Activities/Cause of damage information:

Excavator request locates: No Indiana 811 ticket Number:

Type of Equipment: Unknown/Other

Type of work performed: Grading

Synopsis: A 1” natural gas service was damaged during grading work by a skid steer.

Findings: Reported by Indiana 811; excavator response received 11/01/2011. Excavator was working on an invalid locate request, the previous request having expired nine days earlier. Excavator submits that they have taken steps to reinforce the company’s damage prevention activities and provided remedial training to all appropriate employees.

Conclusion: By working off of an expired locate request, excavator failed to provide notice of excavation.

Violation: IC 8-1-26-16(g): Failure to provide notice of excavation.

Sunesis Construction currently has 5 reports of damages in the record between 04/22/2010 and 10/29/2011.


NO

LOCATE

TICKET

PROVIDED

STATE OF INDIANA

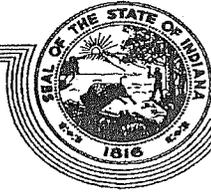

INDIANA UTILITY REGULATORY COMMISSION
101 W. WASHINGTON STREET, SUITE 1500E
INDIANAPOLIS, INDIANA 46204-3407

<http://www.in.gov/iurc>
Office: (317) 232-2701
Facsimile: (317) 232-6758

September 20, 2011

Ms. Darlene Kulhanek
Vectren
1 N Main Street
Evansville, IN 47702

Subject: Investigation Request for Information

Date of Event: 10/18/2010

Event Location: 1230 N Main St., Rushville

Facility Owner: Vectren

Excavator: Sunesis Construction

Other Party: N/A

Pipeline Division Case No. 1273

Dear Ms. Kulhanek:

Pursuant to Indiana Code 8-1-26, the *Indiana Damage to Underground Facilities Act*, the Pipeline Safety Division of the Indiana Utility Regulatory Commission ("Pipeline Division") is required to investigate reported incidents of alleged statutory violations involving underground pipeline safety. The purpose of this statute is to promote excavation and pipeline safety and to reduce the imminent danger to life, health, property, or loss of service associated with unsafe digging practices. Please note that the investigation does not entail determining criminal liability or a civil determination of fault or damages; however, it does determine whether any statutory violations were committed regarding public safety.

The Pipeline Division received information regarding potential statutory violations regarding the date and location referenced above. You were identified as a person or entity that might have information that would assist the Pipeline Division in its investigation. Therefore, we have contacted you in order to receive the full account of information in order to make a fair determination related to the circumstances of this incident.

We have asked all involved parties, entities and witnesses to provide *written* information within *30 days* in order to meet legal deadlines to conclude our investigation. **Please consider this letter as a formal request to receive any and all information and evidence (including a narrative, documentation,**

RECEIVED

SEP 23 2011

INDIANA UTILITY
REGULATORY COMMISSION

maps, photographs or any other written information) you can access regarding anything you may know about the incident referenced above.

Please promptly provide your information to: Pipeline Safety Division – Case No. 1273, Indiana Utility Regulatory Commission, 101 West Washington Street, # 1500E, Indianapolis, IN 46204. Also, please include the Investigation Number referenced above on your materials. In the alternative, if you would prefer to scan the materials and send them electronically, please send the documents to: *PipelineDamageCase@urc.in.gov*.

Although you are not a formal party in this investigation, please treat this request for information seriously, because the potential civil penalties for violations include: a potential civil fine up to \$10,000.00; mandatory education and training for employees regarding pipeline safety; a required development plan to avoid future violations; or a warning letter for certain homeowner/tenants who are first time offenders. Consequently, your input will assist the Pipeline Division with its determination and may have a substantial impact on the case.

After the investigation is completed, the Pipeline Division will prepare an Investigation Report with findings and forward it to the Underground Plant Protection Advisory Committee (“Advisory Committee”). This is a statutory committee, comprised of excavators, facility operators, investor and municipal utilities, the 811 Association and facility locate marking companies, whose role is to evaluate the Pipeline Division’s findings and make a recommendation for a civil penalty. In the event there is disagreement regarding the Advisory Committee’s recommendation to the Commission, parties are entitled to request a hearing before the full Commission. If there is a violation, the Indiana Utility Regulatory Commission (“Commission”) will impose the penalty. Any fines imposed are statutorily required to be spent funding the Commission’s training and educational programming to promote excavation and pipeline safety.

Thank you for your *prompt* assistance in providing written information to the Pipeline Division regarding the previously referenced incident. Any information received after the deadlines will not be considered in the investigation, will be unavailable to the Advisory Committee and will result in a lack of full information being made available; hence, your participation is vital to serving the interests of justice and enhancing the public’s safety. In an effort to assist you, please find an enclosure entitled “Information Request.” Should you have procedural or legal questions regarding the Underground Plant Protection Advisory Committee or the Indiana Utility Regulatory Commission, please contact David L. Welch, Assistant General Counsel, at (317) 234-4715. Should you have questions regarding the pipeline damage identified above, or our investigation, please contact me at (317) 232-2718. Thank you for your assistance.

Sincerely,



William Boyd
Director, Pipeline Safety Division

Enclosure: Information Request

Information Request

Pipeline Safety Division
Indiana Utility Regulatory Commission

The Pipeline Safety Division of the Indiana Utility Regulatory Commission requests any and all information you can provide regarding the following criteria:

The Parties:

Excavator Information:

Business Name: **Sunesis Construction**

Responsible Party Personal Name: **Darrell James**

Title (if any): **Unknown**

Address: **2610 Crescentville Rd.**

City, State Zip: **West Chester, OH 45069**

Preferred Telephone: 765-716-9942

Cell Phone Number:

Email Address:

Facility Information:

Business Name: **Vectren Energy**

Responsible Party Personal Name: **Darlene Kulhanek**

Title (if any): **Manager Facilities Damages**

City, State, Zip **Evansville, IN 47711**

Address: **1 Main Street**

Preferred Telephone: **812-491-4227**

Cell Phone Number: **812-568-5235**

Email Address: **Dkulhanek@vectren.com**

Locator Service Information:

Business Name: **USIC Inc.**

Responsible Party Personal Name: **Tim Sanders**

Title (if any): **Southern Indiana District Manager**

Address: **3818 E Morgan Avenue**

City, State Zip: **Evansville, IN 47715**

Preferred Telephone: **812-479-9236**

Cell Phone Number:

Email Address: **timsanders@usicinc.com**

Other (Witness, Police, Fire, Othea-) Information: N/A

Personal Contact: Business/Organization Name: N/A

Title (if any)

Address:

City, State, Zip

Preferred Telephone:

Cell Phone Number:

Email Address:

Utility Line Impact:

Product Type (circle one):

Natural Gas

Liquid Pipeline

Unknown/Other

Facility Type (circle one):

Distribution

Gathering

Service/Drop

Transmission

Unknown/Other

Size (Diameter/etc.): 1"

Pressure (PSIG/Inches): 60 psig

Interruption in Service: Yes / No

Number of Customers Affected: 1

Evacuation: Yes / No If yes, How Many Evacuated? 0

Repair Cost (if known): \$ 749.66

Cause of Damage Information:

Type of Equipment (circle one):

Auger

Backhoe / Trackhoe

Boring / Drilling

Directional Drilling

Explosives

Farm Equipment

Grader/Scraper

Hand Tools

Milling Equipment

Probing Device

Trencher

Vacuum Equipment

Unknown/Other

Type of Work Performed (circle one):

- Agriculture Cable
- TV Curb/Sidewalk
- Bldg. Construction
- Bldg. Demolition
- Drainage
- Driveway Electric
- Engineering/Surveying
- Fencing
- Grading
- Irrigation
- Landscaping
- Liquid Pipeline
- Milling
- Natural Gas
- Pole
- Public Transit Authority
- Railroad Maintenance
- Road Work
- Sewer (Sanitary/Stoml)
- Site Development
- Steam
- Storm Drain/Culvert
- Street Light
- Telecommunications
- Traffic Signal
- Traffic Sign
- Water
- Waterway Improvement
- Unknown/Other

Release of Product: Yes / No

Ignition and/or Fire: Yes / No

Excavator Notify 811: Yes / No ?

Locate Information:

Excavator Request Locate: Yes / No


Indiana 811 Locate Ticket Number: 0

Locate Marks Visible: Yes / No

Locate Marks Correct: Yes / No

Excavator "White Lined": Yes / No

Maps Used to Mark Facilities: Yes / No

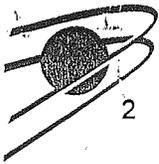

2 VECTREN ENERGY DELIVERY OF INDIANA - NORTH


PAID

NOW DUE
\$749.66

SUNESIS CONSTRUCTION
2610 CRESENTVILLE RD
WEST CHESTER, OH 45069

Type: GAS
Invoice: FDS0013451
BillToID: 29423
Billing Date: 11/24/2010
Date of Loss: 10/18/2010
5753 103.0510

Please return this portion with your remittance.

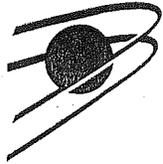

Mail Payment To: VECTREN ENERGY DELIVERY OF INDIANA - NORTH
Vectren Utilities Holding Group, Inc.
1239 Reliable Parkway
Chicago, IL 60686-0012
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5
Risk Management/Claims Department

NOW DUE
\$749.66

SUNESIS CONSTRUCTION
2610 CRESENTVILLE RD
WEST CHESTER, OH 45069

Type: GAS
Invoice: FDS0013451
BillToID: 29423
Billing Date: 11/24/2010
Date of Loss: 10/18/2010

Invoice For Costs to Repair and Reconstruct Damaged Property

Address: 1230 N MAIN STREET, RUSHVILLE

1" PLASTIC SERVICE SEVERED BY BACKHOE. NO VALID LOCATE AND NOT HAND EXPOSED.

Material:	\$38.56
Company Labor:	\$511.48
Contract Labor:	\$0.00
Transportation/Equipment:	\$175.56
Misc:	\$0.00
Gas Loss:	\$24.06
Adjustments:	\$0.00
Payments:	\$0.00
Total:	\$749.66

5753 103.0510

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

FACILITIES DAMAGE REPORT GAS

Vectren Corporation
Form 3112 (Rev. 10/04)

- Indiana Gas
- Sigeco
- Vectren Energy Delivery of Ohio

Task No.: 103,0510

Capital / O&M (circle one)

FDS0013451

TIME: 3:33 AM/PM

DATE OF DAMAGE: 10/18/10

Cost Center No.: 5153

DAMAGE SITE ADDRESS: 1230 N. MAIN

LOT #: _____ CITY: Rushville

FACILITIES DAMAGED	SIZE(S)
<input type="checkbox"/> MAIN	<input type="checkbox"/> 0.50 INCH
<input checked="" type="checkbox"/> SERVICE	<input type="checkbox"/> 0.75 INCH
<input type="checkbox"/> REGULATOR STATION	<input checked="" type="checkbox"/> 1.00 INCH
<input type="checkbox"/> FARM TAP	<input type="checkbox"/> 2.00 INCH
<input type="checkbox"/> RESIDENTIAL METER	<input type="checkbox"/> 4.00 INCH
<input type="checkbox"/> METER INDUSTRIAL/COMMERICAL	<input type="checkbox"/> 6.00 INCH
<input type="checkbox"/> OTHER	<input type="checkbox"/> OTHER

0.927

TYPE OF MATERIAL	DAMAGE TYPE	PRESSURE
<input checked="" type="checkbox"/> PLASTIC	<input checked="" type="checkbox"/> SEVERED	<input type="checkbox"/> 25 PSIG
<input type="checkbox"/> STEEL	<input type="checkbox"/> NOT CUT	<input type="checkbox"/> 40 PSIG
<input type="checkbox"/> CAST IRON	<input type="checkbox"/> PUNCTURE	<input type="checkbox"/> 50 PSIG
<input type="checkbox"/> OTHER	SIZE <u>1" X 1"</u>	<input checked="" type="checkbox"/> 60 PSIG
		<input type="checkbox"/> 6 WC
		<input type="checkbox"/> OTHER

PROTECTION IN PLACE

RAIL POST NONE N/A 24,887

LEAK REPORT

551361 DURATION OF ESCAPING GAS
MINUTES 5
 ONE-WAY FEED EFV ACTIVATED YES NO
 TWO-WAY FEED

DAMAGED BY

- | DAMAGED BY | TYPE OF CONSTRUCTION |
|--|--|
| <input checked="" type="checkbox"/> CONTRACTOR | <input type="checkbox"/> SEWER/DRAIN |
| <input type="checkbox"/> MUNICIPALITY/UTILITY | <input type="checkbox"/> WATER |
| <input type="checkbox"/> VEHICULAR ACCIDENT | <input type="checkbox"/> ELECTRIC |
| <input type="checkbox"/> COMPANY CREW | <input type="checkbox"/> TELEPHONE |
| <input type="checkbox"/> UNKNOWN | <input type="checkbox"/> CEMENT/PAVING |
| <input type="checkbox"/> PROPERTY OWNER/TENANT | <input type="checkbox"/> TV CABLE |
| <input type="checkbox"/> OTHER | <input type="checkbox"/> FENCING |
| | <input type="checkbox"/> FOOTERS |

WORKING FOR

CITY STATE PROPERTY OWNER OTHER STREET REPLACEMENT
State of Ind.
NAME SUNESIS CONSTRUCTION

TYPE OF EQUIPMENT

- | TYPE OF EQUIPMENT | DAMAGING PARTY |
|---|--|
| <input checked="" type="checkbox"/> BACKHOE | <input type="checkbox"/> DID NOT REQUEST LOCATES |
| <input type="checkbox"/> TRACKHOE | <input type="checkbox"/> DID NOT HAND DIG |
| <input type="checkbox"/> PLOW | <input checked="" type="checkbox"/> USED EXPIRED LOCATES |
| <input type="checkbox"/> TRENCHER | <input type="checkbox"/> OTHER |
| <input type="checkbox"/> BULLDOZER | |
| <input type="checkbox"/> POSTHOLE DIGGERS | NUMBER OF CUSTOMERS AFFECTED: <u>1</u> |
| <input type="checkbox"/> BORE | |
| <input type="checkbox"/> AUGER | TOTAL HOURS SERVICE WAS OFF: <u>2</u> |
| <input type="checkbox"/> STAKE/SHOVEL | |
| <input type="checkbox"/> OTHER | |

INVOICE: YES NO

DAMAGING PARTY

NAME: SUNESIS CONSTRUCTION
ADDRESS: 2610 Cresentville Rd.
CITY/STATE/ZIP: Westchester, OHIO, 45069

PREPARED BY: [Signature] DATE: _____

VISUAL OBSERVATION AT DAMAGE SITE

- LOCATE NOT APPLICABLE (Above Ground Damage Only)
- FACILITIES PROPERLY MARKED
- MARKING METHODS: CONVENTIONAL OFFSET
- FLAGS PAINT STAKES WHISKERS
- LOCATE MARKINGS FADED: YES NO
- WRONG ADDRESS REQUESTED
- FACILITIES IMPROPERLY LOCATED
- QUALIFIED LOCATOR COULD NOT HAVE ACCURATELY LOCATED
- INACCURATE MAPS/CARDS
- BROKEN OR NO TRACER WIRE (PLASTIC)
- INSULATION PREVENTING ACCURATE LOCATE
- LOCATOR ERROR
- QUALIFIED LOCATOR COULD HAVE ACCURATELY LOCATED
- INCOMPLETE LOCATE
- MARKINGS OFF BY _____ (FEET/INCHES)
- INAPPROPRIATE SITE MARKINGS
- NO LOCATE PERFORMED
- FAILURE TO FOLLOW POLICY
- WRONG ADDRESS LOCATED

OBSERVATION BY: RC

NAME OF LOCATOR: sunb

NOTIFICATION AND OTHER DETAILS OF LOCATE

- LOCATE TICKET #:
- DATE: _____ TIME: _____ AM/PM
- REGULAR REQUEST EMERGENCY REQUEST
- LOCATE COMPANY NOTIFIED
- CONTACT NAME: _____
- TIME CALLED: _____ AM/PM
- TIME LOCATOR ARRIVED AT SITE: _____ AM/PM
- COMPANY NOTIFIED OF LOCATE NEAR CRITICAL FACILITIES: YES NO

CONTRACTOR REPAIRS

- CONTRACTOR WORKING FOR VECTREN MADE REPAIRS AT OWN EXPENSE
- CONTRACTOR REPAIRED DAMAGE
- NAME OF CONTRACTOR: _____
- # OF REGULAR HOURS _____
- # OF OVERTIME HOURS _____
- CREW TYPE _____

MATERIALS OR ROAD WORK

- METER WAS REPLACED _____ (STORES CODE)
- REGULATOR WAS REPLACED _____ (STORES CODE)
- TEMPORARY ASPHALT REPAIR _____ (SQ. FT.)
- PERMANENT ASPHALT REPAIR _____ (SQ. FT.)

PARTY TO INVOICE

NAME: SAME AS DAMAGING PARTY
ADDRESS: _____
CITY/STATE/ZIP: _____

REVIEWED BY: [Signature] DATE: 10-19-10

4595072

Friday, November 5, 2010

Service Order Status

Enter Service Order Number:

4595072



Banner Instance: CS03PROD CS01PROD CS02PROD

Order Number: N4595072

Order Type: LEAK

Order Status: Completed

Customer: 600166622 - RUSH MEMORIAL HOSPITAL

Prem: 5018225 - 1230 N MAIN ST

Technician: 2107 - Crumbaugh, Rich

Order Dates and Times

Need Date: 10/18/2010 3:33:00 PM
Time Created: 10/18/2010 3:30:20 PM
Time Dispatched: 10/18/2010 3:30:20 PM
Time In Route: 10/18/2010 3:34:38 PM
Time On-Site: 10/18/2010 3:41:56 PM
Tech Complete: 10/18/2010 4:57:42 PM
Time Closed: 10/18/2010 4:57:42 PM

Events Performed/Completion Code

LKOT - CMP

Meter Information

Current ReadStatus

Old Meter: 3128 Active

New Meter:

Completion Notes

rep made,1 in pl serv cut into.

Request Notes

SUNESIS CONSTRUCTION CALLED TO REPORT THEY HAVE CUT INTO A SERVICE AT THISADDRESS. XST 13TH CALLER D ARRELL JAMES 765-716-9942 WILL BE THERE .

MDSI Event Dates and Times

Event	Date/Time	User
AsnAssignmentManualAck_evt	10/18/2010 3:33:57 PM	Crumbaugh, Rich
AsnAssignmentEnRoute_evt	10/18/2010 3:34:38 PM	Crumbaugh, Rich
AsnAssignmentOnSite_evt	10/18/2010 3:41:56 PM	Crumbaugh, Rich
OrdOrderComplete_evt	10/18/2010 4:57:42 PM	Crumbaugh, Rich

NOTE:The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.

CHECK ALL THAT APPLY TO METHOD OF INVESTIGATION (at least one must be checked):

Visual, Facility Exposed At Time Of Investigation,
Investigation Results Verified By Utility Representative

INVESTIGATOR STATEMENT/CAUSAL FACTORS:

1230 n main. sunesis was benching back for grade and hit gas service. there is not any paint visible nor flags present. cant find last request as this is an ongoing project. contractor could not produce one either.

NAMES OF UTILITY REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

vectren bill clark- no paint or flags visible. ticket should have been called in for updates

NAMES OF EXCAVATOR'S REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

sunesis daryll- service was in grade. cant find request number

LIST ANY OTHER INDIVIDUALS ON SITE:

n/a

WERE ANY MARKINGS VISIBLE ON THE DAMAGE SITE UPON ARRIVAL? No

WERE ANY OTHER INDICATORS OF FACILITY PRESENT IN THE AREA? Yes

WAS THE EXCAVATION WITHIN THE TOLERANCE ZONE OF MARKS? No

EXTENT OF FACILITY DAMAGE

REPLACEMENT FOOTAGE

WAS CONTRACTOR ASSISTANCE REQUIRED? IF YES, WHO? No

WHAT CONTRACTOR EQUIPMENT WAS USED?

IS THE FACILITY SHOWN ON THE UTILITY RECORDS? No

IF YES, PLEASE LIST RECORD #(S) n/a

MISCELLANEOUS CASH RECEIPT

(PLEASE ATTACH A COPY OF ALL CHECKS TO THIS FORM AND
USE PAPER CLIPS/DO NOT STAPLE CHECKS TO FORM)

PROCESS ROUTING FOR ALL VECTREN COMPANIES INCLUDING UTILITIES
AND NON REGULATED SUBSIDIARIES: SEND COMPLETED FORM,
ORIGINAL CHECK AND COPY OF CHECK TO REBECCA MINEAR IN
FINANCIAL ACCOUNTING, BRAUN BUILDING, EVANSVILLE. RETAIN COPY
OF CHECK AND FORM FOR YOUR RECORDS. PLEASE INCLUDE PROPER
ACCOUNTING SO RECEIPT MAY BE CREDITED ACCURATELY. PLEASE
INCLUDE YOUR PHONE NUMBER SO THE RECEIPT MAY BE EASILY
RESEARCHED BY THE FINANCIAL ACCOUNTING GROUP.

Activity Date: 1/3/2011
Your Name, not your initials (employee): Pam Barber
Your Phone Number (employee): 812-491-4734
Party Check Received From (Check Payor):
Address of Check Writer (Check Payor):
SUNESIS CONSTRUCTION CO

Check Number 079086
Amount of Check \$749.66
Utility/Company Name VECTREN ENERGY DELIVERY OF INDIANA - NORTH
Task Number 103.0510
Job Number FDS0013451

Date Printed: 1/28/2011

Transaction Transactions

Transactions

Transaction Number | 71406
Source | FDR
Transaction Date | 03-JAN-2011
Reason / Comments | IGC/FDR #FDS0013451
G/L Code Combination | 02 - 000 - 0000 - 1221000 - 0000

Transaction Type | CASH
Amount | 749.66

Bank Statement

Bank Account Number | 4620608904
Bank Name | INDIANA GAS WIRES/ACHS
Cleared Amount |
Charges Amount |
Currency Code | 4150
Cleared Date |

Status

Reconciled | Unreconciled
GL Date | 03-JAN-2011
JE Transfer |
Cleared JE Transfer |

Save

Cancel

SUNESIS CONSTRUCTION CO.
 2610 CRESCENTVILLE ROAD
 WEST CHESTER, OH 45069
 (513) 326-6000


PNC BANK, N.A.
 PITTSBURGH, PA

8-9 / 430

079086

DATE	CHECK NO.	AMOUNT
12/22/10	79086	\$2,255.62

Two thousand two hundred fifty-five and 62 / 100 Dollars

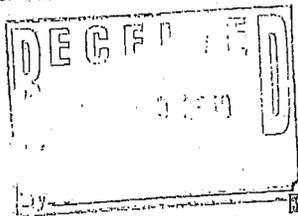

Vectren Energy Delivery
 PO Box 6248
 Indianapolis, IN 46206-6248

SUNESIS CONSTRUCTION CO.

PAY
 TO THE
 ORDER
 OF


[Signature]
 AUTHORIZED SIGNATURE


⑈079086⑈ ⑆043000096⑆ 1019290364⑈

SUNESIS CONSTRUCTION CO.

079086

VENDOR NO.		VENDOR NAME		CHECK NUMBER					
2133		Vectren Energy Delivery		79086					
TRANSACTION NUMBER	REFERENCE	DATE	DESCRIPTION	GROSS AMOUNT	DISCOUNT	RETAINAGE	PREVIOUS	BALANCE	NET AMOUNT
1110 934	FDS0013521	11/24/10		1,409.79	0.00	0.00	0.00	0.00	1,409.79
1110 935	FDS0013451	11/24/10		749.66	0.00	0.00	0.00	0.00	749.66
1210 243	121510	12/15/10	Acct No 02-620700164-548363	96.17	0.00	0.00	0.00	0.00	96.17
				GROSS AMOUNT	DISCOUNT	RETAINAGE	TOTAL DEDUCTIONS	BALANCE	NET AMOUNT
				2,255.62	0.00	0.00	0.00	0.00	2,255.62

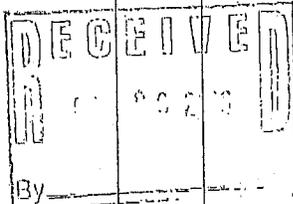

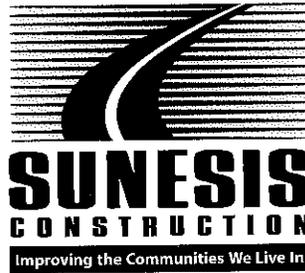

November 1, 2011

Pipeline Safety Division – Case 1273
Indiana Utility Regulatory Commission
101 West Washington Street Suite 1500 E
Indianapolis, IN 46204

Re: Case 1273

Dear Sir or Madam:

This letter is in response to your request for information on the captioned case pursuant to your letter dated September 20, 2011. Enclosed is the completed Information Request.


Sunesis workmen were leveling ground on October 18, 2010 at or near 1230 North Main Street, Rushville, Indiana. We had had the underground utilities marked by USIC Locating Services in late September 2010 and for seven marking periods before this date. The utility markings though had expired nine days before October 18, 2010 because our project manager had failed to renew the markings due to a failure of his tickler software. Hence, when we were leveling, the utility markings had expired.

After we hit the gas pipe, we took the following actions:

1. We notified Indiana 811 of the gas pipe hit immediately.
2. We had USIC refresh the utility markings on the site.
3. We provided remedial training in Indiana excavation law for all our foremen and the crew on the Rushville job.
4. We instructed our foremen on all our jobs to check periodically with the project managers for the need to renew utility markings.
5. We instructed our project managers to make sure they periodically reviewed the age of utility markings on their jobs.

If you have any further questions, please contact me.

Very truly yours,

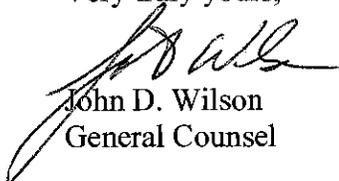

John D. Wilson
General Counsel

Information Request

Pipeline Safety Division Indiana Utility Regulatory Commission

The Pipeline Safety Division of the Indiana Utility Regulatory Commission requests any and all information you can provide regarding the following criteria:

The Parties:

Excavator Information:

Business Name: *Sunesis Construction*
Responsible Party Personal Name: *Tim Keul*
Title (if any): *Safety Manager*
Address: *2610 Crescentville Rd*
City, State Zip:
Preferred Telephone: *513-326-6000*
Cell Phone Number: *513-326-6000*
Email Address: *Tkeul@SUNESIS.CC.COM*

Facility Information:

Business Name: *Vectren*
Responsible Party Personal Name:
Title (if any):
City, State, Zip *Franklin, IN, 46131*
Address: *600 Industrial Drive*
Preferred Telephone: *1-800-227-1376*
Cell Phone Number:
Email Address:

Locator Service Information:

Business Name: *USIC Locating Services*
Responsible Party Personal Name:
Title (if any):
Address: *13085 Hamilton Crossings Bldg 200*
City, State Zip: *Carmel, IN, 46032*
Preferred Telephone: *317-561-7800*
Cell Phone Number:
Email Address:

Other (Witness, Police, Fire, Other) Information:

Personal Contact:

Business/Organization Name:

Title (if any)

Address:

City, State, Zip

Preferred Telephone:

Cell Phone Number:

Email Address:

Utility Line Impact:

Product Type (circle one):

Natural Gas

Liquid Pipeline

Unknown/Other

Facility Type (circle one):

Distribution

Gathering

Service/Drop

Transmission

Unknown/Other

Size (Diameter/etc.): 3/4"

Pressure (PSIG/Inches): Automatic shut off valve engaged

Interruption in Service: Yes / No Number of Customers Affected: 1

Evacuation: Yes No If yes, How Many Evacuated? _____

Repair Cost (if known): \$ 750

Cause of Damage Information:

Type of Equipment (circle one):

Auger

Backhoe/Trackhoe

Boring /Drilling

Directional Drilling

Explosives

Farm Equipment

Grader/Scraper

Hand Tools

Milling Equipment

Probing Device

Trencher

Vacuum Equipment

Unknown/Other skid steer

Type of Work Performed (circle one):

- Agriculture
- Cable TV
- Curb/Sidewalk
- Bldg. Construction
- Bldg. Demolition
- Drainage
- Driveway
- Electric
- Engineering/Surveying
- Fencing
- Grading
- Irrigation
- Landscaping
- Liquid Pipeline
- Milling
- Natural Gas
- Pole
- Public Transit Authority
- Railroad Maintenance
- Road Work
- Sewer (Sanitary/Storm)
- Site Development
- Steam
- Storm Drain/Culvert
- Street Light
- Telecommunications
- Traffic Signal
- Traffic Sign
- Water
- Waterway Improvement
- Unknown/Other

Release of Product: Yes / No

Ignition and/or Fire: Yes / No

Excavator Notify 811: Yes / No

Locate Information:

Excavator Request Locate: Yes / No *Previously marked*

Indiana 811 Locate Ticket Number: _____

Locate Marks Visible: Yes / No

Locate Marks Correct: Yes / No

Excavator "White Lined": Yes / No *Originally at project commencement*

Maps Used to Mark Facilities: Yes / No

