



Pipeline Safety Division Investigation Report

Investigation regarding: **Filson Earth Work Company Incorporated**

UPPAC Database Record ID: 3806

Investigator: Mike Orr

Report Date: 3/7/2013

Damage Date: 9/12/2012 9:35:33 AM

Damage Address: 260 S Ford Rd

City: Zionsville

County: Boone

The Parties

Excavator: **Filson Earth Work Company Incorporated**

Contact: Aaron Hughes

Address: Po Box 538, Noblesville, In 46061

Telephone:

Facility Owner: Vectren

Contact: Darlene Kulhanek

Address: 1 N Main Street, Evansville, IN 47702

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Distribution

Investigation regarding: Filson Earth Work Company Incorporated

UPPAC Database Record ID: 3806

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 3

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$2864

Excavator Activities/Cause of damage information:

Excavator request locates: Yes Indiana 811 ticket Number: 1209072947

Type of Equipment: Backhoe/Trackhoe

Type of work performed: Water

Synopsis: Damage to a natural gas main occurred during a procedure to install a water line.

Findings: Reported by Indiana 811; excavator did not respond to initial notice mailed 11/30/2012. The gas operator reported a gas main was compromised from mechanical equipment within the two (2) foot exclusion zone of the underground facility.

Conclusion: Excavator failed to maintain the required clearance with mechanized equipment.

Violation: IC 8-1-26-20(a)(2): Failure to maintain two (2) feet clearance with mechanized equipment.



DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)
INDIANA UTILITY REGULATORY COMMISSION

INITIAL DOCUMENTS -
OPERATOR
CASE 3806

Submitted to IURC-Pipeline Safety on: 12-7-2012

Who is submitting this information?

Name of person providing this information: Darlene Kulhanek

Business address (number and street): 1 Main Street

City, State, and ZIP code: Evansville, IN 47711

Telephone number (area code): 812-491-4227

Fax number (area code): 812-491-4504

E-mail address: dkulhanek@vectren.com

Excavator Information, if known

Full name: Filson Earth Work

Business address (number and street): 21785 Riverwood Avenue

City, State, and ZIP code: Noblesville, IN 46060

Telephone number (area code): 317-774-3180

Fax number (area code): 317-774-3181

E-mail address: Unknown

Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Backhoe/Trackhoe

Type of work performed: Water

Date and Location of Damage

Date of damage (month, day, year): 9-12-2012

County: Boone

City: Zionsville

Street address (number and street, city, state, and ZIP code):
200 S Ford Rd, Zionsville, IN

Nearest intersection: Unknown

Right of way where damage occurred: Public - Other

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? Yes

If yes, how many affected? 3

Time to restore service (in hours): 3

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$ 2,863.85

Affected Facility Information

What type of pipeline was damaged? Natural Gas

What was the affected facility? Distribution

What was the depth of the facility, in inches? _____

Notification, Locating, Marking

Did excavator request locates prior to commencing work? Yes

Enter Indiana 811 ticket number, if known: 1209072947

Was the locate request completed within two working days? Yes

If locates were performed, were they done so by a contractor or pipeline employee? Contract Locator

If a contractor locator, enter the company name, if known: USIC _____

Were facility marks visible in the area of excavation? Yes

Were facilities marked correctly? Yes

Type of markings used: Paint and Flags

If other, please specify: None _____

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? No

Did the excavator notify Indiana 811 in the event of this damage? Yes

Did the excavator notify 911 in the event of a release of product? Unknown/Other

Description of Cause

Select from the list the most accurate cause for the damage: --Failure to use hand tools where required

Additional Comments

2" plastic main severed by hoe. Not hand exposed.



2 VECTREN ENERGY DELIVERY OF INDIANA - NORTH

NOW DUE
FINAL
\$2,863.85

FILSON EARTH WORK

Type: GAS

21785 RIVERWOOD AVENUE,

Invoice: FDS0016898

NOBLESVILLE, IN 46060

BillToID: 32519


Billing Date: 10/26/2012

Date of Loss: 9/12/2012

5954 103.0509

PAID

Please return this portion with your remittance.

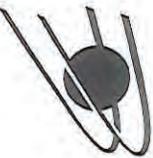

Mail Payment To:
Vectren Utilities Holdings
1239 Reliable Parkway
Chicago, IL 60686-0012
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5
Risk Management/Claims Department

NOW DUE
FINAL
\$2,863.85

FILSON EARTH WORK

Type: GAS

21785 RIVERWOOD AVENUE,

Invoice: FDS0016898

NOBLESVILLE, IN 46060

BillToID: 32519

Billing Date: 10/26/2012

Date of Loss: 9/12/2012

Invoice For Costs to Repair and Reconstruct Damaged Property

Address: 200 S FORD ROAD, ZIONSVILLE

2" PLASTIC MAIN SEVERED BY HOE. DID NOT HAND DIG.

Material:	\$184.11
Company Labor:	\$1,554.38
Contract Labor:	\$0.00
Transportation/Equipment:	\$771.25
Misc:	\$0.00
Gas Loss:	\$354.11
Adjustments:	\$0.00
Payments:	\$0.00
Total:	\$2,863.85

5954 103.0509

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

Task No: 103.0509 Capital/O & M (check one)
Date of Damage 9/1/12 2012
Cost Center # 5953
Time Occurred 9:15 (am/pm)
Time Found 9:30 (am/pm)
Latitude 39.98182 Longitude: -86.279240

FACILITIES DAMAGE REPORT

GAS

VE02497

DAMAGE SITE: 200 S. Ford RD Lot # _____
Address _____
County Bowe City Zionsville State IN Township Eagle

FACILITY TYPE: Distribution Propane
 Service Storage
 Transmission: (include supplemental report)

FACILITIES DAMAGED:

FACILITIES DAMAGED:	ORIFICE SIZE(S): (1)	(2)	(3)
<input type="checkbox"/> Farm Tap	0.50 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Heater	5/8 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Main	0.75 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Meter (Residential)	1.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Meter (Industrial / Commercial)	1.25 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Odorizer	2.00 inch	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Regulator Station	3.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Relief Valve	4.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Riser	5.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Service Line	6.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Valve	10.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Other	12.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
	16.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
	20.00 inch	<input type="checkbox"/>	<input type="checkbox"/>
	Other	<input type="checkbox"/>	<input type="checkbox"/>

VISUAL OBSERVATION AT DAMAGE SITE: 9/1/12
Visual Observation: Above Ground Below Ground
 Yes No
 Yes No
 Yes No
N/S N/S

Locate Applicable Facilities Properly Marked: Yes No
Marking Methods: Conventional None
 Offset Paint Stakes Whiskers
Locate Marking Padded: Yes No
Wrong Address Requested: Yes No

Facilities Improperly Located:
 Qualified Locator Could Not Have Accurately Located
 Inaccurate Maps / Cards
 Broken or No Tracer Wire (Plastic)
 Insulation Preventing Accurate Locate

Locator Error:
 Failure to Follow Policy
 Inappropriate Site Markings
 Incomplete Locate
 No Locates Performed
 Qualified Locator Could Have Accurately Located
 Wrong Address Located
Marking Off By: _____ (Feet / Inches)

TYPE OF MATERIAL: Cast Iron Severed
 Plastic (HDPE) Not Cut
 Plastic (MDPE) Severed
 Steel Size 2 x 2

PRESSURE: 25 PSIG 40 PSIG
 50 PSIG 55 PSIG
 60 PSIG 6 WC (.2163)
 7 WC (.252)
 Other _____

50.6711

PROTECTION IN PLACE: None
 Building Fence None
 Post Rail Vault N/A
 Other _____

DURATION OF ESCAPING GAS:
Minutes: 75

Were Facility Marks Visible: Yes No
Was Area White Lined: Yes No
Positive Response: Yes No
Tolerance Zone Violated: Yes No
Part of Project: Yes No
Company Representative On-Site: Yes No

LEAK REPORT NUMBER: _____

EFV Activated Yes No N/S

Observation by (ID#): _____

FEED TYPE: One-Way Feed
 Two-Way Feed
Number of Customers Affected: 3
Total Hours Served: 3
Was Off: 3

Name of Locator: _____
LOCATING ORGANIZATION: Contract Locator
 Unknown / Other
 Utility Owner

DAMAGED BY: Company Crew
 Contractor
 County
 Developer
 Farmer
 Municipality
 Property Owner/ Tenant
 Railroad
 State
 Unknown
 Utility
 Vehicle Accident
 Other _____

TYPE OF CONSTRUCTION: Agriculture
 Building Construction
 Building Demolition
 Cable TV
 Curbs / Sidewalk
 Drainage
 Driveway
 Electric
 Engineering / Surveying
 Fencing
 Grading
 Irrigation
 Landscaping
 Liquid Pipeline
 Milling
 Pole
 Natural Gas
 Public Transit Authority
 Railroad Maintenance
 Other _____

NOTIFICATIONS AND OTHER DETAILS OF LOCATE: Locate Ticket: 1209070947

Date: 9/1/2012 Time: _____ am / pm

TYPE OF REQUEST: Regular Request Emergency Request
 Locate Company Notified
Contact Name: _____ am / pm
Time Called: _____ am / pm
Time Locator Arrived at the Site: _____ am / pm

Company Notified of Locate Near Critical Facilities
 Yes No N/S

Copy of Mark Out Request Provided Within 2 Working Days
 Yes No N/S

WORKING FOR: City County Developer
 State Property Owner
 Utility

Natural Gas
 Public Transit Authority
 Railroad Maintenance
 Other _____

ONE-CALL CENTER: IUPPS
 OUPS
 Unknown

TYPE OF EQUIPMENT:

- Auger
- Backhoe / Track hoe
- Boring
- Drilling
- Explosives
- Farm Equipment
- Grader / Scraper
- Hand Tools
- Milling Equipment
- Plow
- Probing Device
- Trencher
- Vacuum Equipment
- Vehicle

ROOT DAMAGING CAUSE:

- Abandoned Facility
- Deteriorated Facility
- Facility Could Not be Found/ Located
- Facility Was Not Located / Marked
- Failure to Maintain Clearance
- Failure to Maintain Marks
- Failure to Support Exposed Facility
- Failure to Use Hand Tools Where Required
- Improper Backfilling
- Incorrect Records / Maps
- Marking or Location Not Sufficient
- No Notification Made to One-Call
- One-Call Notification Error
- Previous Damage
- Wrong Information Provided

Other _____

Other _____

Did Excavator Notify You

Yes No

Excavation Required

Yes No

Media at Site

Yes No

Was There Ignition of Gas?

Yes No

INVOICE:

Yes No N/S

CONTRACTOR REPAIRS:

- Contractor Working for Veetren Made Repairs at Own Expense
 - Yes No N/S
- Contractor Repaired Damage
 - Yes No N/S

Name of Contractor: _____

of Regular Hours: _____

of Overtime Hours: _____

of Regular Hours: _____

Crew Type: _____

MATERIALS OR ROAD WORK:

- Meter was replaced _____ (Stores Code)
- Regulator Was Replaced _____ (Stores Code)
- Temporary Asphalt Repair: _____ (sq. ft.)
- Permanent Asphalt Repair: _____ (sq. ft.)

RIGHT OF WAY:

- Dedicated Utility Easement
- Federal Utility Easement
- Pipeline
- Power / Transmission Line
- Private - Business
- Private - Easement
- Private - Land Owner
- Public - County Road
- Public - Interstate Highway
- Public - Other
- Public - State Highway
- Public - City Street
- Unknown

DAMAGING PARTY:

Name: Fi Lion Earth Works Co.
Address: PO. Box 538
City/ State/ Zip: Noblesville IN 46061
Phone: (317) 994-3180
Steelmanth 9-12-2012
Prepared / Investigated By: _____ Date: _____

PARTY TO INVOICE:

Name: Smith
Address: _____
City/ State/ Zip: _____
Phone: _____
Alexander
Refused by Field Supervisor: _____ Date: _____

Using Track hoe had main exposed.
And took out more scrap of sand
and hit the gas main
Locates where good.

NORMAL NOTICE

Ticket : 1209072947 Date: 09/07/2012 Time: 16:15 Oper: BLIEVERTZ Chan:025

State: IN Cnty: BOONE Twp: EAGLE
 Cityname: ZIONSVILLE Inside: Y Near: N
 Subdivision:

Address : 260
 Street : S FORD RD
 Cross 1 : IN RT 334 Within 1/4 mile: Y
 Location: LOCATE ENTIRE PROPERTY

Grids : 3956A8616B 3957D8616B 3956A8616A 3957D8616A

Work type : INSTALL SANITARY SEWER/WATER LINE/GRADIN
 Done for : TNW CORPORATION
 Start date: 09/11/2012 Time: 16:30 Hours notice: 96/048 Priority: NORM
 Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: N
 Duration : 2 MONTHS Depth: 7 FEET

Company : FILSON EARTH WORK COMPANY INCORPORATED Type: CONT
 Co addr : PO BOX 538
 City : NOBLESVILLE State: IN Zip: 46061
 Caller : AARON HUGHES Phone: (317)774-3180
 Contact : AARON HUGHES---CELL Phone:
 BestTime:
 Mobile : (317)714-2890
 Fax : (317)774-3181

Remarks : All tickets are taken and processed on Eastern Daylight Time
 Will you be white-lining the dig site area? NO
 :

Submitted date: 09/07/2012 Time: 16:15
 Members: ID0002 ID0022 ID1048 ID1501 ID2469 ID4471 ID9999 SBCIN ID6921 SM

Failed to get message text or map data: Object expected

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
BOONE COUNTY REMC	ELECTRIC
BRIGHT HOUSE NETWORKS INDIANAPOLIS	CABLE TV
CITIZENS WATER / FORMERLY VEOLIA WATER	WATER
DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
MARATHON PIPE LINE CO. - CLERMONT	PIPELINE
VECTREN - DANVILLE	GAS
ZIONSVILLE SEWER DEPARTMENT	SEWER

[View Map](#)

[Close Map](#)



Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:10 AM



Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:16 AM




Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:20 AM



Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:28 AM

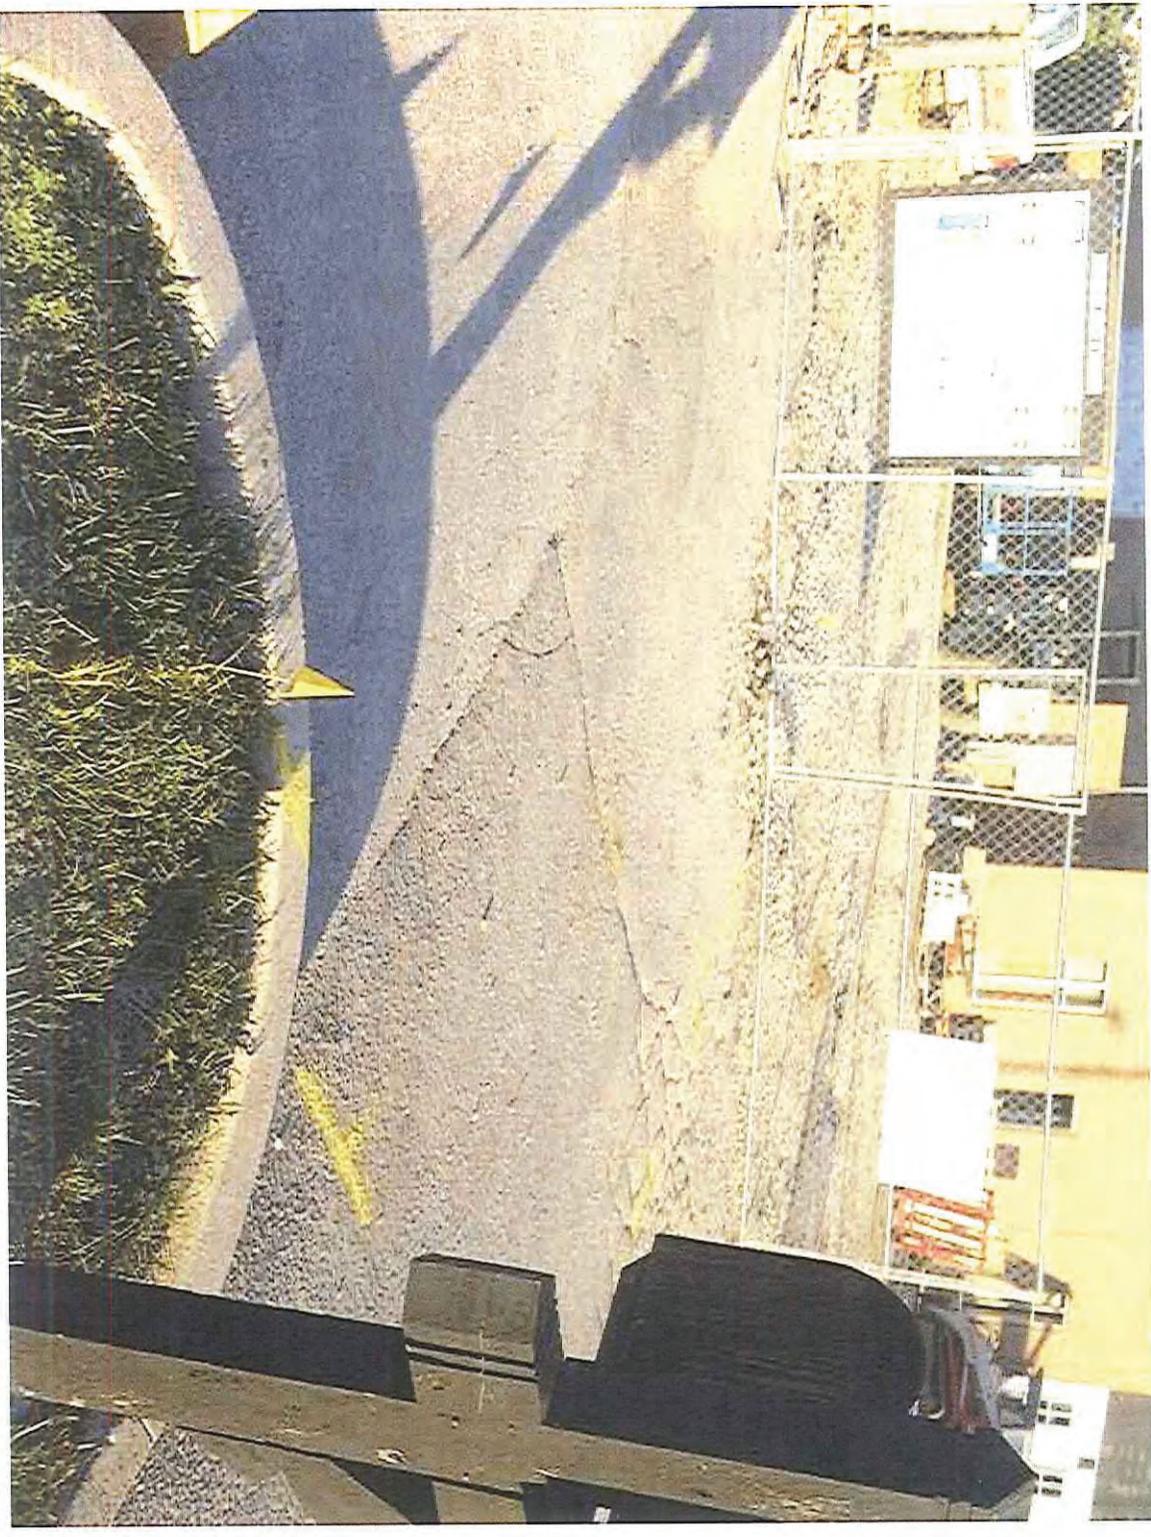

Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:42 AM



Property of United States Infrastructure Corporation

Photo taken on 9/11/2012 7:56:50 AM

DAMAGE DAMAGE

Ticket : 1209120928 Date: 09/12/2012 Time: 09:33 Oper: JELEWITZ Chan:086

State: IN Cnty: BOONE Twp: EAGLE
 Cityname: ZIONSVILLE Inside: Y Near: N
 Subdivision:

Address : 260
 Street : S FORD RD
 Cross 1 : IN RT 334 Within 1/4 mile: Y
 Location: LOCATE ENTIRE PROPERTY

Grids : 3956A8616B 3957D8616B 3956A8616A 3957D8616A

Work type : INSTALL SANITARY SEWER/WATER LINE/GRADIN
 Done for : TNW CORPORATION
 Start date: 09/12/2012 Time: 09:33 Hours notice: 0/000 Priority: EMER
 Ug/Oh/Both: 0 Blasting: N Boring: N Railroad: N Emergency: Y
 Duration : 2 MONTHS Depth: 7 FEET

Company : FILSON EARTH WORK COMPANY INCORPORATED Type: CONT
 Co addr : PO BOX 538
 City : NOBLESVILLE State: IN Zip: 46061
 Caller : AARON HUGHES Phone: (317)774-3180
 Contact : AARON HUGHES---CELL Phone:
 BestTime:
 Mobile : (317)714-2890
 Fax : (317)774-3181

Remarks : All tickets are taken and processed on Eastern Daylight Time
 VECTREN GAS LINE HAS BEEN CUT ON THE EAST SIDE OF THE PARKING LOT -- LINE IS
 BLOWING -- LINE IS APPROX 2 INCH PLASTIC UNSURE OF COLOR -- ADVISED TO CALL 911
 AND VECTREN -- CREW IS ON SITE -- PREVIOUS TICKET NUMBER 1209072947 -- THANK YOU
 Will you be white-lining the dig site area? NO
 ;

Submitted date: 09/12/2012 Time: 09:33
 Members: ID0002 ID0022 ID1048 ID1501 ID2469 ID4471 ID9999 SBCIN ID6921 SM

Failed to get message text or map data: Object expected

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
BOONE COUNTY REMC	ELECTRIC
BRIGHT HOUSE NETWORKS INDIANAPOLIS	CABLE TV
CITIZENS WATER / FORMERLY VEOLIA WATER	WATER
DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
MARATHON PIPE LINE CO. - CLERMONT	PIPELINE
VECTREN - DANVILLE	GAS
ZIONSVILLE SEWER DEPARTMENT	SEWER

[View Map](#)

[Close Map](#)




Property of United States Infrastructure Corporation
Photo taken on 9/12/2012 10:04:42 AM



Property of United States Infrastructure Corporation

Photo taken on 9/12/2012 10:04:44 AM

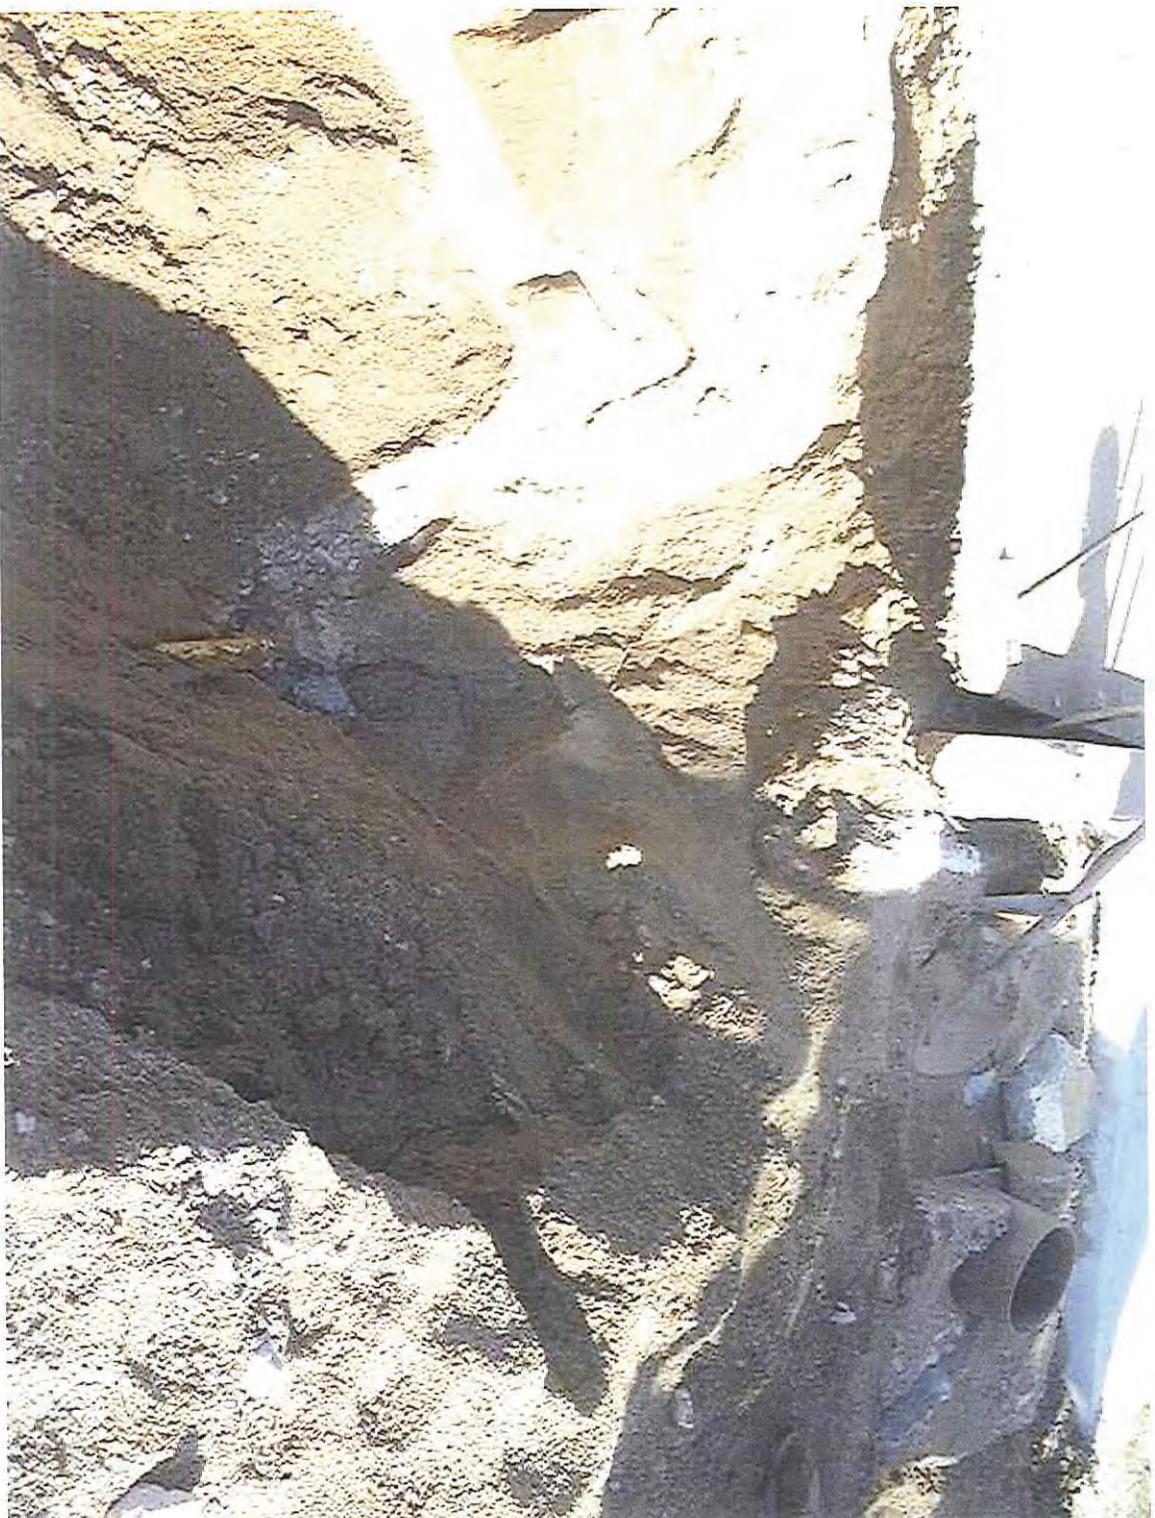

Property of United States Infrastructure Corporation


Photo taken on 9/12/2012 10:40:16 AM



Property of United States Infrastructure Corporation
Photo taken on 9/12/2012 10:40:20 AM



Property of United States Infrastructure Corporation
Photo taken on 9/12/2012 10:40:26 AM

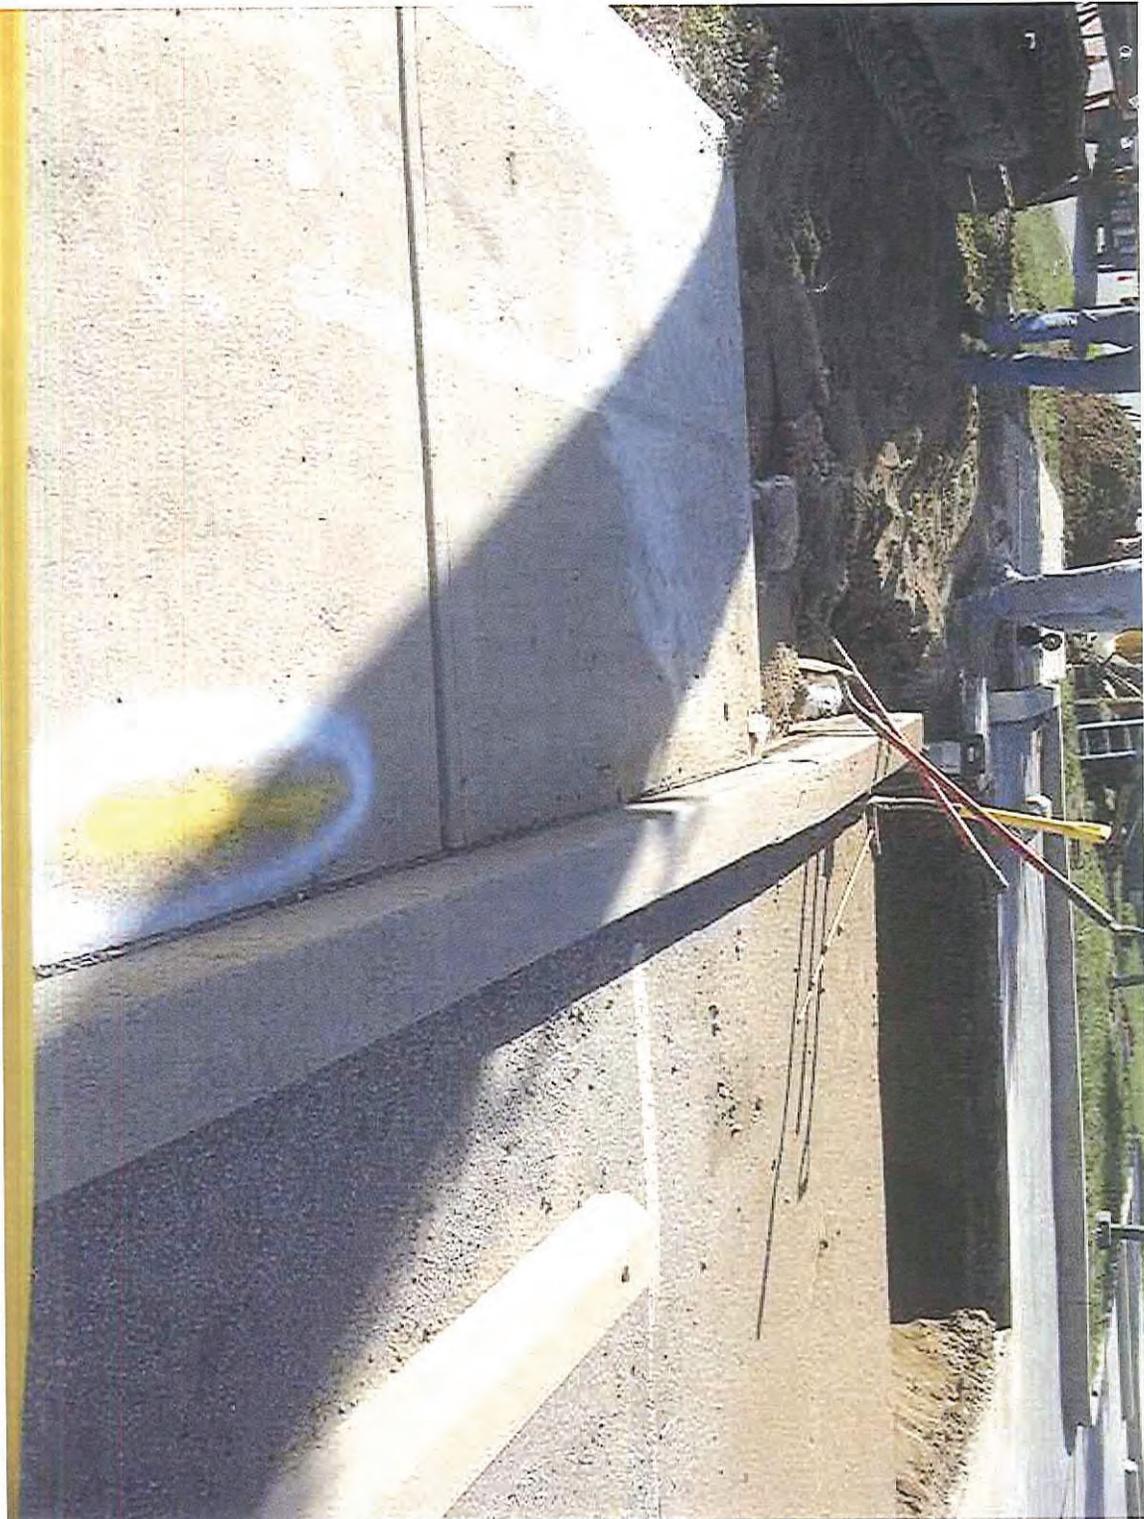

Property of United States Infrastructure Corporation
Photo taken on 9/12/2012 10:40:42 AM



Property of United States Infrastructure Corporation
Photo taken on 9/12/2012 10:41:18 AM



Property of United States Infrastructure Corporation
Photo taken on 9/14/2012 1:59:32 PM



Property of United States Infrastructure Corporation
Photo taken on 9/14/2012 1:59:44 PM



Property of United States Infrastructure Corporation
Photo taken on 9/14/2012 1:59:42 PM

Service Order Status

Enter Service Order Number:
5363486



Close Window Refresh Screen

Banner Instance: CS03PROD CS01PROD CS02PROD
Order Number: N5363486
Order Type: LEAK
Order Status: Completed

Customer: 620396559 - KRG CONSTRUCTION LLC
Prem: 5064536 - 200 S FORD RD

Technician: 2822 - Steelsmith, Greg

Order Dates and Times

Need Date: 9/12/2012 9:28:00 AM
Time Created: 9/12/2012 9:18:49 AM
Time Dispatched: 9/12/2012 9:18:49 AM
Time In Route: 9/12/2012 9:19:50 AM
Time On-Site: 9/12/2012 9:30:15 AM
Tech Complete: 9/12/2012 11:10:15 AM
Time Closed: 9/12/2012 11:10:15 AM

Events Performed/Completion Code

LKOT - CMP
 LKOT

Meter Information
Current Read/Status

Completion Notes
 damaged 2 in pl main fds 0016898 crew onsite to repair///2822

Old Meter:
New Meter:

Request Notes

BLOWING LINE PER JENNY WITH T&W CORP. NOT SURE WHAT HIT WITH. DID NOT HAVE LOCATES. ONSITE CONTA CT IS BRUCE CROSSSTREET. 317-710-8876.MIKE W/ BOONE CO FD- PH# 765-482-1412- FD IN ROUTE-HIT MAIN//

MDSI Event Dates and Times		
Event	Date/Time	User
AsnAssignmentEnRoute_evt	9/12/2012 9:19:50 AM	Steelsmith, Greg
AsnAssignmentManualAck_evt	9/12/2012 9:19:51 AM	Steelsmith, Greg
AsnAssignmentOnSite_evt	9/12/2012 9:30:15 AM	Steelsmith, Greg
OrdOrderComplete_evt	9/12/2012 11:10:15 AM	Steelsmith, Greg

NOTE: The Reporting database replicates in near real-time; it has been approximately 1 minute(s) since the last transaction replicated.

MISCELLANEOUS CASH RECEIPT

(PLEASE ATTACH A COPY OF ALL CHECKS TO THIS FORM AND
USE PAPER CLIPS/DO NOT STAPLE CHECKS TO FORM)

PROCESS ROUTING FOR ALL VECTREN COMPANIES INCLUDING UTILITIES
AND NON REGULATED SUBSIDIARIES: SEND COMPLETED FORM,
ORIGINAL CHECK AND COPY OF CHECK TO REBECCA MINEAR IN
FINANCIAL ACCOUNTING, BRAUN BUILDING, EVANSVILLE. RETAIN COPY
OF CHECK AND FORM FOR YOUR RECORDS. PLEASE INCLUDE PROPER
ACCOUNTING SO RECEIPT MAY BE CREDITED ACCURATELY. PLEASE
INCLUDE YOUR PHONE NUMBER SO THE RECEIPT MAY BE EASILY
RESEARCHED BY THE FINANCIAL ACCOUNTING GROUP.

Activity Date:

12/3/2012
12:00:00 AM

Your Name, not your initials (employee):

Pam Barber

Your Phone Number (employee):

812-491-4734

Party Check Received From (Check Payor):

Address of Check Writer (Check Payor):

BATCH1-FILSON EARTHWORK COMPANY INC

Check Number

8494

Amount of Check

\$2,863.85

Utility/Company Name

VECTREN ENERGY DELIVERY OF INDIANA - NORTH

Task Number

103.0509

Job Number

FDS0016898

Date Printed: 12/5/2012

Transaction Information G-9647855 CHI-861239 2012/12/03

[Back to Table of Contents](#)

Transaction Level Details

Env Num	2	Envelope	G-9647855
Transaction	G-9647855	Lockbox	CHI-861239
Date	2012/12/03	Time	04:00
Batch	1	Batch Item	2
Check	2	Amount	\$2,863.85
ABA/RT	074905380	Account Num	0095915
Check Num	008494		

Envelope and Check Image

8494

COMMUNITY BANK
 Serving Hamilton and Madison Counties
 71-538-749

FILSON EARTHWORK COMPANY, INC.
 P.O. BOX 538
 NOBLESVILLE, IN 46061
 317-774-3180

11/29/12

PAY TO THE ORDER OF: Vectren Energy Delivery of Indiana

Two Thousand Eight Hundred Sixty-Three and 85/100*****

\$ **2,863.85

DOLLARS


 AUTHORIZED SIGNATURE

MEMO 12-11

⑆008191⑆ ⑆0P4905380⑆ 009⑆591⑆5⑆

Security features. Details on back.

Vectren Energy Delivery of Indiana
 Risk Mgmt./Claims Dept.
 P.O. Box 209
 Evansville, IN 47702-0209

YOUR ADDRESS

Vectren Utilities Holding Group, Inc.
 1239 Reliable Parkway
 Chicago, IL 60686-0012

⑆06860012⑆

⑆06860012⑆

UNITED STATES POSTAGE
 02 1P
 000302992 NOV 29 2012
 MAILED FROM ZIP CODE 48061

\$000.450

Transaction Level Keyed Data

Remitter Name : FIISSON EARTHWORK COMPANY INC Check Date : 2012/11/29

Invoice Level Keyed Data

Invoice Number	Reference Number
FDS0016898	99999999

FIISSON EARTHWORK COMPANY, INC.		Vectren Energy Delivery of Indiana		11/29/12		8494	
Date	Type	Reference	Original Amt.	Balance Due	Discount	Payment	
11/1/12	Bill	FDS0016898	2,863.85	2,863.85		2,863.85	
				Check Amount		2,863.85	
Community Bank CHE 12-11							2,863.85