



Pipeline Safety Division Investigation Report

Investigation regarding: **Gordon Engineering**

UPPAC Database Record ID: 3937

Investigator: Mike Orr

Report Date: 3/7/2013

Damage Date: 8/28/2012

Damage Address: Fellows

City: South Bend

County: St. Joseph

The Parties

Excavator: **Gordon Engineering**

Contact:

Address: 2534 Detroit Rd, 49120, Niles, Mi

Telephone: (269)683-6554

Facility Owner: NIPSCO

Contact: Kit Earle

Address: 150 W Market Street, Indianapolis, IN 46204

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Investigation regarding: Gordon Engineering

UPPAC Database Record ID: 3937

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$

Excavator Activities/Cause of damage information:

Excavator request locates: No Indiana 811 ticket Number:

Type of Equipment: Auger

Type of work performed: Cable TV

Synopsis: Damage to a natural gas service occurred during a auger procedure to install a cable TV line.

Findings: Reported by Steve Noffsinger (NIPSCo); excavator did not respond to initial notice mailed 11/30/2012. Excavator failed to provide notice of excavation causing a compromise of the underground facility.

Conclusion: Excavator failed to provide notice of excavation.

Violation: IC 8-1-26-16(g): Failure to provide notice of excavation.



DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)

INDIANA UTILITY REGULATORY COMMISSION

Submitted to IURC-Pipeline Safety on: Oct 8, 2012

Who is submitting this information?

Name of person providing this information: Steve Noffsinger (NIPSCo)

Business address (*number and street*): 3511 E 15th Ave

City, State, and ZIP code: Gary, IN, 46403

Telephone number (*area code*): (219)962-0422

Fax number (*area code*): (219)962-0404

E-mail address: cludwig@nisource.com

Excavator Information, if known

Full name: Gordon Engineering

Business address (*number and street*): 2534 Detroit Rd, 49120

City, State, and ZIP code: Niles, MI

Telephone number (*area code*): (269)683-6554

Fax number (*area code*): _____

E-mail address: _____

Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Auger

Type of work performed: Cable TV

Date and Location of Damage

Date of damage (*month, day, year*): Aug 28, 2012

County: St. Joseph

City: South Bend

Street address (*number and street, city, state, and ZIP code*):
Fellows

Nearest intersection: Altgeld St

Right of way where damage occurred: Public - City Street

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? Yes

If yes, how many affected? 1

Time to restore service (*in hours*): 3

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$

Affected Facility Information

What type of pipeline was damaged? Natural Gas

What was the affected facility? Service/Drop

What was the depth of the facility, in inches? 12

Notification, Locating, Marking

Did excavator request locates prior to commencing work? No

Enter Indiana 811 ticket number, if known:

Was the locate request completed within two working days? Unknown/Other

If locates were performed, were they done so by a contractor or pipeline employee? Unknown/Other

If a contractor locator, enter the company name, if known: _____

Were facility marks visible in the area of excavation? No

Were facilities marked correctly? Unknown/Other

Type of markings used: Other

If other, please specify: No locates _____

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? Yes

Did the excavator notify Indiana 811 in the event of this damage? No

Did the excavator notify 911 in the event of a release of product? Yes

Description of Cause

Select from the list the most accurate cause for the damage: --No notification made to the one-call center

Additional Comments

Nipsco emergency repair ticket 1208283202



150 West Market Street, Suite 600
Indianapolis, IN 46204

January 30, 2013

Via Electronic Transmission – PipelineDamageCase@urc.in.gov

Pipeline Safety Division – Case No. 3937
Indiana Utility Regulatory Commission
101 West Washington Street, Suite 1500 East
Indianapolis, Indiana 46204

RE: Investigation Request for Information; Pipeline Division Case No. 3937

To Whom It May Concern:

Attached please find Northern Indiana Public Service Company's ("NIPSCO") written information, and supporting documentation, relating to the following event:

Date of Event: 8/28/2012

Event Location: Fellows

Facility Owner: Northern Indiana Public Service Company

Excavator: Gordon Engineering

Other Party: N/A

Pipeline Division Case No. 3937

NIPSCO has reviewed its recovery and damage prevention files for this matter and has provided answers, when known, to the list of questions set forth in the Information Request. To the extent available, NIPSCO is also providing a copy of the Damage Information Report – Pipeline Safety Division previously submitted by NIPSCO to IURC Pipeline Safety as well as additional documentation relating to this Event Location.

Upon completion of the investigation, NIPSCO requests that it be provided with a copy of the Pipeline Division's Investigation Report with findings that will be forwarded to the Underground Plant Protection Advisory Committee. If there are any additional questions, please contact the undersigned.

Very truly yours,

Christopher C. (Kit) Earle
NiSource Corporate Services - Legal
Phone: 317-684-4904
Fax: 317-684-4918
Email: cearle@nisource.com

IURC INFORMATION REQUEST	
Pipeline Safety Division Case No. 3937	
Date of Event	8/28/2012
Event Location	Fellows
Event City	South Bend
Facility Owner	Northern Indiana Public Service Company
Excavator	Gordon Engineering
Date of IURC Information Request	12/5/2012
THE PARTIES	
EXCAVATOR:	
BUSINESS NAME	Gordon Engineering
RESPONSIBLE PARTY PERSONAL NAME	
TITLE (IF ANY)	
ADDRESS	2534 Detroit Rd
CITY/ STATE/ZIP	Niles, MI 49120
PREFERRED TELEPHONE	269-683-6554
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
FACILITY INFORMATION - OWNER/OPERATOR OF UTILITY LINE:	
BUSINESS NAME	NORTHERN INDIANA PUBLIC SERVICE COMPANY
RESPONSIBLE PARTY PERSONAL NAME	LUKE SELKING
TITLE	
ADDRESS	1501 HALE AVENUE
CITY/STATE/ZIP	FORT WAYNE, IN 46802
PREFERRED TELEPHONE	260/439-1290
SECONDARY TELEPHONE	
EMAIL ADDRESS	LSELKING@NISOURCE.COM
LOCATOR SERVICE INFORMATION	
BUSINESS NAME	USIC
RESPONSIBLE PARTY PERSONAL NAME	Morgan Thompson
TITLE (IF ANY)	Claims Coordinator
ADDRESS	9045 N. River Rd. Suite 300
CITY/ STATE/ZIP	Indianapolis, IN 46240
PREFERRED TELEPHONE	1-317-538-7301
CELL PHONE TELEPHONE	
EMAIL ADDRESS	morganthompson@usicinc.com
OTHER (WITNESS, POLICE, FIRE, OTHER) INFORMATION	
PERSONAL CONTACT	
BUSINESS/ORGANIZATION NAME	
TITLE (IF ANY)	

ADDRESS	
CITY/ STATE/ZIP	
PREFERRED TELEPHONE	
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
UTILITY LINE IMPACT	
LOCATION OF DAMAGE	
ADDRESS	Fellows St
CITY/STATE/ZIP	South Bend, IN 46614
NEAREST INTERSECTION	Altgeld St
PRODUCT TYPE (Select One)	
NATURAL GAS	X
LIQUID PIPELINE	
UNKNOWN/OTHER	
FACILITY TYPE (Select One)	
DISTRIBUTION	
GATHERING	
SERVICE/DROP	X
TRANSMISSION	
UNKNOWN/OTHER	
SIZE (DIAMETER/ETC.)	5/8" plastic
PRESSURE (PSIG/INCHES)	N/A
INTERRUPTION IN SERVICE (YES/NO)	Yes
NUMBER OF CUSTOMERS AFFECTED	1
EVACUATION (YES/NO)	No
IF YES, HOW MANY EVACUATED	0
REPAIR COST (IF KNOWN) (\$)	N/A
CAUSE OF DAMAGE INFORMATION:	
TYPE OF EQUIPMENT (Select One)	
Auger	X
Backhoe/Trackhoe	
Boring/Drilling	
Directional Drilling	
Explosives	
Farm Equipment	
Grader/Scraper	
Hand Tools	
Milling Equipment	
Probing Device	

Trancher	
Vacuum Equipment	
Unknown/Other	
TYPE OF WORK PERFORMED (Select One)	
Agriculture	
Cable TV	X
Curb/Sidewalk	
Bldg. Construction	
Bldg. Demolition	
Drainage	
Driveway	
Electric	
Engineering/Surveying	
Fencing	
Grading	
Irrigation	
Landscaping	
Liquid Pipeline	
Milling	
Natural Gas	
Pole	
Public Transit Authority	
Railroad Maintenance	
Road Work	
Sewer (Sanitary/Storm)	
Site Development	
Steam	
Storm Drain/Culvert	
Street Light	
Telecommunications	
Traffic Signal	
Traffic Sign	
Water	
Waterway Improvement	
Unknown/Other	
RELEASE OF PRODUCT (YES/NO)	Yes
IGNITION AND/OR FIRE (YES/NO)	No
EXCAVATOR NOTIFY 811 (YES/NO)	No
LOCATE INFORMATION:	
EXCAVATOR REQUEST LOCATE (YES/NO)	No

INDIANA 811 LOCATE TICKET NUMBER	N/A
LOCATE MARKS VISIBLE (YES/NO)	No
LOCATE MARKS CORRECT (YES/NO)	No
EXCAVATOR "WHITE LINED" (YES/NO)	No
MAPS USED TO MARK FACILITIES (YES/NO)	No
OPERATOR EMPLOYEES ON-SITE DURING EXCAVATION (YES/NO)	No
INCIDENT IMPACT INFORMATION	
NUMBER OF OUTPATIENT TREATED	0
NUMBER OF INPATIENT TREATED	0
NUMBER OF FATALITIES	0
FIRE DEPARTMENT RESPONSE (YES/NO)	Yes
POLICE DEPARTMENT RESPONSE (YES/NO)	Yes
AMBULANCE RESPONSE (YES/NO)	No
ADDITIONAL INFORMATION/COMMENTS	
<p>No notification made to the one-call center. Nipsco emergency repair ticket – 1208283202.</p>	

NAMES OF UTILITY REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:
N/A

NAMES OF EXCAVATOR'S REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:
N/A

LIST ANY OTHER INDIVIDUALS ON SITE:
N/A

WERE ANY MARKINGS VISIBLE ON THE DAMAGE SITE UPON ARRIVAL? No

WERE ANY OTHER INDICATORS OF FACILITY PRESENT IN THE AREA? No

WAS THE EXCAVATION WITHIN THE TOLERANCE ZONE OF MARKS? No

EXTENT OF FACILITY DAMAGE Cut gas service

REPLACEMENT FOOTAGE N/A

WAS CONTRACTOR ASSISTANCE REQUIRED? IF YES, WHO? No N/A

WHAT CONTRACTOR EQUIPMENT WAS USED? Anchor

IS THE FACILITY SHOWN ON THE UTILITY RECORDS? No

IF YES, PLEASE LIST RECORD #(S) N/A

NORTHERN INDIANA PUBLIC SERVICE COMPANY
FACILITY DAMAGE REPORT

** COMPLETE FORM FOR ALL DAMAGES TO NIPSCO FACILITIES **

REPORTING OPERATING AREA South Base MAXIMO WO #
OPERATING AREA CONTACT Gary Dodge JOB ORDER # 575742
TRACKING NUMBER 018-2012-0828-010 LOCATE REF #
Locate Performed By:

DATE AND TIME OF ACCIDENT 8-28 2012, 16:21 M DATE OF REPORT 8-28-12

PLACE OF DAMAGE (INCLUDE CITY) Clo Algelde & Fellows (418 E Ewing)

DAMAGE WAS TO:

ELECTRIC - POLE / TRANSFORMER: # SIZE YEAR INSTALLED BROKEN YES () NO ()

OTHER (DESCRIBE)

GAS: SERVICE (X) MAIN () SIZE 3/8 MATERIAL: PLASTIC (X) STEEL () METER () REG STATION () STUB ()

DEPTH OF FACILITY (inches) 12" PRESSURE (PSI) 35 Lbs.

RELEASE OF GAS: YES (X) NO () IGNITION OF GAS: YES () NO (X) EVACUATION REQUIRED: YES () # NO (X)

INTERRUPTION OF SERVICE: YES (X) NO () NUMBER OF CUSTOMERS LOST: 1

DURATION OF INTERRUPTION: TIME REPORTED 16:21 TIME RESTORED 19:30

DIAMETER/MEASUREMENT OF HOLE IN GAS FACILITY: 3/8

LOCATE MARKS ON SITE: YES () DISTANCE BETWEEN FACILITY AND LOCATE MARKS HOW LOCATED: PAINT () FLAGS () BOTH () WHITE LINED ()

PARTY THAT CAUSED DAMAGES (NAME) Gordon Engineering

ADDRESS OF PARTY (INCLUDE CITY) 2534 Detroit Rd Niles Mi Ph 269-683-6554

WHO WAS IN CHARGE OF THE WORK SITE AT TIME OF DAMAGE Lanny Moonman

WITNESS NAME AND ADDRESS

WITNESS REMARKS

AGENCIES NOTIFIED / ONSITE: POLICE (X) AGENCY REPORT # FIRE (X) AGENCY REPORT # OTHER () Any Injuries? () YES # NO (X)

PHOTOS TAKEN: YES () NO (X) TAKEN BY: MEDIA ON SITE YES (X) NO () (ATTACH PHOTOS TO REPORT)

WORK IN PROGRESS WHEN FACILITY DAMAGED - CHECK APPROPRIATE CHOICE BELOW

- () AGRICULTURE/FARMING (X) CABLE TV () CURB/SIDEWALK () TELECOMMUNICATIONS
() BLDG CONSTRUCTION () DEMOLITION () DRAINAGE () WATER
() DRIVEWAY () ELECTRIC () SURVEYING () DRAINS/CULVERTS
() FENCING () GRADING () IRRIGATION () MOWING
() LANDSCAPING () PIPELINE () MILLING () OTHER
() POLE/SIGN POST () ROAD WORK () SEWER

TYPE OF EQUIPMENT USED - CHECK APPROPRIATE CHOICE BELOW

- (X) AUGER () HAND TOOLS () BACKHOE/TRACKHOE
() MILLING EQUIPMENT () PROBING DEVICE () BORING / DRILLING
() EXPLOSIVES () TRENCHER () FARM EQUIPMENT
() VACCUUM EQUIPMENT () GRADER () OTHER

REASON DAMAGE OCCURRED - CHECK APPROPRIATE CHOICE BELOW

- (X) AUTOMOTIVE ACCIDENT () EXCAVATING BEFORE LOCATES DUE () CARELESS MACHINE OPERATOR
() NO NOTIFICATION () MARKS DISTURBED () STUB () OTHER

COMMENTS: When Augering Anchor for gas wire - Auger cut
thru 5/8 service.


PERSON PREPARING REPORT K.T.

FIELD SUPERVISOR Gay Dodge - Tim Armstrong

FIELD MANAGER Rick Gray Blaney

- ORIGINAL REPORT AND SUPPORTING INFORMATION IS TO BE SENT TO FACILITY DAMAGE RECOVERY
- COPY OF REPORT IS TO BE SENT TO DAMAGE PREVENTION

SKETCH: - Show position of all pertinent information

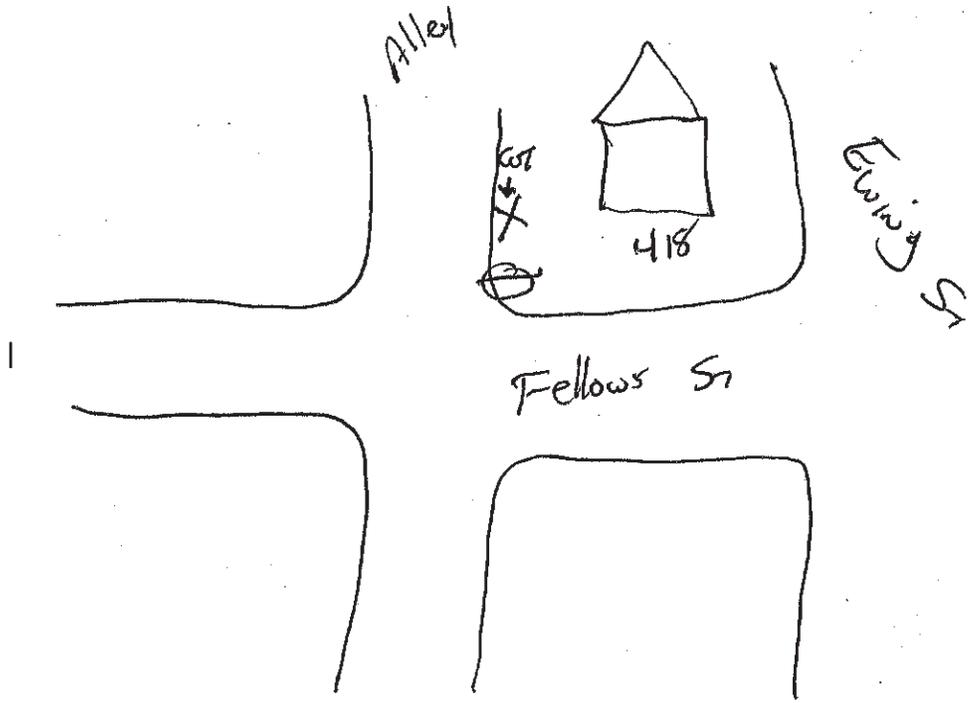

FOR OFFICE USE ONLY:

- | | | |
|---|-----|----|
| • DID EXCAVATION OCCUR BEFORE LOCATES WERE DUE | YES | NO |
| • NO IN 811 LOCATE CALLED IN | YES | NO |
| • DAMAGE CAUSED FROM EXCAVATION WITHIN 24" ZONE | YES | NO |
| • EXPIRED LOCATE | YES | NO |
| • WAS WHITE LINING INDICATED ON LOCATE REQUEST | YES | NO |

COMPLETED BY: _____ DATE: _____



DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)
INDIANA UTILITY REGULATORY COMMISSION

Submitted to IURC-Pipeline Safety on: Oct 8, 2012

Who is submitting this information?

Name of person providing this information: Steve Noffsinger

Business address (number and street): 3511 E 15th Ave

City, State, and ZIP code: Gary, IN, 46403

Telephone number (area code): (219)962-0422

Fax number (area code): (219)962-0404

E-mail address: cludwig@nisource.com

Excavator Information, if known

Full name: Gordon Engineering

Business address (number and street): 2534 Detroit Rd, 49120

City, State, and ZIP code: Niles, MI

Telephone number (area code): (269)683-6554

Fax number (area code): _____

E-mail address: _____

Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Auger

Type of work performed: Cable TV

Date and Location of DamageDate of damage (*month, day, year*): Aug 28, 2012County: St. JosephCity: South BendStreet address (*number and street, city, state, and ZIP code*):
Fellows & Altgeld, South Bend, IN, 46614Nearest intersection: Altgeld StRight of way where damage occurred: Public - City StreetWas there a release of product? YesIf yes, was there an ignition of product? NoWere evacuations necessary as a result of release? NoIf yes, how many evacuated? 0Was there a customer service interruption? YesIf yes, how many affected? 1Time to restore service (*in hours*): 3Enter number of injuries, if applicable and known: 0Enter number of fatalities, if applicable and known: 0Property damage, Estimate \$

Affected Facility InformationWhat type of pipeline was damaged? Natural GasWhat was the affected facility? Service/DropWhat was the depth of the facility, in inches? 12

Notification, Locating, MarkingDid excavator request locates prior to commencing work? NoEnter Indiana 811 ticket number, if known:

Was the locate request completed within two working days? Unknown/Other

If locates were performed, were they done so by a contractor or pipeline employee? Unknown/Other

If a contractor locator, enter the company name, if known: _____

Were facility marks visible in the area of excavation? No

Were facilities marked correctly? Unknown/Other

Type of markings used: Other

If other, please specify: No locates _____

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? Yes

Did the excavator notify Indiana 811 in the event of this damage? No

Did the excavator notify 911 in the event of a release of product? Yes

Description of Cause

Select from the list the most accurate cause for the damage: --No notification made to the one-call center

Additional Comments

Nipsco emergency repair ticket 1208283202