



Pipeline Safety Division Investigation Report

Investigation regarding: H and G Underground Utilities LLC

UPPAC Database Record ID: 4310

Report Date: 9/16/2013

Investigator: Mike Orr

Damage Date: 1/3/2013 3:56:12 PM

Damage Address: In Rt 13, Turkey Creek, Kosciusko

The Parties

Excavator: **H and G Underground Utilities LLC**

Address: 7 Berkel Drive, La Porte, In 46350

Facility Owner: **NIPSCO**

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Type of Equipment: Backhoe/Trackhoe

Type of Work Performed: Sewer

Damage Impact

Product Release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$

Excavator Activities/Cause of Damage Information:

Excavator Request Locates: Yes
12/26/2012

Indiana 811 Ticket Number: 1212200516

Original Start Date:

Locate Instructions: FROM THE INTERSECTION - LOCATE GOING SOUTH ON BOTH SIDES OF IN RT 13 FOR APPROX 700 FEET

Follow-Up Locate Instructions (if applicable):

Synopsis: Excavator struck and damaged an underground natural gas service while performing sewer work.

Findings: Reported by Indiana 811; excavator did not respond to initial notice mailed 2/14/2013. Excavator had a valid locate ticket; however, the gas operator self reported a failure to provide facility locate markings of a second service line on the property.

Conclusion: There was a failure to provide facility locate markings.

Violation: IC 8-1-26-18(f) Operator failed to locate or provided incorrect locate markings.



150 West Market Street, Suite 600
Indianapolis, IN 46204

March 7, 2013

Via Electronic Transmission – PipelineDamageCase@urc.in.gov

Pipeline Safety Division – Case No. 4310
Indiana Utility Regulatory Commission
101 West Washington Street, Suite 1500 East
Indianapolis, Indiana 46204

RE: Investigation Request for Information; Pipeline Division Case No. 4310

To Whom It May Concern:

Attached please find Northern Indiana Public Service Company's ("NIPSCO") written information, and supporting documentation, relating to the following event:

Date of Event: 1/3/2013

Event Location: In Rt 13

City: Turkey Creek

Facility Owner: Northern Indiana Public Service Company

Excavator: H And G Underground Utilities Llc

Other Party: N/A

Pipeline Division Case No. 4310

NIPSCO has reviewed its recovery and damage prevention files for this matter and has provided answers, when known, to the list of questions set forth in the Information Request. To the extent available, NIPSCO is also providing a copy of the Damage Information Report – Pipeline Safety Division previously submitted by NIPSCO to IURC Pipeline Safety as well as additional documentation relating to this Event Location.

Upon completion of the investigation, NIPSCO requests that it be provided with a copy of the Pipeline Division's Investigation Report with findings that will be forwarded to the Underground Plant Protection Advisory Committee. If there are any additional questions, please contact the undersigned.

Very truly yours,

Christopher C. (Kit) Earle
NiSource Corporate Services - Legal
Phone: 317-684-4904
Fax: 317-684-4918
Email: cearle@nisource.com

IURC INFORMATION REQUEST	
Pipeline Safety Division Case No. 4310	
Date of Event	1/3/2013
Event Location	In Rt 13
Event City	Turkey Creek
Facility Owner	Northern Indiana Public Service Company
Excavator	H And G Underground Utilities Llc
Date of IURC Information Request	2/13/2013
THE PARTIES	
EXCAVATOR:	
BUSINESS NAME	H and G Underground Utilities
RESPONSIBLE PARTY PERSONAL NAME	
TITLE (IF ANY)	
ADDRESS	7 Berkel Drive
CITY/ STATE/ZIP	La Porte / IN / 46350
PREFERRED TELEPHONE	(219) 326-0000
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
FACILITY INFORMATION - OWNER/OPERATOR OF UTILITY LINE:	
BUSINESS NAME	NORTHERN INDIANA PUBLIC SERVICE COMPANY
RESPONSIBLE PARTY PERSONAL NAME	LUKE SELKING
TITLE	
ADDRESS	1501 HALE AVENUE
CITY/STATE/ZIP	FORT WAYNE, IN 46802
PREFERRED TELEPHONE	260/439-1290
SECONDARY TELEPHONE	
EMAIL ADDRESS	LSELKING@NISOURCE.COM
LOCATOR SERVICE INFORMATION	
BUSINESS NAME	USIC
RESPONSIBLE PARTY PERSONAL NAME	Morgan Thompson
TITLE (IF ANY)	Claims Coordinator
ADDRESS	9045 N. River Rd. Suite 300
CITY/ STATE/ZIP	Indianapolis, IN 46240
PREFERRED TELEPHONE	1-317-538-7301
CELL PHONE TELEPHONE	Same
EMAIL ADDRESS	morganthompson@usicinc.com
OTHER (WITNESS, POLICE, FIRE, OTHER) INFORMATION	
PERSONAL CONTACT	
BUSINESS/ORGANIZATION NAME	
TITLE (IF ANY)	

ADDRESS	
CITY/ STATE/ZIP	
PREFERRED TELEPHONE	
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
UTILITY LINE IMPACT	
LOCATION OF DAMAGE	
ADDRESS	1403 N Indiana Avenue
CITY/STATE/ZIP	Syracuse / IN / 46567
NEAREST INTERSECTION	S County Line Road
PRODUCT TYPE (Select One)	
NATURAL GAS	X
LIQUID PIPELINE	
UNKNOWN/OTHER	
FACILITY TYPE (Select One)	
DISTRIBUTION	
GATHERING	
SERVICE/DROP	X
TRANSMISSION	
UNKNOWN/OTHER	
SIZE (DIAMETER/ETC.)	5/8"
PRESSURE (PSIG/INCHES)	
INTERRUPTION IN SERVICE (YES/NO)	Y
NUMBER OF CUSTOMERS AFFECTED	1
EVACUATION (YES/NO)	N
IF YES, HOW MANY EVACUATED	
REPAIR COST (IF KNOWN) (\$)	
CAUSE OF DAMAGE INFORMATION:	
TYPE OF EQUIPMENT (Select One)	
Auger	
Backhoe/Trackhoe	X
Boring/Drilling	
Directional Drilling	
Explosives	
Farm Equipment	
Grader/Scraper	
Hand Tools	
Milling Equipment	
Probing Device	

Trencher	
Vacuum Equipment	
Unknown/Other	
TYPE OF WORK PERFORMED (Select One)	
Agriculture	
Cable TV	
Curb/Sidewalk	
Bldg. Construction	
Bldg. Demolition	
Drainage	
Driveway	
Electric	
Engineering/Surveying	
Fencing	
Grading	
Irrigation	
Landscaping	
Liquid Pipeline	
Milling	
Natural Gas	
Pole	
Public Transit Authority	
Railroad Maintenance	
Road Work	
Sewer (Sanitary/Storm)	X
Site Development	
Steam	
Storm Drain/Culvert	
Street Light	
Telecommunications	
Traffic Signal	
Traffic Sign	
Water	
Waterway Improvement	
Unknown/Other	
RELEASE OF PRODUCT (YES/NO)	Y
IGNITION AND/OR FIRE (YES/NO)	N
EXCAVATOR NOTIFY 811 (YES/NO)	Y 1301032099
LOCATE INFORMATION:	
EXCAVATOR REQUEST LOCATE (YES/NO)	Y

INDIANA 811 LOCATE TICKET NUMBER	1212200516
LOCATE MARKS VISIBLE (YES/NO)	N
LOCATE MARKS CORRECT (YES/NO)	N/A
EXCAVATOR "WHITE LINED" (YES/NO)	N
MAPS USED TO MARK FACILITIES (YES/NO)	N/A
OPERATOR EMPLOYEES ON-SITE DURING EXCAVATION (YES/NO)	N
INCIDENT IMPACT INFORMATION	
NUMBER OF OUTPATIENT TREATED	
NUMBER OF INPATIENT TREATED	
NUMBER OF FATALITIES	
FIRE DEPARTMENT RESPONSE (YES/NO)	N/A
POLICE DEPARTMENT RESPONSE (YES/NO)	N/A
AMBULANCE RESPONSE (YES/NO)	N/A
ADDITIONAL INFORMATION/COMMENTS	
<p>Facility was not located or marked.</p> <p>Emergency Ticket# 1301032126.</p>	

Fact Based Investigation Report

NOTIFICATION ID: 01820130103008

DISTRICT: Northern IN

DAMAGE DATE: 1/3/2013 12:00:00 AM

NOTIFICATION DATE: 1/3/2013 4:18:35 PM

NOTIFIED BY: LAURA Facility Owner

DAMAGE ADDRESS: 1403 N INDIANA AVE (IN RT 3)

CITY: SYRACUSE

ST: IN ZIP:

DAMAGED CUSTOMER: NIPSCO

INVESTIGATION DATE: 01/03/2013

FROM: 18:35:00

TO: 19:50:00

EXCAVATOR INVOLVED: H&G EXCAVATION

TYPE OF EXCAVATION: Install Sewer and Water

ORIG. LOCATE REQ.: 1212200516

START DATE/TIME: 12/26/2012 10:30:00 AM

TYPE OF TICKET: Ongoing Project

LOCATE REQ. INFO N/A:

DIG UP/DAMAGE REQ.: 1301032099

START DATE/TIME: 1/3/2013 3:55:00 PM

PICTURES TAKEN BY: Sean Travis

DATE/TIME: 1/3/2013 6:55:00 PM

PHOTOGRAPHY TYPE: Digital

FRAME #:

INVESTIGATOR EMP#: 128296

INVESTIGATOR NAME: Sean Travis

BASED ON YOUR INVESTIGATION, IS FURTHER INVESTIGATION NEEDED? No

Fact Based Investigation Customer Information

NOTIFICATION ID: 01820130103008

SELECT A CUSTOMER: NIPSCO

CUSTOMER #: (optional)

FACILITY DESCRIPTION: LOWPROF

FACILITY ID: Gas Service

LOCATOR NAME & EMP #: Pasko Tom - 121650

LOCATOR NOT KNOWN:

CHECK ALL THAT APPLY TO INVESTIGATION:

Other

Other: not marked

CHECK ALL THAT APPLY TO METHOD OF INVESTIGATION (at least one must be checked):

Visual, Facility Exposed At Time Of Investigation,
Investigator Verified Existing Marks By Hooking Up,
Investigation Results Verified By Utility Representative

INVESTIGATOR STATEMENT/CAUSAL FACTORS:

Arrived on site to find damaged half inch service. Was not marked. At address 1403 there is a building in rear that is fenced

in. Meter came off of that building and was visually obstructed by vehicles and dumpster in parking lot.

NAMES OF UTILITY REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

George Freeman. Made repairs.

NAMES OF EXCAVATOR'S REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

n/a

LIST ANY OTHER INDIVIDUALS ON SITE:

n/a

WERE ANY MARKINGS VISIBLE ON THE DAMAGE SITE UPON ARRIVAL? No

WERE ANY OTHER INDICATORS OF FACILITY PRESENT IN THE AREA? No

WAS THE EXCAVATION WITHIN THE TOLERANCE ZONE OF MARKS? No

EXTENT OF FACILITY DAMAGE cut service

REPLACEMENT FOOTAGE 1 ft

WAS CONTRACTOR ASSISTANCE REQUIRED? IF YES, WHO? No

WHAT CONTRACTOR EQUIPMENT WAS USED? Excavator

IS THE FACILITY SHOWN ON THE UTILITY RECORDS? No

IF YES, PLEASE LIST RECORD #(S)

Facility: Transmission Lines; Folder: GM & T tickets; Assigned To: N/A

NIPSCO 00133 IUPPSa 12/20/2012 10:19:50 1212200516-00A NORM NEW GRID

NORMAL NOTICE

Ticket : 1212200516 Date: 12/20/2012 Time: 10:15 Oper: CJODOM Chan:056

State: IN Cnty: KOSCIUSKO Twp: TURKEY CREEK
Cityname: SYRACUSE Inside: Y Near: N
Subdivision:

Address :

Street : IN RT 13

Cross 1 : S COUNTY LINE RD Within 1/4 mile: Y

Location: FROM THE INTERSECTION - LOCATE GOING SOUTY ON BOTH SIDES OF IN RT 13
FOR APPROX 700 FEET

***Boring Where = UNDER IN RT 13

:

Grids : 4125A8545D 4126D8544A 4126D8545D

Boundary: n 41.435914 s 41.432736 w -85.751734 e -85.749173

Work type : INSTALL SEWER AND WATER LINES

Done for : TOWN OF SYCARUSE

Start date: 12/26/2012 Time: 10:30 Hours notice: 144/048 Priority: NORM

Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N

Duration : 3 MONTHS Depth: 6 FEET

Company : H AND G UNDERGROUND UTILITIES LLC Type: CONT

Co addr : 7 BERKEL DRIVE

City : LA PORTE State: IN Zip: 46350

Caller : MATT BERNACCHI Phone: (219)326-0000

Contact : MATT BERNACCHI - OFFICE Phone:

BestTime:

Mobile : (219)326-0000

Fax : (219)326-6656

Email : MATT@HNGUU.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time
Will you be white-lining the dig site area? NO

:

Submitted date: 12/20/2012 Time: 10:15

Members: ID2034 ID3229 ID5857 ID7634 NIPSCO SM

Facility: Transmission Lines; Folder: GM & T tickets; Assigned To: N/A

NIPSCO 00596 IUPPSa 01/03/2013 15:56:16 1301032099-00A EMER DAMG GRID

DAMAGE SEE REMARKS

Ticket : 1301032099 Date: 01/03/2013 Time: 15:53 Oper: AHINES Chan:075

State: IN Cnty: KOSCIUSKO Twp: TURKEY CREEK
Cityname: SYRACUSE Inside: Y Near: N
Subdivision:

Address :

Street : IN RT 13

Cross 1 : S COUNTY LINE RD Within 1/4 mile: Y

Location: FROM THE INTERSECTION - LOCATE GOING SOUTY ON BOTH SIDES OF IN RT 13
FOR APPROX 700 FEET

***Boring Where = UNDER IN RT 13

:

Grids : 4125A8545D 4126D8544A 4126D8545D

Boundary: n 41.435914 s 41.432736 w -85.751734 e -85.749173

Work type : INSTALL SEWER AND WATER LINES

Done for : TOWN OF SYCARUSE

Start date: 01/03/2013 Time: 15:53 Hours notice: 0/000 Priority: EMER

Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: Y

Duration : 3 MONTHS Depth: 6 FEET

Company : H AND G UNDERGROUND UTILITIES LLC Type: CONT

Co addr : 7 BERKEL DRIVE

City : LA PORTE State: IN Zip: 46350

Caller : MATT BERNACCHI Phone: (219)326-0000

Contact : MATT BERNACCHI - OFFICE Phone:

BestTime:

Mobile : (219)326-0000

Fax : (219)326-6656

Email : MATT@HNGUU.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time

A GAS LINE HAS BEEN DAMAGED -- CALLER THINKS THE LINE BELONGS TO NIPSCO -- THE
LINE IS NOT BLOWING -- THE LINE WAS DAMAGED IN THE FRONT OF THE PROPERTY -- THE
LINE IS 1/2 INCH ORANGE LINE -- ADVISED CALLER TO CONTACT 911 -- CREW IS ON SITE
-- ADVISED CALLER TO CONTACT THE UTILITY COMPANY -- PREVIOUS TICKET 1212200516

Will you be white-lining the dig site area? NO

:

Submitted date: 01/03/2013 Time: 15:53

Members: ID2034 ID3229 ID5857 ID7634 NIPSCO SM

Facility: Transmission Lines; Folder: GM & T tickets; Assigned To: N/A

NIPSCO 00602 IUPPSa 01/03/2013 16:12:30 1301032126-00A EMER NEW GRID

EMERGENCY EMERGENCY

Ticket : 1301032126 Date: 01/03/2013 Time: 16:08 Oper: LSTEVENSON Chan:018

State: IN Cnty: KOSCIUSKO Twp: TURKEY CREEK
Cityname: SYRACUSE Inside: Y Near: N
Subdivision:

Address : 1403
Street : N INDIANA AVE
Cross 1 : N HARRISON ST Within 1/4 mile: Y
Location: LOCATE THE ENTIRE PROPERTY
:
Grids : 4125A8545D 4126D8544A 4126D8545D
Boundary: n 41.436600 s 41.431367 w -85.753360 e -85.749063

Work type : REPAIR GAS LINE
Done for : NIPSCO
Start date: 01/03/2013 Time: 16:10 Hours notice: 0/000 Priority: EMER
Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: Y
Duration : 1 DAY Depth: 6 FEET

Company : NIPSCO Type: MEMB
Co addr : 801 E. 86TH AVE
City : MERRILLVILLE State: IN Zip: 46410
Caller : LAURA SZCZECINA Phone: (800)322-2806
Contact : RICH WALGREN - CELL Phone:
BestTime:
Mobile : (574)360-9736
Fax : (219)647-4764

Remarks : All tickets are taken and processed on Eastern Daylight Time
CREW IS EN ROUTE

Will you be white-lining the dig site area? NO
:

Submitted date: 01/03/2013 Time: 16:08
Members: ID2034 ID3229 ID5857 ID7634 ID9000 NIPSCO SM

NORTHERN INDIANA PUBLIC SERVICE COMPANY FACILITY DAMAGE REPORT

** COMPLETE FORM FOR ALL DAMAGES TO NIPSCO FACILITIES **

REPORTING OPERATING AREA Garhew MAXIMO WO # _____
 OPERATING AREA CONTACT Joe Cole JOB ORDER # 547386
 TRACKING NUMBER 018 2013 0603 008 LOCATE REF # _____
 Locate Performed By: _____

DATE AND TIME OF ACCIDENT 01-03-2013 3:55p M DATE OF REPORT 01-03-2013
 PLACE OF DAMAGE (INCLUDE CITY) 1403 N INDIANA AVE Building 1 Syracuse

DAMAGE WAS TO:
ELECTRIC - POLE / TRANSFORMER: # _____ SIZE _____ YEAR INSTALLED _____ BROKEN YES () NO ()
 OTHER (DESCRIBE) _____

GAS: SERVICE MAIN () SIZE 5/8 MATERIAL: PLASTIC STEEL () METER () REG STATION () STUB ()
 OTHER (DESCRIBE) _____

DEPTH OF FACILITY (inches) 12" PRESSURE (PSI) 50 Lbs.

RELEASE OF GAS: YES NO () IGNITION OF GAS: YES () NO EVACUATION REQUIRED: YES () # _____ NO

INTERRUPTION OF SERVICE: YES NO () NUMBER OF CUSTOMERS LOST: 1

DURATION OF INTERRUPTION: TIME REPORTED 3:55pm TIME RESTORED 7pm

DIAMETER/MEASUREMENT OF HOLE IN GAS FACILITY: cut through 5/8

LOCATE MARKS ON SITE: YES () DISTANCE BETWEEN FACILITY AND LOCATE MARKS _____ NO
 HOW LOCATED: PAINT () FLAGS () BOTH () WHITE LINED ()

PARTY THAT CAUSED DAMAGES (NAME) H&G UTILITIES

ADDRESS OF PARTY (INCLUDE CITY) 7 Berkel Dr. La Porte IN 46350

WHO WAS IN CHARGE OF THE WORK SITE AT TIME OF DAMAGE Scott Schwark

WITNESS NAME AND ADDRESS N/A

WITNESS REMARKS N/A

AGENCIES NOTIFIED / ONSITE: POLICE () AGENCY N/A REPORT # _____

FIRE () AGENCY N/A REPORT # _____

OTHER () N/A Any Injuries? () YES # _____ NO

PHOTOS TAKEN: YES () NO TAKEN BY: _____ (ATTACH PHOTOS TO REPORT)
 MEDIA ON SITE YES () NO

- WORK IN PROGRESS WHEN FACILITY DAMAGED** - CHECK APPROPRIATE CHOICE BELOW
- | | | | |
|--|-------------------------------------|---|---|
| <input type="checkbox"/> AGRICULTURE/FARMING | <input type="checkbox"/> CABLE TV | <input type="checkbox"/> CURB/SIDEWALK | <input type="checkbox"/> TELECOMMUNICATIONS |
| <input type="checkbox"/> BLDG CONSTRUCTION | <input type="checkbox"/> DEMOLITION | <input type="checkbox"/> DRAINAGE | <input type="checkbox"/> WATER |
| <input type="checkbox"/> DRIVEWAY | <input type="checkbox"/> ELECTRIC | <input type="checkbox"/> SURVEYING | <input type="checkbox"/> DRAINS/CULVERTS |
| <input type="checkbox"/> FENCING | <input type="checkbox"/> GRADING | <input type="checkbox"/> IRRIGATION | <input type="checkbox"/> MOWING |
| <input type="checkbox"/> LANDSCAPING | <input type="checkbox"/> PIPELINE | <input checked="" type="checkbox"/> MILLING | <input type="checkbox"/> OTHER _____ |
| <input type="checkbox"/> POLE/SIGN POST | <input type="checkbox"/> ROAD WORK | <input checked="" type="checkbox"/> SEWER | |

- TYPE OF EQUIPMENT USED** - CHECK APPROPRIATE CHOICE BELOW
- | | | |
|--|---|--|
| <input type="checkbox"/> AUGER | <input type="checkbox"/> HAND TOOLS | <input checked="" type="checkbox"/> BACKHOE/TRACKHOE |
| <input type="checkbox"/> MILLING EQUIPMENT | <input type="checkbox"/> PROBING DEVICE | <input type="checkbox"/> BORING / DRILLING |
| <input type="checkbox"/> EXPLOSIVES | <input type="checkbox"/> TRENCHER | <input type="checkbox"/> FARM EQUIPMENT |
| <input type="checkbox"/> VACCUUM EQUIPMENT | <input type="checkbox"/> GRADER | <input type="checkbox"/> OTHER _____ |

- REASON DAMAGE OCCURRED** - CHECK APPROPRIATE CHOICE BELOW
- | | | |
|--|--|--|
| <input type="checkbox"/> AUTOMOTIVE ACCIDENT | <input type="checkbox"/> EXCAVATING BEFORE LOCATES DUE | <input type="checkbox"/> CARELESS MACHINE OPERATOR |
| <input type="checkbox"/> NO NOTIFICATION | <input type="checkbox"/> MARKS DISTURBED | <input type="checkbox"/> STUB |
| | | <input checked="" type="checkbox"/> OTHER <u>Request & no locate</u> |

COMMENTS: 2 Buildings on property & 2 meters, only 1 building located.


PERSON PREPARING REPORT George W Freeman

FIELD SUPERVISOR Mark Kniskern

FIELD MANAGER Rick Long

- ORIGINAL REPORT AND SUPPORTING INFORMATION IS TO BE SENT TO FACILITY DAMAGE RECOVERY
- COPY OF REPORT IS TO BE SENT TO DAMAGE PREVENTION

SKETCH: - Show position of all pertinent information

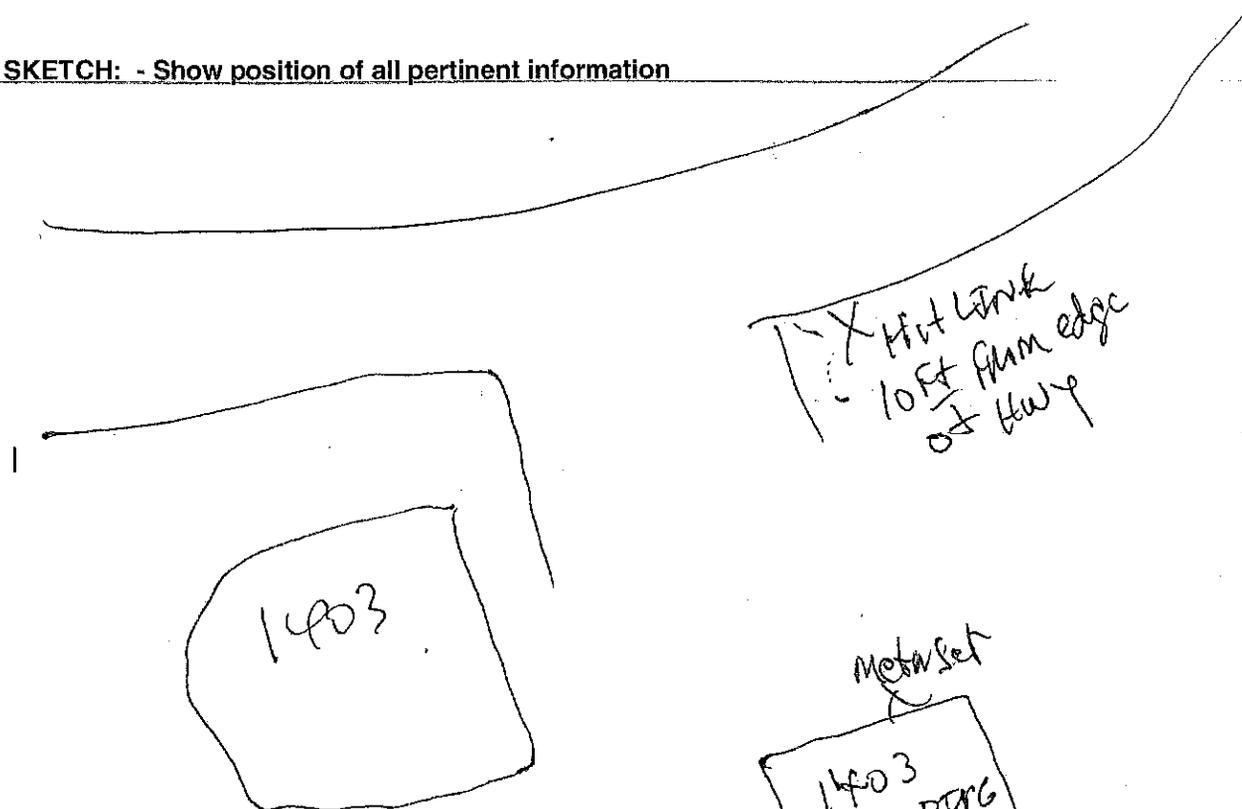

FOR OFFICE USE ONLY:

- | | | |
|---|-----|----|
| • DID EXCAVATION OCCUR BEFORE LOCATES WERE DUE | YES | NO |
| • NO IN 811 LOCATE CALLED IN | YES | NO |
| • DAMAGE CAUSED FROM EXCAVATION WITHIN 24" ZONE | YES | NO |
| • EXPIRED LOCATE | YES | NO |
| • WAS WHITE LINING INDICATED ON LOCATE REQUEST | YES | NO |

COMPLETED BY: _____ DATE: _____

Ticket

1301032126



ID2034 00207 IUPPSa 01/03/2013 16:12:30 1301032126-00A EMER NEW GRID

EMERGENCY EMERGENCY

Ticket : 1301032126 Date: 01/03/2013 Time: 16:08 Oper: LSTEVENSON Chan:018

State: IN Cnty: KOSCIUSKO Twp: TURKEY CREEK
Cityname: SYRACUSE Inside: Y Near: N
Subdivision:

Address : 1403
Street : N INDIANA AVE
Cross 1 : N HARRISON ST Within 1/4 mile: Y
Location: LOCATE THE ENTIRE PROPERTY
:
Grids : 4125A8545D 4126D8544A 4126D8545D
Boundary: n 41.436600 s 41.431367 w -85.753360 e -85.749063

Work type : REPAIR GAS LINE
Done for : NIPSCO
Start date: 01/03/2013 Time: 16:10 Hours notice: 0/000 Priority: EMER
Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: Y
Duration : 1 DAY Depth: 6 FEET

Company : NIPSCO Type: MEMB
Co addr : 801 E. 86TH AVE
City : MERRILLVILLE State: IN Zip: 46410
Caller : LAURA SZCZECINA Phone: (800)322-2806
Contact : RICH WALGREN - CELL Phone:
BestTime:
Mobile : (574)360-9736
Fax : (219)647-4764

Remarks : All tickets are taken and processed on Eastern Daylight Time
CREW IS EN ROUTE
Will you be white-lining the dig site area? NO
:

Submitted date: 01/03/2013 Time: 16:08
Members: ID2034 ID3229 ID5857 ID7634 ID9000 NIPSCO SM

Email_From: IRTH.Net@qwest.com
Email_Subject: Seq# 167: 1301032126 for ID2034
Email_Sent_Date: 2013-01-03 15:13:02 CST
Email_MessageID: <201301032113.r03LD2Xr024028@suomp60i.qintra.com>
Email_host: tickets6.811tickets.com
Email_user: 811.in.ct1
Email_To: 811.in.ct1@tickets.811tickets.com
Email_ContentType: text/Plain; charset=US-ASCII

Ticket

1301032126



Ticket Position: 41.4339835,-85.7512115


Ticket

1301032126



Attachments

Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183252_IM G0085.jpg	Jan 3, 2013 5:59 PM CST	Travis, Sean	1/3/13 6:32 PM	

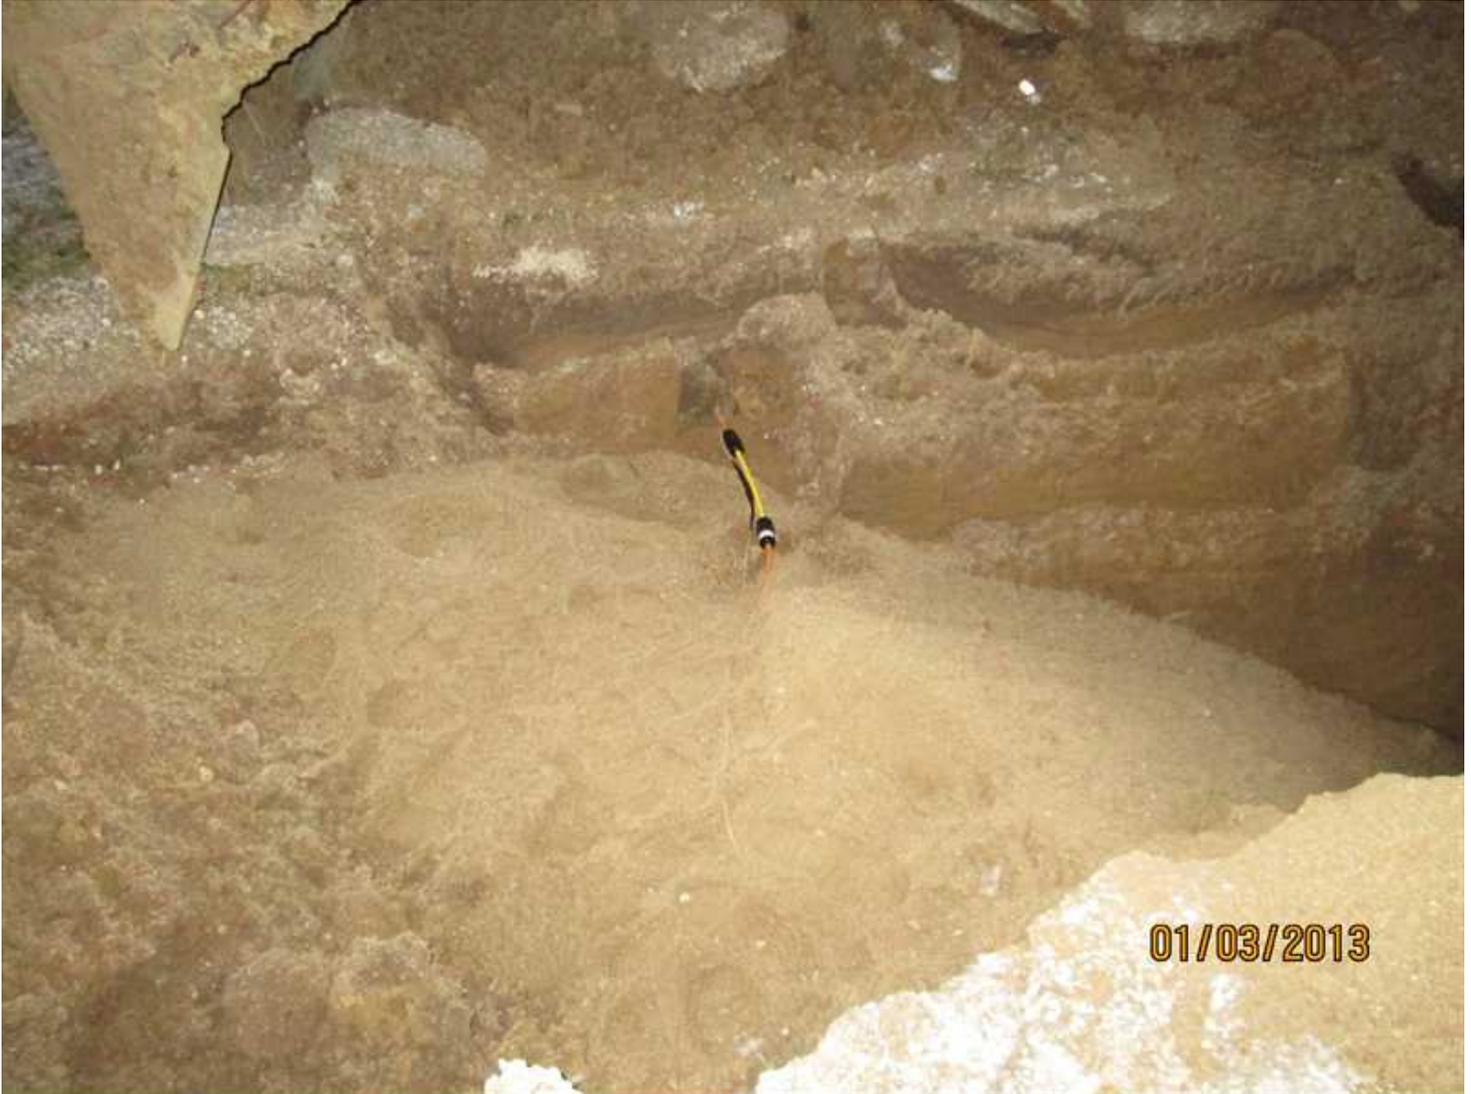

Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:32:52 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183307_IM G0086.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:33 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:33:07 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183324_IM G0087.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:33 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:33:24 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183341_IM G0088.jpg	Jan 3, 2013 5.59 PM CST	Travis, Sean	1/3/13 6:33 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:33:41 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183358_IM G0089.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:33 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:33:58 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103183417_IM G0090.jpg	Jan 3, 2013 5:58 PM CST	Travis, Sean	1/3/13 6:34 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:34:17 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185356_IM G0091.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:53 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:53:56 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185415_IM G0092.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:54 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:54:15 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185441_IM G0093.jpg	Jan 3, 2013 5:58 PM CST	Travis, Sean	1/3/13 6:54 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:54:41 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185458_IM G0094.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:54 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:54:58 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185521_IM G0095.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:55 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:55:21 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185533_IM G0096.jpg	Jan 3, 2013 5:58 PM CST	Travis, Sean	1/3/13 6:55 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:55:33 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185547_IM G0097.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:55 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:55:47 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185603_IM G0098.jpg	Jan 3, 2013 5.58 PM CST	Travis, Sean	1/3/13 6:56 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:56:03 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	20130103185616_IM G0099.jpg	Jan 3, 2013 5:57 PM CST	Travis, Sean	1/3/13 6:56 PM	



Property of United States Infrastructure Corporation
Photo taken on 1/3/2013 6:56:16 PM

Ticket

1301032126



Attached to	Name	Upload Date	Uploaded by	Created	Position
Ticket 1301032126	callout_2013-01-03- 15-21-00.mp3	Jan 3, 2013 3.42 PM CST	Schlemmer, Dan		
Ticket 1301032126	callout_2013-01-03- 15-27-40.mp3	Jan 3, 2013 3.43 PM CST	Schlemmer, Dan		
Ticket 1301032126	callout_2013-01-03- 15-28-55.mp3	Jan 3, 2013 3.43 PM CST	Travis, Sean		
Ticket 1301032126	response_sent_66238 451.txt	Jan 4, 2013 5.22 PM CST	System		