



Pipeline Safety Division Investigation Report

Investigation regarding: All Bore, Inc.

UPPAC Database Record ID: 4319

Report Date: 9/16/2013

Investigator: Mike Orr

Damage Date: 1/8/2013 2:03:51 PM

Damage Address: Inwood Dr, St Joseph, Allen

The Parties

Excavator: **All Bore, Inc.**

Address: 16100 Allisonville Road, Noblesville, In 46060

Facility Owner: **NIPSCO**

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Distribution

Type of Equipment: Drilling

Type of Work Performed: Telecommunications

Damage Impact

Product Release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 22

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$

Excavator Activities/Cause of Damage Information:

Excavator Request Locates: Yes
1/2/2013

Indiana 811 Ticket Number: 1212280105

Original Start Date:

Locate Instructions: FROM THE SOUTHEAST CORNER OF ABOVE TRAVEL SOUTH APPROX 1500 FEET --
LOCATE THE EAST SIDE OF INWOOD DR GOING SOUTH FOR APPROX 1200 FEET TO THE NORTHEAST
CORNER OF INWOOD DR AND LAKE AVE

Follow-Up Locate Instructions (if applicable):

Synopsis: Excavator struck and damaged an underground natural gas main while performing telecommunications work.

Findings: Reported by Indiana 811; excavator did not respond to initial notice 2/14/2013. Excavator had a valid locate ticket; however, the gas operator self reported the facility was mis-located.

Conclusion: There was a failure to provide accurate facility locate markings

Violation: IC 8-1-26-18(f) Operator failed to locate or provided incorrect locate markings.



150 West Market Street, Suite 600
Indianapolis, IN 46204

March 7, 2013

Via Electronic Transmission – PipelineDamageCase@urc.in.gov

Pipeline Safety Division – Case No. 4319
Indiana Utility Regulatory Commission
101 West Washington Street, Suite 1500 East
Indianapolis, Indiana 46204

RE: Investigation Request for Information; Pipeline Division Case No. 4319

To Whom It May Concern:

Attached please find Northern Indiana Public Service Company's ("NIPSCO") written information, and supporting documentation, relating to the following event:

Date of Event: 1/8/2013

Event Location: Inwood Dr

City: St Joseph

Facility Owner: Northern Indiana Public Service Company

Excavator: All Bore

Other Party: N/A

Pipeline Division Case No. 4319

NIPSCO has reviewed its recovery and damage prevention files for this matter and has provided answers, when known, to the list of questions set forth in the Information Request. To the extent available, NIPSCO is also providing a copy of the Damage Information Report – Pipeline Safety Division previously submitted by NIPSCO to IURC Pipeline Safety as well as additional documentation relating to this Event Location.

Upon completion of the investigation, NIPSCO requests that it be provided with a copy of the Pipeline Division's Investigation Report with findings that will be forwarded to the Underground Plant Protection Advisory Committee. If there are any additional questions, please contact the undersigned.

Very truly yours,

Christopher C. (Kit) Earle
NiSource Corporate Services - Legal
Phone: 317-684-4904
Fax: 317-684-4918
Email: cearle@nisource.com

IURC INFORMATION REQUEST	
Pipeline Safety Division Case No. 4319	
Date of Event	1/8/2013
Event Location	Inwood Dr
Event City	St Joseph
Facility Owner	Northern Indiana Public Service Company
Excavator	All Bore
Date of IURC Information Request	2/13/2013
THE PARTIES	
EXCAVATOR:	
BUSINESS NAME	All Bore
RESPONSIBLE PARTY PERSONAL NAME	
TITLE (IF ANY)	
ADDRESS	16100 Allisonville Road
CITY/ STATE/ZIP	Noblesville / IN / 46060
PREFERRED TELEPHONE	(317) 670-5509
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
FACILITY INFORMATION - OWNER/OPERATOR OF UTILITY LINE:	
BUSINESS NAME	NORTHERN INDIANA PUBLIC SERVICE COMPANY
RESPONSIBLE PARTY PERSONAL NAME	LUKE SELKING
TITLE	
ADDRESS	1501 HALE AVENUE
CITY/STATE/ZIP	FORT WAYNE, IN 46802
PREFERRED TELEPHONE	260/439-1290
SECONDARY TELEPHONE	
EMAIL ADDRESS	LSELKING@NISOURCE.COM
LOCATOR SERVICE INFORMATION	
BUSINESS NAME	USIC
RESPONSIBLE PARTY PERSONAL NAME	Morgan Thompson
TITLE (IF ANY)	Claims Coordinator
ADDRESS	9045 N. River Rd. Suite 300
CITY/ STATE/ZIP	Indianapolis, IN 46240
PREFERRED TELEPHONE	1-317-538-7301
CELL PHONE TELEPHONE	Same
EMAIL ADDRESS	morganthompson@usicinc.com
OTHER (WITNESS, POLICE, FIRE, OTHER) INFORMATION	
PERSONAL CONTACT	
BUSINESS/ORGANIZATION NAME	
TITLE (IF ANY)	

ADDRESS	
CITY/ STATE/ZIP	
PREFERRED TELEPHONE	
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
UTILITY LINE IMPACT	
LOCATION OF DAMAGE	
ADDRESS	1818 N. Coliseum Blvd
CITY/STATE/ZIP	Fort Wayne / IN / 46805
NEAREST INTERSECTION	E State Blvd
PRODUCT TYPE (Select One)	
NATURAL GAS	X
LIQUID PIPELINE	
UNKNOWN/OTHER	
FACILITY TYPE (Select One)	
DISTRIBUTION	X
GATHERING	
SERVICE/DROP	
TRANSMISSION	
UNKNOWN/OTHER	
SIZE (DIAMETER/ETC.)	2"
PRESSURE (PSIG/INCHES)	
INTERRUPTION IN SERVICE (YES/NO)	Y
NUMBER OF CUSTOMERS AFFECTED	22
EVACUATION (YES/NO)	N
IF YES, HOW MANY EVACUATED	
REPAIR COST (IF KNOWN) (\$)	
CAUSE OF DAMAGE INFORMATION:	
TYPE OF EQUIPMENT (Select One)	
Auger	
Backhoe/Trackhoe	
Boring/Drilling	X
Directional Drilling	
Explosives	
Farm Equipment	
Grader/Scraper	
Hand Tools	
Milling Equipment	
Probing Device	

Trencher	
Vacuum Equipment	
Unknown/Other	
TYPE OF WORK PERFORMED (Select One)	
Agriculture	
Cable TV	
Curb/Sidewalk	
Bldg. Construction	
Bldg. Demolition	
Drainage	
Driveway	
Electric	
Engineering/Surveying	
Fencing	
Grading	
Irrigation	
Landscaping	
Liquid Pipeline	
Milling	
Natural Gas	
Pole	
Public Transit Authority	
Railroad Maintenance	
Road Work	
Sewer (Sanitary/Storm)	
Site Development	
Steam	
Storm Drain/Culvert	
Street Light	
Telecommunications	X
Traffic Signal	
Traffic Sign	
Water	
Waterway Improvement	
Unknown/Other	
RELEASE OF PRODUCT (YES/NO)	Y
IGNITION AND/OR FIRE (YES/NO)	N
EXCAVATOR NOTIFY 811 (YES/NO)	Y 1301081253
LOCATE INFORMATION:	
EXCAVATOR REQUEST LOCATE (YES/NO)	Y

INDIANA 811 LOCATE TICKET NUMBER	1212280105
LOCATE MARKS VISIBLE (YES/NO)	Y
LOCATE MARKS CORRECT (YES/NO)	Y
EXCAVATOR "WHITE LINED" (YES/NO)	N
MAPS USED TO MARK FACILITIES (YES/NO)	Y
OPERATOR EMPLOYEES ON-SITE DURING EXCAVATION (YES/NO)	N
INCIDENT IMPACT INFORMATION	
NUMBER OF OUTPATIENT TREATED	
NUMBER OF INPATIENT TREATED	
NUMBER OF FATALITIES	
FIRE DEPARTMENT RESPONSE (YES/NO)	N/A
POLICE DEPARTMENT RESPONSE (YES/NO)	N/A
AMBULANCE RESPONSE (YES/NO)	N/A
ADDITIONAL INFORMATION/COMMENTS	
<p>Facility marking or location not sufficient (mismarked).</p> <p>Emergency Ticket# 1301081485.</p>	

Fact Based Investigation Report

NOTIFICATION ID: 01820130108005

DISTRICT: Northern IN

DAMAGE DATE: 1/8/2013 2:03:59 PM

NOTIFICATION DATE: 1/8/2013 2:10:15 PM

NOTIFIED BY: STEVE SPILLER

DAMAGE ADDRESS: INWOOD DR & 1818 Coliseum Rd

CITY: FORT WAYNE ST: IN ZIP:

DAMAGED CUSTOMER: NIPSCO

INVESTIGATION DATE: 01/08/2013

FROM: 14:45:00

TO: 15:30:00

EXCAVATOR INVOLVED: ALL BORE INC

TYPE OF EXCAVATION: boring subduct

ORIG. LOCATE REQ.: 1212280105

START DATE/TIME: 1/7/2013 8:00:00 AM

TYPE OF TICKET: Routine

LOCATE REQ. INFO N/A:

DIG UP/DAMAGE REQ.: 1301081253

START DATE/TIME:

PICTURES TAKEN BY: John Deitrick

DATE/TIME: 1/8/2013 3:20:00 PM

PHOTOGRAPHY TYPE: Digital

FRAME #:

INVESTIGATOR EMP#: 131108

INVESTIGATOR NAME: John Deitrick

BASED ON YOUR INVESTIGATION, IS FURTHER INVESTIGATION NEEDED? No

Fact Based Investigation Customer Information

NOTIFICATION ID: 01820130108005

SELECT A CUSTOMER: NIPSCO

CUSTOMER #: (optional)

FACILITY DESCRIPTION: LOWPROF

FACILITY ID: Gas Main

LOCATOR NAME & EMP #: Blanton Eric - 134735

LOCATOR NOT KNOWN:

CHECK ALL THAT APPLY TO INVESTIGATION:

Other

Other: Mismarked

CHECK ALL THAT APPLY TO METHOD OF INVESTIGATION (at least one must be checked):

Visual, Facility Exposed At Time Of Investigation,
Investigator Verified Existing Marks By Hooking Up

INVESTIGATOR STATEMENT/CAUSAL FACTORS:

MAIN CURVED OUT FROM ORIG. PATH FOR ABOUT 25FT BORE CAUGHT THE EDGE OF MAIN AT CURVE- 26IN OFF MARKS- PAINT FROM PREV. TIC SHOWS CORRECT PATH

NAMES OF UTILITY REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

NA

NAMES OF EXCAVATOR'S REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:

NA

LIST ANY OTHER INDIVIDUALS ON SITE:

NA

WERE ANY MARKINGS VISIBLE ON THE DAMAGE SITE UPON ARRIVAL? Yes

WERE ANY OTHER INDICATORS OF FACILITY PRESENT IN THE AREA? Yes

WAS THE EXCAVATION WITHIN THE TOLERANCE ZONE OF MARKS? No

EXTENT OF FACILITY DAMAGE 2IN PL

REPLACEMENT FOOTAGE 5

WAS CONTRACTOR ASSISTANCE REQUIRED? IF YES, WHO? No

WHAT CONTRACTOR EQUIPMENT WAS USED? BORE

IS THE FACILITY SHOWN ON THE UTILITY RECORDS? Yes

IF YES, PLEASE LIST RECORD #(S) 1

Facility: Transmission Lines; Folder: N/A; Assigned To: N/A

NIPSCO 00024 IUPPSa 12/28/2012 08:16:54 1212280105-00A NORM NEW GRID

NORMAL NOTICE

Ticket : 1212280105 Date: 12/28/2012 Time: 08:12 Oper: CJODOM Chan:056

State: IN Cnty: ALLEN Twp: ST JOSEPH
Cityname: FORT WAYNE Inside: Y Near: N
Subdivision:

Address :

Street : INWOOD DR

Cross 1 : E STATE BLVD Within 1/4 mile: Y

Location: FROM THE SOUTHEAST CORNER OF ABOVE TRAVEL SOUTH APPROX 1500 FEET --

LOCATE THE EAST SIDE OF INWOOD DR GOING SOUTH FOR APPROX 1200 FEET TO THE

NORTHEAST CORNER OF INWOOD DR AND LAKE AVE

***Boring Where = ADJACENT TO THE PROPERTY

:

Grids : 4105B8505C 4105B8505D 4105C8505D

Boundary: n 41.093909 s 41.090484 w -85.087542 e -85.086017

Work type : INSTALL CONDUIT FOR FIBER OPTICS

Done for : ON POINT

Start date: 01/02/2013 Time: 08:30 Hours notice: 120/048 Priority: NORM

Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N

Duration : 30 DAYS Depth: UNKNOWN

Company : ALL BORE Type: CONT

Co addr : 16100 ALLISONVILLE ROAD

City : NOBLESVILLE State: IN Zip: 46060

Caller : STEVE SPILLER Phone: (317)670-5509

Contact : STEVE SPILLER - CELL Phone:

BestTime:

Mobile : (317)670-5509

Remarks : All tickets are taken and processed on Eastern Daylight Time

Will you be white-lining the dig site area? NO

:

Submitted date: 12/28/2012 Time: 08:12

Members: AEPIN CC FW ID7150 ID8000 NIPSCO SM

Facility: Transmission Lines; Folder: N/A; Assigned To: N/A

NIPSCO 00386 IUPPSa 01/08/2013 14:03:59 1301081253-00A EMER DAMG GRID

DAMAGE DAMAGE

Ticket : 1301081253 Date: 01/08/2013 Time: 13:59 Oper: DWILSON Chan:006

State: IN Cnty: ALLEN Twp: ST JOSEPH
Cityname: FORT WAYNE Inside: Y Near: N
Subdivision:

Address :

Street : INWOOD DR

Cross 1 : E STATE BLVD Within 1/4 mile: Y

Location: FROM THE SOUTHEAST CORNER OF ABOVE TRAVEL SOUTH APPROX 1500 FEET --

LOCATE THE EAST SIDE OF INWOOD DR GOING SOUTH FOR APPROX 1200 FEET TO THE

NORTHEAST CORNER OF INWOOD DR AND LAKE AVE

***Boring Where = ADJACENT TO THE PROPERTY

:

Grids : 4105B8505C 4105B8505D 4105C8505D

Boundary: n 41.093909 s 41.090484 w -85.087542 e -85.086017

Work type : INSTALL CONDUIT FOR FIBER OPTICS

Done for : ON POINT

Start date: 01/08/2013 Time: 13:59 Hours notice: 0/000 Priority: EMER

Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: Y

Duration : 30 DAYS Depth: UNKNOWN

Company : ALL BORE Type: CONT

Co addr : 16100 ALLISONVILLE ROAD

City : NOBLESVILLE State: IN Zip: 46060

Caller : STEVE SPILLER Phone: (317)670-5509

Contact : STEVE SPILLER - CELL Phone:

BestTime:

Mobile : (317)670-5509

Remarks : All tickets are taken and processed on Eastern Daylight Time

UNKNOWN GAS LINE WAS HIT--ONLY GAS COMPANY LISTED IS NIPSCO--GAS IS BLOWING--CAN

HEAR IT--CANNOT SMELL IT--APPROX 1000 FEET NORTH OF LAKE AVENUE ON EASTSIDE OF

INWOOD DRIVE--CANNOT DESCRIBED THE LINE--DID ADVISE TO CALL 911--CREW IS ON

SITE--WILL CALL NIPSCO--PREVIOUS TICKET 1212280105--

Will you be white-lining the dig site area? NO

:

Submitted date: 01/08/2013 Time: 13:59

Members: AEPIN CC FW ID7150 ID8000 NIPSCO SM

Facility: Transmission Lines; Folder: N/A; Assigned To: N/A

NIPSCO 00460 IUPPSa 01/08/2013 15:02:04 1301081485-00A EMER NEW GRID

EMERGENCY

Ticket : 1301081485 Date: 01/08/2013 Time: 14:58 Oper: TFRICKE Chan:028

State: IN Cnty: ALLEN Twp: ADAMS
Cityname: FORT WAYNE Inside: Y Near: N
Subdivision:

Address : 1818
Street : N COLISEUM BLVD
Cross 1 : LAKE AVE Within 1/4 mile: Y
Location: LOCATE ENTIRE PROPERTY
:
Grids : 4105A8505C 4105A8505D 4105B8505C 4105B8505D 4105C8505C
Grids : 4105C8505D
Boundary: n 41.098531 s 41.089358 w -85.089117 e -85.086654

Work type : REPAIR GAS LINE
Done for : NIPSCO
Start date: 01/08/2013 Time: 15:00 Hours notice: 0/000 Priority: EMER
Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: Y
Duration : 1 DAY Depth: 8 FEET

Company : NIPSCO Type: MEMB
Co addr : 801 E 86TH AVENUE
City : MERRILLVILLE State: IN Zip: 46410
Caller : MARK DILLOSO Phone: (800)322-2806
Contact : ROGER BROWN Phone:
BestTime:
Mobile : (260)433-6622

Remarks : All tickets are taken and processed on Eastern Daylight Time
Will you be white-lining the dig site area? NO
:

Submitted date: 01/08/2013 Time: 14:58
Members: AEPIN CC FW ID4866 ID7150 ID8000 NIPSCO SM

NORTHERN INDIANA PUBLIC SERVICE COMPANY
FACILITY DAMAGE REPORT

** COMPLETE FORM FOR ALL DAMAGES TO NIPSCO FACILITIES **

REPORTING OPERATING AREA FORT WAYNE MAXIMO WO # 17644767
OPERATING AREA CONTACT ROGER BROWN JOB ORDER # 564470
TRACKING NUMBER 018-20130108006 LOCATE REF # 1302081485
Locate Performed By: 1212280105

DATE AND TIME OF ACCIDENT 1-8 2013 14:19 P DATE OF REPORT 1-8-13

PLACE OF DAMAGE (INCLUDE CITY) LAKE AVE AND INWOOD Dr Fort Wayne, IN 46805
* 1818 N. Coliseum

DAMAGE WAS TO:
ELECTRIC - POLE / TRANSFORMER: # _____ SIZE _____ YEAR INSTALLED _____ BROKEN YES () NO ()

OTHER (DESCRIBE) _____
GAS: SERVICE () MAIN SIZE 2" MATERIAL: PLASTIC STEEL () METER () REG STATION () STUB ()
OTHER (DESCRIBE) _____

DEPTH OF FACILITY (Inches) 30 PRESSURE (PSI) 45 Lbs.

RELEASE OF GAS: YES NO () IGNITION OF GAS: YES () NO EVACUATION REQUIRED: YES () # _____ NO

INTERRUPTION OF SERVICE: YES NO () NUMBER OF CUSTOMERS LOST: 22

DURATION OF INTERRUPTION: TIME REPORTED 13:19 TIME SHUT OFF 17:21 TIME RESTORED 19:30

DIAMETER/MEASUREMENT OF HOLE IN GAS FACILITY: Multiple holes in 18" section of pipe hanging from 4 inch holes to 2 inch holes

LOCATE MARKS ON SITE: YES DISTANCE BETWEEN FACILITY AND LOCATE MARKS 1' NO ()
HOW LOCATED: PAINT FLAGS BOTH () WHITE LINED ()

PARTY THAT CAUSED DAMAGES (NAME) All BORE INC. Steve Spiller (317) 670-5509
16100 Allisonville Rd. 46060

ADDRESS OF PARTY (INCLUDE CITY) P.O. Box 1791 Noblesville, IN 46061

WHO WAS IN CHARGE OF THE WORK SITE AT TIME OF DAMAGE GREG NORTON

WITNESS NAME AND ADDRESS RUTTS - WEAVER - CULVER

WITNESS REMARKS WHILE BORING IN TELECOMMUNICATIONS LINE, GREN HIT

AGENCIES NOTIFIED / ONSITE: POLICE () AGENCY _____ REPORT # _____
FIRE () AGENCY _____ REPORT # _____
OTHER () _____ Any Injuries? () YES # _____ NO

PHOTOS TAKEN: YES () NO TAKEN BY: _____ (ATTACH PHOTOS TO REPORT)
MEDIA ON SITE YES () NO

- WORK IN PROGRESS WHEN FACILITY DAMAGED -- CHECK APPROPRIATE CHOICE BELOW
- | | | | |
|----------------------------------------------|-------------------------------------|----------------------------------------|--------------------------------------------------------|
| <input type="checkbox"/> AGRICULTURE/FARMING | <input type="checkbox"/> CABLE TV | <input type="checkbox"/> CURB/SIDEWALK | <input checked="" type="checkbox"/> TELECOMMUNICATIONS |
| <input type="checkbox"/> BLDG CONSTRUCTION | <input type="checkbox"/> DEMOLITION | <input type="checkbox"/> DRAINAGE | <input type="checkbox"/> WATER |
| <input type="checkbox"/> DRIVEWAY | <input type="checkbox"/> ELECTRIC | <input type="checkbox"/> SURVEYING | <input type="checkbox"/> DRAINS/CULVERTS |
| <input type="checkbox"/> FENCING | <input type="checkbox"/> GRADING | <input type="checkbox"/> IRRIGATION | <input type="checkbox"/> MOWING |
| <input type="checkbox"/> LANDSCAPING | <input type="checkbox"/> PIPELINE | <input type="checkbox"/> MILLING | <input type="checkbox"/> OTHER _____ |
| <input type="checkbox"/> POLE/SIGN POST | <input type="checkbox"/> ROAD WORK | <input type="checkbox"/> SEWER | |

- TYPE OF EQUIPMENT USED -- CHECK APPROPRIATE CHOICE BELOW
- | | | |
|--------------------------------------------|-----------------------------------------|-------------------------------------------------------|
| <input type="checkbox"/> AUGER | <input type="checkbox"/> HAND TOOLS | <input checked="" type="checkbox"/> BACKHOE/TRACKHOE |
| <input type="checkbox"/> MILLING EQUIPMENT | <input type="checkbox"/> PROBING DEVICE | <input checked="" type="checkbox"/> BORING / DRILLING |
| <input type="checkbox"/> EXPLOSIVES | <input type="checkbox"/> TRENCHER | <input type="checkbox"/> FARM EQUIPMENT |
| <input type="checkbox"/> VACCUUM EQUIPMENT | <input type="checkbox"/> GRADER | <input type="checkbox"/> OTHER _____ |

- REASON DAMAGE OCCURRED -- CHECK APPROPRIATE CHOICE BELOW
- | | | |
|----------------------------------------------|--------------------------------------------------------|------------------------------------------------------------------|
| <input type="checkbox"/> AUTOMOTIVE ACCIDENT | <input type="checkbox"/> EXCAVATING BEFORE LOCATES DUE | <input type="checkbox"/> CARELESS MACHINE OPERATOR |
| <input type="checkbox"/> NO NOTIFICATION | <input type="checkbox"/> MARKS DISTURBED | <input type="checkbox"/> STUB |
| | | <input checked="" type="checkbox"/> OTHER <u>LOCATES ARE OFF</u> |

COMMENTS :


PERSON PREPARING REPORT STEVE WEACHOCK

FIELD SUPERVISOR g. phillips

FIELD MANAGER Randell Durr

- ORIGINAL REPORT AND SUPPORTING INFORMATION IS TO BE SENT TO FACILITY DAMAGE RECOVERY
- COPY OF REPORT IS TO BE SENT TO DAMAGE PREVENTION

SKETCH: - Show position of all pertinent information

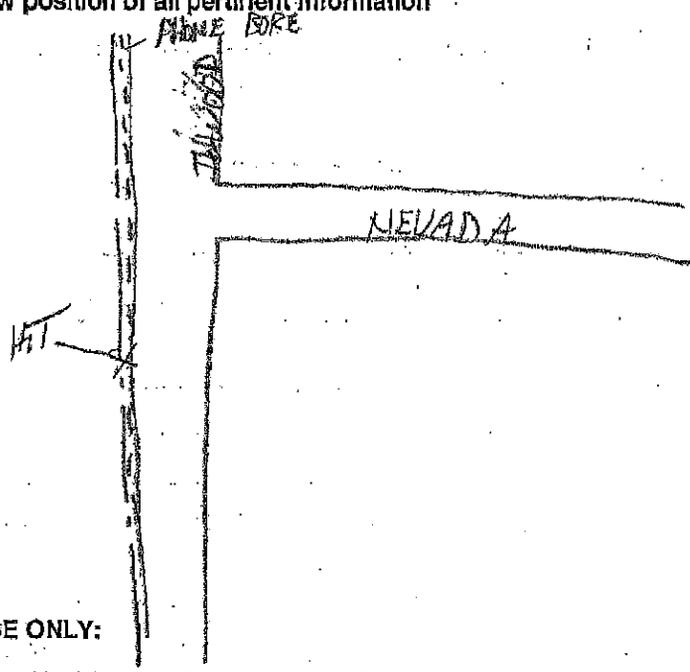

FOR OFFICE USE ONLY:

- | | | |
|-------------------------------------------------|-----|----|
| • DID EXCAVATION OCCUR BEFORE LOCATES WERE DUE | YES | NO |
| • NO IN 811 LOCATE CALLED IN | YES | NO |
| • DAMAGE CAUSED FROM EXCAVATION WITHIN 24" ZONE | YES | NO |
| • EXPIRED LOCATE | YES | NO |
| • WAS WHITE LINING INDICATED ON LOCATE REQUEST | YES | NO |

COMPLETED BY: _____ DATE: _____

Fw: Fort Wayne LOA damage form / Lake Ave & Inwood Dr
Carrie Ludwig to: Tymie Morrow, Deborah Kelley

02/12/2013 07:43 AM

FYI

Carrie Ludwig | Damage Prevention Coordinator
Nipsco Damage Prevention Department
NIPSCO | 3511 East 15th Ave Gary, IN 46403
☎: 219.962.0422 | ✉: cludwig@nisource.com

----- Forwarded by Carrie Ludwig/NCS/Enterprise on 02/12/2013 07:42 AM -----

From: Jason E Otis/NCS/Enterprise
To: David A Schaafsma/NCS/Enterprise@NiSource
Cc: Quentin R Brown/NCS/Enterprise@NiSource, Carrie Ludwig/NCS/Enterprise@NiSource
Date: 02/08/2013 10:22 AM
Subject: Re: Fort Wayne LOA damage form / Lake Ave & Inwood Dr

Dave , I talked with the crew they were saying that the locate was 1' off , it was still with in the 2' zone.

Thanks,
Jason Otis
C/M Supervisor
Nipsco
1501 Hale Ave.
Fort Wayne, IN
Cell 260-241-3246
Office 260-439-1238

David A Schaafsma Jason and Roger, This one says 'locates are of... 02/07/2013 05:21:40 PM

From: David A Schaafsma/NCS/Enterprise
To: Jason E Otis/NCS/Enterprise@NiSource, Quentin R Brown/NCS/Enterprise@NiSource
Cc: Carrie Ludwig/NCS/Enterprise@NiSource
Date: 02/07/2013 05:21 PM
Subject: Re: Fort Wayne LOA damage form / Lake Ave & Inwood Dr

Jason and Roger,

This one says 'locates are off' as the cause yet they have it stated that the marks were within 1' of the facility.... That is not 'locates off' as they have a 2' tolerance zone before the locates are considered to be off. Is there something different to the story?

David Schaafsma | Leader of Damage Prevention



Know what's below.
Call before you dig.



NIPSCO 3511 E. 15th Ave. Gary, IN. 46403
(O) 219-962-0448 (M) 219-688-6552

Jason E Otis

Carrie this should be what you need not the 181...

02/07/2013 03:22:31 PM