



## Pipeline Safety Division Investigation Report

### Investigation regarding: City Of Bloomington Utilities

UPPAC Database Record ID: 4478

Report Date: 7/18/2013

Investigator: William Boyd

Damage Date: 2/13/2013 1:41:39 PM

Damage Address: 1633 W. 8th St., Bloomington, Monroe

### The Parties

Excavator: City Of Bloomington Utilities

Address: 600 East Miller Drive, Bloomington, In 47402

Facility Owner: Vectren

### Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Type of Equipment: Backhoe/Trackhoe

Type of Work Performed: Water

### Damage Impact

Product Release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$1267.00

### Excavator Activities/Cause of Damage Information:

Excavator Request Locates: Yes  
2/14/2013

Indiana 811 Ticket Number: 1302040645

Original Start Date:

Locate Instructions: FRONT OF THE PROPERTY LOCATE A 30 FEET RADIUS OF THE FIRE HYDRANT -- ROUTE IS MARKED

Follow-Up Locate Instructions (if applicable):

**Synopsis:** Excavator struck and damaged an underground natural gas service while performing water work.

**Findings:** Reported by Indiana 811; excavator's response to initial notice was received on 4/2/2013. Excavator does not adequately respond to the damage incident. Excavator indicates uncovering an abandoned 6 inch main and called gas operator to verify line is abandoned. Excavator photos indicate the address as 2719 E. St. Rd 45. The damage occurred at 1633 E. 8th St. The excavator claims the incident occurred on 2/20; but, Vectren indicates it happened on 2/13. Vectren's response indicates the line was cut by a backhoe and the locates were accurate. Vectren also has pictures of the incident indicating accurate locates and the use of mechanized equipment.

**Conclusion:** The excavator failed to maintain adequate clearance with mechanized equipment.

**Violation: IC 8-1-26-20(a)(2) Failure to maintain two (2) feet clearance with mechanized equipment.**



## DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)  
INDIANA UTILITY REGULATORY COMMISSION

INITIAL DOCUMENTS -  
OPERATOR  
CASE # 4478

Submitted to IURC-Pipeline Safety on: 04/03/2013

### Who is submitting this information?

Name of person providing this information: Darlene Kulhanek

Business address (number and street): 1 Main Street

City, State, and ZIP code: Evansville, IN 47711

Telephone number (area code): 812-491-4227

Fax number (area code): 812-491-4504

E-mail address: dkulhanek@vectren.com

### Excavator Information, if known

Full name: Bloomington City Utilities

Business address (number and street): 600 E Miller Drive

City, State, and ZIP code: Bloomington, IN 47402

Telephone number (area code): 812-349-3690

Fax number (area code): 812-331-5962

E-mail address: Unknown

### Excavation or Demolition Information

Excavator type: Municipality

Excavation or demolition equipment: Backhoe/Trackhoe

Type of work performed: Water

**Date and Location of Damage**

Date of damage (month, day, year): 2-13-2013

County: Monroe

City: Bloomington

Street address (number and street, city, state, and ZIP code):  
1633 W 8th Street, Bloomington, IN

Nearest intersection: Unknown

Right of way where damage occurred: Public - City Street

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? Yes

If yes, how many affected? 1

Time to restore service (in hours): 1

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$ 1,267.31

**Affected Facility Information**

What type of pipeline was damaged? Natural Gas

What was the affected facility? Service/Drop

What was the depth of the facility, in inches?

**Notification, Locating, Marking**

Did excavator request locates prior to commencing work? Yes

Enter Indiana 811 ticket number, if known: 1302040645

Was the locate request completed within two working days? Yes

If locates were performed, were they done so by a contractor or pipeline employee? Contract Locator

If a contractor locator, enter the company name, if known: USIC

Were facility marks visible in the area of excavation? Yes

Were facilities marked correctly? Yes

Type of markings used: Paint

If other, please specify: None

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? Yes

Did the excavator notify Indiana 811 in the event of this damage? Unknown/Other


Did the excavator notify 911 in the event of a release of product? Unknown/Other

### **Description of Cause**

Select from the list the most accurate cause for the damage: --Failure to use hand tools where required

### **Additional Comments**

1" plastic service severed by hoe. Not Hand exposed.

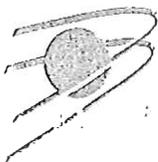


2 VECTREN ENERGY DELIVERY OF INDIANA - NORTH

NOW DUE  
\$1,267.31

BLOOMINGTON CITY UTILITIES  
600 E MILLER DRIVE,  
BLOOMINGTON, IN 47402

Type: GAS  
Invoice: FDS0017479  
BillToID: 33026  
Billing Date: 3/19/2013  
Date of Loss: 2/13/2013  
5924 103.0510

Please return this portion with your remittance.

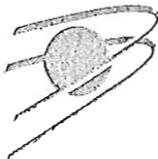

Mail Payment To:  
Vectren Utilities Holdings Corporation  
1239 Reliable Parkway  
Chicago, IL 60686-0012  
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5  
Risk Management/Claims Department

NOW DUE  
\$1,267.31

BLOOMINGTON CITY UTILITIES  
600 E MILLER DRIVE,  
BLOOMINGTON, IN 47402

Type: GAS  
Invoice: FDS0017479  
BillToID: 33026  
Billing Date: 3/19/2013  
Date of Loss: 2/13/2013

**Invoice For Costs to Repair and Reconstruct Damaged Property**

Address: 1633 W 8TH ST, BLOOMINGTON  
1" PLASTIC SERVICE SEVERED BY HOE. NOT HAND EXPOSED.

Material:	\$69.43
Company Labor:	\$336.53
Contract Labor:	\$522.75
Transportation/Equipment:	\$55.00
Misc:	\$0.00
Gas Loss:	\$283.60
Adjustments:	\$0.00
Payments:	\$0.00
Total:	\$1,267.31

5924 103.0510

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

Vectren Claim Number: \_\_\_\_\_

FDS 10017499

Task No: 1080510 Capital/Q&M (circle one)

Police Report /MO #: \_\_\_\_\_

Date of Damage 2/13/13

Cost Center # 5924

Time Occurred 1:15 am (pm)

Time Found 1:36 am (pm)

Latitude N39° 10' 17" W Longitude 108° 16' 33" W

# FACILITIES DAMAGE REPORT

Vectren Claims Camera:  
**VE03387**  
4

DAMAGE SITE: Address 1633 W 24th St Lot # \_\_\_\_\_

County MONROE City Blain State LA Township Blain

FACILITY TYPE:  
 Distribution  Propane  
 Service  Storage  
 Transmission: (include supplemental report)

FACILITIES DAMAGED:	ORIFICE SIZE(S):	(1)	(2)	(3)
<input type="checkbox"/> Farm Tap	0.50 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Heater	5/8 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Main	0.75 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Meter (Residential)	1.00 inch	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Meter (Industrial / Commercial)	1.25 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Odorizer	2.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Regulator Station	3.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Relief Valve	4.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Riser	5.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Service Line	6.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Valve	10.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
	12.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
	16.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
	20.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Other _____	Other _____			

**VISUAL OBSERVATION AT DAMAGE SITE:**

Visual Observation:  Above Ground  Below Ground

Locate Applicable:  Yes  No  N/S

Facilities Properly Marked:  Yes  No  N/S

Marking Methods:  Conventional  Flags  Nonc  Offset  Paint  Stakes  Whiskers

Locate Marking Faded:  Yes  No  N/S

Wrong Address Requested:  Yes  No  N/S

**Facilities Improperly Located:**

Qualified Locator Could Not Have Accurately Located

Inaccurate Maps / Cards

Broken or No Tracer Wire (Plastic)

Insulation Preventing Accurate Locate

**Locator Error:**

Failure to Follow Policy

Inappropriate Site Markings

Incomplete Locate

No Locates Performed

Qualified Locator Could Have Accurately Located

Wrong Address Located

Marking Off By: \_\_\_\_\_ (Feet / Inches)

**TYPE OF MATERIAL:**

Cast Iron

Plastic (HDPE)

Plastic (MDPE)

Steel

Other \_\_\_\_\_

**DAMAGE TYPE:**

Severed

Not Cut

Severed

Size \_\_\_\_\_ x \_\_\_\_\_

**PRESSURE:**

25 PSIG

40 PSIG

50 PSIG

55 PSIG

60 PSIG

6 WC (.2163)

7 WC (252)

Other \_\_\_\_\_

**PROTECTION IN PLACE:**

Building  Fence  None

Post  Rail  Vault  N/A

Other \_\_\_\_\_

### DURATION OF ESCAPING GAS:

Minutes: 125 min.

**LEAK REPORT NUMBER:** 105333

EFV Activated  Yes  No  N/S

**FEED TYPE:**

One-Way Feed

Two-Way Feed

Number of Customers Affected: 1

Total Hours Service Was Off: 1 HR

**SERVICE ORDER NUMBER:** 5524859

Were Facility Marks Visible:  Yes  No

Was Area White Lined:  Yes  No  Destroyed

Positive Response:  Yes  No  Destroyed

Tolerance Zone Violated:  Yes  No

Part of Project:  Yes  No

Company Representative On-Site:  Yes  No

Observation by (ID#): M. Burton 5065

Name of Locator: USEC

### LOCATING ORGANIZATION:

Contract Locator

Unknown / Other

Utility Owner

**DAMAGED BY:**

Company Crew

Contractor

County

Developer

Farmer

Municipality

Property Owner/ Tenant

Railroad

State

Unknown

Utility

Vehicle Accident

Other \_\_\_\_\_

### TYPE OF CONSTRUCTION:

Agriculture

Building Construction

Building Demolition

Cable TV

Curbs / Sidewalk

Drainage

Driveway

Electric

Engineering / Surveying

Fencing

Grading

Irrigation

Landscaping

Liquid Pipeline

Milling

Pole

Natural Gas

Public Transit Authority

Railroad Maintenance

Other Water Main

### NOTIFICATIONS AND OTHER DETAILS OF LOCATE:

Locate Ticket: \_\_\_\_\_

Date: \_\_\_\_\_ Time: \_\_\_\_\_ am / pm

### TYPE OF REQUEST:

Regular Request  Emergency Request

Locate Company Notified

Contact Name: \_\_\_\_\_

Time Called: \_\_\_\_\_ am / pm

Time Locator Arrived at the Site: \_\_\_\_\_ am / pm

Company Notified of Locate Near Critical Facilities  Yes  No  N/S

Copy of Mark Out Request Provided Within 2 Working Days  Yes  No  N/S

### ONE-CALL CENTER:

IUPPS

OUPS

Unknown

Vectren Claim Number: \_\_\_\_\_

**TYPE OF EQUIPMENT:**

- Auger
- Backhoe / Track hoe
- Boring
- Drilling
- Explosives
- Farm Equipment
- Grader / Scraper
- Hand Tools
- Milling Equipment
- Plow
- Probing Device
- Trencher
- Vacuum Equipment
- Vehicle
- Other \_\_\_\_\_

**ROOT DAMAGING CAUSE:**

- Abandoned Facility
- Deteriorated Facility
- Facility Could Not be Found/ Located
- Facility Was Not Located / Marked
- Failure to Maintain Clearance
- Failure to Maintain Marks
- Failure to Support Exposed Facility
- Failure to Use Hand Tools Where Required
- Improper Backfilling
- Incorrect Records / Maps
- Marking or Location Not Sufficient
- No Notification Made to One-Call
- One-Call Notification Error
- Previous Damage
- Wrong Information Provided
- Other \_\_\_\_\_

**CONTRACTOR REPAIRS:**

- Contractor Working for Vectren Made Repairs at Own Expense  
 Yes  No  N/S
- Contractor Repaired Damage  
 Yes  No  N/S

Name of Contractor: \_\_\_\_\_  
 # of Regular Hours; \_\_\_\_\_  
 # of Overtime Hours; \_\_\_\_\_  
 # of Regular Hours; \_\_\_\_\_  
 Crew Type: \_\_\_\_\_

**MATERIALS OR ROAD WORK:**

- Meter was replaced \_\_\_\_\_ (Stores Code)
- Regulator Was Replaced \_\_\_\_\_ (Stores Code)
- Temporary Asphalt Repair: \_\_\_\_\_ (sq. ft.)
- Permanent Asphalt Repair: \_\_\_\_\_ (sq. ft.)

Did Excavator Notify You

- Yes  No

Excavation Required

- Yes  No

Media at Site

- Yes  No

Was There Ignition of Gas?

- Yes  No

INVOICE:

- Yes  No  N/S

**RIGHT OF WAY:**

- Dedicated Utility Easement
- Federal Utility Easement
- Pipeline
- Power / Transmission Line
- Private - Business
- Private - Easement
- Private - Land Owner
- Public - County Road
- Public - Interstate Highway
- Public - Other
- Public - State Highway
- Public - City Street
- Unknown

**DAMAGING PARTY:**  
 Name: City Blgtn UTAH  
 Address: \_\_\_\_\_  
 City/ State/ Zip: \_\_\_\_\_  
 Phone: (\_\_\_\_) \_\_\_\_\_  
 Prepared / Investigated By: [Signature]  
 Date: 2-13-13

**PARTY TO INVOICE:**  
 Name: Gamb  
 Address: \_\_\_\_\_  
 City/ State/ Zip: \_\_\_\_\_  
 Phone: (\_\_\_\_) \_\_\_\_\_  
 Reviewed by Field Supervisor: Randa Powers  
 Date: 2/15/13

NORMAL NOTICE

Ticket : 1302040645 Date: 02/04/2013 Time: 09:45 Oper: CJODOM Chan:056

State: IN Cnty: MONROE Twp: BLOOMINGTON  
 Cityname: BLOOMINGTON Inside: Y Near: N  
 Subdivision:

Address : 1600  
 Street : W 8TH ST  
 Cross 1 : N HAY ST Within 1/4 mile: Y  
 Location: FROM ABOVE ADDRESS -- LOCATE GOING WEST TO 1680 W 8TH STREET --  
 APPROX 200 FEET -- AREA FLAGGED AND PAINTED

:  
 Grids : 3910D8633C 3910D8633D  
 Boundary: n 39.170157 s 39.169056 w -86.555488 e -86.552773

Work type : INSTALL WATER LINE  
 Done for : CITY OF BLOOMINGTON UTILITIES  
 Start date: 02/06/2013 Time: 10:00 Hours notice: 48/048 Priority: NORM  
 Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: N  
 Duration : 2 WEEKS Depth: 6 FEET

Company : CITY OF BLOOMINGTON UTILITIES Type: MEMB  
 Co addr : 600 EAST MILLER DRIVE  
 City : BLOOMINGTON State: IN Zip: 47402  
 Caller : KATHLEEN BROWN Phone: (812)349-3690  
 Contact : LARRY HARDIN - OFFICE Phone:  
 BestTime:  
 Mobile : (812)349-3690  
 Fax : (812)331-5962  
 Email : BROWNK@BLOOMINGTON.IN.GOV

Remarks : All tickets are taken and processed on Eastern Daylight Time  
 Will you be white-lining the dig site area? YES  
 :

Submitted date: 02/04/2013 Time: 09:45  
 Members: ID0002 ID1443 ID3147 ID5960 ID7053 ID8060 SBCIN SM

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
AT&T - TRANSMISSION	FIBER OPTIC
BLOOMINGTON UTILITIES, CITY OF	SEWER & WATER
COMCAST CENTRAL (BLOOMINGTON)	CABLE TV
DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
SMITHVILLE TELEPHONE COMPANY, INC	TELEPHONE
VECTREN - BLOOMINGTON	GAS

NORMAL NOTICE

Ticket : 1301180131 Date: 01/18/2013 Time: 07:58 Oper: BLIEVERTZ Chan:025

State: IN Cnty: MONROE Twp: BLOOMINGTON  
 Cityname: BLOOMINGTON Inside: Y Near: N  
 Subdivision:

Address :  
 Street : W 8TH ST  
 Cross 1 : N SPRING ST Within 1/4 mile: Y  
 Location: FROM THE STREET IN FRONT OF THE PROPERTY AT 1601 W 8TH ST - LOCATE  
 WEST ON THE SOUTH SIDE OF W 8TH ST TO THE PROPERTY AT 1709 W 8TH ST -  
 APPROXIMATELY 500 FEET - ARE IS WHITE LINED  
 :  
 Grids : 3910D8633C 3910D8633D  
 Boundary: n 39.170141 s 39.169042 w -86.557748 e -86.552754

Work type : WATER MAIN INSTALL  
 Done for : CITY OF BLOOMINGTON UTILITIES  
 Start date: 01/23/2013 Time: 08:15 Hours notice: 120/048 Priority: NORM  
 Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: N  
 Duration : 2 WEEKS Depth: 6 FEET

Company : CITY OF BLOOMINGTON UTILITIES Type: MEMB  
 Co addr : 600 EAST MILLER DRIVE  
 City : BLOOMINGTON State: IN Zip: 47402  
 Caller : KATHLEEN BROWN Phone: (812)349-3690  
 Contact : LARRY HARDIN - OFFICE Phone:  
 BestTime:  
 Mobile : (812)349-3690  
 Fax : (812)331-5962  
 Email : BROWNK@BLOOMINGTON.IN.GOV

Remarks : All tickets are taken and processed on Eastern Daylight Time  
 Will you be white-lining the dig site area? YES  
 :

Submitted date: 01/18/2013 Time: 07:58  
 Members: ID0002 ID1443 ID3147 ID5960 ID7053 ID8060 SBCIN SM

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
AT&T - TRANSMISSION	FIBER OPTIC
BLOOMINGTON UTILITIES, CITY OF	SEWER & WATER
COMCAST CENTRAL (BLOOMINGTON)	CABLE TV
DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
SMITHVILLE TELEPHONE COMPANY, INC	TELEPHONE
VECTREN - BLOOMINGTON	GAS

# Service Order Status

Tuesday, March 12, 2013

**Enter Service Order Number:**

5524593



Clear Form

Refresh Data

**Banner Instance:**  CS03PROD  CS01PROD  CS02PROD

**Order Number:** N5524593

**Order Type:** LEAK

**Order Status:** Completed

**Customer:** 621258088 - DAJA I II III LLC

**Prem:** 5074449 - 1600 W 8TH ST

**Technician:** 5065 - Burton, Matt

**Order Dates and Times**

**Need Date:** 2/13/2013 1:30:00 PM  
**Time Created:** 2/13/2013 1:19:39 PM  
**Time Dispatched:** 2/13/2013 1:23:16 PM  
**Time In Route:** 2/13/2013 1:24:04 PM  
**Time On-Site:** 2/13/2013 1:36:40 PM  
**Tech Complete:** 2/13/2013 4:30:48 PM  
**Time Closed:** 2/13/2013 4:30:48 PM

**Events Performed/Completion Code**

LKOT - CMP

**Meter Information**

**Current ReadStatus**

**Old Meter:** 2944 Active

**New Meter:**

**Completion Notes**

cbu hit 1" pl serv dist made repairs i did tong

**Request Notes**

2/13/13- FIRED DEPT/ POLICE ON SITE, CREW HIT A LINE, IT IS BLOWING, OUTSIDE WATER DEPT WORKING ON WATER MAIN, LARRY HARDIN ON SITE 812 325 0192 LARRY IS SUPR OF CREW ON SITE. X STR N SPRING

**MDSI Event Dates and Times**

Event	Date/Time	User
AsnAssignmentManualAck_evt	2/13/2013 1:23:56 PM	Burton, Matt
AsnAssignmentEnRoute_evt	2/13/2013 1:24:04 PM	Burton, Matt
AsnAssignmentOnSite_evt	2/13/2013 1:36:40 PM	Burton, Matt
OrdOrderComplete_evt	2/13/2013 4:30:48 PM	Burton, Matt

NOTE:The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.

# Service Order Status

Tuesday, March 12, 2013

**Enter Service Order Number:**

5524859



[Clear Form](#)

[Refresh Data](#)

**Banner Instance:**  CS03PROD  CS01PROD  CS02PROD

**Order Number:** N5524859

**Order Type:** LEAK

**Order Status:** Completed

**Customer:** 620412096 - GEORGE JESSICA L

**Prem:** 5834980 - 1633 W 8TH ST

**Technician:** 5065 - Burton, Matt

**Order Dates and Times**

**Need Date:** 2/13/2013 4:07:00 PM  
**Time Created:** 2/13/2013 4:07:28 PM  
**Time Dispatched:** 2/13/2013 4:07:28 PM  
**Time In Route:** 2/13/2013 4:32:21 PM  
**Time On-Site:** 2/13/2013 4:32:23 PM  
**Tech Complete:** 2/13/2013 4:33:38 PM  
**Time Closed:** 2/13/2013 4:33:38 PM

**Events Performed/Completion Code**

LKOT - CMP

**Meter Information**

**Current ReadStatus**

**Old Meter:**

**New Meter:**

**Completion Notes**

0% let on gmi all valves open tog clk mtr 5 min ok frn elect igfn ck draft,oper ok advised

**Request Notes**

ONSITE FOR ORDER # N5524593, AND HIT LINE WAS AT THIS ADDRESS.


**MDSI Event Dates and Times**

Event	Date/Time	User
AsnAssignmentManualAck_evt	2/13/2013 4:10:08 PM	Burton, Matt
AsnAssignmentEnRoute_evt	2/13/2013 4:32:21 PM	Burton, Matt
AsnAssignmentOnSite_evt	2/13/2013 4:32:23 PM	Burton, Matt
OrdOrderComplete_evt	2/13/2013 4:33:38 PM	Burton, Matt

NOTE: The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.



Property of United States Infrastructure Corporation  
Photo taken on 2/13/2013 3:42:34 PM

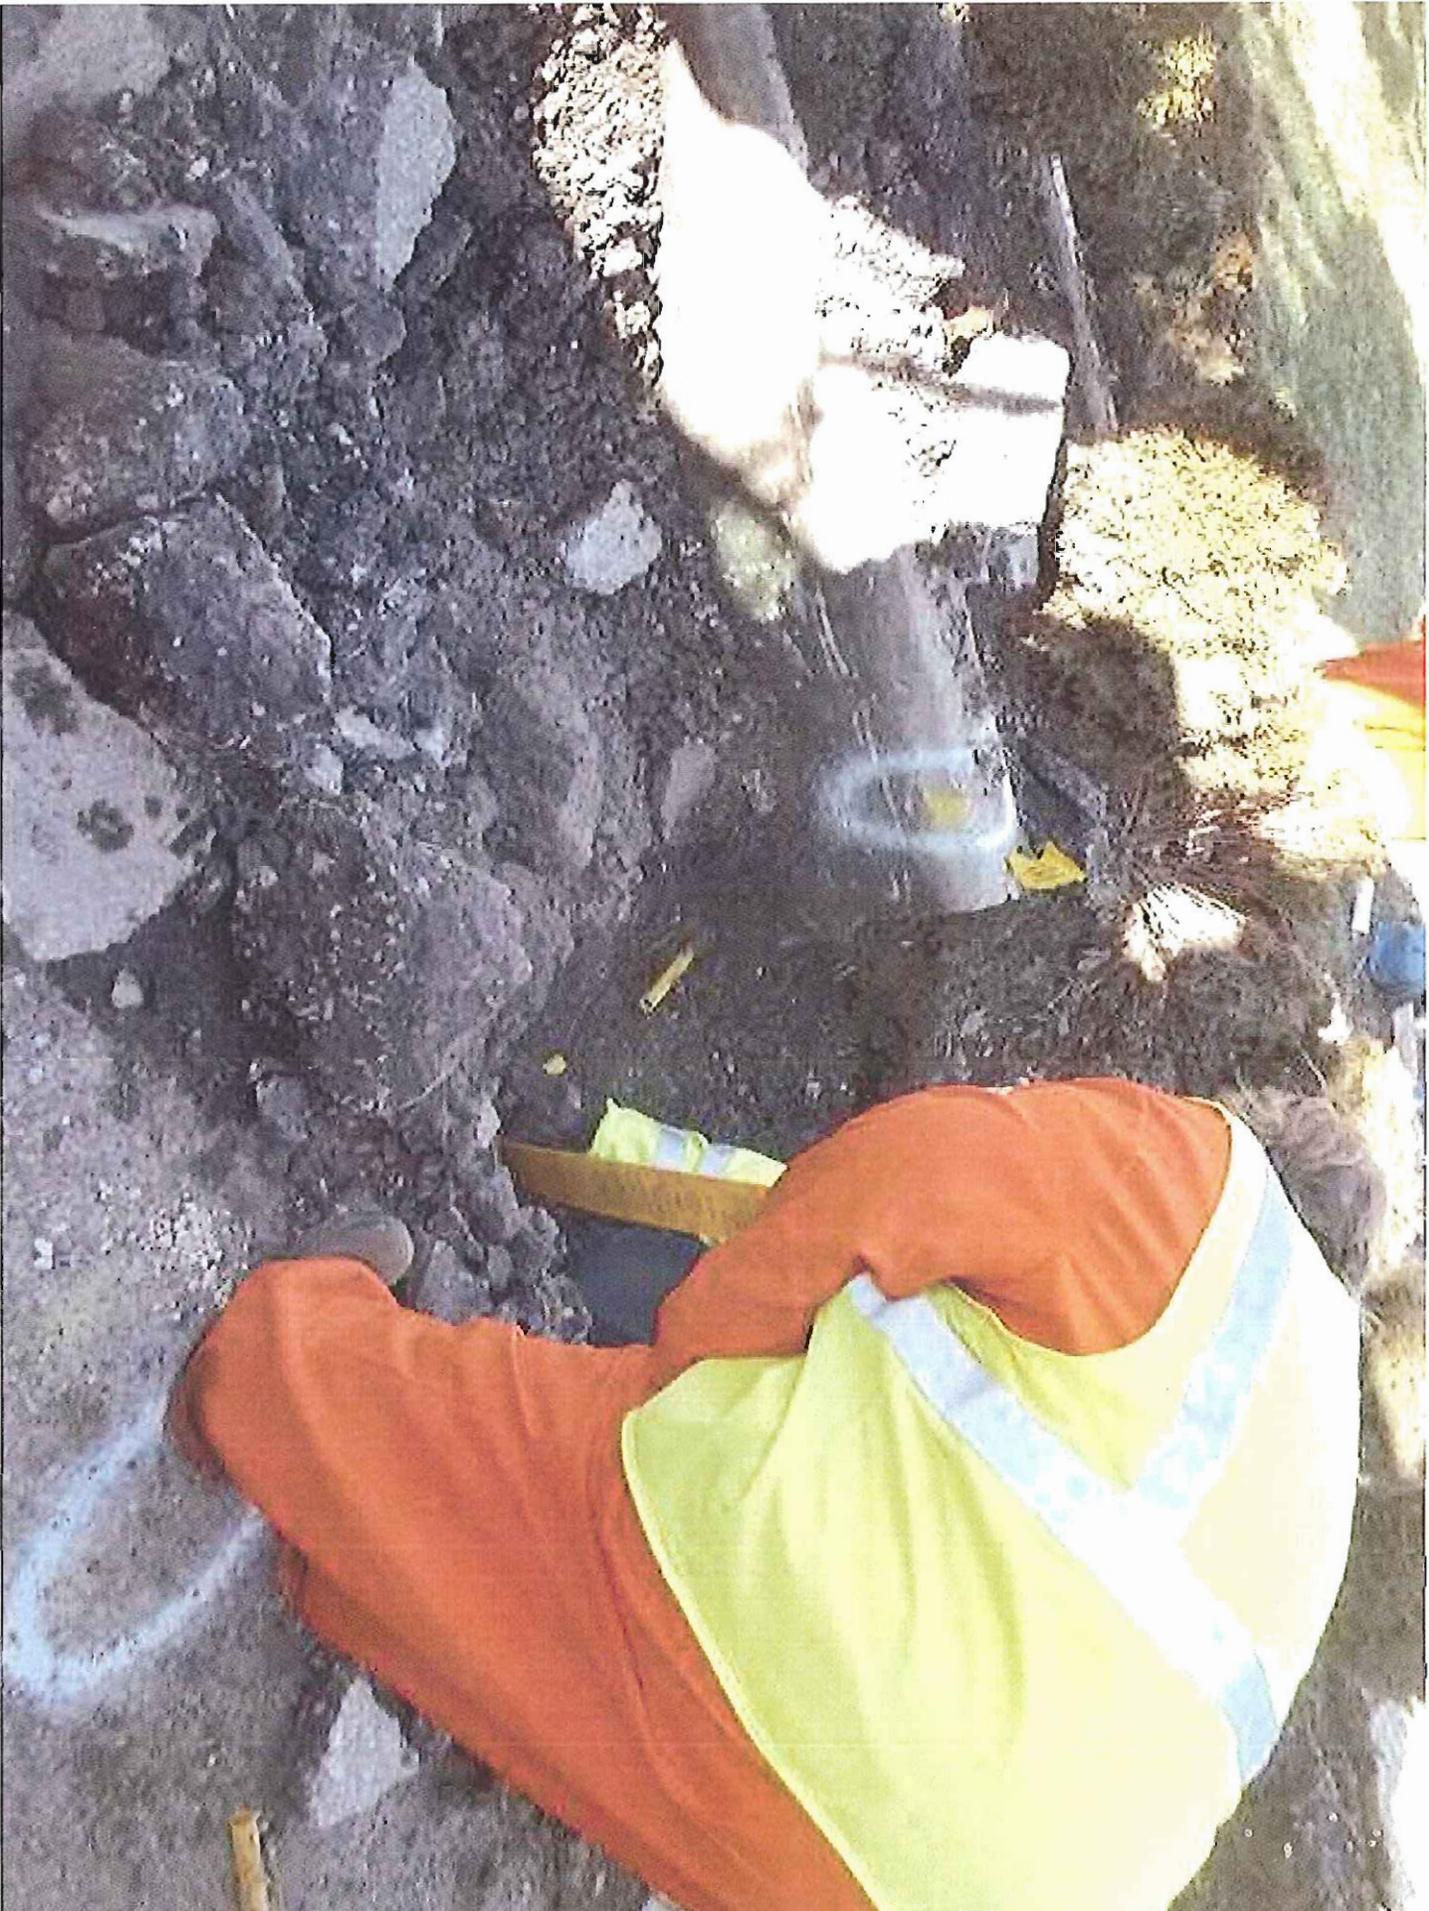

Property of United States Infrastructure Corporation  
Photo taken on 2/13/2013 3:42:42 PM



Property of United States Infrastructure Corporation

Photo taken on 2/13/2013 3:42:50 PM

## Woods, Janea

---

**From:** Tom Axsom [axsomt@bloomington.in.gov]  
**Sent:** Tuesday, April 02, 2013 10:05 AM  
**To:** IURC PipelineDamageCase  
**Subject:** Case # 4478  
**Attachments:** Unmarked gas main at 2719 E. St. Rd. 45 001.png; Unmarked gas main at 2719 E. St. Rd. 45 002.png; Unmarked gas main at 2719 E. St. Rd. 45 004.png

Mr. Boyd,

I am responding to case #4478. On 2/20/13 The City of Bloomington Utilities started repair work on a fire hydrant that was struck by a car. We called in our locate request on 2/12/13. The area was flagged OK by all utilities. We started our repair and uncovered an unmarked 6" gas main. We did not damage the main. At that time we called in a second notice, Vectren arrived at the job site and determined the main to be dead. I have attached pictures of the job site.

Please feel free to contact me if there are more Questions.

--

Tom Axsom  
Assistant Director  
City Of Bloomington Utilities T&D  
Office (812) 349-3637  
Cell (812) 327-0802





