



## Pipeline Safety Division Investigation Report

### Investigation regarding: Badger Directional Boring

UPPAC Database Record ID: 4481

Report Date: 8/12/2013

Investigator: Mike Orr

Damage Date: 2/21/2013 3:04:53 PM

Damage Address: 1374 S Range Line Rd, Clay, Hamilton

### The Parties

Excavator: **Badger Directional Boring**

Address: 6125 West 400 North, Fairland, In 46126

Facility Owner: **Vectren**

### Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Type of Equipment: Boring

Type of Work Performed: Electric

### Damage Impact

Product Release: Yes

Ignition: No

Service Interruption: False

Number of Customers Affected: 0

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$

### Excavator Activities/Cause of Damage Information:

Excavator Request Locates: Yes  
2/6/2013

Indiana 811 Ticket Number: 1302040229

Original Start Date:

Locate Instructions: THIS IS THE CENTRE SHOPPING CENTER--LOCATE THE NORTH SIDE OF THE PROPERTY AT THE ENTIRE AREA UNDER CONSTRUCTION

Follow-Up Locate Instructions (if applicable):

**Synopsis:** Excavator struck and damaged an underground natural gas service while performing electric installation work.

**Findings:** Reported by Indiana 811; excavator did not respond to initial notice mailed 3/27/2013. Excavator failed to maintain required clearance from the gas main with the boring machine and utilize hand tools in the tolerance zone.

**Conclusion:** There was a failure to use hand tools where required within the tolerance zone.

**Violation:** IC 8-1-26-20(a)(2) Failure to maintain two (2) feet clearance with mechanized equipment.



# DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)  
INDIANA UTILITY REGULATORY COMMISSION

INITIAL DOCUMENTS -  
OPERATOR  
CASE # 4481

Submitted to IURC-Pipeline Safety on: 04/03/2013

## Who is submitting this information?

Name of person providing this information: Darlene Kulhanek

Business address (number and street): 1 Main Street

City, State, and ZIP code: Evansville, IN 47711

Telephone number (area code): 812-491-4227

Fax number (area code): 812-491-4504

E-mail address: dkulhanek@vectren.com

## Excavator Information, if known

Full name: Badger Directional Boring

Business address (number and street): 6125 W County Rd 400 N

City, State, and ZIP code: Fairland, IN 46126

Telephone number (area code): 317-460-9310

Fax number (area code): Unknown

E-mail address: Unknown

## Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Boring

Type of work performed: Electric

---

**Date and Location of Damage**

Date of damage (month, day, year): 2-21-2013

County: Hamilton

City: Carmel

Street address (number and street, city, state, and ZIP code):  
1356 S Range Line Rd, Carmel, IN

Nearest intersection: Unknown

Right of way where damage occurred: Private - Business

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? No

If yes, how many affected? 0

Time to restore service (in hours): 0

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$ 1,113.47

---

**Affected Facility Information**

What type of pipeline was damaged? Natural Gas

What was the affected facility? Service/Drop

What was the depth of the facility, in inches? \_\_\_\_\_

---

**Notification, Locating, Marking**

Did excavator request locates prior to commencing work? Yes

Enter Indiana 811 ticket number, if known: 1302040229

Was the locate request completed within two working days? Yes

If locates were performed, were they done so by a contractor or pipeline employee? Contract Locator

If a contractor locator, enter the company name, if known: USIC

Were facility marks visible in the area of excavation? Yes

Were facilities marked correctly? Yes

Type of markings used: Paint

If other, please specify: None

Was site marked by "White Lining"? No

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? Yes

Did the excavator notify Indiana 811 in the event of this damage? Unknown/Other

Did the excavator notify 911 in the event of a release of product? Unknown/Other

---

### **Description of Cause**

Select from the list the most accurate cause for the damage: --Failure to use hand tools where required

---

### **Additional Comments**

2" plastic service damaged by bore. Not Hand exposed.



2 VECTREN ENERGY DELIVERY OF INDIANA - NORTH


NOW DUE

\$1,113.47

BADGER DIRECTIONAL BORING  
6125 W COUNTY RD 400 N  
FAIRLAND, IN 46126

Type: GAS  
Invoice: FDS0017496  
BillToID: 33033  
Billing Date: 3/12/2013  
Date of Loss: 2/21/2013  
5830 103.0510

Please return this portion with your remittance.

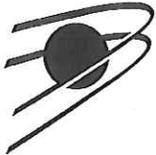

Mail Payment To:  
Vectren Utilities Holding Group  
1239 Reliable Parkway  
Chicago, IL 60686-0012  
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5  
Risk Management/Claims Department

BADGER DIRECTIONAL BORING  
6125 W COUNTY RD 400 N  
FAIRLAND, IN 46126

Type: GAS  
Invoice: FDS0017496  
BillToID: 33033  
Billing Date: 3/12/2013  
Date of Loss: 2/21/2013

NOW DUE  
\$1,113.47

**Invoice For Costs to Repair and Reconstruct Damaged Property**

Address: 1356 S RANGE LINE RD, CARMEL

2" PLASTIC SERVICE DAMAGED BY BORE. NOT HAND EXPOSED.

Material:	\$48.00
Company Labor:	\$886.65
Contract Labor:	\$0.00
Transportation/Equipment:	\$126.88
Misc:	\$0.00
Gas Loss:	\$51.94
Adjustments:	\$0.00
Payments:	\$0.00
<b>Total:</b>	<b>\$1,113.47</b>

5830 103.0510

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

FDS 0017496

Task No: 020510 Capital / O & M (circle one)

Vectren Claim Number: \_\_\_\_\_

Date of Damage: 2/12/13

Police Report / MO #: \_\_\_\_\_

Cost Center #: 5830

# FACILITIES DAMAGE REPORT

Time Occurred: 2:13 am/pm

Time Found: 3:13 am/pm

Latitude: 39.5101 Longitude: -82.12118

Vectren Claims Camera:  
**VE01340**  
Form 3112

DAMAGE SITE: 1316 S. RANGELINE RD Lot # \_\_\_\_\_  
Address \_\_\_\_\_  
County: Hamilton City: CARMEI State: IN Township: CLAY

FACILITY TYPE:  
 Distribution  Propane  
 Service  Storage  
 Transmission: (include supplemental report)

FACILITIES DAMAGED:	ORIFICE SIZE(S):	(1)	(2)	(3)
<input type="checkbox"/> Farm Tap	0.50 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Heater	5/8 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Main	0.75 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Meter (Residential)	1.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Meter (Industrial / Commercial)	1.25 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Odorizer	2.00 inch	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Regulator Station	3.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Relief Valve	4.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Riser	5.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Service Line	6.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Valve	10.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
	12.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
	16.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Other _____	20.00 inch	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

VISUAL OBSERVATION AT DAMAGE SITE: 2/22  
 Visual Observation:  Above Ground  Below Ground 2/22  
 Locate Applicable:  Yes  No  N/S  
 Facilities Properly Marked:  Yes  No  N/S  
 Marking Methods:  Conventional  Flags  None  
 Offset  Paint  Stakes  Whiskers  
 Locate Marking Faded:  Yes  No  N/S  
 Wrong Address Requested:  Yes  No  N/S

Facilities Improperly Located:  
 Qualified Locator Could Not Have Accurately Located  
 Inaccurate Maps / Cards  
 Broken or No Tracer Wire (Plastic)  
 Insulation Preventing Accurate Locate

Locator Error:  
 Failure to Follow Policy  
 Inappropriate Site Markings  
 Incomplete Locate  
 No Locates Performed  
 Qualified Locator Could Have Accurately Located  
 Wrong Address Located  
 Marking Off By: \_\_\_\_\_ (Feet / Inches)

TYPE OF MATERIAL:  Cast Iron  Plastic (HDPE)  Plastic (MDPE)  Steel  
 DAMAGE TYPE:  Severed  Not Cut  Covered  
 Size: 1/2" x 1/2" x 1/2"

PRESSURE:  
 25 PSIG  40 PSIG  50 PSIG  55 PSIG  
 60 PSIG  6 WC (.2163)  7 WC (.252)  Other \_\_\_\_\_

Were Facility Marks Visible:  Yes  No  Destroyed  
 Was Area White Lined:  Yes  No  Destroyed  
 Positive Response:  Yes  No  Destroyed  
 Tolerance Zone Violated:  Yes  No  
 Part of Project:  Yes  No  
 Company Representative On-Site:  Yes  No

PROTECTION IN PLACE:  
 Building  Fence  None  
 Post  Rail  Vault  N/A  
 Other \_\_\_\_\_

DURATION OF ESCAPING GAS:  
 Minutes: 30min

LEAK REPORT NUMBER: \_\_\_\_\_

EFV Activated:  Yes  No  N/S  
 Number of Customers Affected: 0  
 Total Hours Service: \_\_\_\_\_  
 Was Off: \_\_\_\_\_

Observation by (ID#): \_\_\_\_\_

FEED TYPE:  
 One-Way Feed  
 Two-Way Feed

Name of Locator: \_\_\_\_\_  
 LOCATING ORGANIZATION:  
 Contract Locator  
 Unknown / Other  
 Utility Owner

SERVICE ORDER NUMBER: 415533061

DAMAGED BY:  
 Company Crew  
 Contractor  
 County  
 Developer  
 Farmer  
 Municipality  
 Property Owner / Tenant  
 Railroad  
 State  
 Unknown  
 Utility  
 Vehicle Accident  
 Other \_\_\_\_\_

TYPE OF CONSTRUCTION:  
 Agriculture  
 Building Construction  
 Building Demolition  
 Cable TV  
 Curbs / Sidewalk  
 Drainage  
 Driveway  
 Electric  
 Engineering / Surveying  
 Fencing  
 Grading  
 Irrigation  
 Landscaping  
 Liquid Pipeline  
 Milling  
 Pole  
 Natural Gas  
 Public Transit Authority  
 Railroad Maintenance  
 Other: Electrical Conduit Installation

NOTIFICATIONS AND OTHER DETAILS OF LOCATE:  
 Locate Ticket: \_\_\_\_\_  
 Date: \_\_\_\_\_ Time: \_\_\_\_\_ am / pm

TYPE OF REQUEST:  
 Regular Request  Emergency Request  
 Locate Company Notified  
 Contact Name: \_\_\_\_\_  
 Time Called: \_\_\_\_\_ am / pm  
 Time Locator Arrived at the Site: \_\_\_\_\_ am / pm

Company Notified of Locate Near Critical Facilities:  
 Yes  No  N/S  
 Copy of Mark Out Request Provided Within 2 Working Days:  
 Yes  No  N/S

WORKING FOR:  
 City  County  Developer  
 State  Property Owner  
 Utility

ONE-CALL CENTER:  
 RUPPS  
 OUPS  
 Unknown

Vectren Claim Number: \_\_\_\_\_

**TYPE OF EQUIPMENT:**

- Auger
- Backhoe / Track hoe
- Boring
- Drilling
- Explosives
- Farm Equipment
- Grader / Scraper
- Hand Tools
- Milling Equipment
- Plow
- Probing Device
- Trencher
- Vacuum Equipment
- Vehicle

Other \_\_\_\_\_

Did Excavator Notify You

- Yes  No

Excavation Required

- Yes  No

Media at Site

- Yes  No

Was There Ignition of Gas?

- Yes  No

INVOICE:

- Yes  No  N/S

**ROOT DAMAGING CAUSE:**

- Abandoned Facility
- Deteriorated Facility
- Facility Could Not be Found/ Located
- Facility Was Not Located / Marked
- Failure to Maintain Clearance
- Failure to Maintain Marks
- Failure to Support Exposed Facility
- Failure to Use Hand Tools Where Required
- Improper Backfilling
- Incorrect Records / Maps
- Marking or Location Not Sufficient
- No Notification Made to One-Call
- One-Call Notification Error
- Previous Damage
- Wrong Information Provided

Other \_\_\_\_\_

**CONTRACTOR REPAIRS:**

- Contractor Working for Vectren Made Repairs at Own Expense
  - Yes  No  N/S
- Contractor Repaired Damage
  - Yes  No  N/S

Name of Contractor: \_\_\_\_\_

# of Regular Hours: \_\_\_\_\_

# of Overtime Hours: \_\_\_\_\_

# of Regular Hours: \_\_\_\_\_

Crew Type: \_\_\_\_\_

**MATERIALS OR ROAD WORK:**

- Meter was replaced \_\_\_\_\_ (Stores Code)
- Regulator Was Replaced \_\_\_\_\_ (Stores Code)
- Temporary Asphalt Repair: \_\_\_\_\_ (sq. ft.)
- Permanent Asphalt Repair: \_\_\_\_\_ (sq. ft.)

**RIGHT OF WAY:**

- Dedicated Utility Easement
- Federal Utility Easement
- Pipeline
- Power / Transmission Line
- Private - Business
- Private - Easement
- Private - Land Owner
- Public - County Road
- Public - Interstate Highway
- Public - Other
- Public - State Highway
- Public - City Street
- Unknown

**DAMAGING PARTY:**  
 Name: BADGER DIRECTIONAL BORING  
 Address: 6123 W. HORN  
 City/ State/ Zip: FAIRLAND, TN 37026  
 Phone: (317) 460-9310  
KEVIN RUSSELL  
 Prepared / Investigated By: \_\_\_\_\_ Date: 2-21-13

**PARTY TO INVOICE:**  
 Name: Same  
 Address: \_\_\_\_\_  
 City/ State/ Zip: \_\_\_\_\_  
 Phone: ( ) \_\_\_\_\_  
[Signature]  
 Reviewed by Field Supervisor: \_\_\_\_\_ Date: 2-21-13

Contractor bored through 2" in PL SERVICE in parking lot

NORMAL NOTICE

Ticket : 1302040229 Date: 02/04/2013 Time: 08:30 Oper: KCUNNINGHAM Chan:001

State: IN Cnty: HAMILTON Twp: CLAY  
 Cityname: CARMEL Inside: Y Near: N  
 Subdivision:

Address : 1374  
 Street : S RANGE LINE RD  
 Cross 1 : MEDICAL DR Within 1/4 mile: Y  
 Location: THIS IS THE CENTRE SHOPPING CENTER--LOCATE THE NORTH SIDE OF THE  
 PROPERTY AT THE ENTIRE AREA UNDER CONSTRUCTION  
 \*\*\*Boring Where = UNDER NEW/EXISTING PARKING LOTS

:  
 Grids : 3957B8607A 3957B8607B 3957C8607A 3957C8607B  
 Boundary: n 39.961864 s 39.956292 w -86.130903 e -86.126171

Work type : INSTALLING ELECTRICAL FOR LIGHTING  
 Done for : BABCOCK ELECTRIC  
 Start date: 02/06/2013 Time: 08:45 Hours notice: 48/048 Priority: NORM  
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N  
 Duration : 2 DAYS Depth: 6 FEET

Company : BADGER DIRECTIONAL BORING Type: CONT  
 Co addr : 6125 WEST 400 NORTH  
 City : FAIRLAND State: IN Zip: 46126  
 Caller : BRIAN LEMMER Phone: (317)460-9310  
 Contact : BRIAN LEMMER--CELL Phone:  
 BestTime:  
 Mobile : (317)460-9310  
 Email : BADGERDIRECTIONALBORING@YAHOO.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time  
 Will you be white-lining the dig site area? NO  
 :

Submitted date: 02/04/2013 Time: 08:30  
 Members: ID0002 ID0103 ID0660 ID2001 ID2400 ID2708 ID4866 ID5117 ID7053 ID8122  
 ID8999 ID9200 ID9979 ID9999 SBCIN SM

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
AT&T - TRANSMISSION	FIBER OPTIC
AT&T - TRANSMISSION/TCG	FIBER OPTIC
BRIGHT HOUSE NETWORKS INDIANAPOLIS	CABLE TV
CARMEL STREET DEPARTMENT, CITY OF	
CARMEL UTILITIES	
CLAY TOWNSHIP REGIONAL WASTE DISTRICT	SEWER
COMCAST NORTHEAST (NOBLESVILLE)	CABLE TV
DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
FIBERTECH	FIBER OPTIC

MCI	FIBER OPTIC
PAETEC / FORMERLY MCCLEOD USA	FIBER OPTIC
TW TELECOM	
VECTREN - NOBLESVILLE #1	GAS
ZAYO BANDWIDTH	FIBER OPTIC



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:15:20 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:15:20 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:15:24 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:14:53 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:14:36 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/5/2013 2:14:06 AM

DAMAGE SEE REMARKS

Ticket : 1302211544 Date: 02/21/2013 Time: 14:59 Oper: DLANE Chan:089

State: IN Cnty: HAMILTON Twp: CLAY  
 Cityname: CARMEL Inside: Y Near: N  
 Subdivision:

Address : 1374  
 Street : S RANGE LINE RD  
 Cross 1 : MEDICAL DR Within 1/4 mile: Y  
 Location: THIS IS THE CENTRE SHOPPING CENTER--LOCATE THE NORTH SIDE OF THE  
 PROPERTY AT THE ENTIRE AREA UNDER CONSTRUCTION  
 \*\*\*Boring Where = UNDER NEW/EXISTING PARKING LOTS

:  
 Grids : 3957B8607A 3957B8607B 3957C8607A 3957C8607B  
 Boundary: n 39.961864 s 39.956292 w -86.130903 e -86.126171

Work type : INSTALLING ELECTRICAL FOR LIGHTING  
 Done for : BABCOCK ELECTRIC  
 Start date: 02/21/2013 Time: 15:00 Hours notice: 0/000 Priority: EMER  
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: Y  
 Duration : 2 DAYS Depth: 6 FEET

Company : BADGER DIRECTIONAL BORING Type: CONT  
 Co addr : 6125 WEST 400 NORTH  
 City : FAIRLAND State: IN Zip: 46126  
 Caller : BRIAN LEMMER Phone: (317)460-9310  
 Contact : BRIAN LEMMER--CELL Phone:  
 BestTime:  
 Mobile : (317)460-9310  
 Email : BADGERDIRECTIONALBORING@YAHOO.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time  
 GAS LINE HAS BEEN HIT-VECTREN-GAS LINE IS BLOWING-YES HEAR AND SMELL GAS-NORTH  
 SIDE OF PROPERTY-UNKNOWN SIZE / COLOR/ MATERIAL-ADVISED TO CALL 911-CREW ON  
 SITE-ADVISED CALLER TO CALL VECTREN-PREVIOUS TICKET 1302040229-THANK YOU  
 Will you be white-lining the dig site area? NO  
 :

Submitted date: 02/21/2013 Time: 14:59  
 Members: ID0002 ID0103 ID0660 ID2001 ID2400 ID2708 ID4866 ID5117 ID7053 ID8122  
 ID8999 ID9200 ID9979 ID9999 SBCIN SM

Member Name	Facility Types
AT&T - DISTRIBUTION	COMMUNICATIONS
AT&T - TRANSMISSION	FIBER OPTIC
AT&T - TRANSMISSION/TCG	FIBER OPTIC
BRIGHT HOUSE NETWORKS INDIANAPOLIS	CABLE TV
CARMEL STREET DEPARTMENT, CITY OF	
CARMEL UTILITIES	
CLAY TOWNSHIP REGIONAL WASTE DISTRICT	SEWER
COMCAST NORTHEAST (NOBLESVILLE)	CABLE TV

DUKE ENERGY / FORMERLY CINERGY	ELECTRIC
FIBERTECH	FIBER OPTIC
MCI	FIBER OPTIC
PAETEC / FORMERLY MCCLEOD USA	FIBER OPTIC
TW TELECOM	
VECTREN - NOBLESVILLE #1	GAS
ZAYO BANDWIDTH	FIBER OPTIC



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:36:48 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:36:51 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:37:01 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:37:16 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:37:20 AM



Property of United States Infrastructure Corporation  
Photo taken on 2/21/2013 3:37:29 AM

# Service Order Status

Friday, February 22, 2013

**Enter Service Order Number:**

5533857



[Clear Form](#)

[Refresh Data](#)

**Banner Instance:**  CS03PROD  CS01PROD  CS02PROD

**Order Number:** N5533857

**Order Type:** LEAK

**Order Status:** Completed

**Customer:** 621281230 - CITY BARBECUE

**Prem:** 5398447 - 1356 S RANGE LINE RD

**Technician:** 2912 - Russell, Kevin

**Order Dates and Times**

**Need Date:** 2/21/2013 3:08:00 PM  
**Time Created:** 2/21/2013 3:05:32 PM  
**Time Dispatched:** 2/21/2013 3:05:33 PM  
**Time In Route:** 2/21/2013 3:07:47 PM  
**Time On-Site:** 2/21/2013 3:25:16 PM  
**Tech Complete:** 2/21/2013 4:12:49 PM  
**Time Closed:** 2/21/2013 4:12:49 PM

**Events Performed/Completion Code**

LKOT - INC

**Meter Information**

**Current ReadStatus**

**Old Meter:**

**New Meter:**

**Completion Notes**

WRONG ADDRESS GIVEN FOR DAMAGE.SEE INFO FOR ADDRESS 1346 S.RANGELINE RD.

**Request Notes**

[ER JEFF GUINN STATES MARK HELLER PHONED IN POSSIBLE HIT LINE WHILE BORING 2"PL/SW CORNER OF PROPERT  
 Y CONT# 317-557-4672

**MDSI Event Dates and Times**

Event	Date/Time	User
AsnAssignmentManualAck_evt	2/21/2013 3:06:49 PM	Russell, Kevin
AsnAssignmentEnRoute_evt	2/21/2013 3:07:47 PM	Russell, Kevin
AsnAssignmentOnSite_evt	2/21/2013 3:25:16 PM	Russell, Kevin
OrdOrderComplete_evt	2/21/2013 4:12:49 PM	Russell, Kevin

NOTE:The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.