



## Pipeline Safety Division Investigation Report

**Investigation regarding:** C and E Excavating Inc.

UPPAC Database Record ID: 5062

Investigator: Grant Gray

Report Date: 9/27/13

### The Parties

Excavator: C and E Excavating

Contact: Jennifer Burgess

Address (City, State): 53767 CR 9 North, Elkhart, IN 46514

Telephone: 574-262-4346

### Facility Owner Information:

Business Name: NIPSCO

**Synopsis:** A natural gas service line was damaged during work to a curb/sidewalk.

**Findings:** Operator indicates the facilities were accurately marked but somewhat obscured by weather and construction activities. A re-mark would have been appropriate. Excavator indicates at first it was assumed the facility was mis-marked but locator showed pictures of the marking in the road and an almost clear mark in the grass. Excavator's employee indicates he tried to argue the depth and the old marking. If excavator was unsure of which locate marks to use, especially during construction activities when the markings can become obscured, it should have called in for a re-locate. Operator also included a picture indicating the facility was within 24" of the locate marks.

**Conclusion:** Failure to notify IN 811 when locate marks become illegible.

**Violation:** IC 8-1-26-20(a)(3)(b): Failure to notify IN 811 when locate marks become illegible.



150 West Market Street, Suite 600  
Indianapolis, IN 46204

August 26, 2013

*Via Electronic Transmission – [PipelineDamageCase@urc.in.gov](mailto:PipelineDamageCase@urc.in.gov)*

Pipeline Safety Division – Case No. 5062  
Indiana Utility Regulatory Commission  
101 West Washington Street, Suite 1500 East  
Indianapolis, Indiana 46204

RE: Investigation Request for Information; Pipeline Division Case No. 5062

To Whom It May Concern:

Attached please find Northern Indiana Public Service Company's ("NIPSCO") written information, and supporting documentation, relating to the following event:

Date of Event: 7/9/2013  
Event Location: NEW ST  
City: ELKHART  
Facility Owner: NIPSCO  
Excavator: C AND E EXCAVATING  
Other Party: N/A  
Pipeline Division Case No. 5062

NIPSCO has reviewed its recovery and damage prevention files for this matter and has provided answers, when known, to the list of questions set forth in the Information Request. To the extent available, NIPSCO is also providing a copy of the Damage Information Report – Pipeline Safety Division previously submitted by NIPSCO to IURC Pipeline Safety as well as additional documentation relating to this Event Location.

Upon completion of the investigation, NIPSCO requests that it be provided with a copy of the Pipeline Division's Investigation Report with findings that will be forwarded to the Underground Plant Protection Advisory Committee. If there are any additional questions, please contact the undersigned.

Very truly yours,

Christopher C. (Kit) Earle  
NiSource Corporate Services - Legal  
Phone: 317-684-4904  
Fax: 317-684-4918  
Email: [cearle@nisource.com](mailto:cearle@nisource.com)

<b>IURC INFORMATION REQUEST</b>	
<b>Pipeline Safety Division Case No. 5062</b>	
Date of Event	7/9/2013
Event Location	NEW ST
Event City	ELKHART
Facility Owner	NIPSCO
Excavator	C AND E EXCAVATING
Date of IURC Information Request	July 26, 2013
<b>THE PARTIES</b>	
<b>EXCAVATOR:</b>	
BUSINESS NAME	C and E Excavating
RESPONSIBLE PARTY PERSONAL NAME	
TITLE (IF ANY)	
ADDRESS	53767 CO RT 9
CITY/ STATE/ZIP	Elkhart / IN / 46514
PREFERRED TELEPHONE	574-262-4346
CELL PHONE TELEPHONE	
EMAIL ADDRESS	tbessinger@candeexcavating.com
<b>FACILITY INFORMATION - OWNER/OPERATOR OF UTILITY LINE:</b>	
BUSINESS NAME	NORTHERN INDIANA PUBLIC SERVICE COMPANY
RESPONSIBLE PARTY PERSONAL NAME	LUKE SELKING
TITLE	
ADDRESS	1501 HALE AVENUE
CITY/STATE/ZIP	FORT WAYNE, IN 46802
PREFERRED TELEPHONE	260/439-1290
SECONDARY TELEPHONE	
EMAIL ADDRESS	LSELKING@NISOURCE.COM
<b>LOCATOR SERVICE INFORMATION</b>	
BUSINESS NAME	USIC
RESPONSIBLE PARTY PERSONAL NAME	Morgan Thompson
TITLE (IF ANY)	Claims Coordinator
ADDRESS	9045 N. River Rd. Suite 300
CITY/ STATE/ZIP	Indianapolis, IN 46240
PREFERRED TELEPHONE	1-317-538-7301
CELL PHONE TELEPHONE	Same
EMAIL ADDRESS	morganthompson@usicinc.com
<b>OTHER (WITNESS, POLICE, FIRE, OTHER) INFORMATION</b>	
PERSONAL CONTACT	
BUSINESS/ORGANIZATION NAME	
TITLE (IF ANY)	

ADDRESS	
CITY/ STATE/ZIP	
PREFERRED TELEPHONE	
CELL PHONE TELEPHONE	
EMAIL ADDRESS	
<b>UTILITY LINE IMPACT</b>	
<b>LOCATION OF DAMAGE</b>	
ADDRESS	309 New Street
CITY/STATE/ZIP	Goshen / IN /
NEAREST INTERSECTION	
<b>PRODUCT TYPE (Select One)</b>	
NATURAL GAS	X
LIQUID PIPELINE	
UNKNOWN/OTHER	
<b>FACILITY TYPE (Select One)</b>	
DISTRIBUTION	
GATHERING	
SERVICE/DROP	X
TRANSMISSION	
UNKNOWN/OTHER	
SIZE (DIAMETER/ETC.)	5/8"
PRESSURE (PSIG/INCHES)	
INTERRUPTION IN SERVICE (YES/NO)	Yes
NUMBER OF CUSTOMERS AFFECTED	1
EVACUATION (YES/NO)	No
IF YES, HOW MANY EVACUATED	
REPAIR COST (IF KNOWN) (\$)	
<b>CAUSE OF DAMAGE INFORMATION:</b>	
<b>TYPE OF EQUIPMENT (Select One)</b>	
Auger	
Backhoe/Trackhoe	
Boring/Drilling	
Directional Drilling	
Explosives	
Farm Equipment	
Grader/Scraper	X
Hand Tools	
Milling Equipment	
Probing Device	

Trencher	
Vacuum Equipment	
Unknown/Other	
<b>TYPE OF WORK PERFORMED (Select One)</b>	
Agriculture	
Cable TV	
Curb/Sidewalk	
Bldg. Construction	
Bldg. Demolition	
Drainage	
Driveway	
Electric	
Engineering/Surveying	
Fencing	
Grading	X
Irrigation	
Landscaping	
Liquid Pipeline	
Milling	
Natural Gas	
Pole	
Public Transit Authority	
Railroad Maintenance	
Road Work	
Sewer (Sanitary/Storm)	
Site Development	
Steam	
Storm Drain/Culvert	
Street Light	
Telecommunications	
Traffic Signal	
Traffic Sign	
Water	
Waterway Improvement	
Unknown/Other	
RELEASE OF PRODUCT (YES/NO)	Yes
IGNITION AND/OR FIRE (YES/NO)	No
EXCAVATOR NOTIFY 811 (YES/NO)	Yes – 1307092446
<b>LOCATE INFORMATION:</b>	
EXCAVATOR REQUEST LOCATE (YES/NO)	Yes

INDIANA 811 LOCATE TICKET NUMBER	1306280114
LOCATE MARKS VISIBLE (YES/NO)	Yes
LOCATE MARKS CORRECT (YES/NO)	Yes
EXCAVATOR "WHITE LINED" (YES/NO)	No
MAPS USED TO MARK FACILITIES (YES/NO)	Yes
OPERATOR EMPLOYEES ON-SITE DURING EXCAVATION (YES/NO)	No
<b>INCIDENT IMPACT INFORMATION</b>	
NUMBER OF OUTPATIENT TREATED	0
NUMBER OF INPATIENT TREATED	0
NUMBER OF FATALITIES	0
FIRE DEPARTMENT RESPONSE (YES/NO)	N/A
POLICE DEPARTMENT RESPONSE (YES/NO)	N/A
AMBULANCE RESPONSE (YES/NO)	N/A
<b>ADDITIONAL INFORMATION/COMMENTS</b>	
<p>Failure to use hand tools where required. Facilities accurately marked, but somewhat obscured by weather and/or construction activities. A re-mark might have also been appropriate.  Emergency ticket number: 1307092467.</p>	

NORTHERN INDIANA PUBLIC SERVICE COMPANY
FACILITY DAMAGE REPORT

\*\* COMPLETE FORM FOR ALL DAMAGES TO NIPSCO FACILITIES \*\*

REPORTING OPERATING AREA GOSWEN 110 MAXIMO WO #

OPERATING AREA CONTACT Cole/RMSLEY JOB ORDER # 605211

TRACKING NUMBER 018 2013 0709 010 LOCATE REF # 1306280114
Locate Performed By: USIC

DATE AND TIME OF ACCIDENT 7/9/13 1326 M DATE OF REPORT 7/9/13

PLACE OF DAMAGE (INCLUDE CITY) 309 NEW ST GOSWEN

DAMAGE WAS TO:

ELECTRIC - POLE / TRANSFORMER: # N/A SIZE N/A YEAR INSTALLED N/A BROKEN YES ( ) NO ( )

OTHER (DESCRIBE) N/A

GAS: SERVICE X MAIN ( ) SIZE 1 1/8 MATERIAL: PLASTIC X STEEL ( ) METER ( ) REG STATION ( ) STUB ( )

OTHER (DESCRIBE) N/A

DEPTH OF FACILITY (Inches) 20" PRESSURE (PSI) 50 Lbs.

RELEASE OF GAS: YES X NO ( ) IGNITION OF GAS: YES ( ) NO X EVACUATION REQUIRED: YES ( ) # NO X

INTERRUPTION OF SERVICE: YES X NO ( ) NUMBER OF CUSTOMERS LOST: 1

DURATION OF INTERRUPTION: TIME REPORTED 1.5 Hrs TIME RESTORED 15:00

DIAMETER/MEASUREMENT OF HOLE IN GAS FACILITY: 1 1/8

LOCATE MARKS ON SITE: YES X DISTANCE BETWEEN FACILITY AND LOCATE MARKS NO ( )

HOW LOCATED: PAINT X FLAGS ( ) BOTH ( ) WHITE LINED ( )

PARTY THAT CAUSED DAMAGES (NAME) C & E EXCAVATING

ADDRESS OF PARTY (INCLUDE CITY)

WHO WAS IN CHARGE OF THE WORK SITE AT TIME OF DAMAGE THAD (574-262-4346)

WITNESS NAME AND ADDRESS N/A

WITNESS REMARKS N/A

AGENCIES NOTIFIED / ONSITE: POLICE ( ) AGENCY N/A REPORT # N/A

FIRE ( ) AGENCY N/A REPORT # N/A

OTHER ( ) N/A Any Injuries? ( ) YES # NO X

PHOTOS TAKEN: YES ( ) NO X TAKEN BY: N/A (ATTACH PHOTOS TO REPORT)
MEDIA ON SITE YES ( ) NO X

WORK IN PROGRESS WHEN FACILITY DAMAGED - CHECK APPROPRIATE CHOICE BELOW

- ( ) AGRICULTURE/FARMING ( ) CABLE TV ( ) CURB/SIDEWALK ( ) TELECOMMUNICATIONS
( ) BLDG CONSTRUCTION ( ) DEMOLITION ( ) DRAINAGE ( ) WATER
( ) DRIVEWAY ( ) ELECTRIC ( ) SURVEYING ( ) DRAINS/CULVERTS
( ) FENCING ( ) GRADING ( ) IRRIGATION ( ) MOWING
( ) LANDSCAPING ( ) PIPELINE ( ) MILLING ( ) OTHER
( ) POLE/SIGN POST ( ) ROAD WORK ( ) SEWER

TYPE OF EQUIPMENT USED - CHECK APPROPRIATE CHOICE BELOW

- ( ) AUGER ( ) HAND TOOLS ( ) BACKHOE/TRACKHOE
( ) MILLING EQUIPMENT ( ) PROBING DEVICE ( ) BORING / DRILLING
( ) EXPLOSIVES ( ) TRENCHER ( ) FARM EQUIPMENT
( ) VACCUUM EQUIPMENT X GRADER/DOZER ( ) OTHER

REASON DAMAGE OCCURRED - CHECK APPROPRIATE CHOICE BELOW

- ( ) AUTOMOTIVE ACCIDENT ( ) EXCAVATING BEFORE LOCATES DUE X CARELESS MACHINE OPERATOR
( ) NO NOTIFICATION ( ) MARKS DISTURBED ( ) STUB ( ) OTHER

SEE REVERSE SIDE FOR COMMENTS AND DIAGRAM

COMMENTS :

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

PERSON PREPARING REPORT

*Shadd Grigsby*

FIELD SUPERVISOR


*Mark Knisley*

FIELD MANAGER

*JC*

- ORIGINAL REPORT AND SUPPORTING INFORMATION IS TO BE SENT TO FACILITY DAMAGE RECOVERY
- COPY OF REPORT IS TO BE SENT TO DAMAGE PREVENTION

SKETCH: - Show position of all pertinent information

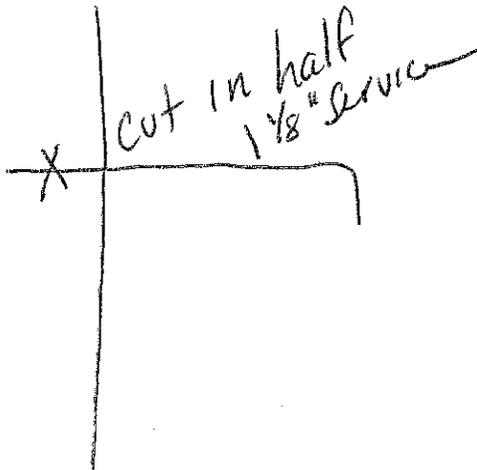

FOR OFFICE USE ONLY:

- |   |     |    |
|---|-----|----|
| • DID EXCAVATION OCCUR BEFORE LOCATES WERE DUE  | YES | NO |
| • NO IN 811 LOCATE CALLED IN                    | YES | NO |
| • DAMAGE CAUSED FROM EXCAVATION WITHIN 24" ZONE | YES | NO |
| • EXPIRED LOCATE                                | YES | NO |
| • WAS WHITE LINING INDICATED ON LOCATE REQUEST  | YES | NO |

COMPLETED BY: \_\_\_\_\_ DATE: \_\_\_\_\_

Facility: Distribution Lines; Folder: On-Hold folder; Assigned To: N/A

NIPSCO 00052 IUPPSa 06/28/2013 07:18:32 1306280114-00A NORM NEW GRID

NORMAL NOTICE REMARK SEE REMARKS

Ticket : 1306280114 Date: 06/28/2013 Time: 07:16 Oper: LWILLIAMS Chan:000  
Old Tkt: 1306180918 Date: 06/18/2013 Time: 09:30 Oper: LSTEVENSON Rev: 00A

State: IN Cnty: ELKHART Twp: ELKHART  
Cityname: GOSHEN Inside: Y Near: N  
Subdivision:

Address :

Street : NEW ST

Cross 1 : W PIKE ST Within 1/4 mile: Y

Location: FROM THE INTERSECTION - LOCATE THE ENTIRE ROAD - RIGHT OF WAY TO RIGHT  
OF WAY - GOING NORTH APPROX 500 FEET TO WEST WILKINSON STREET - PLEASE PAINT  
AND FLAG

:

Grids : 4135C8550C

Boundary: n 41.590668 s 41.588625 w -85.839263 e -85.837716

Work type : NEW STREET - WATER MAIN

Done for : CITY OF GOSHEN

Start date: 07/02/2013 Time: 07:30 Hours notice: 96/048 Priority: NORM

Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: N

Duration : 1 MONTH Depth: 6 FEET

Company : C AND E EXCAVATING Type: CONT

Co addr : 53767 CO RT 9

City : ELKHART State: IN Zip: 46514

Caller : THAD BESSINGER Phone: (574)262-4346

Contact : THAD BESSINGER - OFFICE Phone:

BestTime:

Mobile : (574)262-4346

Fax : (574)262-9251

Email : TBESSINGER@CANDEEXCAVATING.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time

REMARK AS NEEDED DUE TO CONSTRUCTION---THANK YOU

Will you be white-lining the dig site area? NO

:

Submitted date: 06/28/2013 Time: 07:16

Members: COMCN ID5306 ID6794 ID7053 ID8000 NIPSCO SM

Facility: Transmission Lines; Folder: N/A; Assigned To: N/A

NIPSCO 00798 IUPPSa 07/09/2013 13:34:56 1307092446-00A EMER DAMG GRID

DAMAGE SEE REMARKS

Ticket : 1307092446 Date: 07/09/2013 Time: 13:33 Oper: KSWANK Chan:063

State: IN Cnty: ELKHART Twp: ELKHART  
Cityname: GOSHEN Inside: Y Near: N  
Subdivision:

Address :

Street : NEW ST

Cross 1 : W PIKE ST Within 1/4 mile: Y

Location: FROM THE INTERSECTION - LOCATE THE ENTIRE ROAD - RIGHT OF WAY TO RIGHT  
OF WAY - GOING NORTH APPROX 500 FEET TO WEST WILKINSON STREET - PLEASE PAINT  
AND FLAG

:

Grids : 4135C8550C

Boundary: n 41.590668 s 41.588625 w -85.839263 e -85.837716

Work type : NEW STREET - WATER MAIN

Done for : CITY OF GOSHEN

Start date: 07/09/2013 Time: 13:33 Hours notice: 0/000 Priority: EMER

Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: Y

Duration : 1 MONTH Depth: 6 FEET

Company : C AND E EXCAVATING Type: CONT

Co addr : 53767 CO RT 9

City : ELKHART State: IN Zip: 46514

Caller : THAD BESSINGER Phone: (574)262-4346

Contact : THAD BESSINGER - OFFICE Phone:

BestTime:

Mobile : (574)262-4346

Fax : (574)262-9251

Email : TBESSINGER@CANDEEXCAVATING.COM

Remarks : All tickets are taken and processed on Eastern Daylight Time

A NIPSCO GAS LINE WAS HIT IN THE ROAD IN FRONT OF THE ADDRESS 309 NEW STREET -  
GAS IS BLOWING - CREW IS ON SITE - THE DESCRIPTION OF THE LINE IS UNKNOWN BUT IT  
IS A SERVICE LINE - CALLER HAS CALLED NIPSCO AND HAS BEEN ADVISED TO CALL 911 -  
PREVIOUS TICKET NUMBER 1306280114 - THANKS

Will you be white-lining the dig site area? NO

:

Submitted date: 07/09/2013 Time: 13:33

Members: COMCN ID5306 ID6794 ID7053 ID8000 NIPSCO SM

Facility: Transmission Lines; Folder: N/A; Assigned To: N/A

NIPSCO 00800 IUPPSa 07/09/2013 13:38:46 1307092467-00A EMER NEW STRT

EMERGENCY SEE REMARKS

Ticket : 1307092467 Date: 07/09/2013 Time: 13:35 Oper: JELEWITZ Chan:086

State: IN Cnty: ELKHART Twp: ELKHART  
Cityname: GOSHEN Inside: Y Near: N  
Subdivision:

Address : 309  
Street : NEW ST  
Cross 1 : W PIKE ST Within 1/4 mile: Y  
Location: LOCATE THE ENTIRE PROPERTY  
:  
Grids : 4135C8550C  
Boundary: n 41.591062 s 41.588586 w -85.839325 e -85.837813

Work type : REPAIRING A GAS LINE  
Done for : NIPSCO  
Start date: 07/09/2013 Time: 13:37 Hours notice: 0/000 Priority: EMER  
Ug/Oh/Both: U Blasting: N Boring: N Railroad: N Emergency: Y  
Duration : 1 DAY Depth: 6 FEET

Company : NIPSCO Type: MEMB  
Co addr : 801 EAST 86TH AVENUE  
City : MERRILLVILLE State: IN Zip: 46410  
Caller : LAURA SZCZECINA Phone: (800)322-2806  
Contact : MARK KINGSLEY - CELL Phone:  
BestTime:  
Mobile : (574)535-3001  
Fax : (219)647-4764

Remarks : All tickets are taken and processed on Eastern Daylight Time  
CREW IS EN ROUTE

Will you be white-lining the dig site area? NO  
:

Submitted date: 07/09/2013 Time: 13:35  
Members: COMCN ID5306 ID6794 ID7053 ID8000 NIPSCO SM

Fact Based Investigation Report

**Notification ID** 01820130709009  
**Damage Date** 07/09/2013 13:34  
**Notified By** THAD BESSINGER ()  
**Damage Address** NEW ST  
GOSHEN, IN  
**District** Northern Indiana  
**Notification Date** 07/09/2013  
13:40

---

**Damaged Customer** NIPSCO

---

**Investigation Date From** 07/09/2013 13:45:00 **To** 07/09/2013 14:50:00

---

**Excavator Involved** C & E EXCAVATING  
**Type of Excavation** NEW STREET - WATER MAIN

---

**Orig. Locate Request** 1306280114 **Start Date** 07/02/2013 07:30  
**Type of Ticket** Ongoing Project **Locate Req. Info** N/A

---

**Damage Request #** 1307092446 **Start Date** 07/09/2013 13:35

---

**Pictures Taken By** Scott Schooley **Date** 07/09/2013 14:00  
**Photography Type** Digital **Frame #** see 1307092446

---

**Investigator Emp. #** 130534 **Investigator Name** Josh Scheibelhut  
**Based on your investigation, is further investigation needed?** No

---

**Fact Based Investigation Customer Information**

**Facility Description** Low Profile **Facility ID** Gas Service

**Locator Name & EMP #** Schooley Scott - 125980 **Locator Not Known**

---

**Investigation Findings**

Facility Marked Accurately

**Other Notes**

---

**Investigation Methods**

Investigator Verified Existing Marks By Hooking Up  
Visual, Facility Exposed At Time Of Investigation

---

**Investigator Statement/Causal Factors**

Facility was marked accurately. Marks had faded due to recent weather and construction traffic. (See post locate photo 20130702081921\_IMG2193.jpg on ticket 1306280114)

**Names of Utility Representatives Contacted or on Site and Statement**

n/a

**Names of Excavator's Representatives Contacted or on Site and Statement**

n/a

**Other individuals on site**

Scott Schooley, USIC

---

**Were any markings visible on the damage site upon arrival?** Yes

**Were any other indicators of facility present in the area?** Yes

<b>Was the excavation within the tolerance zone of marks?</b>	Yes
<b>Extent of facility damage</b>	cut
<b>Replacement Footage</b>	splice
<b>Was contractor assistance required? If yes, who?</b>	No n/a
<b>What contractor equipment was used?</b>	n/a
<b>Is the facility shown on the utility records?</b>	No
<b>If yes, list record numbers</b>	n/a



Property of United States Infrastructure Corporation  
Photo taken on 7/9/2013 2:11:50 PM



## INFORMATION REQUEST

State Form 54909 (R / 3-13)

INDIANA UTILITY REGULATORY COMMISSION – PIPELINE SAFETY DIVISION

Case Number: 5062

Date of Damage (month, day, year): 07/09/2013

---

### Location of Damage:

Address (number and street): 309 New Street

City, State and ZIP Code: Goshen, IN 46528

Nearest Intersection: W. Pike Street

---

### Excavator Information:

Business Name: C & E Excavating, Inc.

Responsible Party Personal Name: Jennifer Burgess

Title (if any): Corporate Secretary

Address (number and street): 53767 CR 9 N

City, State and ZIP Code: Elkhart, IN 46514

Preferred Telephone Number (area code): 574-262-4346

Email Address: jburgess@candeexcavating.com

---

### Utility Information:

Utility Name: NIPSCO

Contact Person: \_\_\_\_\_

Title (if any): \_\_\_\_\_

**Cause of Damage Information**

Type of Equipment (*select one*):

Backhoe/Trackhoe

Type of Work Performed (*select one*):

Curb/Sidewalk

Repair Cost: \$ \_\_\_\_\_

Did a leak result from damage:  Yes  No

Was there ignition:  Yes  No

Excavator Notify 911 due to leak:  Yes  No

Excavator Notify 811 upon damage:  Yes  No

Excavator Notify Utility upon Damage:  Yes  No

---

**Locate Information**

Excavator Request Locate:  Yes  No

Indiana 811 Locate Ticket Number: 1306280114

Locate Marks Visible:  Yes  No

Locate Marks Correct:  Yes  No

Excavator "White Lined":  Yes  No

Was Locate Provided within Two (2) Working Days:  Yes  No

Utility Employees On-site during Excavation:  Yes  No

---

**Incident Information:**

Fire Department Response:  Yes  No

Police Department Response:  Yes  No

Ambulance Response:  Yes  No

**Additional Information / Comments**

The gas line that was hit on 7/9/13 at 309 New Street was at the edge of the road near the curb line. There were previous marks that had been disrupted by construction activities. The line was extremely shallow in depth, and there were old and new marking lines that made it difficult for our operator to avoid the damage. The operator immediately notified NIPSCO and the project manager, who then notified Indiana 811. The operator was able to make the worksite safe, and NIPSCO was onsite very quickly thus avoiding the need to call 911 Emergency Services. I have included a copy of the Daily Report from the foreman on site.

Printed Name: Jennifer Burgess, Corporate Secretary

Signature:  Date (month, day, year): 8/13/13

*\*If submitting this form electronically, typing your name in the signature box will act as an electronic signature.*

**Please return completed form to:**

**[PipelineDamageCase@urc.in.gov](mailto:PipelineDamageCase@urc.in.gov)**

**Or mail to:**

**Indiana Utility Regulatory Commission  
Pipeline Safety Division - Case Number \_\_\_\_\_  
101 West Washington Street, 1500E  
Indianapolis, IN 46204**

**Or fax to:  
317-233-2410**

## Daily Report

Diary: Date - 07/09/2013 (Tuesday)

Foreman - TY G

Warm - (80 - 85), Partly Sunny / Cloudy, Overcast, Afternoon Rain, Ground Wet - Workable

We dried out the road from the rain over night. I started hauling off sand and back hauled 1 round of #53 recycle. The rest went to V and S.

The 550 blew a hyd. fitting which we changed out luckily while the trucks were gone.

Klink hauled off 10 loads of sand at 16 yards per load.

2 loads of stone were hauled in at 23.8 and 23.66 tons per load.

I hit a gas service at 309 New street in the curb line grading for stone. The line came up to shallow depth at the edge of the road and since they shifted the road to the west I hit it. It first appeared that it was miss marked with the mark being on the drive but the locator was able to pull up pictures of the marking in the road and an almost clear mark in the grass. The mark I was referring to was the what he said was the old line. My guess is from what I saw it will be charged to us. I tried to argue the depth and the old marking and that the line I hit had no fresh paint in the grass but I think it was for not.

x

Date: \_\_\_\_\_

'C' - indicates a completed item.  
'(R)' - indicates a rework quantity.