



Pipeline Safety Division Investigation Report

Investigation regarding: Mcf Construction

UPPAC Database Record ID: 1578

Investigator: Howard Friend

Telephone: (317) 232-2717

Report Date: 01/17/2012

Damage Date: 08/17/2010

Damage Address: Salem Drive, Concord Drive

City: Newburgh

County: Warrick

The Parties

Excavator: Mcf Construction

Commercial Business

Contact: Mike Freeman, President

Address: 7051 Savannah Drive, Newburgh, In 47630

Telephone: (812) 853-6852

Facility Owner: Vectren

Contact: Darlene Kulhanek, Manager, Facilities Damages

Address: 1 N Main Street, Evansville, IN 47702

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Distribution

Pipeline Safety Division Investigation Report

Investigation regarding: Mcf Construction

UPPAC Database Record ID: 1578

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: Yes

Number of Customers Affected: 21

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$3857

Excavator Activities

Indiana 811 Locate Request Number: NA

Excavation Equipment: Auger

Nature of Excavation: Fencing

Synopsis: 2" plastic natural gas main damaged during installation of a fence.

Findings: Reported by utility; excavator signed for initial mailing on 09/26/2011. Excavator was augering in fence posts, was working off of expired locates that had been called in for previous work to the lot.

Conclusion: Failure by the excavator to request location of underground facilities.

Violation: IC 8-1-26-16(g): Failure to provide notice of excavation.

Mcf Construction has no other damage reports in the record.


NO

LOCATE

TICKET

PROVIDED

STATE OF INDIANA

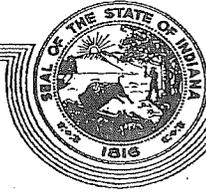

INDIANA UTILITY REGULATORY COMMISSION
101 W. WASHINGTON STREET, SUITE 1500E
INDIANAPOLIS, INDIANA 46204-3407

<http://www.in.gov/iurc>
Office: (317) 232-2701
Facsimile: (317) 232-6758

September 20, 2011

Ms. Darlene Kulhanek
Vectren
1 N Main Street
Evansville, IN 47702

Subject: Investigation Request for Information

Date of Event: 8/17/2010

Event Location: Salem Drive, Concord Drive, Newburgh

Facility Owner: Vectren

Excavator: MCF Construction

Other Party: N/A

Pipeline Division Case No. 1578

Dear Ms. Kulhanek:

Pursuant to Indiana Code 8-1-26, the *Indiana Damage to Underground Facilities Act*, the Pipeline Safety Division of the Indiana Utility Regulatory Commission ("Pipeline Division") is required to investigate reported incidents of alleged statutory violations involving underground pipeline safety. The purpose of this statute is to promote excavation and pipeline safety and to reduce the imminent danger to life, health, property, or loss of service associated with unsafe digging practices. Please note that the investigation does not entail determining criminal liability or a civil determination of fault or damages; however, it does determine whether any statutory violations were committed regarding public safety.

The Pipeline Division received information regarding potential statutory violations regarding the date and location referenced above. You were identified as a person or entity that might have information that would assist the Pipeline Division in its investigation. Therefore, we have contacted you in order to receive the full account of information in order to make a fair determination related to the circumstances of this incident.

We have asked all involved parties, entities and witnesses to provide *written* information within *30 days* in order to meet legal deadlines to conclude our investigation. **Please consider this letter as a formal request to receive any and all information and evidence (including a narrative, documentation,**

RECEIVED

SEP 23 2011

INDIANA UTILITY
REGULATORY COMMISSION

maps, photographs or any other written information) you can access regarding anything you may know about the incident referenced above.

Please promptly provide your information to: Pipeline Safety Division – Case No. 1578, Indiana Utility Regulatory Commission, 101 West Washington Street, # 1500E, Indianapolis, IN 46204. Also, please include the Investigation Number referenced above on your materials. In the alternative, if you would prefer to scan the materials and send them electronically, please send the documents to: *PipelineDamageCase@urc.in.gov*.

Although you are not a formal party in this investigation, please treat this request for information seriously, because the potential civil penalties for violations include: a potential civil fine up to \$10,000.00; mandatory education and training for employees regarding pipeline safety; a required development plan to avoid future violations; or a warning letter for certain homeowner/tenants who are first time offenders. Consequently, your input will assist the Pipeline Division with its determination and may have a substantial impact on the case.

After the investigation is completed, the Pipeline Division will prepare an Investigation Report with findings and forward it to the Underground Plant Protection Advisory Committee (“Advisory Committee”). This is a statutory committee, comprised of excavators, facility operators, investor and municipal utilities, the 811 Association and facility locate marking companies, whose role is to evaluate the Pipeline Division’s findings and make a recommendation for a civil penalty. In the event there is disagreement regarding the Advisory Committee’s recommendation to the Commission, parties are entitled to request a hearing before the full Commission. If there is a violation, the Indiana Utility Regulatory Commission (“Commission”) will impose the penalty. Any fines imposed are statutorily required to be spent funding the Commission’s training and educational programming to promote excavation and pipeline safety.

Thank you for your *prompt* assistance in providing written information to the Pipeline Division regarding the previously referenced incident. Any information received after the deadlines will not be considered in the investigation, will be unavailable to the Advisory Committee and will result in a lack of full information being made available; hence, your participation is vital to serving the interests of justice and enhancing the public’s safety. In an effort to assist you, please find an enclosure entitled “Information Request.” Should you have procedural or legal questions regarding the Underground Plant Protection Advisory Committee or the Indiana Utility Regulatory Commission, please contact David L. Welch, Assistant General Counsel, at (317) 234-4715. Should you have questions regarding the pipeline damage identified above, or our investigation, please contact me at (317) 232-2718. Thank you for your assistance.

Sincerely,



William Boyd
Director, Pipeline Safety Division

Enclosure: Information Request

Information Request

Pipeline Safety Division Indiana Utility Regulatory Commission

The Pipeline Safety Division of the Indiana Utility Regulatory Commission requests any and all information you can provide regarding the following criteria:

The Parties:

Excavator Information:

Business Name: **MCF Construction Inc**

Responsible Party Personal Name: **Mike**

Title (if any): **Unknown**

Address: **7051 Savannah Drive**

City, State Zip: **Newburgh, IN 47630**

Preferred Telephone: **812-205-5000**

Cell Phone Number:

Email Address:

Facility Information:

Business Name: **Vectren Energy**

Responsible Party Personal Name: **Darlene Kulhanek**

Title (if any): **Manager Facilities Damages**

City, State, Zip **Evansville, IN 47711**

Address: **1 Main Street**

Preferred Telephone: **812-491-4227**

Cell Phone Number: **812-568-5235**

Email Address: **Dkulhanek@vectren.com**

Locator Service Information:

Business Name: **USIC Inc.**

Responsible Party Personal Name: **Tim Sanders**

Title (if any): **Southern Indiana District Manager**

Address: **3818 E Morgan Avenue**

City, State Zip: **Evansville, IN 47715**

Preferred Telephone: **812-479-9236**

Cell Phone Number:

Email Address: **timsanders@usicinc.com**

Other (Witness, Police, Fire, Othea) Information: Warrick Co Sheriff's Dept.
Personal Contact: Business/Organization Name: N/A

Title (if any)

Address:

City, State, Zip

Preferred Telephone:

Cell Phone Number:

Email Address:

Utility Line Impact:

Product Type (circle one):

Natural Gas

Liquid Pipeline

Unknown/Other

Facility Type (circle one):

Distribution

Gathering

Service/Drop

Transmission

Unknown/Other

Size (Diameter/etc.): 2"

Pressure (PSIG/Inches): 60 PSIG

Interruption in Service: Yes / No

Number of Customers Affected: 2

Evacuation: Yes / No No If yes, How Many Evacuated? 0

Repair Cost (if known): \$ 3857.04

Cause of Damage Information:

Type of Equipment (circle one):

Auger

Backhoe/Trackhoe

Boring /Drilling

Directional Drilling

Explosives

Farm Equipment

Grader/Scraper

Hand Tools

Milling Equipment

Probing Device

Trencher

Vacuum Equipment

Unknown/Other

Type of Work Performed (circle one):

- Agriculture Cable
- TV Curb/Sidewalk
- Bldg. Construction
- Bldg. Demolition
- Drainage
- Driveway Electric
- Engineering/Surveying
- Fencing
- Grading
- Irrigation
- Landscaping
- Liquid Pipeline
- Milling
- Natural Gas
- Pole
- Public Transit Authority
- Railroad Maintenance
- Road Work
- Sewer (Sanitary/Storm)
- Site Development
- Steam
- Storm Drain/Culvert
- Street Light
- Telecommunications
- Traffic Signal
- Traffic Sign
- Water
- Waterway Improvement
- Unknown/Other

Release of Product: Yes / No

Ignition and/or Fire: Yes / No ?

Excavator Notify 811: Yes / No

Locate Information:

Excavator Request Locate: Yes / No


Indiana 811 Locate Ticket Number: ___ 0

Locate Marks Visible: Yes / No

Locate Marks Correct: Yes / No

Excavator "White Lined": Yes / No

Maps Used to Mark Facilities: Yes / No

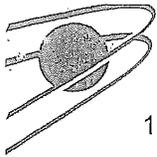

1 VECTREN ENERGY DELIVERY OF INDIANA - SOUTH


\$3,857.04

M C F CONSTRUCTION INC
7051 SAVANNAH DRIVE,
NEWBURGH, IN 47630

PAID

Type: GAS
Invoice: FDS0013046
BillToID: 29095
Billing Date: 8/30/2010
Date of Loss: 8/17/2010
5856 103.0509

Please return this portion with your remittance.

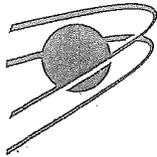

Mail Payment To: VECTREN ENERGY DELIVERY OF INDIANA - SOUTH
Vectren Utilities Holding Group, Inc.
1239 Reliable Parkway
Chicago, IL 60686-0012
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5
Risk Management/Claims Department

NOW DUE
\$3,857.04

M C F CONSTRUCTION INC
7051 SAVANNAH DRIVE,
NEWBURGH, IN 47630

Type: GAS
Invoice: FDS0013046
BillToID: 29095
Billing Date: 8/30/2010
Date of Loss: 8/17/2010

Invoice For Costs to Repair and Reconstruct Damaged Property

Address: 4955 SALEM DRIVE, NEWBURGH

2" PLASTIC MAIN DAMAGED BY AUGER. DID NOT REQUEST LOCATES.

Paid \$3857.04 9/7/10

*82892.78 Account
8 964.26 2026 Account
83857.04*

Material:	\$254.23
Company Labor:	\$3,018.55
Contract Labor:	\$0.00
Transportation/Equipment:	\$258.60
Misc:	\$37.50
Gas Loss:	\$288.16
Adjustments:	\$0.00
Payments:	\$0.00
<hr/> Total:	<hr/> \$3,857.04

5856 103.0509

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

FACILITIES DAMAGE REPORT GAS

Task No.: _____

Capital O&M (circle one)

FDS0013046

Vectren Corporation
Form 3112 (Rev. 10/04)

TIME: 8:50 AM PM

DATE OF DAMAGE: 8, 17, 10

- Indiana Gas
- Sigeco
- Vectren Energy Delivery of Ohio

Cost Center No.: 5856

DAMAGE SITE ADDRESS: Salem Dr.

LOT #: _____ CITY: Newburgh

FACILITIES DAMAGED

- MAIN
- SERVICE
- REGULATOR STATION
- FARM TAP
- RESIDENTIAL METER
- METER INDUSTRIAL/COMMERCIAL
- OTHER

- SIZE(S)
- 0.50 INCH
 - 0.75 INCH
 - 1.00 INCH
 - 2.00 INCH
 - 4.00 INCH
 - 6.00 INCH
 - OTHER _____

TYPE OF MATERIAL

- PLASTIC
- STEEL
- CAST IRON
- OTHER _____

DAMAGE TYPE

- SEVERED
- NOT CUT
- PUNCTURE
- SIZE 1 1/2" X 1 1/2"

PRESSURE

- 25 PSIG
- 40 PSIG
- 50 PSIG
- 60 PSIG
- 6 WC
- OTHER _____

PROTECTION IN PLACE

- RAIL
- POST
- NONE
- N/A

LEAK REPORT

606878

- ONE-WAY FEED
- TWO-WAY FEED

DURATION OF ESCAPING GAS

MINUTES 90

- EFV ACTIVATED YES NO

DAMAGED BY

- CONTRACTOR
- MUNICIPALITY/UTILITY
- VEHICULAR ACCIDENT
- COMPANY CREW
- UNKNOWN
- PROPERTY OWNER/TENANT
- OTHER _____

TYPE OF CONSTRUCTION

- SEWER/DRAIN
- WATER
- ELECTRIC
- TELEPHONE
- CEMENT/PAVING
- TV CABLE
- FENCING
- FOOTERS
- OTHER _____

WORKING FOR

- CITY
- STATE
- PROPERTY OWNER
- OTHER _____

TYPE OF EQUIPMENT

- BACKHOE
- TRACKHOE
- PLOW
- TRENCHER
- BULLDOZER
- POSTHOLE DIGGERS
- BORE
- AUGER
- STAKE/SHOVEL
- OTHER _____

DAMAGING PARTY

- DID NOT REQUEST LOCATES
- DID NOT HAND DIG
- USED EXPIRED LOCATES
- OTHER _____

NUMBER OF CUSTOMERS AFFECTED: _____

TOTAL HOURS SERVICE WAS OFF: _____

INVOICE: YES NO

DAMAGING PARTY

NAME: Wm A FREEMAN

ADDRESS: 2311 HOLBROOK DR

CITY/STATE/ZIP: NEWBURGH IN 47630

MCF CONSTRUCTION 7051 SAVANNAH

PREPARED BY _____ DATE _____

VISUAL OBSERVATION AT DAMAGE SITE

- LOCATE NOT APPLICABLE (Above Ground Damage Only)
- FACILITIES PROPERLY MARKED
- MARKING METHODS: CONVENTIONAL OFFSET
- FLAGS PAINT STAKES WHISKERS
- LOCATE MARKINGS FADED: YES NO
- WRONG ADDRESS REQUESTED
- FACILITIES IMPROPERLY LOCATED
- QUALIFIED LOCATOR COULD NOT HAVE ACCURATELY LOCATED
- INACCURATE MAPS/CARDS
- BROKEN OR NO TRACER WIRE (PLASTIC)
- INSULATION PREVENTING ACCURATE LOCATE
- LOCATOR ERROR
- QUALIFIED LOCATOR COULD HAVE ACCURATELY LOCATED
- INCOMPLETE LOCATE
- MARKINGS OFF BY _____ (FEET/INCHES)
- INAPPROPRIATE SITE MARKINGS
- NO LOCATE PERFORMED
- FAILURE TO FOLLOW POLICY
- WRONG ADDRESS LOCATED

OBSERVATION BY: _____

NAME OF LOCATOR: _____

- COPY OF MARKOUT REQUEST PROVIDED WITHIN 2 WORKING DAYS

NOTIFICATION AND OTHER DETAILS OF LOCATE

LOCATE TICKET #: _____

DATE: _____ TIME: _____ AM/PM

- REGULAR REQUEST
- EMERGENCY REQUEST

LOCATE COMPANY NOTIFIED

CONTACT NAME: _____

TIME CALLED: _____ AM/PM

TIME LOCATOR ARRIVED AT SITE: _____ AM/PM

COMPANY NOTIFIED OF LOCATE NEAR CRITICAL FACILITIES:

- YES
- NO

CONTRACTOR REPAIRS

- CONTRACTOR WORKING FOR VECTREN MADE REPAIRS AT OWN EXPENSE
- CONTRACTOR REPAIRED DAMAGE

NAME OF CONTRACTOR: _____

OF REGULAR HOURS _____

OF OVERTIME HOURS _____

CREW TYPE _____

MATERIALS OR ROAD WORK

- METER WAS REPLACED _____ (STORES CODE)
- REGULATOR WAS REPLACED _____ (STORES CODE)
- TEMPORARY ASPHALT REPAIR _____ (SQ. FT.)
- PERMANENT ASPHALT REPAIR _____ (SQ. FT.)

PARTY TO INVOICE

NAME: Same as other side

ADDRESS: _____

CITY/STATE/ZIP: _____

REVIEWED BY FIELD SUPERVISOR [Signature] DATE 8-17-10

Hit 2' main with auger on excavator
one way feed - 21 customers
shut off

MAXIMO WO#
4888188

INCLUDE ANY OBSERVATIONS ON BACK OF FORM

Service Order Status

Thursday, August 19, 2010

Enter Service Order Number:

1753898



Banner Instance: CS03PROD CS01PROD CS02PROD
Order Number: S1753898 *** Needs Review ***
Order Type: LEAK
Order Status: Completed

Customer: 008888888 - INACTIVE CUSTOMER
Prem: 1407326 - HERITAGE DRIVE AND CONCORD

Technician: 0753 - Mockobee, Conrad

Order Dates and Times

Need Date: 8/17/2010 8:58:00 AM
Time Created: 8/17/2010 8:50:51 AM
Time Dispatched: 8/17/2010 8:50:51 AM
Time In Route: 8/17/2010 8:51:33 AM
Time On-Site: 8/17/2010 8:58:04 AM
Tech Complete: 8/17/2010 1:50:31 PM
Time Closed: 8/17/2010 1:50:31 PM

Events Performed/Completion Code

LKNS - CMP

Meter Information

Current ReadStatus

Old Meter:
New Meter:

Completion Notes

CONTRACTOR INSTALLING FENCE,PUNCTURED 2" PLASTIC MAIN,CALLED FOR CREW.EVANSVILLEE
 ALSO ASSISTED,HAD TO SQUEEZE OFF ONE WAY FEED, TURNED ALL ACTIVE CUSTOMER OFF. S
 TILL HAVE 13 OFF WITH DOORS TAGGED FOR RELITE. CM

Request Notes

PER WARRICK CTY SHERIFF'S OFFICE, HIT LINE...NOT SURE IF BLOWING...CONTRACTORONSITE....FIRE DEPT IN
 ROUTE....OHIO TOWNSHIP...PH 812-897-1200.....THANKS

MDSI Event Dates and Times

Event	Date/Time	User
AsnAssignmentManualAck_evt	8/17/2010 8:51:26 AM	Mockobee, Conrad
AsnAssignmentEnRoute_evt	8/17/2010 8:51:33 AM	Mockobee, Conrad
AsnAssignmentOnSite_evt	8/17/2010 8:58:04 AM	Mockobee, Conrad
OrdOrderComplete_evt	8/17/2010 1:50:31 PM	Mockobee, Conrad

NOTE:The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.

Thursday, August 19, 2010

Service Order Status

Enter Service Order Number:

1753908



Banner Instance: CS03PROD CS01PROD CS02PROD

Order Number: S1753908

Order Type: LEAK

Order Status: Completed

Customer: 009999999 - OWNER UNKNOWN

Prem: 1407327 - HERITAGE AND SALEM

Technician: 0753 - Mockobee, Conrad

Order Dates and Times

Need Date: 8/17/2010 9:08:00 AM
Time Created: 8/17/2010 9:01:02 AM
Time Dispatched: 8/17/2010 9:01:02 AM
Time In Route: 8/17/2010 2:05:07 PM
Time On-Site: 8/17/2010 2:05:08 PM
Tech Complete: 8/17/2010 2:11:05 PM
Time Closed: 8/17/2010 2:11:05 PM

Events Performed/Completion Code

LKNS - CMP

Meter Information

Current ReadStatus

Old Meter:

New Meter:

Completion Notes

CONTRACTOR PUNCTURED 2" PLASTIC MAIN. CALLED FOR CREW, HAD TO SHUT DOWN SERVICE S TO TRAILER PARK. 13 SERVICES DOOR TAGGED FOR RELITE. MAIN RESTORED TO NORMAL.
 CM

Request Notes

PER MIKE WITH MCF CONST CREW HIT GAS LINE WITH MINI EXCAVATOR/ NOT SURE IF BLOWING/ BEHIND NAPPA OFF OF HWY 66-TAKE HERIGATE AND TURN LEFT ON SALEM/THEY WERE INSTALLING A FENCE-NO LOCATES -812-205-5000

MDSI Event Dates and Times

Event	Date/Time	User
AsnAssignmentManualAck_evt	8/17/2010 2:04:56 PM	Mockobee, Conrad
AsnAssignmentEnRoute_evt	8/17/2010 2:05:07 PM	Mockobee, Conrad
AsnAssignmentOnSite_evt	8/17/2010 2:05:08 PM	Mockobee, Conrad
OrdOrderComplete_evt	8/17/2010 2:11:05 PM	Mockobee, Conrad

NOTE:The Reporting database replicates in near real-time; it has been approximately 0 minute(s) since the last transaction replicated.

Other:

CHECK ALL THAT APPLY TO METHOD OF INVESTIGATION (at least one must be checked):

Visual, Facility Exposed At Time Of Investigation,
Investigator Verified Existing Marks By Hooking Up,
Investigation Results Verified By Utility Representative

INVESTIGATOR STATEMENT/CAUSAL FACTORS:
CONTRACTOR DID NOT CALL IN FOR LOCATES.

NAMES OF UTILITY REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:
DAN ZILIAK, JEFF HILL

NAMES OF EXCAVATOR'S REPRESENTATIVES CONTACTED OR ON SITE AND STATEMENT:
NONE


LIST ANY OTHER INDIVIDUALS ON SITE:
NONE

WERE ANY MARKINGS VISIBLE ON THE DAMAGE SITE UPON ARRIVAL? No
WERE ANY OTHER INDICATORS OF FACILITY PRESENT IN THE AREA? No
WAS THE EXCAVATION WITHIN THE TOLERANCE ZONE OF MARKS? No
EXTENT OF FACILITY DAMAGE CUT
REPLACEMENT FOOTAGE 10FT
WAS CONTRACTOR ASSISTANCE REQUIRED? IF YES, WHO? No
WHAT CONTRACTOR EQUIPMENT WAS USED? NO
IS THE FACILITY SHOWN ON THE UTILITY RECORDS? Yes
IF YES, PLEASE LIST RECORD #(S) NEWBURGH







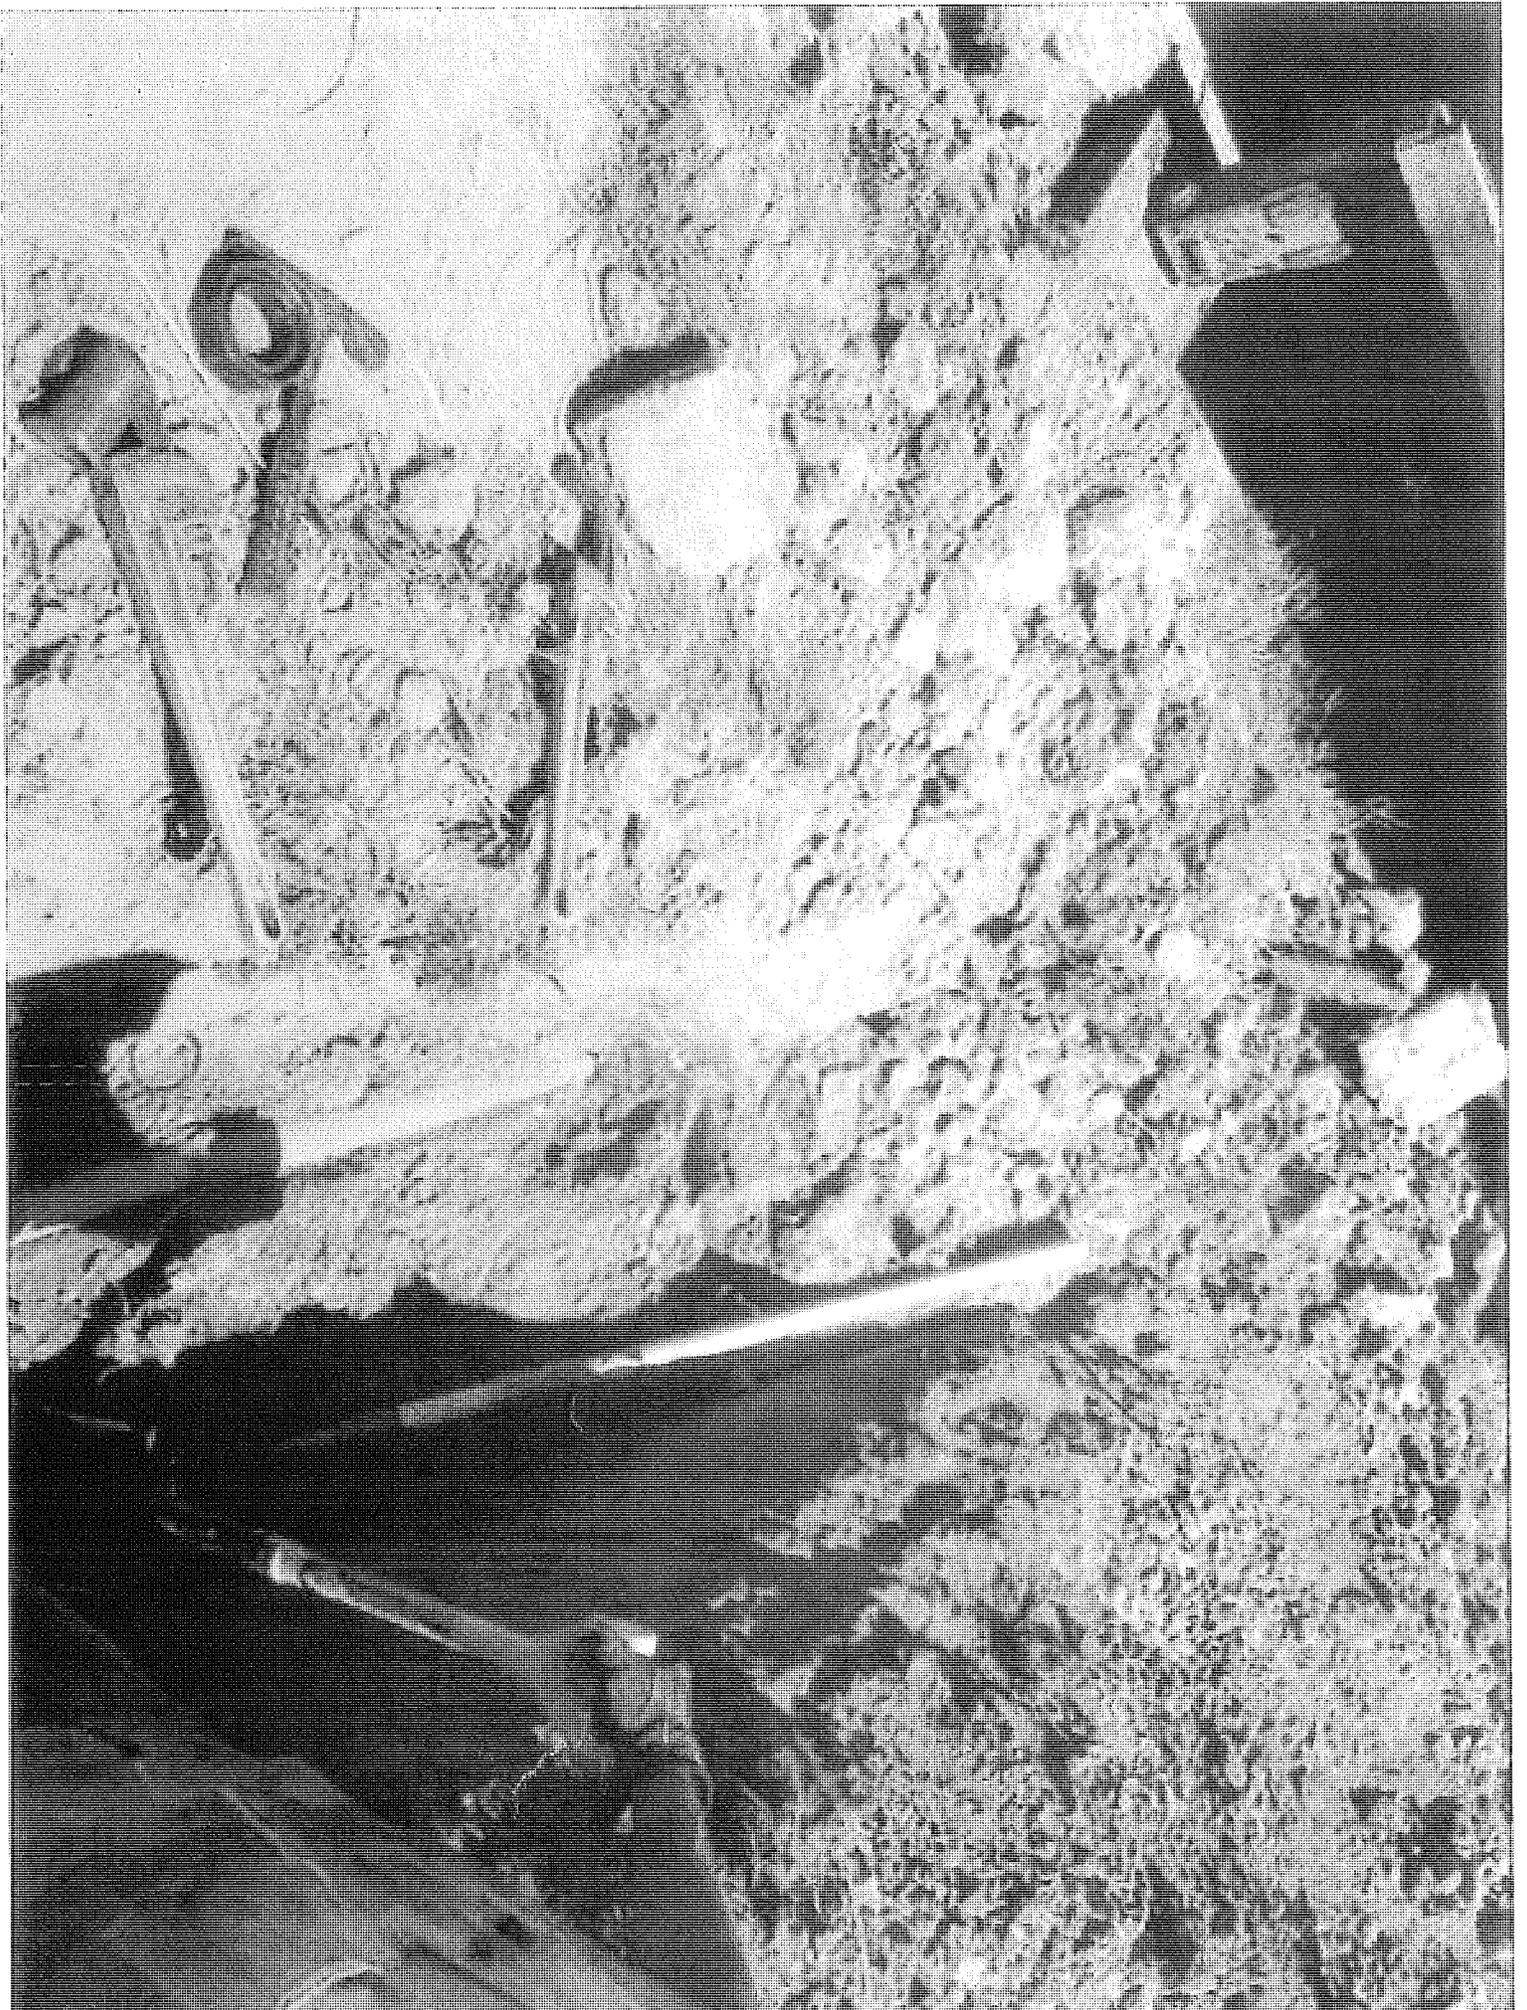

MISCELLANEOUS CASH RECEIPT

(PLEASE ATTACH A COPY OF ALL CHECKS TO THIS FORM AND
USE PAPER CLIPS/DO NOT STAPLE CHECKS TO FORM)

PROCESS ROUTING FOR ALL VECTREN COMPANIES INCLUDING UTILITIES
AND NON REGULATED SUBSIDIARIES: SEND COMPLETED FORM,
ORIGINAL CHECK AND COPY OF CHECK TO REBECCA MINEAR IN
FINANCIAL ACCOUNTING, BRAUN BUILDING, EVANSVILLE. RETAIN COPY
OF CHECK AND FORM FOR YOUR RECORDS. PLEASE INCLUDE PROPER
ACCOUNTING SO RECEIPT MAY BE CREDITED ACCURATELY. PLEASE
INCLUDE YOUR PHONE NUMBER SO THE RECEIPT MAY BE EASILY
RESEARCHED BY THE FINANCIAL ACCOUNTING GROUP.

Activity Date: **9/7/2010**
12:00:00 AM

Your Name, not your initials (employee): **Pam Barber**

Your Phone Number (employee): **812-491-4734**

Party Check Received From (Check Payor):
Address of Check Writer (Check Payor):
BATCH1-MOTORIST MUTUAL INSURANCE COMPANY

Check Number **741697**

Amount of Check **\$2,892.78**

Utility/Company Name **VECTREN ENERGY DELIVERY OF INDIANA - SOUTH**

Task Number **103.0509** *8964.26 - 2026 Account*

Job Number **FDS0013046**

Date Printed: 9/9/2010

Transaction Information G-6609570 CHI-861239 2010/09/07

[Back to Table of Contents](#)

Transaction Level Details

Env Num	9	Envelope	G-6609570
Transaction	G-6609570	Lockbox	CHI-861239
Date	2010/09/07	Time	04:00
Batch	1	Batch Item	9
Check	9	Check Amount	\$3,857.04
ABA/RT	041203895	Account Num	0099776
Check Num	0000741697		

Envelope and Check Image

VERIFY THE AUTHENTICITY OF THIS MULTI-TONE SECURITY DOCUMENT. CHECK BACKGROUND AREA CHANGES COLOR GRADUALLY FROM TOP TO BOTTOM.

Motorists Mutual Insurance Company
National City Bank
As'and, Ohio

Policy No.: 33-270099-401
Insured: MCF CONSTRUCTION, INC ETAL For: PAYMENT FOR YOUR INVOICE
FDSC013046

Claim No.: 5319310

Check No.: 0000741697
Date of Loss: 08/17/2010
Date Issued: 09/03/2010

\$3,857.04

Pay THREE THOUSAND EIGHT HUNDRED FIFTY-SEVEN DOLLARS AND FOUR CENTS *****

To The Order Of: VECTREN UTILITY GROUP

MUST BE CASHED WITHIN 90 DAYS AFTER ISSUE
Void Over \$3,857.04

Michael L. Wisner

⑈0000741697⑈ ⑆041203895⑆ 0099776⑈

THE ORIGINAL DOCUMENT HAS A WHITE REFLECTIVE WATERMARK ON THE BACK. HOLD AT AN ANGLE TO SEE THE MARK WHEN CHECKING THE ENDORSEMENT.

Transaction Level Keyed Data

Remitter Name : MOTORIST MUTUAL INSURANCE COMPANY Check Date : 2010/09/03

Invoice Level Keyed Data

Invoice Number	Reference Number
FDS0013046	9999999



Claim No.: 5319310
Check No.: 0000741697 Date Issued: 09/03/2010
Check Amount: \$3,857.04
Date of Loss: 08/17/2010
Policy No.: 33.270099.40
Insured: MCF CONSTRUCTION INC ETAL
Tax ID No.:
Adjuster: MATTHEW NICHOLAS
Adjuster Ph.: (812) 626-1854

VECTREN UTILITY GROUP
1239 RELIABLE PARKWAY
CHICAGO, IL 60686

For: PAYMENT FOR YOUR INVOICE
FDS0013046

Information Request

Pipeline Safety Division Indiana Utility Regulatory Commission

The Pipeline Safety Division of the Indiana Utility Regulatory Commission requests any and all information you can provide regarding the following criteria:

The Parties:

Excavator Information:

Business Name: MCF
Responsible Party Personal Name: MIKE
Title (if any): PRESIDENT
Address: 7051 Savannah Dr.
City, State Zip: Newburgh, IN 47630
Preferred Telephone: (812) 853-6852
Cell Phone Number: (812) 205-5000
Email Address: mikefreeman@mcfconstruction.com

RECEIVED

SEP 29 2011

INDIANA UTILITY
REGULATORY COMMISSION

Facility Information:

Business Name: MCF
Responsible Party Personal Name: Mike
Title (if any): President
City, State, Zip: Newburgh, IN 47630
Address: 7051 Savannah Dr.
Preferred Telephone: (812) 853-6852
Cell Phone Number: (812) 205-5000
Email Address: mike.freeman@mcfconstruction.com

Locator Service Information:

Business Name: INDIANA 811
Responsible Party Personal Name:
Title (if any):
Address:
City, State Zip:
Preferred Telephone:
Cell Phone Number:
Email Address:

Other (Witness, Police, Fire, Other) Information:

Personal Contact:

Business/Organization Name:

Title (if any)

Address:

City, State, Zip

Preferred Telephone:

Cell Phone Number:

Email Address:

Utility Line Impact:

Product Type (circle one):

Natural Gas

Liquid Pipeline

Unknown/Other

Facility Type (circle one):

Distribution

Gathering

Service/Drop

Transmission

Unknown/Other

Size (Diameter/etc.): 2"

Pressure (PSIG/Inches): UNKNOWN

Interruption in Service Yes/No

Number of Customers Affected: UNKNOWN

Evacuation Yes/No

If yes, How Many Evacuated? APPROX 12 HOMES

Repair Cost (if known): \$ _____

WE PAID THE UTILITY COMPANY
APPROX. \$ 3300.00

Cause of Damage Information:

Type of Equipment (circle one):

Auger

Backhoe/Trackhoe

Boring /Drilling

Directional Drilling

Explosives

Farm Equipment

Grader/Scraper

Hand Tools

Milling Equipment

Probing Device

Trencher

Vacuum Equipment

Unknown/Other

Type of Work Performed (circle one):

- Agriculture
- Cable TV
- Curb/Sidewalk
- Bldg. Construction
- Bldg. Demolition
- Drainage
- Driveway
- Electric
- Engineering/Surveying
- Fencing**
- Grading
- Irrigation
- Landscaping
- Liquid Pipeline
- Milling
- Natural Gas
- Pole
- Public Transit Authority
- Railroad Maintenance
- Road Work
- Sewer (Sanitary/Storm)
- Site Development
- Steam
- Storm Drain/Culvert
- Street Light
- Telecommunications
- Traffic Signal
- Traffic Sign
- Water
- Waterway Improvement
- Unknown/Other

Release of Product: Yes / No

Ignition and/or Fire: Yes / No

Excavator Notify 811: Yes / No

Locate Information:

Excavator Request Locate: Yes / No

Indiana 811 Locate Ticket Number: _____

Locate Marks Visible: Yes / No

Locate Marks Correct: Yes / No

Excavator "White Lined": Yes / No

Maps Used to Mark Facilities: Yes / No

Was Locate Provided within Two (2) Working Days: Yes / No

Operator Employees On-site during Excavation: Yes / No

Incident Impact Information:

Number of Outpatient Treated: 0

Number of Inpatient Treated: 0

Number of Fatalities: 0

Fire Department Response: Yes / No

Police Department Response: Yes / No

Ambulance Response: Yes / No DON'T KNOW

Additional Information/Comments: WE HAD THIS VACANT LOT
LOCATED A COUPLE OF TIMES FOR DRAINAGE WORK
TO THE LOT.

WHEN THE FENCE WORK WAS DONE WE FOUND
OUT THE LOCATE WAS DONE ON THE OTHER
SIDE OF THE LOT.

WE TAKE RESPONSABILITY FOR THE COMMUNICATION
TO THE LOCATE COMPANY & WILL BE SURE
TO PROVIDE BETTER INFORMATION REGARDING
WHAT AREA IS BEING EXCAVATED ON EACH JOB.
WE NOW HAVE OUR OFFICE CALL IN EACH JOB & NOT THE FOREMAN.
WE ALSO PAID THE UTILITY COMPANY FOR
THE LOSS THEY INCURRED.