



HAZARDOUS AND REGULATED MATERIALS INSPECTION REPORT

Former Saint Mary Mercy Hospital
540 Tyler Street
Parcel Number: 45-08-04-332-012/013
Gary, IN 46402

Prepared for:

Northwest Indiana Regional Development Authority
9800 Connecticut Drive
Crown Point, Indiana 46307
Client Reference: Gary Blight Elimination Program

Prepared by:

Egis
48797 Alpha Drive, Suite 130
Wixom, MI 48393
Egis Project ID: 240100
April 14, 2025

TABLE OF CONTENTS

1.0	Introduction.....	1
1.1	Certification	1
2.0	Description of Structure.....	2
2.1	Accessibility Limitations	3
3.0	General Inspection Methodology	4
4.0	Laboratory Analytical Results.....	5
5.0	Other Hazardous and/or Regulated Materials	16
6.0	Conclusions and Recommendations.....	24
7.0	Limitations	24

ATTACHMENTS

Attachment 1 – Laboratory Analytical Report

Attachment 2 – Figures

Attachment 3 – Photographic Log

1.0 INTRODUCTION

Egis has been contracted by Northwest Indiana Regional Development Authority (the RDA) to provide industrial hygiene services for commercial properties in the City of Gary. Egis industrial hygienists are conducting hazardous and regulated materials (HRM) inspections of commercial buildings and associated exterior portions of properties for select properties in the City of Gary. The properties to be inspected by Egis are included in a portfolio of work provided by the RDA, in concurrence with City of Gary governance, for the Gary Blight Elimination Program.

To facilitate demolition of blighted buildings, Egis has completed a HRM inspection (including asbestos) of, three interconnected vacant commercial buildings (Building A, B, and C), located at 540 Tyler Street, Gary, Indiana (Site) commonly referred to as the Former Saint Mary Mercy Hospital. Building A is a five-story former hospital building. Building B is a two-story former heating plant for the hospital that was converted to a maintenance shop. Building C is a three-story former heating plant for the hospital after Building B was converted. Building C also consists of a one-story former paint and carpentry building. The HRM inspection was conducted on February 24 – March 14. During the inspection bulk material samples were collected, and quantities of suspect asbestos-containing materials (ACM) were estimated where applicable. This inspection also included identification and quantification of other hazardous and/or regulated materials (ORM) within the building structure and in exterior portions of the Site.

1.1 CERTIFICATION

The asbestos inspection was conducted by State of Indiana (SOI) Accredited Asbestos Inspectors identified below.

TABLE 1.1.1 – Asbestos Inspectors

Inspector Name and SOI Accreditation Number	Contact Information
Connor Beausejour - 19A015957	beausejour.connor@egis-group.com / (248) 863-2938
Keith Ventimiglia - 19A015969	keith.ventimiglia@egis-group.com / (248) 459-5090
Thomas Wilkewitz - 19A015949	thomas.wilkewitz@egis-group.com / 248-756-4754
Luis Castellanos - 19A015948	luis.castellanos@egis-group.com / 248-209-9023

2.0 DESCRIPTION OF STRUCTURE

The structure is approximately 155,200 square feet in size. It is a concrete structure with brick facade situated on a concrete slab with a full basement. The roof is covered with asphalt shingles.

Property information and a description of the structure(s) and other improvements are provided below. Information was gathered from the site reconnaissance and review of municipal records.

TABLE 2.0.1 – PROPERTY INFORMATION		
Building “A”		
Parcel Number	45-08-04-332-013	
Square Footage	135,808 square feet	
Foundation Type	Concrete Block Basement	
Building Type	Commercial Building	
Exterior Description	Concrete building with brick facade	
Secondary structure(s)	NA	
Pavement/Hardscape	Sidewalk	Concrete Parking Lot
Building “B”		
Parcel Number	45-08-04-332-013	
Square Footage	10,564 square feet	
Foundation Type	Brick and Mortar	
Building Type	Commercial Building	
Exterior Description	Concrete, brick and mortar	
Secondary structure(s)	NA	
Pavement/Hardscape	Sidewalk	
Building “C”		
Parcel Number	45-08-04-332-013	
Square Footage	17,598 square feet	
Foundation Type	Concrete Block Basement	
Building Type	Commercial Building	
Exterior Description	Concrete building with brick facade	
Secondary structure(s)	NA	
Pavement/Hardscape	Sidewalk	Asphalt Parking Lot

2.1 ACCESSIBILITY LIMITATIONS

As part of conducting the HRM inspection, Egis asbestos inspectors assessed the condition of the structure holistically, beginning with the foundation and structural members, and specifically by exterior area (EA) and functional space (FS) for safe accessibility. EA and FS may be considered inaccessible as a result of fire damage, water damage, and/or an unstable foundation. Egis asbestos inspectors made reasonable efforts to sample (by reaching through doorways or windows), or assume, and quantify, any suspect ACM visible from outside the structure that is located in an EA or FS determined to be inaccessible. Building B was completely accessible, however buildings A and C had partial accessibility, see Table 2.1.1 and Table 2.1.2 below for a summary of inaccessibility.

TABLE 2.1.1 ACCESSIBILITY LIMITATIONS BUILDING A

Space Designation	Inaccessibility Determination	Reason
FS63 (fourth and fifth floor only)	Completely Inaccessible	Stairs collapsed
FS153	Completely Inaccessible	Structural Damage
FS263	Partially Inaccessible	Structural Damage
FS346	Partially Inaccessible	Structural Damage
FS353	Partially Inaccessible	Structural Damage
FS354	Completely Inaccessible	Structural Damage
FS393	Partially Inaccessible	Structural Damage
FS421	Partially Inaccessible	Structural Damage
FS438	Completely Inaccessible	Structural Damage

TABLE 2.1.2 ACCESSIBILITY LIMITATIONS BUILDING C

Space Designation	Inaccessibility Determination	Reason
FS24	Completely Inaccessible	Structural Damage
FS33	Completely Inaccessible	Structural Damage
FS35	Completely Inaccessible	Structural Damage

3.0 GENERAL INSPECTION METHODOLOGY

This inspection provides information on the presence of Asbestos Containing Materials (ACMs) in accordance with the National Emission Standard for a Hazardous Air Pollutant (NESHAP) for Asbestos, 40 CFR 61 Subpart M. The Clean Air Act (CAA) requires the U.S. Environmental Protection Agency (EPA) to develop and enforce regulations to protect the public from exposure to airborne contaminants that are known to be hazardous to human health. The U.S. EPA established the NESHAP under the authority of Section 112 of the CAA, and asbestos was one of the first hazardous air pollutants regulated.

NESHAP requires a thorough inspection of the facility for asbestos, including Category I and Category II non-friable ACM. ACM is material containing more than 1% asbestos as determined using the methods specified in Appendix E, subpart E, 40 CFR part 763, section 1, Polarized Light Microscopy (PLM). The NESHAP classifies ACM as friable or non-friable. Per 40 CFR 61, Subpart M, friable ACM is that which, when dry, may be crumbled, pulverized, or reduced to powder by hand pressure. Non-friable ACM is ACM that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure.

Non-friable ACM is further classified as Category I or Category II. Category I and Category II ACM are distinguished from each other by their potential to release fibers when damaged. Examples of Category I non-friable ACM include but are not limited to: asbestos containing packing, gaskets, resilient floor coverings, resilient floor covering mastic and asphalt roofing products containing more than 1% asbestos as determined using PLM/EPA Method 600R. Category II ACM includes all other non-friable ACM, such as asbestos-cement (A/C) shingles, A/C tiles, and Transite® boards or panels containing more than 1% asbestos. Generally, Category II ACM is more likely to become friable when damaged than Category I ACM. The applicability of NESHAP to Category I and II ACM depends on:

- (1) the condition of the material at the time of demolition or renovation
- (2) the nature of the operation to which the material will be subjected
- (3) the amount of ACM involved

ACM regulated under NESHAP are identified as Regulated ACMs (RACMs). RACM is defined in §61.141 of the NESHAP and includes:

- (1) Friable ACM
- (2) Category I non-friable ACM that has become friable
- (3) Category I non-friable ACM that will be or has been subjected to sanding, grinding, cutting, or abrading
- (4) Category II non-friable ACM that has already been or is likely to become crumbled, pulverized, or reduced to powder by forces expected to act on the material during demolition or renovation operations regulated by EPA 40 CFR 61 Subpart M, NESHAP for Asbestos

The determination of suspect ACMs was based on visual examination, material age and professional experience. Specifically, materials similar in color and texture were classified into homogenous areas. A homogeneous area is an area of surfacing material (SM), thermal system insulation material (TSI), or miscellaneous material (MM) that is uniform in color, texture, and/or date of installation. The appropriate number of samples were collected from suspect material in each established homogenous area. Egis implemented the “3-5-7” rule of sampling surfacing materials required by the Asbestos Hazard Emergency Response Act (AHERA). Samples were analyzed by PLM via EPA Method 600/R-93/116, by EMSL Laboratories, an NVLAP accredited laboratory.

It is generally understood that mudded pipe fittings are mixed in batches on site prior to installation, and that asbestos content can vary from batch to batch. It is unlikely that different pipe diameters had unique batches assigned to them and more likely that a batch was applied to multiple pipe diameters. During sampling, Egis field staff collected samples of mudded pipe fittings based on pipe diameter. Out of the 13 unique homogeneous areas

analyzed seven were identified as ACM by laboratory analysis. Based on the uncertainty of how batches were applied and the likelihood that asbestos is present, all mudded pipe fittings have been assumed positive as ACM regardless of laboratory results.

4.0 LABORATORY ANALYTICAL RESULTS

A total of 279 bulk materials (homogenous areas [HA]) identified as suspect ACM were sampled from the three buildings and submitted for laboratory analysis and 74 HAs tested positive for the presence of asbestos fibers greater than 1% by weight. Additionally, 20 materials were assumed to be ACM. Tables 4.0.1 (Building “A”), 4.0.2 (Building “B”), and 4.0.3 (Building “C”) below provide details for ACMs identified in each building. Bulk materials were analyzed for asbestos pursuant to EPA Method 600/R-93/116 using PLM, unless otherwise indicated. Bulk material samples that tested between a trace amount and one percent (1%) asbestos were point counted (400-point count; EPA 600/R-93/116) to confirm the result. Copies of laboratory analytical reports are provided as *Attachment 1, Laboratory Analytical Report*. Figures depicting the building layouts and sample locations are included as *Attachment 2, Figures*, and are organized by building. A photographic log that documents the inspection is provided as *Attachment 3, Photographic Log*.

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-Ext-4	Exterior Caulk - On Metal Framed Windows	N	MM	EA1; EA2; EA3; EA4	14,016 LF	Non-Friable - Category 2
A-Ext-9	Exterior Caulk - Metal Framed Wall Caulk, Large Windows	N	MM	EA1	550 LF	Non-Friable - Category 2
A-Ext-10	Exterior Caulk - Metal Pan Seam Sealant	N	MM	EA1	1,058 LF	Non-Friable - Category 2
A-Ext-11	Gasket Material - Air Handling Units	N	MM	EA3	2 SF	Non-Friable - Category 1
A-Ext-12	Exterior Caulk-Vent Sealant - On Vents	N	MM	EA1; EA3	110 LF	Non-Friable - Category 2
A-Ext-16	Window Glaze - Wood Framed Sliding Windows	N	MM	EA3	10 Units	Non-Friable - Category 2

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-30-Bas	Ceiling Tile - 1X1 stapled w/Glue Pod, White with Dot pattern (Mastic)	N	MM	FS11; FS15; FS16; FS23; FS37; FS39; FS71-FS74; FS77; FS86; FS89; FS93; FS102; FS126; FS130; FS131; FS133-FS145; FS149; FS160; FS165; FS166; FS 185-FS192; FS195; FS196; FS203; FS207; FS209; FS214; FS215; FS246-FS257; FS259-FS262; FS263-FS270; FS273; FS278-FS283; FS285-FS291; FS295; FS299-FS301; FS308; FS309; FS324; FS325; FS327-FS338; FS340-FS342; FS343-FS345; FS349; FS351-FS353; FS355; FS358; FS362-FS363; FS365; FS366; FS368; FS371-FS398; FS400; FS402; FS403; FS409; FS410; FS411-FS470	51,118 SF	Non-Friable - Category 2
A-44-Bas	Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern	N	MM	FS39; FS167; FS168; FS169; FS170; FS174; FS175; FS390	1,460 SF	Non-Friable - Category 1
A-45-Bas	Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes	N	MM	FS39	200 SF	Non-Friable - Category 1
A-46-Bas	Flooring - 9X9 Floor Tile with Mastic- Beige with Green and White Circles	N	MM	FS38	135 SF	Non-Friable - Category 1

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-48-Bas	Flooring - 12X12 Floor Tile with Mastic- White with Dot pattern	N	MM	FS39; FS440	400 SF	Non-Friable - Category 1
A-54-Bas	Gasket Material - Pipe Valve	N	MM	FS44; FS69; FS78	10 SF	Non-Friable - Category 1
A-55-Bas	Vibration Dampener - Woven, Coarse Textile, White	N	MM	FS73	5 SF	Regulated Asbestos Containing Material
A-60-Bas	Insulator - Elevator Control Insulator	N	MM	FS51	5 SF	Non-Friable - Category 2
A-62-Bas	Fireproofing - Spray Applied	N	SM	FS69	1,400 SF	Regulated Asbestos Containing Material
A-64-Bas	Cork Ceiling Tile with Mastic - Break room Ceiling	N	MM	FS66	150 SF	Non-Friable - Category 2
A-65-Bas	Window Glaze - Wood Framed Fixed Windows	N	MM	FS60	2 Units	Non-Friable - Category 2
A-66-Bas	Flooring - 12X12 Floor Tile with Mastic, White	N	MM	FS6; FS165; FS166; FS207; FS208; FS249; FS273; FS308; FS309; FS314; FS315; FS317; FS318; FS356; FS387; FS391; FS395; FS400; FS404; FS423; FS444; FS445	5,095 SF	Non-Friable - Category 1
A-67-Bas	Pipe Insulation - 2" O.D. Air Cell SRPI	N	TSI	FS1-FS470	1,515 LF	Regulated Asbestos Containing Material

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-68-Bas	Pipe Fitting - 2" O.D. Mudded pipe fitting insulation on Air Cell SRPI	N	TSI	FS1-FS470	48 Elbows	Regulated Asbestos Containing Material
A-69-Bas	Pipe Insulation - 4" O.D. Air Cell SRPI	N	TSI	FS1-FS470	2,905 LF	Regulated Asbestos Containing Material
A-70-Bas	Pipe Fitting - 4" O.D. Mudded pipe fitting insulation on Air Cell SRPI	N	TSI	FS1-FS470	74 Elbows	Regulated Asbestos Containing Material
A-71-Bas	Pipe Insulation - 6" O.D. Air Cell SRPI	N	TSI	FS1-FS470	470 LF	Regulated Asbestos Containing Material
A-72-Bas	Pipe Fitting - 6" O.D. Mudded pipe fitting insulation on Air Cell SRPI	Assumed	TSI	FS1-FS470	29 Elbows	Regulated Asbestos Containing Material
A-73-Bas	Pipe Insulation - 8" O.D. Air Cell SRPI	N	TSI	FS1-FS470	30 LF	Regulated Asbestos Containing Material
A-74-Bas	Pipe Fitting - 8" O.D. Mudded pipe insulation on Air Cell SRPI	Assumed	TSI	FS1-FS470	2 Elbows	Regulated Asbestos Containing Material
A-75-Bas	Pipe Insulation - 10" O.D. Air Cell SRPI	N	TSI	FS1-FS470	10 LF	Regulated Asbestos Containing Material

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-76-Bas	Pipe Fitting - 10" O.D. Mudded pipe insulation on Air Cell SRPI	Assumed	TSI	FS1-FS470	2 Elbows	Regulated Asbestos Containing Material
A-78-Bas	Pipe Fitting - 2" O.D. Mudded pipefitting insulation on Fiberglass SRPI	Assumed	TSI	FS1-FS470	198 Elbows	Regulated Asbestos Containing Material
A-80-Bas	Pipe Fitting - 4" O.D. Mudded pipe insulation on Fiberglass SRPI	N	TSI	FS1-FS470	220 Elbows	Regulated Asbestos Containing Material
A-82-Bas	Pipe Fitting - 6" O.D. Mudded pipe insulation on Fiberglass SRPI	N	TSI	FS1-FS470	80 Elbows	Regulated Asbestos Containing Material
A-84-Bas	Pipe Fitting - 8" O.D. Mudded pipe insulation on Fiberglass SRPI	Assumed	TSI	FS1-FS470	14 Elbows	Regulated Asbestos Containing Material
A-86-Bas	Pipe Fitting - 10-12" O.D. Mudded pipe insulation on Fiberglass SRPI	N	TSI	FS1-FS470	30 Elbows	Regulated Asbestos Containing Material
A-88-Bas	Pipe Insulation - O.D. Mag SRPI	N	TSI	FS1-FS470	1,405 LF	Regulated Asbestos Containing Material

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-89-Bas	Pipe Fitting - O.D. Mudded pipe fitting insulation on Mag and Duplex on SRPI	N	TSI	FS1-FS470	129 Elbows	Regulated Asbestos Containing Material
A-1-100	Ceramic Tile with Grout and Adhesive - Bathroom Walls	N	MM	FS93	55 SF	Non-Friable - Category 2
A-1-105	Flooring - Linoleum with Paper Backing- Red Brick Pattern	N	MM	FS145	155 SF	Non-Friable - Category 1
A-1-106	Flooring - 9X9 Floor Tile with Mastic- Brown	N	MM	FS137	150 SF	Non-Friable - Category 1
A-1-109	Fireproofing - Spray Applied	N	SM	FS164-FS174	1,100 SF	Regulated Asbestos Containing Material
A-2-112	Flooring - Linoleum with Paper Backing- Yellow	N	MM	FS200; FS208; FS209; FS218; FS227; FS396	960 SF	Non-Friable - Category 1
A-2-115	Flooring - Linoleum with Paper Backing- White with Red	N	MM	FS221	155 SF	Non-Friable - Category 1
A-2-118	Flooring - Linoleum with Paper Backing- White	N	MM	FS230; FS231; FS232; FS250	980 SF	Non-Friable - Category 1

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
A-3-126	Flooring - Linoleum with Paper Backing- Gray	N	MM	FS264; FS267; FS278; FS281; FS313; FS330; FS332; FS333; FS334	1,560 SF	Non-Friable - Category 1
A-4-135	Construction Adhesive - Gray on fake marble paneling	N	MM	FS361	215 SF	Non-Friable - Category 2
A-4-138	Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture	N	MM	FS355	300 SF	Non-Friable - Category 1
A-R-148	Glue Pods - On ceramic tile walls	N	MM	FS411; FS412; FS413; FS414; FS415; FS466; FS467	3,000 SF	Non-Friable - Category 2
A-R-149	Interior Caulk - Around ceramic tile walls	N	MM	FS411; FS412; FS413; FS414; FS415; FS466; FS467	250 LF	Non-Friable - Category 2
A-R-151	Glue Pods- Black - On ceramic tile walls	N	MM	FS411; FS412; FS413; FS414; FS415; FS466; FS467	250 LF	Non-Friable - Category 2
A-R-154	Exterior Caulk - Around sliding Windows	N	MM	FS471	150 LF	Non-Friable - Category 2
NA	Pipe Insulation - TSI debris throughout the basement flooring	Assumed	TSI	FS1-FS64	29,232 SF	Regulated Asbestos Containing Material
NA	Fire Door - Metal	Assumed	MM	FS2; FS10; FS11; FS18; FS39; FS44; FS67; FS69	18 Doors	Non-Friable - Category 2

TABLE 4.0.1 – BUILDING “A” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
NA	Fire Door - Metal	Assumed	MM	FS184; FS131; FS154; FS153; FS154; FS155; FS157; FS179; FS180; FS183	12 Doors	Non-Friable - Category 2
NA	Fire Door - Metal	Assumed	MM	FS17; FS194	4 Doors	Non-Friable - Category 2
NA	Fire Door - Metal	Assumed	MM	FS276	4 Doors	Non-Friable - Category 2
NA	Fire Door - Metal	Assumed	MM	FS50; FS370	5 Doors	Non-Friable - Category 2
NA	Fire Door - Metal	Assumed	MM	FS424; FS442; FS449; FS438; FS439	12 Doors	Non-Friable - Category 2

TABLE 4.0.2 – BUILDING “B” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
B-Ext-2	Exterior Caulk - on Brick Siding & Trim, Windows, Doors, Transitions, Seams	N	MM	EA1; EA2; EA3; EA4	1,650 LF	Non-Friable - Category 2
B-Ext-6	Window Glaze - Metal Framed Windows, Basement, 1st, 2nd	N	MM	EA1; EA2; EA3; EA4	41 Units	Non-Friable - Category 2
B-Ext-11	Roofing Material - Flashing	N	MM	EA2	33 LF	Non-Friable - Category 1
B-Base-15	Transite - Panel for electrical devices	N	MM	FS4	5 SF	Non-Friable - Category 2

TABLE 4.0.2 – BUILDING “B” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
B-Base-27	Gasket Material - Pipe Valves and Flanges	N	MM	FS1; FS9	100 SF	Non-Friable - Category 1
NA	Pipe Insulation - Misc TSI Debris mixed with general debris	Assumed	TSI	FS1-FS11; FS15; FS16; FS17	6,486 SF	Regulated Asbestos Containing Material
NA	Fire Door - Metal	Assumed	MM	FS5; FS8; FS16	7 Doors	Non-Friable - Category 2
B-1-31	Interior Caulk - Doors	N	MM	FS17; FS18	60 LF	Non-Friable - Category 2
B-1-34	Transite - Table Top	N	MM	FS15	25 SF	Non-Friable - Category 2
B-2-40	Construction Adhesive - Brown on paneling- White	N	MM	FS23	10 SF	Non-Friable - Category 2
B-2-41	Window Glaze - Wood Framed Sliding Windows	N	MM	FS20; FS21; FS22; FS23	40 Units	Non-Friable - Category 2
B-2-43	Roofing Material - Flat Roof Materials	N	MM	EA5	4,290 SF	Non-Friable - Category 1
B-2-44	Roofing Material - Flashing	N	MM	EA5	500 SF	Non-Friable - Category 1
B-2-48	Exterior Caulk - Door Caulk	N	MM	EA5	40 LF	Non-Friable - Category 2

TABLE 4.0.3 – BUILDING “C” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
C-Ext-3-A-C	Exterior Caulk - Around wood windows- 1st floor	N	MM	EA1; EA2; EA3; EA4	945 LF	Non-Friable - Category 2

TABLE 4.0.3 – BUILDING “C” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
C-Ext-4-A-C	Exterior Caulk - Around Aluminum Window Frames- 2nd floor	N	MM	EA1; EA2; EA3; EA4	235 LF	Non-Friable - Category 2
C-Ext-7-A-C	Exterior Caulk - Around Glass Block Windows, Exhaust Window	N	MM	EA2; EA3; EA4	255 LF	Non-Friable - Category 2
C-B-18-A-C	Gasket Material - Pipe Valves	N	MM	FS1; FS7; FS11	20 SF	Non-Friable - Category 1
C-B-20-A-C	Tank Insulation - Fiberglass with Foil Paper- Tank 2	N	TSI	FS1	500 SF	Regulated Asbestos Containing Material
C-B-22-A-C	Concrete - Foundation Walls	N	MM	FS1-FS11	3,500 SF	Non-Friable - Category 2
C-B-23-A-C	Pipe Insulation - 10"Mag Block Type Insulation	N	TSI	FS1; FS2	300 LF	Regulated Asbestos Containing Material
C-B-24-A-C	Pipe Fitting - Mudded on Corrugated Paper Pipe Insulation	N	TSI	FS1-FS11	150 Units	Regulated Asbestos Containing Material
C-B-37-A-C	Gasket Material - Boiler Door Gaskets	N	MM	FS1	240 LF	Non-Friable - Category 1
C-B-38-A-C	Boiler Insulation - Fiberglass with Foil	N	TSI	FS1	300 SF	Regulated Asbestos Containing Material
C-B-39-A-C	Duct Insulation - Fibrous Paper on Ducts	N	TSI	FS1	1,500 SF	Regulated Asbestos Containing Material
NA	Pipe Insulation - Misc Debris	Assumed	TSI	FS1-FS11	5,670 SF	Regulated Asbestos Containing Material
NA	Vermiculite - Assumed - No Sample	Assumed	MM	EA4	500 SF	Regulated Asbestos Containing Material

TABLE 4.0.3 – BUILDING “C” LABORATORY ANALYTICAL RESULTS

Sample ID	Material Description	Assumed	Material Type	Location(s) (FS/EA)	Estimated Quantity	ACM Category
C-1-40	Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles	N	MM	FS36; FS37; FS38; FS39	420 SF	Non-Friable - Category 1
C-1-45	Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles	N	MM	FS41	560 SF	Non-Friable - Category 1
C-1-46	Interior Caulk - Windows, Door openings	N	MM	FS37	80 LF	Non-Friable - Category 2
C-1-54	Pipe Insulation - Duplex Insulation	N	TSI	FS34; FS37	60 LF	Regulated Asbestos Containing Material
NA	Pipe Insulation - 0"-6" fiberglass with cloth	Assumed	TSI	FS43	12 LF	Regulated Asbestos Containing Material
NA	Pipe Fitting - 0"-6" Mudded pipe insulation on Fiberglass with Cloth Pipe Insulation	Assumed	TSI	FS43	6 Elbows	Regulated Asbestos Containing Material
C-2-57	Flooring - 12X12 Floor Tile with Mastic- Beige with Brown	N	MM	FS16; FS17; FS19; FS21	570 SF	Non-Friable - Category 1
C-2-63	Pipe Insulation - Corrugated Paper (AirCell)	N	TSI	FS13	10 LF	Regulated Asbestos Containing Material
C-2-66	Transite - Transite Table	N	MM	FS17	20 SF	Non-Friable - Category 2

5.0 OTHER HAZARDOUS AND/OR REGULATED MATERIALS

In addition to inspecting the structure(s) for ACMs pursuant to the NESHAP for Asbestos, 40 CFR 61 Subpart M, Egis conducted a visual, non-intrusive inspection of hazardous and/or regulated materials, which did not involve testing. Egis has attempted to accurately quantify the number of hazardous and/or regulated materials that may require decontamination or disposal prior to demolition. Further inspecting, testing, sampling, and/or remediation of any conditions inspected or noted in this report, including actual quantities, remain the sole responsibility of others. Potential hazardous and/or regulated materials addressed by the inspection include, but are not limited to, the following:

- (1) Refrigerants and related chemicals (40 CFR 82);
- (2) Solid wastes which exhibit any of the characteristics of ignitability, corrosivity, reactivity, or toxicity (40 CFR 261.20 – 261.24);
- (3) Hazardous wastes (40 CFR 261.31, 261.32) and discarded commercial chemical products (40 CFR 261.33 & Part 111, Public Act 451 of 1994, as amended);
- (4) Universal wastes, including batteries, pesticides, mercury-containing products, and certain household wastes (40 CFR 273);
- (5) PCB-containing products (40 CFR 761);
- (6) Scrap tires (IC 13-20-14-4);
- (7) Medical or Infectious Wastes (IC 16-41-16 and 410 IAC 1-3-22);
- (8) Electronic Waste (IC 13-20.5)

Lead-based paint (LBP) may be present on the site and is a hazardous substance. Its condition, handling and disposal are regulated by federal, state, and local agencies. LBP does not pose a health threat unless particles are disturbed, become airborne and are inhaled or ingested. Contractors and their employers that will be disturbing the building during demolition should follow all applicable requirements in the OSHA Lead in Construction Standard.

Further testing of debris generated from demolition activities may be required to determine whether the debris should be disposed of as hazardous waste under the Resource Conservation and Recovery Act (RCRA) in accordance with 40-CFR Part 261 Subpart C.

Tables 5.0.1 (Building “A”), 5.0.2 (Building “B”), and 5.0.3 (Building “C”) summarize other regulated materials (ORM) by building that were observed at the Site by Egis field staff during the inspection.

TABLE 5.0.1 – BUILDING “A” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
BALLASTS	FS1- FS82	415 UNITS	Basement
FLUORESCENT LAMP	FS1- FS82	620 UNITS	4' Tube, Basement
FLUORESCENT LAMP	FS1- FS82	11 UNITS	9 mm U Shape, Basement

TABLE 5.0.1 – BUILDING “A” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
USED OIL, FUELS, FUEL OIL OTHER	FS1- FS82	34 UNITS	Hydraulic Door Closers, Basement
ABOVE GROUND STORAGE TANKS	FS3	1 UNIT	1000-Gallon, Basement
FIRE EXTINGUISHERS	FS4; FS7	2 UNITS	Basement
ABOVE GROUND STORAGE TANKS	FS3	2 UNITS	30-Gallon, Basement
THERMOMETERS	FS4	1 UNIT	Basement
CHEMICALS	FS4	2 UNITS	100 Gallon Drums, Unknown Contents, Basement
Emergency Lighting	FS6	1 UNIT	Basement
SMOKE DETECTORS	FS1- FS82	17 UNITS	Fire Suppression System, Basement
ABOVE GROUND STORAGE TANKS	FS8	4 UNITS	50-Gallon, Basement
CHEMICALS	FS13	1 UNIT	55 Gallon Drum, Unknown Contents, Basement
COMPRESSED GAS CYLINDERS	FS13	1 UNIT	20-Gallon, Basement
COMPRESSED GAS CYLINDERS	FS13	1 UNIT	100-Gallon, Basement
AIR CONDITIONERS	FS44	1 UNIT	8'x8'x8' Size, Basement
CHEMICALS	FS55	3 UNITS	5-Gallon Buckets Unknown Contents, Basement
SECURITY ALARMS	FS63	1 UNIT	Wall Mounted, Basement
COMPRESSED GAS CYLINDERS	FS69	1 UNIT	5-Gallon, Basement
CHEMICALS	FS69	1 UNIT	10-Gallon Water Chemical Feed, Basement

TABLE 5.0.1 – BUILDING “A” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
CHEMICALS	FS69	1 UNIT	5-Gallon Bucket Unknown Contents, Basement
FLUORESCENT LAMP	FS1; FS7	18 UNITS	3' Tube, Basement
FLUORESCENT LAMP	FS82- FS184	816 UNITS	4' Tube, 1st Floor
BALLASTS	FS82-FS184	482 UNITS	1st Floor
SMOKE DETECTORS	FS82-FS184	44 UNITS	1st Floor
THERMOSTATS	FS82-FS184	23 UNITS	1st Floor
FLUORESCENT LAMP	FS82; FS180; FS184	26 UNITS	U Shape, 1st Floor
EXIT SIGN	FS82; FS129; FS155	5 UNITS	1st Floor
USED OIL, FUELS, FUEL OIL OTHER	FS82-FS184	31 UNITS	Hydraulic Door Closers, 1st Floor
FLUORESCENT LAMP	FS83; FS86; FS88; FS89	32 UNITS	2' Tubes, 1st Floor
GAS PRESSURE REGULATORS	FS157	4 UNITS	1st Floor
FIRE EXTINGUISHERS	FS178	1 UNIT	1st Floor
BALLASTS	FS185-FS262	285 UNITS	2nd Floor
FLUORESCENT LAMP	FS185-FS262	510 UNITS	4' Tube, 2nd Floor
SMOKE DETECTORS	FS185-FS262	25 UNITS	2nd Floor
USED OIL, FUELS, FUEL OIL OTHER	FS185-FS262	15 UNITS	Hydraulic Door Closers, 2nd Floor
Emergency Lighting	FS185	2 UNITS	2nd Floor
THERMOSTATS	FS196; FS246	2 UNITS	2nd Floor
FLUORESCENT LAMP	FS185-FS262	67 UNITS	9mm U Shape, 2nd Floor
FLUORESCENT LAMP	FS243	1 UNIT	5' Tube, 2nd Floor, 2nd Floor
BALLASTS	FS263-FS342	227 UNITS	3rd Floor
FLUORESCENT LAMP	FS263-FS342	394 UNITS	4' Tube, 3rd Floor
SMOKE DETECTORS	FS263-FS342	34 UNITS	3rd Floor
USED OIL, FUELS, FUEL OIL OTHER	FS263	6 UNITS	Hydraulic Door Closers, 3rd Floor
Emergency Lights	FS263	4 UNITS	3rd Floor

TABLE 5.0.1 – BUILDING “A” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
FLUORESCENT LAMP	FS286; FS314	6 UNITS	U Shape Large, 3rd Floor
THERMOSTATS	FS314	1 UNIT	3rd Floor
EXIT SIGN	FS263; FS317	3 UNITS	3rd Floor
FLUORESCENT LAMP	FS289	1 UNIT	2' Tube, 3rd Floor
FLUORESCENT LAMP	FS291	4 UNITS	Ring Light, 3rd Floor
FRIDGE, FREEZER, BLAST CHILLERS	FS68	1 UNIT	Mini Freezer, Basement
GAS PRESSURE REGULATORS	FS69	9 UNITS	Pressure Gauge, Basement
MERCURY LIGHT SWITCHES	FS4	1 UNIT	Basement
X Ray Room Wall Sheeting	FS82; FS83; FS84; FS85; FS86; FS87; FS88; FS89; FS90	7,500 SF	Lead Sheets Inside Walls, 1st Floor
FLUORESCENT LAMP	FS343-FS410	447 UNITS	4' Tubes, 4th Floor
BALLASTS	FS343-FS410	265 UNITS	4th Floor
FLUORESCENT LAMP	FS362	2 UNITS	8' Tube, 4th Floor
FLUORESCENT LAMP	FS387; FS388; FS393	54 UNITS	U Shape Bulb, 4th Floor
FLUORESCENT LAMP	FS388; FS354	26 UNITS	9mm U Shape, 4th Floor
SMOKE DETECTORS	FS343-FS410	20 UNITS	4th Floor
EXIT SIGN	FS343; FS388; FS390	5 UNITS	4th Floor
FRIDGE, FREEZER, BLAST CHILLERS	FS343	1 UNIT	Drinking Fountain, 4th Floor
Mercury Gauges	FS391	6 UNITS	4th Floor
USED OIL, FUELS, FUEL OIL OTHER	FS391	1 UNIT	Motor, 4th Floor
BALLASTS	FS411-FS468	196 UNITS	5th Floor
FLUORESCENT LAMP	FS411-FS468	378 UNITS	4' Tube, 5th Floor
SMOKE DETECTORS	FS411-FS468	59 UNITS	5th Floor
USED OIL, FUELS, FUEL OIL OTHER	FS411-FS468	20 UNITS	Hydraulic Door Closers, 5th Floor
EXIT SIGN	FS411-FS468	8 UNITS	5th Floor

TABLE 5.0.1 – BUILDING “A” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
FRIDGE, FREEZER, BLAST CHILLERS	FS429	1 UNIT	Refrigerator, 5th Floor
THERMOSTATS	FS436; FS453	3 UNITS	5th Floor
FLUORESCENT LAMP	FS449; FS456	3 UNITS	9mm U Shape, 5th Floor
COMPRESSED GAS CYLINDERS	FS449	1 UNIT	40 Gallon, Ansul Halon 1301, 5th Floor
SECURITY SYSTEMS	FS452	1 UNIT	5th Floor
AIR CONDITIONERS	FS452	1 UNIT	Air Handler, 6'x3'x8', 5th Floor
GLUE	EA3	1 UNIT	5 Gallon Bucket Bonding Adhesive, Exterior
FRIDGE, FREEZER, BLAST CHILLERS	EA3	1 UNIT	Refrigerator, Exterior
Emergency Lighting	EA3	1 UNIT	Exterior
AIR CONDITIONERS	EA3	3 UNITS	Exterior
USED OIL, FUELS, FUEL OIL OTHER	EA3	1 UNIT	Engine Motor, Exterior
AIR CONDITIONERS	EA5	1 UNIT	5'x4'x4', Roof
AIR CONDITIONERS	EA5	1 UNIT	2'x2'x2', Roof
USED OIL, FUELS, FUEL OIL OTHER	EA5	1 UNIT	Hydraulic Door Closer, Roof
AIR CONDITIONERS	EA5	1 UNIT	5'x5'x5', Roof Bump Out

TABLE 5.0.2 – BUILDING “B” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
BALLASTS	FS1; FS2; FS5; FS8; FS9; FS13; FS16; FS19; FS21; FS23	272 UNITS	
FLUORESCENT LAMP	FS1; FS7	47 UNITS	8ft tubes
USED OIL, FUELS, FUEL OIL OTHER	FS1; FS11; FS9	5 UNITS	Motor
Pressure Gauge	FS1; FS9; FS16; FS18	16 UNITS	
FLUORESCENT LAMP	FS1; FS2; FS5; FS8; FS9; FS13; FS16; FS19; FS21; FS23	283 UNITS	4ft tubes
FIRE EXTINGUISHERS	FS9	2 UNITS	
THERMOSTATS	FS4; FS15; FS16	4 UNITS	
USED OIL, FUELS, FUEL OIL OTHER	FS4	6 UNITS	Electrical Transformers
ABOVE GROUND STORAGE TANKS	FS1; FS11; FS9	5 UNITS	
CLEANERS	FS13	1 GAL	Antimicrobial Cleaner
FRIDGE, FREEZER, BLAST CHILLERS	FS15; FS16	2 UNITS	
TIRES	EA5	8 UNITS	Car Tires
USED OIL, FUELS, FUEL OIL OTHER	FS1; FS10; FS13; FS21	7 UNITS	Hydraulic Door Closers
AIR CONDITIONERS	FS21	1 UNIT	
SMOKE DETECTORS	FS21	6 UNITS	
BATTERIES	FS21	1 UNIT	
FLAME SENSORS (PILOT LIGHTS)	FS5; FS7; FS8; FS9; FS15; FS16; FS21	10 UNITS	

TABLE 5.0.3 – BUILDING “C” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
MERCURY LIGHT SWITCHES	EA1	1 UNIT	
AIR CONDITIONERS	EA1	1 UNIT	Window
MERCURY LIGHT SWITCHES	EA4	2 UNITS	
TIRES	EA4	1 UNIT	
MERCURY LIGHT SWITCHES	EA2	3 UNITS	
BALLASTS	FS1; FS5; FS6; FS7; FS8; FS11; FS9; FS12; FS14-FS21; FS23; FS25; FS28; FS29-FS32; FS37-FS41	223 UNITS	
EXIT SIGN	FS22	1 UNIT	
USED OIL, FUELS, FUEL OIL OTHER	FS1; FS30; FS37; FS39	12 UNITS	Motor
Pressure Gauge	FS1; FS5; FS11; FS30	59 UNITS	
FLUORESCENT LAMP	FS1; FS5; FS6; FS7; FS8; FS11; FS9; FS12; FS14-FS21; FS23; FS25; FS28; FS29-FS32; FS37-FS41	492 UNITS	4ft tubes
FIRE EXTINGUISHERS	FS1; FS11; FS18; FS37; FS39; FS18; FS37; FS39	70 UNITS	
THERMOSTATS	FS1; FS12; FS14; FS15; FS16; FS18; FS20; FS23; FS25; FS31	22 UNITS	
BELOW GROUND STORAGE TANKS	FS1	2 UNITS	
ABOVE GROUND STORAGE TANKS	FS1; FS11	9 UNITS	
USED OIL, FUELS, FUEL OIL OTHER	FS1	2 UNITS	Grease Gun
GAS PRESSURE REGULATORS	FS1; FS7; FS3	10 UNITS	
MERCURY LIGHT bulbs	FS1; FS11	9 UNITS	
USED OIL, FUELS, FUEL OIL OTHER	FS1; FS9; FS22; FS23; FS26; FS27; FS28; FS37	14 UNITS	Hydraulic Door Closers
AIR CONDITIONERS	FS6; FS12; FS13; FS30	5 UNITS	
CLEANERS	FS27; FS31	6 UNITS	1 Gal

TABLE 5.0.3 – BUILDING “C” OTHER REGULATED MATERIALS

Material Description	Location (FS/EA)	Estimated Quantity	Additional Information
BATTERIES	FS1; FS6; FS41	4 UNITS	
Smoke Detectors /FLAME SENSORS (PILOT LIGHTS)	FS1; FS3; FS5; FS7; FS10; FS11; FS16; FS23; FS25; FS29; FS30; FS31	23 UNITS	
Propane tank	FS7; FS41	3 UNITS	40 lbs propane tank
CLEANERS	FS26; FS39; FS41	10 UNITS	5 Gal
FLAME SENSORS (PILOT LIGHTS)	FS30; FS41	6 UNITS	Heater
TIRES	EA4	1 UNIT	
GLUE	FS39	4 UNITS	2 Gal
USED OIL, FUELS, FUEL OIL OTHER	FS39	3 UNITS	4 Gallon drums
FLUORESCENT LAMP	FS41	216 UNITS	3 Foot light bulbs
FLUORESCENT LAMP	FS23; FS41	200 UNITS	2 Foot light bulbs
FLUORESCENT LAMP	FS41	384 UNITS	1 Foot light bulb

6.0 CONCLUSIONS AND RECOMMENDATIONS

The Indiana Department of Environmental Management (IDEM) Air Quality Division Require formal notification of demolition activities for all structures with, or without, regulated asbestos containing materials (RACM) by using state form *Notification of Demolition and Renovation Operations (State Form 44593, available on the IDEM Agency Forms page)*. Notifications must be made at least 10 business days prior to start of work.

Laboratory results for bulk material samples collected during the HRM inspection indicate several building materials are ACMs and are subject to proper abatement and/or disposal based upon planned demolition activities. Refer to 4.0.1 – Laboratory Analytical Results, for a list of all confirmed and assumed ACMs.

7.0 LIMITATIONS

Egis BLN USA, Inc. sampled portions of the roof that could be accessed safely. If sample collection and friability assessment could not be completed for a suspect material, then the material should be considered a friable ACM, and managed in accordance with the applicable regulations governing such material. However, if later the asbestos removal contractor or demolition contractor gains access to the roof, the friability can be assessed, and samples collected (where applicable and determined necessary by said contractor). This secondary assessment will provide the necessary information to determine if the roofing material can remain in place, or if it is required (in part or whole) to be removed prior to demolition. Egis BLN USA, Inc. is not responsible for this secondary inspection unless specifically requested to do so.

The conclusions of this report are based solely upon observations made during this evaluation. This report is intended to present a professional opinion of potential asbestos containing materials that may or may not be present at the project property. Our opinions should not be construed as relating to health and safety issues directly. Should additional information become available, this information should be reviewed, and the conclusions herein modified as appropriate. In addition, this report should not be construed as verification of compliance by the present owners or operators of the Site with federal, state, or local laws and regulations. Egis BLN USA, Inc. is responsible for performing services in a professional manner, consistent with typical industry practice. The conclusions drawn based on this evaluation are deemed as appropriate by Egis BLN USA, Inc. in the exercise of professional judgment.

Our observations did not indicate conditions existing beyond those discussed, although it is possible, limitation of scope or the standard practice precluded recognition of asbestos containing materials present at the site, such as inaccessible and/or confined spaces of the structure. Egis BLN USA, Inc. staff do not enter confined spaces as part of the inspection process. Confined spaces include crawlspaces and attics or any other such space where there is limited ingress and egress.

Egis BLN USA, Inc. reserves the right to determine when and where a confined space may be present and use professional judgment when deciding upon entry. We cannot be held liable for materials that may be present in these spaces and unable to be reported as part of our inspection process. The presence of confined spaces will be reported as applicable, and all limitations expressed herein will apply. Any confined spaces encountered during the inspection are identified in section 2.1 – Accessibility Limitations.

Thermal system insulation (TSI) is typically installed behind walls and ceilings and concealed within pipe chases. It is possible that not every pipe chase was discovered during the HRM Survey and that additional TSI materials may be present beyond what is estimated in this report. Destructive field methodologies applied for locating and estimated the quantity of TSI were performed using best professional judgment and in a manner consistent with industry standards.

We cannot be held liable for consequential damages, if it is determined in the future that contamination of some type is present at the site. This report should not be considered as a recommendation to purchase, sell, or develop the Site, and the opinions expressed herein are not legal opinions. To evaluate the information contained in this report, the reader must understand the limitations associated with this assessment. Specifically, the services for this project have been performed in general conformance with the contract negotiated between the RDA and Egis BLN USA, Inc. This report was prepared for the benefit and exclusive use of the RDA, its agents and assigns. Any third-party use of this report or reliance upon the information and opinions therein is the sole responsibility of the third party. Egis BLN USA, Inc. has no responsibility for any damages that may be suffered by a third party because of any decision made or action taken by a third party based on this report.

ATTACHMENT 1 – LABORATORY REPORT

BUILDING A



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/28/2025
Received: 3/04/2025
Analyzed: 3/07/2025

Proj: IC-004 - 540 Tyler (A Exterior) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-1-A **Lab Sample ID:** 042503814-0001

Sample Description: EA 1-4/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-1-B **Lab Sample ID:** 042503814-0002

Sample Description: EA 1-4/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-1-C-Brick **Lab Sample ID:** 042503814-0003

Sample Description: EA 1-4/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025		0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-1-C-DELETE LAYER **Lab Sample ID:** 042503814-0003A

Sample Description: EA 1-4/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-2-A-Brick **Lab Sample ID:** 042503814-0004

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-2-A-Mortar **Lab Sample ID:** 042503814-0004A

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-2-B-Brick **Lab Sample ID:** 042503814-0005

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-2-B-Mortar **Lab Sample ID:** 042503814-0005A

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-2-C-Brick **Lab Sample ID:** 042503814-0006

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-2-C-Mortar **Lab Sample ID:** 042503814-0006A

Sample Description: EA 1-4/Brick_Mortar - Brick Sliding

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-3-A **Lab Sample ID:** 042503814-0007

Sample Description: EA 3/Concrete - Parking Lot

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-3-B **Lab Sample ID:** 042503814-0008

Sample Description: EA 3/Concrete - Parking Lot

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-3-C **Lab Sample ID:** 042503814-0009

Sample Description: EA 3/Concrete - Parking Lot

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-4-A **Lab Sample ID:** 042503814-0010

Sample Description: EA 1-4/Exterior Caulk - On Metal Framed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	98.0%	2% Chrysotile	

Client Sample ID: A-Ext-4-B **Lab Sample ID:** 042503814-0011

Sample Description: EA 1-4/Exterior Caulk - On Metal Framed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-4-C **Lab Sample ID:** 042503814-0012

Sample Description: EA 1-4/Exterior Caulk - On Metal Framed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-Ext-5-A **Lab Sample ID:** 042503814-0013

Sample Description: EA 1-4/Concrete - Window and Door Sills, Borders

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-5-B **Lab Sample ID:** 042503814-0014

Sample Description: EA 1-4/Concrete - Window and Door Sills, Borders

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-5-C **Lab Sample ID:** 042503814-0015

Sample Description: EA 1-4/Concrete - Window and Door Sills, Borders

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-6-A **Lab Sample ID:** 042503814-0016

Sample Description: EA 1-3/Exterior_Caulk - On Brick Siding Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-6-B **Lab Sample ID:** 042503814-0017

Sample Description: EA 1-3/Exterior_Caulk - On Brick Siding Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-6-C **Lab Sample ID:** 042503814-0018

Sample Description: EA 1-3/Exterior_Caulk - On Brick Siding Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-7-A **Lab Sample ID:** 042503814-0019

Sample Description: EA 1/Concrete - Block Beams for Landscaping

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-7-B **Lab Sample ID:** 042503814-0020
Sample Description: EA 1/Concrete - Block Beams for Landscaping

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-7-C **Lab Sample ID:** 042503814-0021
Sample Description: EA 1/Concrete - Block Beams for Landscaping

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-8-A **Lab Sample ID:** 042503814-0022
Sample Description: EA 1/Concrete - Concrete Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-8-B **Lab Sample ID:** 042503814-0023
Sample Description: EA 1/Concrete - Concrete Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-8-C **Lab Sample ID:** 042503814-0024
Sample Description: EA 1/Concrete - Concrete Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-9-A **Lab Sample ID:** 042503814-0025
Sample Description: EA 1/Exterior_Caulk - Metal FramedWall Caulk,Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-Ext-9-B **Lab Sample ID:** 042503814-0026
Sample Description: EA 1/Exterior_Caulk - Metal FramedWall Caulk,Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-Ext-9-C **Lab Sample ID:** 042503814-0027
Sample Description: EA 1/Exterior_Caulk - Metal FramedWall Caulk,Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-10-A **Lab Sample ID:** 042503814-0028

Sample Description: EA 1/Exterior_Caulk - Metal Pan Seam SEalant

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-10-B **Lab Sample ID:** 042503814-0029

Sample Description: EA 1/Exterior_Caulk - Metal Pan Seam SEalant

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-10-C **Lab Sample ID:** 042503814-0030

Sample Description: EA 1/Exterior_Caulk - Metal Pan Seam SEalant

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown/Gray	0.0%	98.0%	2% Chrysotile	

Client Sample ID: A-Ext-11-A **Lab Sample ID:** 042503814-0031

Sample Description: EA 1/Gasket_Material - Air Handling Units

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-Ext-11-B **Lab Sample ID:** 042503814-0032

Sample Description: EA 1/Gasket_Material - Air Handling Units

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-Ext-11-C **Lab Sample ID:** 042503814-0033

Sample Description: EA 1/Gasket_Material - Air Handling Units

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-Ext-12-A **Lab Sample ID:** 042503814-0034

Sample Description: EA 1,3/Exterior Caulk-Vent Sealant - On Vents

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	94.0%	6% Chrysotile	

Client Sample ID: A-Ext-12-B **Lab Sample ID:** 042503814-0035

Sample Description: EA 1,3/Exterior Caulk-Vent Sealant - On Vents

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-12-C **Lab Sample ID:** 042503814-0036

Sample Description: EA 1,3/Exterior Caulk-Vent Sealant - On Vents

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-Ext-13-A **Lab Sample ID:** 042503814-0037

Sample Description: EA3/Exterior_Caulk - Door Openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-13-B **Lab Sample ID:** 042503814-0038

Sample Description: EA3/Exterior_Caulk - Door Openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-13-C **Lab Sample ID:** 042503814-0039

Sample Description: EA3/Exterior_Caulk - Door Openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-14-A **Lab Sample ID:** 042503814-0040

Sample Description: EA3/Concrete - Ramp tp FS 128

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-14-B **Lab Sample ID:** 042503814-0041

Sample Description: EA3/Concrete - Ramp tp FS 128

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-14-C **Lab Sample ID:** 042503814-0042

Sample Description: EA3/Concrete - Ramp tp FS 128

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-15-A **Lab Sample ID:** 042503814-0043

Sample Description: EA3/Roofing_Material - Flashing above door opening

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-15-B **Lab Sample ID:** 042503814-0044

Sample Description: EA3/Roofing_Material - Flashing above door opening

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-15-C **Lab Sample ID:** 042503814-0045

Sample Description: EA3/Roofing_Material - Flashing above door opening

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-16-A **Lab Sample ID:** 042503814-0046

Sample Description: EA3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown/Gray	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-Ext-16-B **Lab Sample ID:** 042503814-0047

Sample Description: EA3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-Ext-16-C **Lab Sample ID:** 042503814-0048

Sample Description: EA3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-Ext-17-A-Brick **Lab Sample ID:** 042503814-0049

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-17-A-Mortar **Lab Sample ID:** 042503814-0049A

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-17-B-Brick **Lab Sample ID:** 042503814-0050

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-17-B-Mortar **Lab Sample ID:** 042503814-0050A

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-17-C-Brick **Lab Sample ID:** 042503814-0051

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-17-C-Mortar **Lab Sample ID:** 042503814-0051A

Sample Description: EA3/Block_Mortar - Patch & Repair

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-18-A **Lab Sample ID:** 042503814-0052

Sample Description: EA3/Flooring - Gray Sheets of 18 x 18

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-18-B **Lab Sample ID:** 042503814-0053

Sample Description: EA3/Flooring - Gray Sheets of 18 x 18

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-18-C **Lab Sample ID:** 042503814-0054

Sample Description: EA3/Flooring - Gray Sheets of 18 x 18

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-19-A **Lab Sample ID:** 042503814-0055

Sample Description: EA3/Stack_Cement - Chimney at Mechanical Exhausts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-19-B **Lab Sample ID:** 042503814-0056

Sample Description: EA3/Stack_Cement - Chimney at Mechanical Exhausts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503814
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-Ext-19-C

Lab Sample ID: 042503814-0057

Sample Description: EA3/Stack_Cement - Chimney at Mechanical Exhausts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-20-A

Lab Sample ID: 042503814-0058

Sample Description: EA 1-4/Window_Glaze - On Metal Pan Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-20-B

Lab Sample ID: 042503814-0059

Sample Description: EA 1-4/Window_Glaze - On Metal Pan Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-Ext-20-C

Lab Sample ID: 042503814-0060

Sample Description: EA 1-4/Window_Glaze - On Metal Pan Large Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Analyst(s):

Allen Kuestner PLM (41)
Tahirrah Steele PLM (16)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/07/2025 14:40:20



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503814

PHONE: (800) 220-3675

EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Billing Information	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
	Project Information						
Project Name/No:				Purchase Order:			
IC-004 - 540 Tyler (A Exterior)				240100-RDA Program			
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample		No. of Samples	
				2/28/2025		60	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 2857622202147

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-Ext-1 - A, B, C	CC	EA 1-4	Concrete - Foundation Walls
A-Ext-2 - A, B, C	BM	EA 1-4	Brick_Mortar - Brick Siding
A-Ext-3 - A, B, C	CC	EA 3	Concrete - Parking Lot
A-Ext-4 - A, B, C	EC	EA 1-4	Exterior Caulk - On Metal Framed Windows
A-Ext-5 - A, B, C	CC	EA 1-4	Concrete - Window and Door Sills, Borders
A-Ext-6 - A, B, C	EC	EA 1-3	Exterior_Caulk - On Brick Siding Seams
A-Ext-7 - A, B, C	CC	EA 1	Concrete - Block Beams for Landscaping
A-Ext-8 - A, B, C	CC	EA1	Concrete - Concrete Panels

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Meeting Place PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED MAR - 4 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.comEMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503814

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (Exterior)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
A-Ext-9 - A, B, C	EC	EA 1	Exterior_Caulk - Metal FramedWall Caulk, Large Windows
A-Ext-10 - A, B, C	EC	EA 1	Exterior_Caulk - Metal Pan Seam SEalant
A-Ext-11 - A, B, C	GM	EA 1	Gasket_Material - Air Handling Units
A-Ext-12 - A, B, C	EC	EA 1,3	Exterior Caulk-Vent Sealant - On Vents
A-Ext-13 - A, B, C	EC	EA3	Exterior_Caulk - Door Openings
A-Ext-14 - A, B, C	CC	EA 3	Concrete - Ramp tp FS 128
A-Ext-15 - A, B, C	RM	EA 3	Roofing_Material - Flashing above door opening
A-Ext-16 - A, B, C	WG	EA 3	Window_Glaze - Wood Framed Sliding Windows
A-Ext-17 - A, B, C	BM	EA 3	Block_Mortar - Patch & Repair
A-Ext-18 - A, B, C	FLM	EA 3	Flooring - Gray Sheets of 18 x 18
A-Ext-19 - A, B, C	SC	EA 3	Stack_Cement - Chimney at Mechanical Exhausts
A-Ext-20 - A, B, C	WG	EA 1-4	Window_Glaze - On Metal Pan Large Windows
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-

RECEIVED MAR - 4 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/ 3/2025
Received: 3/05/2025
Analyzed: 3/10/2025

Proj: IC-004 - 540 Tyler (A-Base1) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-21-Bas-A **Lab Sample ID:** 042503924-0001

Sample Description: FS 1-80/Concrete - Walls-Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-21-Bas-B **Lab Sample ID:** 042503924-0002

Sample Description: FS 1-80/Concrete - Walls-Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-21-Bas-C **Lab Sample ID:** 042503924-0003

Sample Description: FS 1-80/Concrete - Walls-Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-22-Bas-A-Concrete **Lab Sample ID:** 042503924-0004

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-22-Bas-A-Mortar **Lab Sample ID:** 042503924-0004A

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White/Beige	2.0%	98.0%	None Detected	

Client Sample ID: A-22-Bas-B-Concrete **Lab Sample ID:** 042503924-0005

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-22-Bas-B-Mortar **Lab Sample ID:** 042503924-0005A

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White/Beige	2.0%	98.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-22-Bas-C-Concrete **Lab Sample ID:** 042503924-0006

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-22-Bas-C-Mortar **Lab Sample ID:** 042503924-0006A

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White/Beige	2.0%	98.0%	None Detected	

Client Sample ID: A-22-Bas-D-Concrete **Lab Sample ID:** 042503924-0007

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-22-Bas-D-Mortar **Lab Sample ID:** 042503924-0007A

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-22-Bas-E-Concrete **Lab Sample ID:** 042503924-0008

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-22-Bas-E-Mortar **Lab Sample ID:** 042503924-0008A

Sample Description: FS 1-80/Pyro Bar with Mortar - Interior and Exterior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-A-Skim Coat **Lab Sample ID:** 042503924-0009

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-A-Rough Coat **Lab Sample ID:** 042503924-0009A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	1.0%	99.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-23-Bas-B-Skim Coat **Lab Sample ID:** 042503924-0010

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-B-Rough Coat **Lab Sample ID:** 042503924-0010A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-23-Bas-C-Skim Coat **Lab Sample ID:** 042503924-0011

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-C-Rough Coat **Lab Sample ID:** 042503924-0011A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-23-Bas-D-Skim Coat **Lab Sample ID:** 042503924-0012

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-D-Rough Coat **Lab Sample ID:** 042503924-0012A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-23-Bas-E-Skim Coat **Lab Sample ID:** 042503924-0013

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-E-Rough Coat **Lab Sample ID:** 042503924-0013A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-23-Bas-F-Skim Coat **Lab Sample ID:** 042503924-0014

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-F-Rough Coat **Lab Sample ID:** 042503924-0014A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-23-Bas-G-Skim Coat **Lab Sample ID:** 042503924-0015

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-23-Bas-G-Rough Coat **Lab Sample ID:** 042503924-0015A

Sample Description: FS 1-80/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-24-Bas-A-Tar **Lab Sample ID:** 042503924-0016

Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	<1%	100.0%	None Detected	

Client Sample ID: A-24-Bas-A-Concrete **Lab Sample ID:** 042503924-0016A

Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-24-Bas-B-Tar **Lab Sample ID:** 042503924-0017

Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	<1%	100.0%	None Detected	

Client Sample ID: A-24-Bas-B-Concrete **Lab Sample ID:** 042503924-0017A

Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnaslab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-24-Bas-C-Tar **Lab Sample ID:** 042503924-0018
Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-24-Bas-C-Concrete **Lab Sample ID:** 042503924-0018A
Sample Description: FS 6/Concrete - Columns

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-25-Bas-A-Cove Base **Lab Sample ID:** 042503924-0019
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-25-Bas-A-Adhesive **Lab Sample ID:** 042503924-0019A
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-25-Bas-B-Cove Base **Lab Sample ID:** 042503924-0020
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-25-Bas-B-Adhesive **Lab Sample ID:** 042503924-0020A
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-25-Bas-C-Cove Base **Lab Sample ID:** 042503924-0021
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-25-Bas-C-Adhesive **Lab Sample ID:** 042503924-0021A
Sample Description: FS 6/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-26-Bas-A-Concrete **Lab Sample ID:** 042503924-0022

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-26-Bas-A-Mortar **Lab Sample ID:** 042503924-0022A

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-26-Bas-B-Concrete **Lab Sample ID:** 042503924-0023

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-26-Bas-B-Mortar **Lab Sample ID:** 042503924-0023A

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-26-Bas-C-Concrete **Lab Sample ID:** 042503924-0024

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-26-Bas-C-Mortar **Lab Sample ID:** 042503924-0024A

Sample Description: FS 1-80/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-27-Bas-A **Lab Sample ID:** 042503924-0025

Sample Description: FS 1-78/Flooring - Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	<1%	100.0%	None Detected	

Client Sample ID: A-27-Bas-B **Lab Sample ID:** 042503924-0026

Sample Description: FS 1-78/Flooring - Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-27-Bas-C **Lab Sample ID:** 042503924-0027
Sample Description: FS 1-78/Flooring - Terrazzo Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/White/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-28-Bas-A-Ceramic Tile **Lab Sample ID:** 042503924-0028
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-28-Bas-A-Leveler **Lab Sample ID:** 042503924-0028A
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	<1%	100.0%	None Detected	

Client Sample ID: A-28-Bas-A-Concrete **Lab Sample ID:** 042503924-0028B
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-28-Bas-B-Ceramic Tile **Lab Sample ID:** 042503924-0029
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-28-Bas-B-Leveler **Lab Sample ID:** 042503924-0029A
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	<1%	100.0%	None Detected	

Client Sample ID: A-28-Bas-B-Concrete **Lab Sample ID:** 042503924-0029B
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-28-Bas-C-Ceramic Tile **Lab Sample ID:** 042503924-0030
Sample Description: FS 4-5,/Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-28-Bas-C-Leveler **Lab Sample ID:** 042503924-0030A

Sample Description: FS 4-5./Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-28-Bas-C-Concrete **Lab Sample ID:** 042503924-0030B

Sample Description: FS 4-5./Ceramic_Tile_with_Glue - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-29-Bas-A **Lab Sample ID:** 042503924-0031

Sample Description: FS 1,6,8,18-19,70/Ceiling_Panel - 2X4, White w/ indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/White	75.0%	25.0%	None Detected	

Client Sample ID: A-29-Bas-B **Lab Sample ID:** 042503924-0032

Sample Description: FS 1,6,8,18-19,70/Ceiling_Panel - 2X4, White w/ indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	75.0%	25.0%	None Detected	

Client Sample ID: A-29-Bas-C **Lab Sample ID:** 042503924-0033

Sample Description: FS 1,6,8,18-19,70/Ceiling_Panel - 2X4, White w/ indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	70.0%	30.0%	None Detected	

Client Sample ID: A-30-Bas-A-Ceiling Tile **Lab Sample ID:** 042503924-0034

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/White/Beige	98.0%	2.0%	None Detected	

Client Sample ID: A-30-Bas-A-Mastic **Lab Sample ID:** 042503924-0034A

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Tan	<1%	98.0%	2% Chrysotile	

Client Sample ID: A-30-Bas-B-Ceiling Tile **Lab Sample ID:** 042503924-0035

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/White/Beige	98.0%	2.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-30-Bas-B-Mastic **Lab Sample ID:** 042503924-0035A

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-30-Bas-C-Ceiling Tile **Lab Sample ID:** 042503924-0036

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown	98.0%	2.0%	None Detected	

Client Sample ID: A-30-Bas-C-Mastic **Lab Sample ID:** 042503924-0036A

Sample Description: FS 1-78/Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-31-Bas-A **Lab Sample ID:** 042503924-0037

Sample Description: FS 37,9/Ceiling_Panel - 2X4, White and Smooth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	75.0%	25.0%	None Detected	

Client Sample ID: A-31-Bas-B **Lab Sample ID:** 042503924-0038

Sample Description: FS 37,9/Ceiling_Panel - 2X4, White and Smooth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/White	80.0%	20.0%	None Detected	

Client Sample ID: A-31-Bas-C **Lab Sample ID:** 042503924-0039

Sample Description: FS 37,9/Ceiling_Panel - 2X4, White and Smooth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/White	60.0%	40.0%	None Detected	

Client Sample ID: A-32-Bas-A **Lab Sample ID:** 042503924-0040

Sample Description: FS 8-9/Ceiling_Tile - 1X1, Smooth with White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/White	98.0%	2.0%	None Detected	

Client Sample ID: A-32-Bas-B **Lab Sample ID:** 042503924-0041

Sample Description: FS 8-9/Ceiling_Tile - 1X1, Smooth with White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray/White	98.0%	2.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-32-Bas-C **Lab Sample ID:** 042503924-0042

Sample Description: FS 8-9/Ceiling_Tile - 1X1, Smooth with White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown	98.0%	2.0%	None Detected	

Client Sample ID: A-33-Bas-A **Lab Sample ID:** 042503924-0043

Sample Description: FS 34/Duct_Insulation - Canvas on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Tan/Beige	90.0%	10.0%	None Detected	

Client Sample ID: A-33-Bas-B **Lab Sample ID:** 042503924-0044

Sample Description: FS 34/Duct_Insulation - Canvas on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Tan/Beige	90.0%	10.0%	None Detected	

Client Sample ID: A-33-Bas-C **Lab Sample ID:** 042503924-0045

Sample Description: FS 34/Duct_Insulation - Canvas on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	90.0%	10.0%	None Detected	

Client Sample ID: A-34-Bas-A **Lab Sample ID:** 042503924-0046

Sample Description: FS 34/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black/Beige	90.0%	10.0%	None Detected	

Client Sample ID: A-34-Bas-B **Lab Sample ID:** 042503924-0047

Sample Description: FS 34/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black/Beige	90.0%	10.0%	None Detected	

Client Sample ID: A-34-Bas-C **Lab Sample ID:** 042503924-0048

Sample Description: FS 34/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan/Black	95.0%	5.0%	None Detected	

Client Sample ID: A-35-Bas-A **Lab Sample ID:** 042503924-0049

Sample Description: FS 34/Duct_Insulation - Interior of Ductwork

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan/Yellow	96.0%	4.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnaslab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-35-Bas-B **Lab Sample ID:** 042503924-0050

Sample Description: FS 34/Duct_Insulation - Interior of Ductwork

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Yellow	96.0%	4.0%	None Detected	

Client Sample ID: A-35-Bas-C **Lab Sample ID:** 042503924-0051

Sample Description: FS 34/Duct_Insulation - Interior of Ductwork

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Yellow	100.0%	0.0%	None Detected	

Client Sample ID: A-36-Bas-A **Lab Sample ID:** 042503924-0052

Sample Description: FS 29-33,/Terra-Cotta - Interior and Exterior,Ceilings Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-36-Bas-B **Lab Sample ID:** 042503924-0053

Sample Description: FS 29-33,/Terra-Cotta - Interior and Exterior,Ceilings Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-36-Bas-C **Lab Sample ID:** 042503924-0054

Sample Description: FS 29-33,/Terra-Cotta - Interior and Exterior,Ceilings Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-37-Bas-A **Lab Sample ID:** 042503924-0055

Sample Description: FS 28/Ceiling_Panel - 2X2, White with Swirl patter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Beige	98.0%	2.0%	None Detected	

Client Sample ID: A-37-Bas-B **Lab Sample ID:** 042503924-0056

Sample Description: FS 28/Ceiling_Panel - 2X2, White with Swirl patter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Beige	98.0%	2.0%	None Detected	

Client Sample ID: A-37-Bas-C **Lab Sample ID:** 042503924-0057

Sample Description: FS 28/Ceiling_Panel - 2X2, White with Swirl patter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Beige	95.0%	5.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-38-Bas-A **Lab Sample ID:** 042503924-0058

Sample Description: FS 13/Fire_Brick - Inside incinerator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-38-Bas-B **Lab Sample ID:** 042503924-0059

Sample Description: FS 13/Fire_Brick - Inside incinerator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-38-Bas-C **Lab Sample ID:** 042503924-0060

Sample Description: FS 13/Fire_Brick - Inside incinerator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-39-Bas-A-Ceramic Tile **Lab Sample ID:** 042503924-0061

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-39-Bas-A-Grout **Lab Sample ID:** 042503924-0061A

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-39-Bas-B-Ceramic Tile **Lab Sample ID:** 042503924-0062

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-39-Bas-B-Grout **Lab Sample ID:** 042503924-0062A

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-39-Bas-C-Ceramic Tile **Lab Sample ID:** 042503924-0063

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-39-Bas-C-Grout **Lab Sample ID:** 042503924-0063A

Sample Description: FS 11/Ceramic_Tile_with_Grout - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-40-Bas-A **Lab Sample ID:** 042503924-0064

Sample Description: FS 24/Rolled_In_Insulation - Yellow with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-40-Bas-B **Lab Sample ID:** 042503924-0065

Sample Description: FS 24/Rolled_In_Insulation - Yellow with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black/Silver/Yellow	83.0%	17.0%	None Detected	

Client Sample ID: A-40-Bas-C **Lab Sample ID:** 042503924-0066

Sample Description: FS 24/Rolled_In_Insulation - Yellow with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black/Silver/Yellow	75.0%	25.0%	None Detected	

Client Sample ID: A-41-Bas-A-Joint Compound **Lab Sample ID:** 042503924-0067

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-41-Bas-A-Tape **Lab Sample ID:** 042503924-0067A

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	100.0%	0.0%	None Detected	

Client Sample ID: A-41-Bas-A-Wallboard **Lab Sample ID:** 042503924-0067B

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray	16.0%	84.0%	None Detected	

Client Sample ID: A-41-Bas-B-Joint Compound **Lab Sample ID:** 042503924-0068

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-41-Bas-B-Tape **Lab Sample ID:** 042503924-0068A

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	100.0%	0.0%	None Detected	

Client Sample ID: A-41-Bas-B-Wallboard **Lab Sample ID:** 042503924-0068B

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray	16.0%	84.0%	None Detected	

Client Sample ID: A-41-Bas-C-Joint Compound **Lab Sample ID:** 042503924-0069

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-41-Bas-C-Tape **Lab Sample ID:** 042503924-0069A

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Beige	100.0%	0.0%	None Detected	

Client Sample ID: A-41-Bas-C-Wallboard **Lab Sample ID:** 042503924-0069B

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray	21.0%	79.0%	None Detected	

Client Sample ID: A-41-Bas-D-Joint Compound **Lab Sample ID:** 042503924-0070

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-41-Bas-D-Wallboard **Lab Sample ID:** 042503924-0070A

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-41-Bas-E-Joint Compound **Lab Sample ID:** 042503924-0071

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-41-Bas-E-Wallboard **Lab Sample ID:** 042503924-0071A

Sample Description: FS 1, 15-16,53,70-71-72,74,-7579-80,/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Brown/Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-42-Bas-A **Lab Sample ID:** 042503924-0072

Sample Description: FS 2-22,40.70-71-73/Flooring - Carpet Glue, Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-42-Bas-B **Lab Sample ID:** 042503924-0073

Sample Description: FS 2-22,40.70-71-73/Flooring - Carpet Glue, Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-42-Bas-C **Lab Sample ID:** 042503924-0074

Sample Description: FS 2-22,40.70-71-73/Flooring - Carpet Glue, Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-43-Bas-A **Lab Sample ID:** 042503924-0075

Sample Description: FS 1-80/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-43-Bas-B **Lab Sample ID:** 042503924-0076

Sample Description: FS 1-80/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-43-Bas-C-Brick **Lab Sample ID:** 042503924-0077

Sample Description: FS 1-80/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Tan/Orange	0.0%	100.0%	None Detected	

Client Sample ID: A-43-Bas-C-Mortar **Lab Sample ID:** 042503924-0077A

Sample Description: FS 1-80/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503924
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-44-Bas-A-Floor Tile **Lab Sample ID:** 042503924-0078

Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	White/Beige	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-44-Bas-A-Mastic **Lab Sample ID:** 042503924-0078A

Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-44-Bas-B **Lab Sample ID:** 042503924-0079

Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-44-Bas-C **Lab Sample ID:** 042503924-0080

Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-45-Bas-A-Floor Tile **Lab Sample ID:** 042503924-0081

Sample Description: FS 39/Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Gray/Green	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-45-Bas-A-Mastic **Lab Sample ID:** 042503924-0081A

Sample Description: FS 39/Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-45-Bas-B **Lab Sample ID:** 042503924-0082

Sample Description: FS 39/Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-45-Bas-C **Lab Sample ID:** 042503924-0083

Sample Description: FS 39/Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/10/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503924
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Bobby Wheatley PLM (41)
Nicole MacDowell PLM (80)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Kernersville, NC NVLAP Lab Code 102104-0, Virginia 3333-000228, West Virginia LT000321

Initial report from: 03/10/2025 14:29:37



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

0 4 2 5 0 3 9 2 4

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75			
	Company Name:	Egis		Company Name:	Egis			
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones			
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street			
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250 Country: USA		
	Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
	Project Information							
Project Name/No:				IC-004 - 540 Tyler (A-Base1)		Purchase Order:	240100-RDA Program	
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)		
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample		3/3/2025		No. of Samples 83

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples ≤1% asbestos
Point Count NOB material samples ≤1% asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285999985190

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-21-Bas - A, B, C	CC	FS 1-80	Concrete - Walls-Foundation
A-22-Bas - A, B, C, D, E	PBM	FS 1-80	Pyro Bar with Mortar - Interior and Exterior Walls
A-23-Bas - A, B, C, D, E, F, G	PL	FS 1-80	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh
A-24-Bas - A, B, C	CC	FS 6	Concrete - Columns
A-25-Bas - A, B, C	CB	FS 6	Cove_Base - with Adhesive
A-26-Bas - A, B, C	BM	FS 1-80	Block_Mortar - Interior Wall Block with Mortar
A-27-Bas - A, B, C	FLM	FS 1-78	Flooring - Terrazzo Flooring
A-28-Bas - A, B, C	CC	FS 4-5,	Ceramic_Tile_with_GGlue - Bathroom Walls

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Kernersville, NC		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED MAR - 5 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503924

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
A-29-Bas - A, B, C	CP	FS 1,6,8,18-19,70	Ceiling_Panel - 2X4, White w/ indentations
A-30-Bas - A, B, C	CT	FS 1-78	Ceiling_Tile - 1X1 w/Glue Pod, White with Dot pattern
A-31-Bas - A, B, C	CP	FS 37,9,	Ceiling_Panel - 2X4, White and Smooth
A-32-Bas - A, B, C	CT	FS 8-9,	Ceiling_Tile - 1X1, Smooth with White
A-33-Bas - A, B, C	DI	FS 34	Duct_Insulation - Canvas on Ducts
A-34-Bas - A, B, C	VD	FS 34	Vibration_Dampener - Woven, Coarse Textile, White
A-35-Bas - A, B, C	DI	FS 34	Duct_Insulation - Interior of Ductwork
A-36-Bas - A, B, C	TC	FS 29-33,	Terra-Cotta - Interior and Exterior,Ceilings Walls
A-37-Bas - A, B, C	CP	FS 28	Ceiling_Panel - 2X2, White with Swirl patter
A-38-Bas - A, B, C	FB	FS 13	Fire_Brick - Inside incinerator
A-39-Bas - A, B, C	CTG	FS 11	Ceramic_Tile_with_Grout - Interior Walls
A-40-Bas - A, B, C	RI	FS 24	Rolled_In_Insulation - Yellow with Foil
A-41-Bas - A, B, C, D, E	WB	FS 1, 15-16,53,70-71-72,74,-7579-80,	Wallboard - with Mud & Tape
A-42-Bas - A, B, C	FLM	FS 2-22,40.70-71-73	Flooring - Carpet Glue, Tan
A-43-Bas - A, B, C	BM	FS 1-80	Brick_Mortar - Interior Walls
A-44-Bas - A, B, C	FLM	FS 39	Flooring - 12X12 Floor Tile with Mastic- Beige with Brown and White pattern
A-45-Bas - A, B, C	FLM	FS 39	Flooring - 9X9 Floor Tile with Mastic- Beige with Black Stripes
-	(material)	0	-
-	(material)	0	-

RECEIVED MAR - 5 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/ 4/2025
Received: 3/06/2025
Analyzed: 3/11/2025

Proj: IC-004 - 540 Tyler (Basement) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-46-Bas-A-Floor Tile **Lab Sample ID:** 042504124-0001

Sample Description: FS 38/Flooring - 9X9 Floor Tile with Mastic - Beige with Green and White Circles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Various/Beige	0.0%	92.0%	8% Chrysotile	

Client Sample ID: A-46-Bas-A-Mastic **Lab Sample ID:** 042504124-0001A

Sample Description: FS 38/Flooring - 9X9 Floor Tile with Mastic - Beige with Green and White Circles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Black	1.0%	96.0%	3% Chrysotile	

Client Sample ID: A-46-Bas-B **Lab Sample ID:** 042504124-0002

Sample Description: FS 38/Flooring - 9X9 Floor Tile with Mastic - Beige with Green and White Circles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-46-Bas-C **Lab Sample ID:** 042504124-0003

Sample Description: FS 38/Flooring - 9X9 Floor Tile with Mastic - Beige with Green and White Circles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-47-Bas-A-Ceiling Tile **Lab Sample ID:** 042504124-0004

Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White/Black	85.0%	15.0%	None Detected	

Client Sample ID: A-47-Bas-A-Mastic **Lab Sample ID:** 042504124-0004A

Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-47-Bas-B-Ceiling Tile **Lab Sample ID:** 042504124-0005

Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White	82.0%	18.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-47-Bas-B-Mastic **Lab Sample ID:** 042504124-0005A
Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-47-Bas-C-Ceiling Tile **Lab Sample ID:** 042504124-0006
Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White	85.0%	15.0%	None Detected	

Client Sample ID: A-47-Bas-C-Mastic **Lab Sample ID:** 042504124-0006A
Sample Description: FS 39, 53/Ceiling_Panel - 1x1 White with Indentions and Glue Pods

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-48-Bas-A-Floor Tile **Lab Sample ID:** 042504124-0007
Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic - With with Dot Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White	0.0%	98.0%	2% Chrysotile	

Client Sample ID: A-48-Bas-A-Mastic **Lab Sample ID:** 042504124-0007A
Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic - With with Dot Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-48-Bas-B **Lab Sample ID:** 042504124-0008
Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic - With with Dot Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-48-Bas-C **Lab Sample ID:** 042504124-0009
Sample Description: FS 39/Flooring - 12X12 Floor Tile with Mastic - With with Dot Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-49-Bas-A-Ceramic Tile **Lab Sample ID:** 042504124-0010
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_GROUT and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Beige	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-49-Bas-A-Mastic **Lab Sample ID:** 042504124-0010A
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-A-Leveler **Lab Sample ID:** 042504124-0010B
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/White/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-A-Grout **Lab Sample ID:** 042504124-0010C
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-49-Bas-B-Ceramic Tile **Lab Sample ID:** 042504124-0011
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-49-Bas-B-Mastic **Lab Sample ID:** 042504124-0011A
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-B-Leveler **Lab Sample ID:** 042504124-0011B
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-B-Grout **Lab Sample ID:** 042504124-0011C
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Beige	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-C-Ceramic Tile **Lab Sample ID:** 042504124-0012
Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Beige	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-49-Bas-C-Mastic **Lab Sample ID:** 042504124-0012A

Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-49-Bas-C-Leveler **Lab Sample ID:** 042504124-0012B

Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/White/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-49-Bas-C-Grout **Lab Sample ID:** 042504124-0012C

Sample Description: FS 41, 53, 53, 58, 62, 64-65/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x2" Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-50-Bas-A-Ceramic Tile **Lab Sample ID:** 042504124-0013

Sample Description: FS 41/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-50-Bas-A-Grout **Lab Sample ID:** 042504124-0013A

Sample Description: FS 41/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-50-Bas-A-Mortar **Lab Sample ID:** 042504124-0013B

Sample Description: FS 41/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-50-Bas-B-Ceramic Tile **Lab Sample ID:** 042504124-0014

Sample Description: FS 41/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-50-Bas-B-Grout **Lab Sample ID:** 042504124-0014A

Sample Description: FS 41/Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-50-Bas-B-Mortar **Lab Sample ID:** 042504124-0014B

Sample Description: FS 41/Ceramic_Tile_with_GROUT and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-50-Bas-C-Ceramic Tile **Lab Sample ID:** 042504124-0015

Sample Description: FS 41/Ceramic_Tile_with_GROUT and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-50-Bas-C-Mortar **Lab Sample ID:** 042504124-0015A

Sample Description: FS 41/Ceramic_Tile_with_GROUT and Mortar - Walls, 2"x4" Dark Red and Beige

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-51-Bas-A **Lab Sample ID:** 042504124-0016

Sample Description: FS 43/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan/Green	<1%	100.0%	None Detected	

Client Sample ID: A-51-Bas-B **Lab Sample ID:** 042504124-0017

Sample Description: FS 43/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan/Green	<1%	100.0%	None Detected	

Client Sample ID: A-51-Bas-C **Lab Sample ID:** 042504124-0018

Sample Description: FS 43/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan/Green	<1%	100.0%	None Detected	

Client Sample ID: A-52-Bas-A **Lab Sample ID:** 042504124-0019

Sample Description: FS 43, 58/Flooring - Linoleum with Paper Backing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan	45.0%	55.0%	None Detected	

Client Sample ID: A-52-Bas-B **Lab Sample ID:** 042504124-0020

Sample Description: FS 43, 58/Flooring - Linoleum with Paper Backing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/White	45.0%	55.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-52-Bas-C **Lab Sample ID:** 042504124-0021

Sample Description: FS 43, 58/Flooring - Linoleum with Paper Backing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/White	45.0%	55.0%	None Detected	

Client Sample ID: A-53-Bas-A **Lab Sample ID:** 042504124-0022

Sample Description: FS 75-76, 64-65/Ceiling_Tile - 2x2 White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan/White	70.0%	30.0%	None Detected	

Client Sample ID: A-53-Bas-B **Lab Sample ID:** 042504124-0023

Sample Description: FS 75-76, 64-65/Ceiling_Tile - 2x2 White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan/White	70.0%	30.0%	None Detected	

Client Sample ID: A-53-Bas-C **Lab Sample ID:** 042504124-0024

Sample Description: FS 75-76, 64-65/Ceiling_Tile - 2x2 White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan/White	70.0%	30.0%	None Detected	

Client Sample ID: A-54-Bas-A **Lab Sample ID:** 042504124-0025

Sample Description: FS 69, 78/Gasket_Material - Pipe Valve

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Gray/Black	<1%	20.0%	80% Chrysotile	

Client Sample ID: A-54-Bas-B **Lab Sample ID:** 042504124-0026

Sample Description: FS 69, 78/Gasket_Material - Pipe Valve

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-54-Bas-C **Lab Sample ID:** 042504124-0027

Sample Description: FS 69, 78/Gasket_Material - Pipe Valve

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-55-Bas-A **Lab Sample ID:** 042504124-0028

Sample Description: FS 73/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Black	10.0%	10.0%	80% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-55-Bas-B **Lab Sample ID:** 042504124-0029
Sample Description: FS 73/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-55-Bas-C **Lab Sample ID:** 042504124-0030
Sample Description: FS 73/Vibration_Dampener - Woven, Coarse Textile, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-56-Bas-A-Block **Lab Sample ID:** 042504124-0031
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-56-Bas-A-Mortar **Lab Sample ID:** 042504124-0031A
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-56-Bas-B-Block **Lab Sample ID:** 042504124-0032
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-56-Bas-B-Mortar **Lab Sample ID:** 042504124-0032A
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-56-Bas-C-Block **Lab Sample ID:** 042504124-0033
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-56-Bas-C-Mortar **Lab Sample ID:** 042504124-0033A
Sample Description: FS 7, 58/Glass_Block - Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-57-Bas-A **Lab Sample ID:** 042504124-0034

Sample Description: FS 7/Construction_Adhesive - Brown on White Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Green/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-57-Bas-B **Lab Sample ID:** 042504124-0035

Sample Description: FS 7/Construction_Adhesive - Brown on White Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Green/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-57-Bas-C **Lab Sample ID:** 042504124-0036

Sample Description: FS 7/Construction_Adhesive - Brown on White Panels

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Green	<1%	100.0%	None Detected	

Client Sample ID: A-58-Bas-A **Lab Sample ID:** 042504124-0037

Sample Description: FS 46/Flooring - 18 x 18 Gray Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-58-Bas-B **Lab Sample ID:** 042504124-0038

Sample Description: FS 46/Flooring - 18 x 18 Gray Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-58-Bas-C **Lab Sample ID:** 042504124-0039

Sample Description: FS 46/Flooring - 18 x 18 Gray Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-59-Bas-A **Lab Sample ID:** 042504124-0040

Sample Description: FLM/Flooring - Black Dot Pattern Floor Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Black/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-59-Bas-B **Lab Sample ID:** 042504124-0041

Sample Description: FLM/Flooring - Black Dot Pattern Floor Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Black/Beige	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-59-Bas-C **Lab Sample ID:** 042504124-0042

Sample Description: FLM/Flooring - Black Dot Pattern Floor Sheeting

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Black/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-60-Bas-A **Lab Sample ID:** 042504124-0043

Sample Description: FS 51/Insulator - Elevator Control Insulator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	15.0%	25.0%	60% Chrysotile	

Client Sample ID: A-60-Bas-B **Lab Sample ID:** 042504124-0044

Sample Description: FS 51/Insulator - Elevator Control Insulator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-60-Bas-C **Lab Sample ID:** 042504124-0045

Sample Description: FS 51/Insulator - Elevator Control Insulator

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-61-Bas-A **Lab Sample ID:** 042504124-0046

Sample Description: FS 52/Metal Pan Ceiling Insulatio - Ceiling with 2x2 Metal Panels with Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Yellow	98.0%	2.0%	None Detected	

Client Sample ID: A-61-Bas-B **Lab Sample ID:** 042504124-0047

Sample Description: FS 52/Metal Pan Ceiling Insulatio - Ceiling with 2x2 Metal Panels with Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Yellow	98.0%	2.0%	None Detected	

Client Sample ID: A-61-Bas-C **Lab Sample ID:** 042504124-0048

Sample Description: FS 52/Metal Pan Ceiling Insulatio - Ceiling with 2x2 Metal Panels with Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan/Yellow	98.0%	2.0%	None Detected	

Client Sample ID: A-62-Bas-A **Lab Sample ID:** 042504124-0049

Sample Description: FS 69/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White	40.0%	20.0%	40% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-62-Bas-B **Lab Sample ID:** 042504124-0050
Sample Description: FS 69/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-62-Bas-C **Lab Sample ID:** 042504124-0051
Sample Description: FS 69/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-63-Bas-A **Lab Sample ID:** 042504124-0052
Sample Description: FS 69/Duct_Insulation - Fibrous Paper on Air Handler

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	95.0%	5.0%	None Detected	

Client Sample ID: A-63-Bas-B **Lab Sample ID:** 042504124-0053
Sample Description: FS 69/Duct_Insulation - Fibrous Paper on Air Handler

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	95.0%	5.0%	None Detected	

Client Sample ID: A-63-Bas-C **Lab Sample ID:** 042504124-0054
Sample Description: FS 69/Duct_Insulation - Fibrous Paper on Air Handler

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Yellow	95.0%	5.0%	None Detected	

Client Sample ID: A-64-Bas-A **Lab Sample ID:** 042504124-0055
Sample Description: FS 69/Cork Ceiling Tile with Mastic - Break Room Ceiling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/White/Black	0.0%	95.0%	5% Chrysotile	inseperable

Client Sample ID: A-64-Bas-B **Lab Sample ID:** 042504124-0056
Sample Description: FS 69/Cork Ceiling Tile with Mastic - Break Room Ceiling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-64-Bas-C **Lab Sample ID:** 042504124-0057
Sample Description: FS 69/Cork Ceiling Tile with Mastic - Break Room Ceiling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-65-Bas-A **Lab Sample ID:** 042504124-0058

Sample Description: FS 60/Window_Glaze - Wood Framed Fixed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/White/Beige	<1%	97.0%	3% Chrysotile	

Client Sample ID: A-65-Bas-B **Lab Sample ID:** 042504124-0059

Sample Description: FS 60/Window_Glaze - Wood Framed Fixed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-65-Bas-C **Lab Sample ID:** 042504124-0060

Sample Description: FS 60/Window_Glaze - Wood Framed Fixed Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-66-Bas-A-Floor Tile **Lab Sample ID:** 042504124-0061

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Mastic, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Tan	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-66-Bas-A-Mastic **Lab Sample ID:** 042504124-0061A

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Mastic, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-66-Bas-B **Lab Sample ID:** 042504124-0062

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Mastic, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-66-Bas-C **Lab Sample ID:** 042504124-0063

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Mastic, White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-67-Bas-A **Lab Sample ID:** 042504124-0064

Sample Description: FS 1-80/Pipe_Insulation - 1" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Blue/Beige	20.0%	20.0%	60% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-67-Bas-B **Lab Sample ID:** 042504124-0065
Sample Description: FS 1-80/Pipe_Insulation - 1" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-67-Bas-C **Lab Sample ID:** 042504124-0066
Sample Description: FS 1-80/Pipe_Insulation - 1" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-68-Bas-A **Lab Sample ID:** 042504124-0067
Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	32.0%	60.0%	8% Chrysotile	

Client Sample ID: A-68-Bas-B **Lab Sample ID:** 042504124-0068
Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-68-Bas-C **Lab Sample ID:** 042504124-0069
Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-69-Bas-A **Lab Sample ID:** 042504124-0070
Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Blue/Beige	20.0%	20.0%	60% Chrysotile	

Client Sample ID: A-69-Bas-B **Lab Sample ID:** 042504124-0071
Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-69-Bas-C **Lab Sample ID:** 042504124-0072
Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-70-Bas-A **Lab Sample ID:** 042504124-0073

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Beige	32.0%	60.0%	8% Chrysotile	

Client Sample ID: A-70-Bas-B **Lab Sample ID:** 042504124-0074

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-70-Bas-C **Lab Sample ID:** 042504124-0075

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-71-Bas-A **Lab Sample ID:** 042504124-0076

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Blue/Beige	20.0%	20.0%	60% Chrysotile	

Client Sample ID: A-71-Bas-B **Lab Sample ID:** 042504124-0077

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-71-Bas-C **Lab Sample ID:** 042504124-0078

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-72-Bas-A **Lab Sample ID:** 042504124-0079

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-72-Bas-B **Lab Sample ID:** 042504124-0080

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-72-Bas-C **Lab Sample ID:** 042504124-0081

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-73-Bas-A **Lab Sample ID:** 042504124-0082

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Blue/Beige	20.0%	20.0%	60% Chrysotile	

Client Sample ID: A-73-Bas-B **Lab Sample ID:** 042504124-0083

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-73-Bas-C **Lab Sample ID:** 042504124-0084

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-74-Bas-A **Lab Sample ID:** 042504124-0085

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-74-Bas-B **Lab Sample ID:** 042504124-0086

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-74-Bas-C **Lab Sample ID:** 042504124-0087

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-75-Bas-A **Lab Sample ID:** 042504124-0088

Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Blue/Beige	20.0%	20.0%	60% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-75-Bas-B **Lab Sample ID:** 042504124-0089
Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-75-Bas-C **Lab Sample ID:** 042504124-0090
Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-76-Bas-A **Lab Sample ID:** 042504124-0091
Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-76-Bas-B **Lab Sample ID:** 042504124-0092
Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-76-Bas-C **Lab Sample ID:** 042504124-0093
Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-77-Bas-A **Lab Sample ID:** 042504124-0094
Sample Description: FS 1-80/Pipe_Insulation - 2" Fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-77-Bas-B **Lab Sample ID:** 042504124-0095
Sample Description: FS 1-80/Pipe_Insulation - 2" Fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-77-Bas-C **Lab Sample ID:** 042504124-0096
Sample Description: FS 1-80/Pipe_Insulation - 2" Fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-78-Bas-A **Lab Sample ID:** 042504124-0097

Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-78-Bas-B **Lab Sample ID:** 042504124-0098

Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-78-Bas-C **Lab Sample ID:** 042504124-0099

Sample Description: FS 1-80/Pipe_Fitting - 2" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-79-Bas-A **Lab Sample ID:** 042504124-0100

Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-79-Bas-B **Lab Sample ID:** 042504124-0101

Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-79-Bas-C **Lab Sample ID:** 042504124-0102

Sample Description: FS 1-80/Pipe_Insulation - 4" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-80-Bas-A **Lab Sample ID:** 042504124-0103

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-80-Bas-B **Lab Sample ID:** 042504124-0104

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-80-Bas-C **Lab Sample ID:** 042504124-0105

Sample Description: FS 1-80/Pipe_Fitting - 4" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	30.0%	65.0%	5% Chrysotile	

Client Sample ID: A-81-Bas-A **Lab Sample ID:** 042504124-0106

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-81-Bas-B **Lab Sample ID:** 042504124-0107

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-81-Bas-C **Lab Sample ID:** 042504124-0108

Sample Description: FS 1-80/Pipe_Insulation - 6" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-82-Bas-A **Lab Sample ID:** 042504124-0109

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	22.0%	70.0%	8% Chrysotile	

Client Sample ID: A-82-Bas-B **Lab Sample ID:** 042504124-0110

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-82-Bas-C **Lab Sample ID:** 042504124-0111

Sample Description: FS 1-80/Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-83-Bas-A **Lab Sample ID:** 042504124-0112

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Silver/Yellow/Beige	85.0%	15.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-83-Bas-B **Lab Sample ID:** 042504124-0113

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: A-83-Bas-C **Lab Sample ID:** 042504124-0114

Sample Description: FS 1-80/Pipe_Insulation - 8" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Silver/Yellow/Beige	85.0%	15.0%	None Detected	

Client Sample ID: A-84-Bas-A **Lab Sample ID:** 042504124-0115

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-84-Bas-B **Lab Sample ID:** 042504124-0116

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-84-Bas-C **Lab Sample ID:** 042504124-0117

Sample Description: FS 1-80/Pipe_Fitting - 8" Air Cell SRPI on Mudded Elbows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
400 PLM Pt Ct	3/11/2025	Gray/Tan	0.0%	100.0%	<0.25% Chrysotile	

Client Sample ID: A-85-Bas-A **Lab Sample ID:** 042504124-0118

Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Silver/Yellow	80.0%	20.0%	None Detected	

Client Sample ID: A-85-Bas-B **Lab Sample ID:** 042504124-0119

Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Silver/Yellow/Beige	85.0%	15.0%	None Detected	

Client Sample ID: A-85-Bas-C **Lab Sample ID:** 042504124-0120

Sample Description: FS 1-80/Pipe_Insulation - 12" Air Cell SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Silver/Yellow/Beige	85.0%	15.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-86-Bas-A **Lab Sample ID:** 042504124-0121

Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray	45.0%	50.0%	5% Chrysotile	

Client Sample ID: A-86-Bas-B **Lab Sample ID:** 042504124-0122

Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-86-Bas-C **Lab Sample ID:** 042504124-0123

Sample Description: FS 1-80/Pipe_Fitting - 12" Air Cell on SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-87-Bas-A **Lab Sample ID:** 042504124-0124

Sample Description: FS 1-80/Pipe_Insulation - Duplex

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan/Black	96.0%	4.0%	None Detected	

Client Sample ID: A-87-Bas-B **Lab Sample ID:** 042504124-0125

Sample Description: FS 1-80/Pipe_Insulation - Duplex

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan/Black	96.0%	4.0%	None Detected	

Client Sample ID: A-87-Bas-C **Lab Sample ID:** 042504124-0126

Sample Description: FS 1-80/Pipe_Insulation - Duplex

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Brown/Tan/Black	96.0%	4.0%	None Detected	

Client Sample ID: A-88-Bas-A **Lab Sample ID:** 042504124-0127

Sample Description: FS 1-80/Pipe_Insulation - 8" Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	White	5.0%	40.0%	15% Amosite 40% Chrysotile	

Client Sample ID: A-88-Bas-B **Lab Sample ID:** 042504124-0128

Sample Description: FS 1-80/Pipe_Insulation - 8" Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504124
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-88-Bas-C

Lab Sample ID: 042504124-0129

Sample Description: FS 1-80/Pipe_Insulation - 8" Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-89-Bas-A

Lab Sample ID: 042504124-0130

Sample Description: FS 1-80/Pipe_Fitting - 8" Mag on Mudded Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025	Gray/Beige	5.0%	55.0%	40% Chrysotile	

Client Sample ID: A-89-Bas-B

Lab Sample ID: 042504124-0131

Sample Description: FS 1-80/Pipe_Fitting - 8" Mag on Mudded Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-89-Bas-C

Lab Sample ID: 042504124-0132

Sample Description: FS 1-80/Pipe_Fitting - 8" Mag on Mudded Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/11/2025					Positive Stop (Not Analyzed)

Analyst(s):

Cameron Evans 400 PLM Pt Ct (1)
Jurnee West PLM (24)
400 PLM Pt Ct (7)
Nicole MacDowell PLM (71)
400 PLM Pt Ct (12)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Kernersville, NC NVLAP Lab Code 102104-0, Virginia 3333-000228, West Virginia LT000321

Initial report from: 03/11/2025 15:31:59



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042504124

PHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75			
	Company Name:	Egis		Company Name:	Egis			
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones			
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street			
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:	USA
	Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com				
Project Information								
Project Name/No:				IC-004 - 540 Tyler (Basement)		Purchase Order:	240100-RCA Program	
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected:	MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Sampled By Signature:		Date Sample	3/4/2025	No. of Samples	132	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285999985156

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-46-Bas - A, B, C	FLM	FS 38	Flooring - 9X9 Floor Tile with Mastic- Beige with Green and White Circles
A-47-Bas - A, B, C	CP	FS 39,53,	Ceiling_Panel - 1x1 White with Indentionsand Glue Pods
A-48-Bas - A, B, C	FLM	FS 39	Flooring - 12X12 Floor Tile with Mastic- White with Dot pattern
A-49-Bas - A, B, C	#N/A	FS 41,53,53,58,62,64-65,	Ceramic_Tile_with_Glue and Grout - Walls, 2"x2" Yellow
A-50-Bas - A, B, C	#N/A	FS 41	Ceramic_Tile_with_Grout and Mortar - Walls, 2"x4" Dark Red and Beige
A-51-Bas - A, B, C	CC	FS 43	Concrete - Foundation Wall
A-52-Bas - A, B, C	FLM	FS 43,58	Flooring - Linoleum with Paper Backing
A-53-Bas - A, B, C	CT	FS 75-76,64-65,	Ceiling_Tile - 2x2, White with Indentions

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Kernersville, NC		Sample Condition Upon Receipt:	
Relinquished by:	<i>[Signature]</i>	Date/Time:	3-4-25 / 1800	Received by:	<i>[Signature]</i>
Relinquished by:		Date/Time:		Received by:	

2859 9998 5156



EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

#042504124

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
A-54-Bas - A, B, C	GM	FS 69,78,	Gasket_Material - Pipe Valve
A-55-Bas - A, B, C	VD	FS 73	Vibration_Dampener - Woven, Coarse Textile, White
A-56-Bas - A, B, C	GB	FS 7,58	Glass_Block - Mortar
A-57-Bas - A, B, C	CA	FS 7	Construction_Adhesive - Brown on White Panels
A-58-Bas - A, B, C	FLM	FS 46	Flooring - 18 x 18 Gray Squares
A-59-Bas - A, B, C	FLM	FS 47	Flooring - Black Dot Pattern floor sheeting
A-60-Bas - A, B, C	IB	FS 51	Insulator - Elevator Control Insulator
A-61-Bas - A, B, C	#N/A	FS 52	Metal Pan Ceiling Insulation - Ceiling with 2x2 metal panels with Dots
A-62-Bas - A, B, C	FP	FS 69	Fire_Proofing - Spray Applied
A-63-Bas - A, B, C	DI	FS 69	Duct_Insulation - Fibrous Paper on Air Handler
A-64-Bas - A, B, C	#N/A	FS 66	Cork Ceiling Tile with Madtic - Break room Ceiling
A-65-Bas - A, B, C	WG	FS 60	Window_Glaze - Wood Framed Fixed Windows
A-66-Bas - A, B, C	FLM	FS 6	Flooring - 12X12 Floor Tile with Mastic, White
A-67-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 2" Air Cell SRPI
A-68-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 2" Air Cell SRPI on Mudded Ekboes
A-69-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 4" Air Cell SRPI
A-70-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 4" Air Cell SEPI on Mudded Elboes
A-71-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 6" Air Cell SRPI
A-72-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 6" Air Cell SRPI on Mudded Elbows
A-73-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 8" Air Cell SRPI
A-74-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 8" Air Cell on Mudded Elbows
A-75-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 12" Air Cell SRPI
A-76-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 12" Air Cepp on SRPI
A-77-Bas - A, B, C	PI	FS 1-80	Pipe_Insulation - 2" Fiberglass SRPI
A-78-Bas - A, B, C	PF	FS 1-80	Pipe_Fitting - 2" Air Cell SRPI on Mudded Ekboes

Method of Shipment:

Relinquished by:

Relinquished by:

Date/Time:

Date/Time:

Sample Condition Upon Receipt:

Received by:

Received by:

Date/Time:

Date/Time:

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#0 4 2 5 0 4 1 2 4

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

IC-004 - 540 Tyler (Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:		Sample Condition Upon Receipt:	
Requisitioned by: 	Date/Time: 3-4-25 1800	Received by:	Date/Time:
Requisitioned by:	Date/Time:	Received by:	Date/Time:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/ 5/2025
Received: 3/07/2025
Analyzed: 3/13/2025

Proj: IC-004 - 540 Tyler (1st Floor)

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-90-A-Skim Coat **Lab Sample ID:** 042504237-0001

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-A-White Base Coat **Lab Sample ID:** 042504237-0001A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-A-Gray Base Coat **Lab Sample ID:** 042504237-0001B

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-B-Skim Coat **Lab Sample ID:** 042504237-0002

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-B-Base Coat **Lab Sample ID:** 042504237-0002A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-C-Skim Coat **Lab Sample ID:** 042504237-0003

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-C-White Base Coat **Lab Sample ID:** 042504237-0003A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-90-C-Gray Base Coat **Lab Sample ID:** 042504237-0003B

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-D-Skim Coat **Lab Sample ID:** 042504237-0004

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-D-White Base Coat **Lab Sample ID:** 042504237-0004A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-D-Gray Base Coat **Lab Sample ID:** 042504237-0004B

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-E-Skim Coat **Lab Sample ID:** 042504237-0005

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-E-White Base Coat **Lab Sample ID:** 042504237-0005A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/White	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-E-Gray Base Coat **Lab Sample ID:** 042504237-0005B

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-F-Skim Coat **Lab Sample ID:** 042504237-0006

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-90-F-Base Coat **Lab Sample ID:** 042504237-0006A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-G-Skim Coat **Lab Sample ID:** 042504237-0007

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-90-G-White Base Coat **Lab Sample ID:** 042504237-0007A

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/White	<1%	100.0%	None Detected	

Client Sample ID: A-1-90-G-Gray Base Coat **Lab Sample ID:** 042504237-0007B

Sample Description: FS 84-127/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-91-A-Skim Coat **Lab Sample ID:** 042504237-0008

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-91-A-Base Coat **Lab Sample ID:** 042504237-0008A

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-91-A-Wallboard **Lab Sample ID:** 042504237-0008B

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Beige	10.0%	90.0%	None Detected	

Client Sample ID: A-1-91-B-Skim Coat **Lab Sample ID:** 042504237-0009

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-91-B-Base Coat **Lab Sample ID:** 042504237-0009A

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-91-B-Wallboard **Lab Sample ID:** 042504237-0009B

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Beige	5.0%	95.0%	None Detected	

Client Sample ID: A-1-91-C-Skim Coat **Lab Sample ID:** 042504237-0010

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-91-C-Base Coat **Lab Sample ID:** 042504237-0010A

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-91-C-Wallboard **Lab Sample ID:** 042504237-0010B

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown/Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-1-91-D **Lab Sample ID:** 042504237-0011

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Not Submitted	

Client Sample ID: A-1-91-E **Lab Sample ID:** 042504237-0012

Sample Description: FS 83,93,99-100,119-121,183/Plaster over Wallboard - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Not Submitted	

Client Sample ID: A-1-92-A-Flooring **Lab Sample ID:** 042504237-0013

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Blue	13.0%	87.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-92-A-Mastic **Lab Sample ID:** 042504237-0013A

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-92-B-Flooring **Lab Sample ID:** 042504237-0014

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Blue	12.0%	88.0%	None Detected	

Client Sample ID: A-1-92-B-Mastic **Lab Sample ID:** 042504237-0014A

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-92-C-Flooring **Lab Sample ID:** 042504237-0015

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Tan/Green	6.0%	94.0%	None Detected	

Client Sample ID: A-1-92-C-Mastic **Lab Sample ID:** 042504237-0015A

Sample Description: FS 83-84/Flooring - Linoleum with Paper Backing - Blue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow/Beige	1.0%	99.0%	None Detected	

Client Sample ID: A-1-93-A **Lab Sample ID:** 042504237-0016

Sample Description: FS 127/Construction_Adhesive - Yellow on Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-93-B **Lab Sample ID:** 042504237-0017

Sample Description: FS 127/Construction_Adhesive - Yellow on Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-93-C **Lab Sample ID:** 042504237-0018

Sample Description: FS 127/Construction_Adhesive - Yellow on Paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Tan/Yellow	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-94-A **Lab Sample ID:** 042504237-0019

Sample Description: FS 95,111-119-125,132-134,136,158,161-163,173,178,183/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-94-B **Lab Sample ID:** 042504237-0020

Sample Description: FS 95,111-119-125,132-134,136,158,161-163,173,178,183/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-94-C **Lab Sample ID:** 042504237-0021

Sample Description: FS 95,111-119-125,132-134,136,158,161-163,173,178,183/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Tan/Gold	1.0%	99.0%	None Detected	

Client Sample ID: A-1-95-A-Ceramic Tile **Lab Sample ID:** 042504237-0022

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Blue	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-A-Grout **Lab Sample ID:** 042504237-0022A

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-A-Glue **Lab Sample ID:** 042504237-0022B

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-B-Ceramic Tile **Lab Sample ID:** 042504237-0023

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Blue	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-B-Glue **Lab Sample ID:** 042504237-0023A

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-95-C-Ceramic Tile **Lab Sample ID:** 042504237-0024

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White/Green	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-C-Grout **Lab Sample ID:** 042504237-0024A

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-1-95-C-Glue **Lab Sample ID:** 042504237-0024B

Sample Description: FS 83,87,102/Ceramic_Tile_with_Glue - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown	<1%	100.0%	None Detected	

Client Sample ID: A-1-96-A-Cove Base **Lab Sample ID:** 042504237-0025

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-96-A-Adhesive **Lab Sample ID:** 042504237-0025A

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan/Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-1-96-B-Cove Base **Lab Sample ID:** 042504237-0026

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-96-B-Adhesive **Lab Sample ID:** 042504237-0026A

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan/Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-1-96-C-Cove Base **Lab Sample ID:** 042504237-0027

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Tan/White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-96-C-Adhesive **Lab Sample ID:** 042504237-0027A

Sample Description: FS 96 119-125/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-97-A-Floor Tile **Lab Sample ID:** 042504237-0028

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-97-A-Glue **Lab Sample ID:** 042504237-0028A

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-97-B-Floor Tile **Lab Sample ID:** 042504237-0029

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-97-B-Glue **Lab Sample ID:** 042504237-0029A

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	1.0%	99.0%	None Detected	

Client Sample ID: A-1-97-C-Floor Tile **Lab Sample ID:** 042504237-0030

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-97-C-Glue **Lab Sample ID:** 042504237-0030A

Sample Description: FS 88-89/Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow/Beige	1.0%	99.0%	None Detected	

Client Sample ID: A-1-98-A-Floor Tile **Lab Sample ID:** 042504237-0031

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-98-A-Mastic **Lab Sample ID:** 042504237-0031A

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Black	2.0%	98.0%	None Detected	

Client Sample ID: A-1-98-B-Floor Tile **Lab Sample ID:** 042504237-0032

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-98-B-Mastic **Lab Sample ID:** 042504237-0032A

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Black	3.0%	97.0%	None Detected	

Client Sample ID: A-1-98-C-Floor Tile **Lab Sample ID:** 042504237-0033

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Tan/White/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-1-98-C-Mastic **Lab Sample ID:** 042504237-0033A

Sample Description: FS 89-90,164-174,155-157,159/Flooring - 12X12 Floor Tile with Mastic - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Black	3.0%	97.0%	None Detected	

Client Sample ID: A-1-99-A-Flooring **Lab Sample ID:** 042504237-0034

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan/Pink	12.0%	88.0%	None Detected	

Client Sample ID: A-1-99-A-Mastic **Lab Sample ID:** 042504237-0034A

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-99-B-Flooring **Lab Sample ID:** 042504237-0035

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan/Pink	12.0%	88.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-99-B-Mastic **Lab Sample ID:** 042504237-0035A

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Yellow	<1%	100.0%	None Detected	

Client Sample ID: A-1-99-C-Flooring **Lab Sample ID:** 042504237-0036

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray/Pink/Beige	6.0%	94.0%	None Detected	

Client Sample ID: A-1-99-C-Mastic **Lab Sample ID:** 042504237-0036A

Sample Description: FS 91-92/Flooring - Linoleum with Paper Backing - Tan

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow/Beige	1.0%	99.0%	None Detected	

Client Sample ID: A-1-100-A-Ceramic Tile **Lab Sample ID:** 042504237-0037

Sample Description: FS 93/Ceramic_Tile_with_Grout and Adhesive - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-100-A-Grout **Lab Sample ID:** 042504237-0037A

Sample Description: FS 93/Ceramic_Tile_with_Grout and Adhesive - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-100-A-Adhesive **Lab Sample ID:** 042504237-0037B

Sample Description: FS 93/Ceramic_Tile_with_Grout and Adhesive - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Black	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-1-100-B **Lab Sample ID:** 042504237-0038

Sample Description: FS 93/Ceramic_Tile_with_Grout and Adhesive - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-1-100-C **Lab Sample ID:** 042504237-0039

Sample Description: FS 93/Ceramic_Tile_with_Grout and Adhesive - Bathroom Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-101-A **Lab Sample ID:** 042504237-0040

Sample Description: FS 82/Marble Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-101-B **Lab Sample ID:** 042504237-0041

Sample Description: FS 82/Marble Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-101-C **Lab Sample ID:** 042504237-0042

Sample Description: FS 82/Marble Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-1-102-A **Lab Sample ID:** 042504237-0043

Sample Description: FS 184/Marble Grout - Stairway Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan/Black	<1%	100.0%	None Detected	

Client Sample ID: A-1-102-B **Lab Sample ID:** 042504237-0044

Sample Description: FS 184/Marble Grout - Stairway Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan/Black	<1%	100.0%	None Detected	

Client Sample ID: A-1-102-C **Lab Sample ID:** 042504237-0045

Sample Description: FS 184/Marble Grout - Stairway Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan/Black	<1%	100.0%	None Detected	

Client Sample ID: A-1-103-A **Lab Sample ID:** 042504237-0046

Sample Description: FS 128/Ceiling_Panel - 2X2, White with Bumpy Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	71.0%	29.0%	None Detected	

Client Sample ID: A-1-103-B **Lab Sample ID:** 042504237-0047

Sample Description: FS 128/Ceiling_Panel - 2X2, White with Bumpy Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	71.0%	29.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-103-C **Lab Sample ID:** 042504237-0048

Sample Description: FS 128/Ceiling_Panel - 2X2, White with Bumpy Pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	71.0%	29.0%	None Detected	

Client Sample ID: A-1-104-A-Ceramic Tile **Lab Sample ID:** 042504237-0049

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-A-Grout **Lab Sample ID:** 042504237-0049A

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-A-Thinset **Lab Sample ID:** 042504237-0049B

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-B-Ceramic Tile **Lab Sample ID:** 042504237-0050

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-B-Grout **Lab Sample ID:** 042504237-0050A

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-B-Thinset **Lab Sample ID:** 042504237-0050B

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-1-104-C-Ceramic Tile **Lab Sample ID:** 042504237-0051

Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan/White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-104-C-Grout			Lab Sample ID: 042504237-0051A			
Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	
Client Sample ID: A-1-104-C-Thinset			Lab Sample ID: 042504237-0051B			
Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	0.0%	100.0%	None Detected	
Client Sample ID: A-1-104-C-Skim Coat			Lab Sample ID: 042504237-0051C			
Sample Description: FS 129-130-145,147-148,160/Construction_Adhesive , Grout on Ceramic Tile - Wall Foundations						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	
Client Sample ID: A-1-105-A			Lab Sample ID: 042504237-0052			
Sample Description: FS 145/Flooring - Linoleum with Paper Backing - Red Brick Pattern						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray/Orange	1.0%	69.0%	30% Chrysotile	
Client Sample ID: A-1-105-B			Lab Sample ID: 042504237-0053			
Sample Description: FS 145/Flooring - Linoleum with Paper Backing - Red Brick Pattern						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Positive Stop (Not Analyzed)	
Client Sample ID: A-1-105-C			Lab Sample ID: 042504237-0054			
Sample Description: FS 145/Flooring - Linoleum with Paper Backing - Red Brick Pattern						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025				Positive Stop (Not Analyzed)	
Client Sample ID: A-1-106-A-Floor Tile			Lab Sample ID: 042504237-0055			
Sample Description: FS 137/Flooring - 9X9 Floor Tile with Mastic - Brown						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan/Beige	0.0%	95.0%	5% Chrysotile	
Client Sample ID: A-1-106-A-Mastic			Lab Sample ID: 042504237-0055A			
Sample Description: FS 137/Flooring - 9X9 Floor Tile with Mastic - Brown						
TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Black	3.0%	97.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-106-B **Lab Sample ID:** 042504237-0056

Sample Description: FS 137/Flooring - 9X9 Floor Tile with Mastic - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-1-106-C **Lab Sample ID:** 042504237-0057

Sample Description: FS 137/Flooring - 9X9 Floor Tile with Mastic - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-1-107-A-Ceramic Tile **Lab Sample ID:** 042504237-0058

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-107-A-Grout **Lab Sample ID:** 042504237-0058A

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-107-B-Ceramic Tile **Lab Sample ID:** 042504237-0059

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-107-B-Grout **Lab Sample ID:** 042504237-0059A

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan	<1%	100.0%	None Detected	

Client Sample ID: A-1-107-C-Ceramic Tile **Lab Sample ID:** 042504237-0060

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-1-107-C-Grout **Lab Sample ID:** 042504237-0060A

Sample Description: FS 176/Ceramic_Tile_with_Grout - Bathroom Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/Tan	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-108-A **Lab Sample ID:** 042504237-0061

Sample Description: FS 176/Interior_Caulk - Around Bathroom Door Divider

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Green/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-1-108-B **Lab Sample ID:** 042504237-0062

Sample Description: FS 176/Interior_Caulk - Around Bathroom Door Divider

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Green/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-1-108-C **Lab Sample ID:** 042504237-0063

Sample Description: FS 176/Interior_Caulk - Around Bathroom Door Divider

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White/Green/Beige	<1%	100.0%	None Detected	

Client Sample ID: A-1-109-A **Lab Sample ID:** 042504237-0064

Sample Description: FS 164-174/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Gray/White	66.0%	14.0%	20% Chrysotile	

Client Sample ID: A-1-109-B **Lab Sample ID:** 042504237-0065

Sample Description: FS 164-174/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-1-109-C **Lab Sample ID:** 042504237-0066

Sample Description: FS 164-174/Fire_Proofing - Spray Applied

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-1-110-A-Mud **Lab Sample ID:** 042504237-0067

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	1.0%	99.0%	None Detected	

Client Sample ID: A-1-110-A-Tape **Lab Sample ID:** 042504237-0067A

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Beige	100.0%	0.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-110-A-Wallboard **Lab Sample ID:** 042504237-0067B

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray	16.0%	84.0%	None Detected	

Client Sample ID: A-1-110-B-Mud **Lab Sample ID:** 042504237-0068

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	1.0%	99.0%	None Detected	

Client Sample ID: A-1-110-B-Tape **Lab Sample ID:** 042504237-0068A

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Beige	100.0%	0.0%	None Detected	

Client Sample ID: A-1-110-B-Wallboard **Lab Sample ID:** 042504237-0068B

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray	16.0%	84.0%	None Detected	

Client Sample ID: A-1-110-C-Mud **Lab Sample ID:** 042504237-0069

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	1.0%	99.0%	None Detected	

Client Sample ID: A-1-110-C-Tape **Lab Sample ID:** 042504237-0069A

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Beige	100.0%	0.0%	None Detected	

Client Sample ID: A-1-110-C-Wallboard **Lab Sample ID:** 042504237-0069B

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray	11.0%	89.0%	None Detected	

Client Sample ID: A-1-110-D-Mud **Lab Sample ID:** 042504237-0070

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	<1%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504237
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-1-110-D-Tape **Lab Sample ID:** 042504237-0070A

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	100.0%	0.0%	None Detected	

Client Sample ID: A-1-110-D-Wallboard **Lab Sample ID:** 042504237-0070B

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-1-110-E-Mud **Lab Sample ID:** 042504237-0071

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	White	1.0%	99.0%	None Detected	

Client Sample ID: A-1-110-E-Tape **Lab Sample ID:** 042504237-0071A

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Tan	100.0%	0.0%	None Detected	

Client Sample ID: A-1-110-E-Wallboard **Lab Sample ID:** 042504237-0071B

Sample Description: FS 82, 158/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/12/2025	Brown/Gray	10.0%	90.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042504237
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Jurnee West PLM (65)
Scott Combs PLM (57)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Kernersville, NC NVLAP Lab Code 102104-0, Virginia 3333-000228, West Virginia LT000321

Initial report from: 03/13/2025 10:48:35



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

 EMSL Analytical, Inc.
 200 Route 130 North
 Cinnaminson, NJ 08077

 EMSL ANALYTICAL, INC.
 TESTING LABS • PRODUCTS • TRAINING

#042504237

 PHONE: (800) 220-3675
 EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75			
	Company Name:	Egis		Company Name:	Egis			
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones			
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street			
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:	USA
	Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
	Project Information							
Project Name/No:				IC-004 - 540 Tyler (1st Floor)		Purchase Order:	240100-RCA Program	
EMSL LIMS Project ID: (if applicable, EMSL will provide)				US State where samples collected:	MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Sampled By Signature:		Date Sample	3/5/2025	No. of Samples	72	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

 Point Count all samples ≤1% asbestos
 Point Count NOB material samples ≤1% asbestos by PLM EPA
 NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 28599984458

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-1-90 - A, B, C, D, E, F, G	PL	FS 84-127	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh
A-1-91 - A, B, C, D, E		FS 83,93,99-100,119-121,183	Plaster over Wallboard - Interior Walls
A-1-92 - A, B, C	FLM	FS 83-84	Flooring - Linoleum with Paper Backing- Blue
A-1-93 - A, B, C	CA	FS 127	Construction Adhesive - Yellow on paneling
A-1-94 - A, B, C	FLM	FS 95, 111- 119- 125,132-134,136,158,161-163,173,178,183,	Flooring - Carpet Glue Yellow
A-1-95 - A, B, C		FS 83,87,102	Ceramic Tile with Glue - Interior Walls
A-1-96 - A, B, C	CB	FS 96 119-125,	Cove Base - with Adhesive
A-1-97 - A, B, C	FLM	FS 88-89	Flooring - 12X12 Floor Tile with Glue, White with Gray Speckles

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Kernersville, NC		Sample Condition Upon Receipt:	
Relinquished by:	<i>[Signature]</i>	Date/Time:	3-5-25 18 ⁰⁰	Received by:	<i>[Signature]</i>
Relinquished by:		Date/Time:		Received by:	

2859 9998 4458

EMSL Order Number / Lab Use Only

#042504237

2



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/ 7/2025
Received: 3/11/2025
Analyzed: 3/17/2025

Proj: IC-004 - 540 Tyler (2nd Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-111-A-Skim Coat **Lab Sample ID:** 042504459-0001

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-A-Base Coat **Lab Sample ID:** 042504459-0001A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-B-Skim Coat **Lab Sample ID:** 042504459-0002

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-B-Rough Coat **Lab Sample ID:** 042504459-0002A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-C-Skim Coat **Lab Sample ID:** 042504459-0003

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-C-Rough Coat **Lab Sample ID:** 042504459-0003A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-D-Skim Coat **Lab Sample ID:** 042504459-0004

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-111-D-Rough Coat **Lab Sample ID:** 042504459-0004A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-E-Skim Coat **Lab Sample ID:** 042504459-0005

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-E-Rough Coat **Lab Sample ID:** 042504459-0005A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-F-Skim Coat **Lab Sample ID:** 042504459-0006

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	White	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-F-Rough Coat **Lab Sample ID:** 042504459-0006A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-111-G-Skim Coat **Lab Sample ID:** 042504459-0007

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-111-G-Rough Coat **Lab Sample ID:** 042504459-0007A

Sample Description: FS 186-262/Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	<1%	100.0%	None Detected	

Client Sample ID: A-2-112-A-Linoleum **Lab Sample ID:** 042504459-0008

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray/Tan	5.0%	70.0%	25% Chrysotile	Inseparable mastic included in analysis.



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-112-A-Tar Paper **Lab Sample ID:** 042504459-0008A

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Black	80.0%	20.0%	None Detected	

Client Sample ID: A-2-112-B-Linoleum **Lab Sample ID:** 042504459-0009

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-2-112-B-Tar Paper **Lab Sample ID:** 042504459-0009A

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Black	80.0%	20.0%	None Detected	

Client Sample ID: A-2-112-C-Linoleum **Lab Sample ID:** 042504459-0010

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-2-112-C-Tar Paper **Lab Sample ID:** 042504459-0010A

Sample Description: FS 208200,215,227/Flooring - Linoleum with Paper Backing - Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: A-2-113-A **Lab Sample ID:** 042504459-0011

Sample Description: FS 209/Construction_Adhesive - Brown on Plastic Wall Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-2-113-B **Lab Sample ID:** 042504459-0012

Sample Description: FS 209/Construction_Adhesive - Brown on Plastic Wall Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Beige	0.0%	100.0%	None Detected	

Client Sample ID: A-2-113-C **Lab Sample ID:** 042504459-0013

Sample Description: FS 209/Construction_Adhesive - Brown on Plastic Wall Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-114-A-Linoleum **Lab Sample ID:** 042504459-0014

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	18.0%	82.0%	None Detected	

Client Sample ID: A-2-114-A-Mastic **Lab Sample ID:** 042504459-0014A

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-114-B-Linoleum **Lab Sample ID:** 042504459-0015

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	18.0%	82.0%	None Detected	

Client Sample ID: A-2-114-B-Mastic **Lab Sample ID:** 042504459-0015A

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-2-114-C-Linoleum **Lab Sample ID:** 042504459-0016

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray/Tan	10.0%	90.0%	None Detected	

Client Sample ID: A-2-114-C-Mastic **Lab Sample ID:** 042504459-0016A

Sample Description: FS 194, 210/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Tan	2.0%	98.0%	None Detected	

Client Sample ID: A-2-115-A **Lab Sample ID:** 042504459-0017

Sample Description: FS 221/Flooring - Linoleum with Paper Backing - White with Red

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan/Beige	0.0%	75.0%	25% Chrysotile	Inseparable mastic included in analysis.

Client Sample ID: A-2-115-B **Lab Sample ID:** 042504459-0018

Sample Description: FS 221/Flooring - Linoleum with Paper Backing - White with Red

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-115-C **Lab Sample ID:** 042504459-0019

Sample Description: FS 221/Flooring - Linoleum with Paper Backing - White with Red

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-2-116-A-Yellow Mastic **Lab Sample ID:** 042504459-0020

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-A-Linoleum **Lab Sample ID:** 042504459-0020A

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray/Tan/Beige	45.0%	55.0%	None Detected	

Client Sample ID: A-2-116-A-Brown Mastic 1 **Lab Sample ID:** 042504459-0020B

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-A-Tar Paper **Lab Sample ID:** 042504459-0020C

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown/Black	80.0%	20.0%	None Detected	

Client Sample ID: A-2-116-A-Brown Mastic 2 **Lab Sample ID:** 042504459-0020D

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-B-Yellow Mastic **Lab Sample ID:** 042504459-0021

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-B-Linoleum **Lab Sample ID:** 042504459-0021A

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray/Tan	25.0%	75.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-116-B-Brown Mastic 1 **Lab Sample ID:** 042504459-0021B

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-B-Tar Paper **Lab Sample ID:** 042504459-0021C

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown/Black	80.0%	20.0%	None Detected	

Client Sample ID: A-2-116-B-Brown Mastic 2 **Lab Sample ID:** 042504459-0021D

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-2-116-C-Yellow Mastic **Lab Sample ID:** 042504459-0022

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Yellow	<1%	100.0%	None Detected	

Client Sample ID: A-2-116-C-Linoleum **Lab Sample ID:** 042504459-0022A

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Tan	25.0%	75.0%	None Detected	

Client Sample ID: A-2-116-C-Brown Mastic **Lab Sample ID:** 042504459-0022B

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Brown	<1%	100.0%	None Detected	

Client Sample ID: A-2-116-C-Tar Paper **Lab Sample ID:** 042504459-0022C

Sample Description: FS 223/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray/Black	70.0%	30.0%	None Detected	

Client Sample ID: A-2-117-A-Linoleum **Lab Sample ID:** 042504459-0023

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Beige	13.0%	87.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-117-A-Mastic **Lab Sample ID:** 042504459-0023A

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-2-117-B-Linoleum **Lab Sample ID:** 042504459-0024

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Beige	12.0%	88.0%	None Detected	

Client Sample ID: A-2-117-B-Mastic **Lab Sample ID:** 042504459-0024A

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-2-117-C-Linoleum **Lab Sample ID:** 042504459-0025

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray/Tan	13.0%	87.0%	None Detected	

Client Sample ID: A-2-117-C-Mastic **Lab Sample ID:** 042504459-0025A

Sample Description: FS 48,185,252,257/Flooring - Linoleum Pink

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Yellow	5.0%	95.0%	None Detected	

Client Sample ID: A-2-118-A-Linoleum Remnant **Lab Sample ID:** 042504459-0026

Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	10.0%	10.0%	80% Chrysotile	

Client Sample ID: A-2-118-A-Tar Paper **Lab Sample ID:** 042504459-0026A

Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: A-2-118-B-Linoleum Remnant **Lab Sample ID:** 042504459-0027

Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-118-B-Tar Paper **Lab Sample ID:** 042504459-0027A
Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Black	80.0%	20.0%	None Detected	

Client Sample ID: A-2-118-C-Linoleum Remnant **Lab Sample ID:** 042504459-0028
Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-2-118-C-Tar Paper **Lab Sample ID:** 042504459-0028A
Sample Description: FS 230/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Black	70.0%	30.0%	None Detected	

Client Sample ID: A-2-119-A-Linoleum **Lab Sample ID:** 042504459-0029
Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	11.0%	89.0%	None Detected	

Client Sample ID: A-2-119-A-Mastic **Lab Sample ID:** 042504459-0029A
Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-2-119-B-Linoleum **Lab Sample ID:** 042504459-0030
Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Gray	9.0%	91.0%	None Detected	

Client Sample ID: A-2-119-B-Mastic **Lab Sample ID:** 042504459-0030A
Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-2-119-C-Linoleum **Lab Sample ID:** 042504459-0031
Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	18.0%	82.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-119-C-Mastic **Lab Sample ID:** 042504459-0031A

Sample Description: FS 192,240-245,256/Flooring - Linoleum with Paper Backing - Blue with Mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Tan/Yellow	<1%	100.0%	None Detected	

Client Sample ID: A-2-120-A **Lab Sample ID:** 042504459-0032

Sample Description: FS195 245/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025				Not Submitted	

Client Sample ID: A-2-120-B **Lab Sample ID:** 042504459-0033

Sample Description: FS195 245/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025				Not Submitted	

Client Sample ID: A-2-120-C **Lab Sample ID:** 042504459-0034

Sample Description: FS195 245/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025				Not Submitted	

Client Sample ID: A-2-121-A-Linoleum **Lab Sample ID:** 042504459-0035

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Blue	14.0%	86.0%	None Detected	

Client Sample ID: A-2-121-A-Mastic **Lab Sample ID:** 042504459-0035A

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: A-2-121-B-Linoleum **Lab Sample ID:** 042504459-0036

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Blue	11.0%	89.0%	None Detected	

Client Sample ID: A-2-121-B-Mastic **Lab Sample ID:** 042504459-0036A

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/15/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504459
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-2-121-C-Linoleum **Lab Sample ID:** 042504459-0037

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	16.0%	84.0%	None Detected	

Client Sample ID: A-2-121-C-Mastic **Lab Sample ID:** 042504459-0037A

Sample Description: FS 247/Flooring - Linoleum with Paper Backing - Light Blue with Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Yellow	<1%	100.0%	None Detected	

Client Sample ID: A-2-122-A **Lab Sample ID:** 042504459-0038

Sample Description: FS 254, 259, 261/Flooring - Linoleum with Paper Backing - Green mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	13.0%	87.0%	None Detected	

Client Sample ID: A-2-122-B **Lab Sample ID:** 042504459-0039

Sample Description: FS 254, 259, 261/Flooring - Linoleum with Paper Backing - Green mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray	13.0%	87.0%	None Detected	

Client Sample ID: A-2-122-C **Lab Sample ID:** 042504459-0040

Sample Description: FS 254, 259, 261/Flooring - Linoleum with Paper Backing - Green mini Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/17/2025	Gray/Blue	7.0%	93.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042504459
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

PLM: Material description updated for HAA-2-117 per client request

Analyst(s):

Bobby Wheatley PLM (47)
Cameron Evans PLM (20)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Kernersville, NC NVLAP Lab Code 102104-0, Virginia 3333-000228, West Virginia LT000321

Report amended: 04/08/2025 12:08:51 Replaces initial report from: 03/17/2025 11:51:37 Reason Code: Client-Change to Sample ID



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75			
	Company Name:	Egis		Company Name:	Egis			
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones			
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street			
	City, State, Zip:	Wixom, MI 48393	Country: USA	City, State, Zip:	Indianapolis, IN 46250	Country: USA		
	Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
	Project Information							
Project Name/No:				IC-004 - 540 Tyler (2nd Floor)		Purchase Order:	240100-RDA Program	
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected:	MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Sampled By		Date	3/7/2025		No. of Samples	40
Keith Ventimiglia		Signature:						

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285999986564

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-2-111 - A, B, C, D, E, F, G	PL	FS 186-262	Plaster - Skim & Base Coat Walls and Ceilings on Wire Mesh
A-2-112 - A, B, C	FLM	FS 208200,215,227	Flooring - Linoleum with Paper Backing- Yellow
A-2-113 - A, B, C	CA	FS 209	Construction_Adhesive - Brown on plastic Wall Tiles
A-2-114 - A, B, C	FLM	FS 194, 210,	Flooring - Linoleum with Paper Backing- Gray
A-2-115 - A, B, C	FLM	FS 221	Flooring - Linoleum with Paper Backing- White with Red
A-2-116 - A, B, C	FLM	FS 223	Flooring - Linoleum with Paper Backing- Brown
A-2-117 - A, B, C	FLM	FS 48,185,252,257	Flooring - Linoleum with Paper Backing- Beige with mini squares Pink
A-2-118 - A, B, C	FLM	FS 230	Flooring - Linoleum with Paper Backing- White

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:	Lab Location Kernersville, NC	Sample Condition Upon Receipt:
Relinquished by:	Date/Time: 3/17/25	Received by:
Relinquished by:	Date/Time:	Received by:



FMSI Order Number / Lab Use Only

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

IC-004 - 540 Tyler (2nd Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	<i>Craig Willey</i>	Date/Time: 3/17/25	Received by:
Relinquished by:		Date/Time:	Received by:
			Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/10/2025
Received: 3/12/2025
Analyzed: 3/13/2025

Proj: IC-004 - 540 Tyler (3rd Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-123-A-Base Coat **Lab Sample ID:** 042504534-0001

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-3-123-A-Skim Coat **Lab Sample ID:** 042504534-0001A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-B-Base Coat **Lab Sample ID:** 042504534-0002

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-3-123-B-Skim Coat **Lab Sample ID:** 042504534-0002A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-C-Base Coat **Lab Sample ID:** 042504534-0003

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	10.0%	90.0%	None Detected	

Client Sample ID: A-3-123-C-Skim Coat **Lab Sample ID:** 042504534-0003A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-D-Base Coat **Lab Sample ID:** 042504534-0004

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	10.0%	90.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-123-D-Skim Coat **Lab Sample ID:** 042504534-0004A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-E-Base Coat **Lab Sample ID:** 042504534-0005

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: A-3-123-E-Skim Coat **Lab Sample ID:** 042504534-0005A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-F-Base Coat **Lab Sample ID:** 042504534-0006

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: A-3-123-F-Skim Coat **Lab Sample ID:** 042504534-0006A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-123-G-Base Coat **Lab Sample ID:** 042504534-0007

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: A-3-123-G-Skim Coat **Lab Sample ID:** 042504534-0007A

Sample Description: FS 264-342/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-124-A-Linoleum **Lab Sample ID:** 042504534-0008

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	25.0%	75.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-124-A-Mastic **Lab Sample ID:** 042504534-0008A

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-3-124-B-Linoleum **Lab Sample ID:** 042504534-0009

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	25.0%	75.0%	None Detected	

Client Sample ID: A-3-124-B-Mastic **Lab Sample ID:** 042504534-0009A

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-3-124-C-Linoleum **Lab Sample ID:** 042504534-0010

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	15.0%	85.0%	None Detected	

Client Sample ID: A-3-124-C-Mastic **Lab Sample ID:** 042504534-0010A

Sample Description: FS 263/Flooring - Linoleum with Paper Backing - Beige with Red, White, Blue Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-3-125-A-Linoleum **Lab Sample ID:** 042504534-0011

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	30.0%	70.0%	None Detected	

Client Sample ID: A-3-125-A-Mastic **Lab Sample ID:** 042504534-0011A

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-125-B-Linoleum **Lab Sample ID:** 042504534-0012

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	30.0%	70.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-125-B-Mastic **Lab Sample ID:** 042504534-0012A

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-125-C-Linoleum **Lab Sample ID:** 042504534-0013

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	25.0%	75.0%	None Detected	

Client Sample ID: A-3-125-C-Mastic **Lab Sample ID:** 042504534-0013A

Sample Description: FS 297-298/Flooring - Linoleum with Paper Backing - White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-126-A-Linoleum **Lab Sample ID:** 042504534-0014

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-3-126-A-Mastic **Lab Sample ID:** 042504534-0014A

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-126-B-Linoleum **Lab Sample ID:** 042504534-0015

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-3-126-B-Mastic **Lab Sample ID:** 042504534-0015A

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-126-C-Linoleum **Lab Sample ID:** 042504534-0016

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnaslab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-126-C-Mastic **Lab Sample ID:** 042504534-0016A

Sample Description: FS 281/Flooring - Linoleum with Paper Backing - Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-3-127-A **Lab Sample ID:** 042504534-0017

Sample Description: FS 314-320/Ceiling_Panel - 2X2, White with Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: A-3-127-B **Lab Sample ID:** 042504534-0018

Sample Description: FS 314-320/Ceiling_Panel - 2X2, White with Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: A-3-127-C **Lab Sample ID:** 042504534-0019

Sample Description: FS 314-320/Ceiling_Panel - 2X2, White with Squares

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: A-3-128-A-Drywall **Lab Sample ID:** 042504534-0020

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: A-3-128-A-Joint Compound **Lab Sample ID:** 042504534-0020A

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-3-128-B-Drywall **Lab Sample ID:** 042504534-0021

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: A-3-128-B-Joint Compound **Lab Sample ID:** 042504534-0021A

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504534
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-3-128-C-Drywall

Lab Sample ID: 042504534-0022

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: A-3-128-C-Joint Compound

Lab Sample ID: 042504534-0022A

Sample Description: FS 274-314/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/13/2025	White	0.0%	100.0%	None Detected	

Analyst(s):

Colin Deubell PLM (39)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Depew, NY NVLAP Lab Code 200056-0

Initial report from: 03/17/2025 08:44:04



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042504534

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250 Country: USA	
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
	Project Information						
Project Name/No:				IC-004 - 540 Tyler (3rd Floor)		Purchase Order	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature: 		Date Sample 3/10/2025		No. of Samples 22	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (< 1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples ≤1% asbestos
Point Count NOB material samples ≤1% asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 286264106671

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-3-123 - A, B, C, D, E, F, G	PL	FS 264-342	Plaster - Skim & Base Coat Ceilings and walls on Wire Mesh
A-3-124 - A, B, C	FLM	FS 263	Flooring - Linoleum with Paper Backing-Beige with Red, White, Blue Speckles
A-3-125 - A, B, C	FLM	FS 297-298	Flooring - Linoleum with Paper Backing- White
A-3-126 - A, B, C	FLM	FS 281	Flooring - Linoleum with Paper Backing- Gray
A-3-127 - A, B, C	CP	FS 314-320	Ceiling_Panel - 2X2, White with Squares
A-3-128 - A, B, C	WB	FS 274,314,	Wallboard - with Mud & Tape

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Depew, NY		Sample Condition Upon Receipt:	
Relinquished by:		Date/Time:	3-10-25 1800	Received by:	Date/Time:
Relinquished by:		Date/Time:		Received by:	Date/Time:

RECEIVED
MAR 12 20259:23am
Fed-x

BY:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/11/2025
Received: 3/13/2025
Analyzed: 3/14/2025

Proj: IC-004 - 540 Tyler (4th Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-129-A-Skim Coat **Lab Sample ID:** 042504638-0001

Sample Description: FS 344-373
FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-A-Base Coat **Lab Sample ID:** 042504638-0001A

Sample Description: FS 344-373
FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	8.0%	92.0%	None Detected	

Client Sample ID: A-4-129-B-Skim Coat **Lab Sample ID:** 042504638-0002

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-B-Base Coat **Lab Sample ID:** 042504638-0002A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	5.0%	95.0%	None Detected	

Client Sample ID: A-4-129-C-Skim Coat **Lab Sample ID:** 042504638-0003

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-C-Base Coat **Lab Sample ID:** 042504638-0003A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	5.0%	95.0%	None Detected	

Client Sample ID: A-4-129-D-Skim Coat **Lab Sample ID:** 042504638-0004

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-129-D-Base Coat **Lab Sample ID:** 042504638-0004A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	5.0%	95.0%	None Detected	

Client Sample ID: A-4-129-E-Skim Coat **Lab Sample ID:** 042504638-0005

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-E-Base Coat **Lab Sample ID:** 042504638-0005A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-F-Skim Coat **Lab Sample ID:** 042504638-0006

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-F-Base Coat **Lab Sample ID:** 042504638-0006A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	5.0%	95.0%	None Detected	

Client Sample ID: A-4-129-G-Skim Coat **Lab Sample ID:** 042504638-0007

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-129-G-Base Coat **Lab Sample ID:** 042504638-0007A

Sample Description: FS 344-373/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-130-A **Lab Sample ID:** 042504638-0008

Sample Description: FS 343/Flooring - Linoleum with Paper Backing- Black

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Black	5.0%	95.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-130-B **Lab Sample ID:** 042504638-0009

Sample Description: FS 343/Flooring - Linoleum with Paper Backing- Black

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Black	5.0%	95.0%	None Detected	

Client Sample ID: A-4-130-C **Lab Sample ID:** 042504638-0010

Sample Description: FS 343/Flooring - Linoleum with Paper Backing- Black

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Black	5.0%	95.0%	None Detected	

Client Sample ID: A-4-131-A-Ceramic Tile **Lab Sample ID:** 042504638-0011

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-131-A-Grout **Lab Sample ID:** 042504638-0011A

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-131-B-Ceramic Tile **Lab Sample ID:** 042504638-0012

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-131-B-Grout **Lab Sample ID:** 042504638-0012A

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-131-C-Ceramic Tile **Lab Sample ID:** 042504638-0013

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-131-C-Grout **Lab Sample ID:** 042504638-0013A

Sample Description: FS 373/Ceramic_Tile_with_GROUT and Mortar - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-132-A-Floor Tile **Lab Sample ID:** 042504638-0014

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-132-A-Mastic **Lab Sample ID:** 042504638-0014A

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-4-132-B-Floor Tile **Lab Sample ID:** 042504638-0015

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-132-B-Mastic **Lab Sample ID:** 042504638-0015A

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-4-132-C-Floor Tile **Lab Sample ID:** 042504638-0016

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-132-C-Mastic **Lab Sample ID:** 042504638-0016A

Sample Description: FS 371/Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-4-133-A **Lab Sample ID:** 042504638-0017

Sample Description: FS 366, 378/Ceiling_Panel - 2X2, White with Gouges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	50.0%	50.0%	None Detected	

Client Sample ID: A-4-133-B **Lab Sample ID:** 042504638-0018

Sample Description: FS 366, 378/Ceiling_Panel - 2X2, White with Gouges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	60.0%	40.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-133-C **Lab Sample ID:** 042504638-0019

Sample Description: FS 366, 378/Ceiling_Panel - 2X2, White with Gouges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	40.0%	60.0%	None Detected	

Client Sample ID: A-4-134-A **Lab Sample ID:** 042504638-0020

Sample Description: FS 383/Flooring - Linoleum with Paper Backing- Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	45.0%	55.0%	None Detected	

Client Sample ID: A-4-134-B **Lab Sample ID:** 042504638-0021

Sample Description: FS 383/Flooring - Linoleum with Paper Backing- Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	45.0%	55.0%	None Detected	

Client Sample ID: A-4-134-C **Lab Sample ID:** 042504638-0022

Sample Description: FS 383/Flooring - Linoleum with Paper Backing- Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	45.0%	55.0%	None Detected	

Client Sample ID: A-4-135-A **Lab Sample ID:** 042504638-0023

Sample Description: FS 361/Construction_Adhesive - Gray on fake marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Brown/Gray	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-4-135-B **Lab Sample ID:** 042504638-0024

Sample Description: FS 361/Construction_Adhesive - Gray on fake marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-135-C **Lab Sample ID:** 042504638-0025

Sample Description: FS 361/Construction_Adhesive - Gray on fake marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-136-A **Lab Sample ID:** 042504638-0026

Sample Description: FS 361/Interior_Caulk - Interior Wood Trim, marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-136-B **Lab Sample ID:** 042504638-0027

Sample Description: FS 361/Interior_Caulk - Interior Wood Trim, marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-136-C **Lab Sample ID:** 042504638-0028

Sample Description: FS 361/Interior_Caulk - Interior Wood Trim, marble paneling

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-137-A-Drywall **Lab Sample ID:** 042504638-0029

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	15.0%	85.0%	None Detected	

Client Sample ID: A-4-137-A-Joint Compound **Lab Sample ID:** 042504638-0029A

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-137-B-Drywall **Lab Sample ID:** 042504638-0030

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	12.0%	88.0%	None Detected	

Client Sample ID: A-4-137-B-Joint Compound **Lab Sample ID:** 042504638-0030A

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-137-C-Drywall **Lab Sample ID:** 042504638-0031

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	15.0%	85.0%	None Detected	

Client Sample ID: A-4-137-C-Joint Compound **Lab Sample ID:** 042504638-0031A

Sample Description: FS 388,393/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-138-A-Floor Tile **Lab Sample ID:** 042504638-0032

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Tan	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-4-138-A-Mastic **Lab Sample ID:** 042504638-0032A

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Black	0.0%	97.0%	3% Chrysotile	

Client Sample ID: A-4-138-B-Floor Tile **Lab Sample ID:** 042504638-0033

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-138-B-Mastic **Lab Sample ID:** 042504638-0033A

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-138-C-Floor Tile **Lab Sample ID:** 042504638-0034

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-138-C-Mastic **Lab Sample ID:** 042504638-0034A

Sample Description: FS 355/Flooring - 9X9 Floor Tile with Mastic- White with Gray mixture

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-4-139-A-Pyro Bar **Lab Sample ID:** 042504638-0035

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-139-A-Mortar **Lab Sample ID:** 042504638-0035A

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504638
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-4-139-B-Pyro Bar **Lab Sample ID:** 042504638-0036

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-139-B-Mortar **Lab Sample ID:** 042504638-0036A

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-4-139-C-Pyro Bar **Lab Sample ID:** 042504638-0037

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-4-139-C-Mortar **Lab Sample ID:** 042504638-0037A

Sample Description: FS 344-373/Pyro Bar with Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/14/2025	White	0.0%	100.0%	None Detected	

Analyst(s):

Colin Deubell PLM (53)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Depew, NY NVLAP Lab Code 200056-0

Initial report from: 03/18/2025 08:22:06


Asbestos Bulk Building Materials - Chain of Custody
 EMSL Order Number / Lab Use Only

 EMSL Analytical, Inc.
 200 Route 130 North
 Cinnaminson, NJ 08077

 EMSL ANALYTICAL, INC.
 TESTING LABS • PRODUCTS • TRAINING

#042504638

 PHONE: (800) 220-3675
 EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
Project Information							
Project Name/No:				IC-004 - 540 Tyler (4th Floor)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Sampled By Signature:		Date Sample		No. of Samples	
Keith Ventimiglia				3/11/2025		37	

Turn-Around-Time (TAT)
☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection
PLM - Bulk (reporting limit)
☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk
Other Tests (please specify)

 Point Count all samples ≤1% asbestos
 Point Count NOB material samples ≤1% asbestos by PLM EPA
 NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 286264107336

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-4-129 - A, B, C, D, E, F, G	PL	FS 344-373	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh
A-4-130 - A, B, C	FLM	FS 343	Flooring - Linoleum with Paper Backing- Black
A-4-131 - A, B, C		FS 373	Ceramic_Tile_with_Grout and Mortar - Flooring
A-4-132 - A, B, C	FLM	FS 371	Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots
A-4-133 - A, B, C	CP	FS 366, 378	Ceiling_Panel - 2X2, White with Gouges
A-4-134 - A, B, C	FLM	FS 383	Flooring - Linoleum with Paper Backing- Brown
A-4-135 - A, B, C	CA	FS 361	Construction_Adhesive - Gray on fake marble paneling
A-4-136 - A, B, C	IC	FS 361	Interior_Caulk - Interior Wood Trim, marble paneling

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Depew, NY		Sample Condition Upon Receipt:	
Relinquished by:		Date/Time:	3-11-25 18:00	Received by:	
Relinquished by:		Date/Time:		Received by:	

 RECEIVED
 MAR 13 2025

 BY: 9:16am
 Fed-x

EMSL Order Number / Lab Use Only

#042504638

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

RECEIVED
MAR 13 2025

BY: Phelma
Frdy 9:16am

Method of Shipment:		Sample Condition Upon Receipt:	
Requisitioned by: <i>[Signature]</i>	Date/Time: 3-11-25 18 ⁰⁰	Received by:	Date/Time:
Requisitioned by:	Date/Time:	Received by:	Date/Time:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 3/12/2025
Received: 3/14/2025
Analyzed: 3/18/2025

Proj: IC-004 - 540 Tyler (5th Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-140-A-Base Coat **Lab Sample ID:** 042504760-0001

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-A-Skim Coat

Lab Sample ID: 042504760-0001A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-B-Base Coat

Lab Sample ID: 042504760-0002

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-B-Skim Coat

Lab Sample ID: 042504760-0002A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-C-Base Coat

Lab Sample ID: 042504760-0003

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-C-Skim Coat

Lab Sample ID: 042504760-0003A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-D-Base Coat

Lab Sample ID: 042504760-0004

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-140-D-Skim Coat **Lab Sample ID:** 042504760-0004A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-E-Base Coat **Lab Sample ID:** 042504760-0005

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-E-Skim Coat **Lab Sample ID:** 042504760-0005A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-F-Base Coat **Lab Sample ID:** 042504760-0006

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-F-Skim Coat **Lab Sample ID:** 042504760-0006A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-G-Base Coat **Lab Sample ID:** 042504760-0007

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-140-G-Skim Coat **Lab Sample ID:** 042504760-0007A

Sample Description: FS 412-440/Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-141-A-Mastic **Lab Sample ID:** 042504760-0008

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-141-A-Ceramic Tile **Lab Sample ID:** 042504760-0008A

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Green	0.0%	100.0%	None Detected	

Client Sample ID: A-5-141-B-Mastic **Lab Sample ID:** 042504760-0009

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-141-B-Ceramic Tile **Lab Sample ID:** 042504760-0009A

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Green	0.0%	100.0%	None Detected	

Client Sample ID: A-5-141-C-Mastic **Lab Sample ID:** 042504760-0010

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-141-C-Ceramic Tile **Lab Sample ID:** 042504760-0010A

Sample Description: FS 412/Construction_Adhesive - Grayish White - On 12x12 Green Ceramic Tile

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Green	0.0%	100.0%	None Detected	

Client Sample ID: A-5-142-A **Lab Sample ID:** 042504760-0011

Sample Description: FS 412-469/Roofing_Material - Cloth Like Material above 1x1 Ceiling Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-142-B **Lab Sample ID:** 042504760-0012

Sample Description: FS 412-469/Roofing_Material - Cloth Like Material above 1x1 Ceiling Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-142-C **Lab Sample ID:** 042504760-0013

Sample Description: FS 412-469/Roofing_Material - Cloth Like Material above 1x1 Ceiling Tiles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray/White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-143-A-Drywall **Lab Sample ID:** 042504760-0014

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: A-5-143-A-Joint Compound **Lab Sample ID:** 042504760-0014A

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-143-B-Drywall **Lab Sample ID:** 042504760-0015

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	18.0%	82.0%	None Detected	

Client Sample ID: A-5-143-B-Joint Compound **Lab Sample ID:** 042504760-0015A

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-143-C-Drywall **Lab Sample ID:** 042504760-0016

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	18.0%	82.0%	None Detected	

Client Sample ID: A-5-143-C-Joint Compound **Lab Sample ID:** 042504760-0016A

Sample Description: FS 460/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-144-A-Floor Tile **Lab Sample ID:** 042504760-0017

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-5-144-A-Mastic **Lab Sample ID:** 042504760-0017A

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-144-B-Floor Tile **Lab Sample ID:** 042504760-0018

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-144-B-Mastic **Lab Sample ID:** 042504760-0018A

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-5-144-C-Floor Tile **Lab Sample ID:** 042504760-0019

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-5-144-C-Mastic **Lab Sample ID:** 042504760-0019A

Sample Description: FS 436/Flooring - 12X12 Floor Tile with Mastic - Beige with Red, Blue - White Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: A-5-145-A **Lab Sample ID:** 042504760-0020

Sample Description: FS 436/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	15.0%	85.0%	None Detected	

Client Sample ID: A-5-145-B **Lab Sample ID:** 042504760-0021

Sample Description: FS 436/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	15.0%	85.0%	None Detected	

Client Sample ID: A-5-145-C **Lab Sample ID:** 042504760-0022

Sample Description: FS 436/Flooring - Linoleum with Paper Backing - Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	15.0%	85.0%	None Detected	

Client Sample ID: A-5-146-A **Lab Sample ID:** 042504760-0023

Sample Description: FS 436/Flooring - Underlayment

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	10.0%	90.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042504760
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-5-146-B

Lab Sample ID: 042504760-0024

Sample Description: FS 436/Flooring - Underlayment

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	10.0%	90.0%	None Detected	

Client Sample ID: A-5-146-C

Lab Sample ID: 042504760-0025

Sample Description: FS 436/Flooring - Underlayment

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	Brown	10.0%	90.0%	None Detected	

Client Sample ID: A-5-147-A

Lab Sample ID: 042504760-0026

Sample Description: FS 436/Wall_Sheeting - Layered Paper on Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-147-B

Lab Sample ID: 042504760-0027

Sample Description: FS 436/Wall_Sheeting - Layered Paper on Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: A-5-147-C

Lab Sample ID: 042504760-0028

Sample Description: FS 436/Wall_Sheeting - Layered Paper on Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/18/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042504760
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Colin Deubell PLM (44)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Depew, NY NVLAP Lab Code 200056-0

Initial report from: 03/19/2025 08:16:27



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

 EMSL Analytical, Inc.
 200 Route 130 North
 Cinnaminson, NJ 08077

 EMSL ANALYTICAL, INC.
 TESTING LABS • PRODUCTS • TRAINING

#042504760

 PHONE (800) 220-3675
 EMAIL CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
Project Information							
Project Name/No:				IC-004 - 540 Tyler (5th Floor)			
Purchase Order:				240100-RDA Program			
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN			
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)							
Sampled By Name:		Sampled By Signature:		Date Sample		No. of Samples	
Keith Ventimiglia				3/12/2025		28	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

 Point Count all samples ≤1% asbestos
 Point Count NOB material samples ≤1% asbestos by PLM EPA
 NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 286264108744

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
A-5-140 - A, B, C, D, E, F, G	PL	FS 412-440	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh
A-5-141 - A, B, C		FS 412	Construction Adhesive - Grayish White - On 12x12 Green Ceramic Tile
A-5-142 - A, B, C	RM	FS 412-469	Roofing Material - Cloth like material above 1x1 ceiling tiles
A-5-143 - A, B, C	WB	FS 460	Wallboard - with Mud & Tape
A-5-144 - A, B, C	FLM	FS 436	Flooring - 12X12 Floor Tile with Mastic- Beige with Red, Blue- White Speckles
A-5-145 - A, B, C	FLM	FS 436	Flooring - Linoleum with Paper Backing- Brown
A-5-146 - A, B, C	FLM	FS 436	Flooring - Underlayment
A-5-147 - A, B, C	WS	FS 436	Wall Sheeting - Layered Paper on walls

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Depew, NY		Sample Condition Upon Receipt:	
Relinquished by:		Date/Time:	3/12/25	Received by:	
Relinquished by:		Date/Time:		Received by:	

 RECEIVED
 MAR 14 2025

 G. O'Leary
 Fed-r

BY:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505008
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Proj: IC-0044 - 540 Tyler Roof

Phone: (313) 408-4893
Fax:
Collected: 3/14/2025
Received: 3/18/2025
Analyzed: 3/21/2025

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-R-148-A **Lab Sample ID:** 042505008-0001

Sample Description: FS 411-415, 466-467/Glue pods on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	0.0%	85.0%	15% Chrysotile	

Client Sample ID: A-R-148-B **Lab Sample ID:** 042505008-0002

Sample Description: FS 411-415, 466-467/Glue pods on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-R-148-C **Lab Sample ID:** 042505008-0003

Sample Description: FS 411-415, 466-467/Glue pods on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-R-149-A **Lab Sample ID:** 042505008-0004

Sample Description: FS 411-415, 466-467/Interior Caulk around Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	95.0%	5% Chrysotile	

Client Sample ID: A-R-149-B **Lab Sample ID:** 042505008-0005

Sample Description: FS 411-415, 466-467/Interior Caulk around Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-R-149-C **Lab Sample ID:** 042505008-0006

Sample Description: FS 411-415, 466-467/Interior Caulk around Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025					Positive Stop (Not Analyzed)

Client Sample ID: A-R-150-A **Lab Sample ID:** 042505008-0007

Sample Description: FS 411-415, 466-467/Glue Pods Beige on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505008
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-R-150-B **Lab Sample ID:** 042505008-0008

Sample Description: FS 411-415, 466-467/Glue Pods Beige on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-R-150-C **Lab Sample ID:** 042505008-0009

Sample Description: FS 411-415, 466-467/Glue Pods Beige on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-R-151-A **Lab Sample ID:** 042505008-0010

Sample Description: FS 411-415, 466-467/Glue Pods Black on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	0.0%	92.0%	8% Chrysotile	

Client Sample ID: A-R-151-B **Lab Sample ID:** 042505008-0011

Sample Description: FS 411-415, 466-467/Glue Pods Black on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-R-151-C **Lab Sample ID:** 042505008-0012

Sample Description: FS 411-415, 466-467/Glue Pods Black on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-R-152-A **Lab Sample ID:** 042505008-0013

Sample Description: FS 411-415, 466-467/Flooring Black with Green Dots 12 x 12 Floor Tile with Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-R-152-B **Lab Sample ID:** 042505008-0014

Sample Description: FS 411-415, 466-467/Flooring Black with Green Dots 12 x 12 Floor Tile with Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: A-R-152-C **Lab Sample ID:** 042505008-0015

Sample Description: FS 411-415, 466-467/Flooring Black with Green Dots 12 x 12 Floor Tile with Glue

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505008
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-R-153-A **Lab Sample ID:** 042505008-0016

Sample Description: FS 411-415, 466-467/Construction Adhesive Yellow on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-R-153-B **Lab Sample ID:** 042505008-0017

Sample Description: FS 411-415, 466-467/Construction Adhesive Yellow on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-R-153-C **Lab Sample ID:** 042505008-0018

Sample Description: FS 411-415, 466-467/Construction Adhesive Yellow on Ceramic Tile Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: A-R-154-A **Lab Sample ID:** 042505008-0019

Sample Description: FS 471/Exterior Caulk around Siding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Gray	0.0%	92.0%	8% Chrysotile	

Client Sample ID: A-R-154-B **Lab Sample ID:** 042505008-0020

Sample Description: FS 471/Exterior Caulk around Siding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-R-154-C **Lab Sample ID:** 042505008-0021

Sample Description: FS 471/Exterior Caulk around Siding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025				Positive Stop (Not Analyzed)	

Client Sample ID: A-R-155-A **Lab Sample ID:** 042505008-0022

Sample Description: EA 5/Roofing Material Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	50.0%	50.0%	None Detected	

Client Sample ID: A-R-155-B **Lab Sample ID:** 042505008-0023

Sample Description: EA 5/Roofing Material Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	50.0%	50.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042505008
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: A-R-155-C

Lab Sample ID: 042505008-0024

Sample Description: EA 5/Roofing Material Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	50.0%	50.0%	None Detected	

Client Sample ID: A-R-156-A

Lab Sample ID: 042505008-0025

Sample Description: EA 5/Roofing Material Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-R-156-B

Lab Sample ID: 042505008-0026

Sample Description: EA 5/Roofing Material Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: A-R-156-C

Lab Sample ID: 042505008-0027

Sample Description: EA 5/Roofing Material Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/21/2025	Black	0.0%	100.0%	None Detected	

Analyst(s):

Colin Deubell PLM (19)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Cinnaminson, NJ NVLAP Lab Code 101048-0, AIHA LAP, LLC-IHLAP Lab 100194, PA ID# 68-00367, LA #04127

Initial report from: 03/21/2025 15:14:24



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

 EMSL Analytical, Inc.
 200 Route 130 North
 Cinnaminson, NJ 08077

 EMSL ANALYTICAL, INC.
 TESTING LABS • PRODUCTS • TRAINING

042505008

 PHONE (800) 220-3675
 EMAIL CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
Project Name/No:				IC-004 - 540 Tyler (Roof)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name:		Keith Ventimiglia		Sampled By Signature:		Date Sample:	3/14/2025
						No. of Samples:	27

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

PLM - Bulk (reporting limit) ☒ PLM EPA 600/R-93/116 (<1%)			TEM - Bulk		
Other Tests (please specify) Point Count all samples $\leq 1\%$ asbestos Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)					
FedEx # 286264108766			☒ Positive Stop - Clearly Identified Homogeneous Areas		
Sample Number	HA Number	Sample Location	Material Description		
A-R-148 - A, B, C	GP	FS 411-415,466-467	Glue_Pods - On ceramic tile walls		
A-R-149 - A, B, C	IC	FS 411-415,466-467	Interior_Caulk - Around ceramic tile walls		
A-R-150 - A, B, C		FS 411-415,466-467	Glue_Pods- Beige - On ceramic tile walls		
A-R-151 - A, B, C		FS 411-415,466-467	Glue_Pods- Black - On ceramic tile walls		
A-R-152 - A, B, C		FS 411-415,466-467	Flooring- Black with Green Dots - 12X12 Floor Tile with Glue		
A-R-153 - A, B, C	CA	FS 411-415,466-467	Construction_Adhesive - Yellow on ceramic tile walls		
A-R-154 - A, B, C	EC	FS 471	Exterior_Caulk - Around sliding Windows		
A-R-155 - A, B, C	RM	EA 5	Roofing_Material - Flat Roof Materials		
Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)					
Please provide EDD in CSV format					
Method of Shipment: Lab Location Depew, NY			Sample Condition Upon Receipt:		
Relinquished by:	Date/Time: 3-14-25/1800		Received by:	Date/Time:	
Relinquished by:	Date/Time:		Received by:	Date/Time:	

 RECEIVED
 MAR 18 2025

BY: [Signature] FedEx

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

042505004

IC-004 - 540 Tyler (Roof)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

[illegible]

RECEIVED
MAR 18 2025

BY: mw 9:25 am FedEx

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: 	Date/Time: 3-14-25 1800	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:

BUILDING B



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/26/2025
Received: 2/28/2025
Analyzed: 3/05/2025

Proj: IC-004 - 540 Tyler (Exterior B) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-1-A-Brick **Lab Sample ID:** 042503659-0001

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-1-A-Mortar **Lab Sample ID:** 042503659-0001A

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-1-B-Brick **Lab Sample ID:** 042503659-0002

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-1-B-Mortar **Lab Sample ID:** 042503659-0002A

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-1-C-Brick **Lab Sample ID:** 042503659-0003

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-1-C-Mortar **Lab Sample ID:** 042503659-0003A

Sample Description: EA 1-4/Brick_Mortar- Brown - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-2-A **Lab Sample ID:** 042503659-0004

Sample Description: EA 1-4/Exterior_Caulk - on Brick Siding & Trim, Windows, Doors,Transitions,Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	97.0%	3% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-2-B **Lab Sample ID:** 042503659-0005

Sample Description: EA 1-4/Exterior_Caulk - on Brick Siding & Trim, Windows, Doors,Transitions,Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-Ext-2-C **Lab Sample ID:** 042503659-0006

Sample Description: EA 1-4/Exterior_Caulk - on Brick Siding & Trim, Windows, Doors,Transitions,Seams

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-Ext-3-A-Brick **Lab Sample ID:** 042503659-0007

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-3-A-Mortar **Lab Sample ID:** 042503659-0007A

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-3-B-Brick **Lab Sample ID:** 042503659-0008

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-3-B-Mortar **Lab Sample ID:** 042503659-0008A

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-3-C-Brick **Lab Sample ID:** 042503659-0009

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-3-C-Mortar **Lab Sample ID:** 042503659-0009A

Sample Description: EA 1-4/Brick_Mortar- Orange - Foundation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-4-A **Lab Sample ID:** 042503659-0010

Sample Description: EA 4/Exterior_Caulk - Around fan vents and Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-4-B **Lab Sample ID:** 042503659-0011

Sample Description: EA 4/Exterior_Caulk - Around fan vents and Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-4-C **Lab Sample ID:** 042503659-0012

Sample Description: EA 4/Exterior_Caulk - Around fan vents and Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-5-A **Lab Sample ID:** 042503659-0013

Sample Description: EA 1-4/Concrete - Sidewalk around structure perimeters

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-5-B **Lab Sample ID:** 042503659-0014

Sample Description: EA 1-4/Concrete - Sidewalk around structure perimeters

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-5-C **Lab Sample ID:** 042503659-0015

Sample Description: EA 1-4/Concrete - Sidewalk around structure perimeters

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-6-A **Lab Sample ID:** 042503659-0016

Sample Description: EA 1-4/Window_Glaze - Metal Framed Windows, Basement, 1st, 2nd

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	97.0%	3% Chrysotile	

Client Sample ID: B-Ext-6-B **Lab Sample ID:** 042503659-0017

Sample Description: EA 1-4/Window_Glaze - Metal Framed Windows, Basement, 1st, 2nd

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-6-C **Lab Sample ID:** 042503659-0018

Sample Description: EA 1-4/Window_Glaze - Metal Framed Windows, Basement, 1st, 2nd

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-Ext-7-A-Block **Lab Sample ID:** 042503659-0019

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-7-A-Mortar **Lab Sample ID:** 042503659-0019A

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-7-B-Block **Lab Sample ID:** 042503659-0020

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-7-B-Mortar **Lab Sample ID:** 042503659-0020A

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-7-C-Brick **Lab Sample ID:** 042503659-0021

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-7-C-Mortar **Lab Sample ID:** 042503659-0021A

Sample Description: EA 2/Block_Mortar - Patch & Repair of basement windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-8-A **Lab Sample ID:** 042503659-0022

Sample Description: EA 2/Exterior_Caulk - on Brick Siding, former awning

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-8-B **Lab Sample ID:** 042503659-0023

Sample Description: EA 2/Exterior_Caulk - on Brick Siding, former awning

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-8-C **Lab Sample ID:** 042503659-0024

Sample Description: EA 2/Exterior_Caulk - on Brick Siding, former awning

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-9-A **Lab Sample ID:** 042503659-0025

Sample Description: EA 4/Concrete - Base for electrical cable runs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-9-B **Lab Sample ID:** 042503659-0026

Sample Description: EA 4/Concrete - Base for electrical cable runs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-9-C **Lab Sample ID:** 042503659-0027

Sample Description: EA 4/Concrete - Base for electrical cable runs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-10-A **Lab Sample ID:** 042503659-0028

Sample Description: EA 1-4/Asphalt_Paving - Around structure perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-10-B **Lab Sample ID:** 042503659-0029

Sample Description: EA 1-4/Asphalt_Paving - Around structure perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: B-Ext-10-C **Lab Sample ID:** 042503659-0030

Sample Description: EA 1-4/Asphalt_Paving - Around structure perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Black	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503659
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Ext-11-A

Lab Sample ID: 042503659-0031

Sample Description: EA 2/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Black	0.0%	98.0%	2% Chrysotile	

Client Sample ID: B-Ext-11-B

Lab Sample ID: 042503659-0032

Sample Description: EA 2/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-Ext-11-C

Lab Sample ID: 042503659-0033

Sample Description: EA 2/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Analyst(s):

Allen Kuestner PLM (25)
Kevin Ream PLM (11)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/05/2025 12:29:38



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503659

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75								
	Company Name:	Egis		Company Name:	Egis								
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones								
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street								
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:	USA					
Billing Information	Phone:	(248) 863-2934		Phone:	(248) 863-2762								
	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com								
	Project Information												
Project Name/No:				IC-004 - 540 Tyler (Exterior B)		Purchase Order:		240100-RDA Program					
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)							
Sampled By Name:		Keith Ventimiglia		Sampled By Signature:		Date Sample		2/26/2025		No. of Samples		33	

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762203110

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
B-Ext-1 - A, B, C	BM	EA 1-4	Brick_Mortar- Brown - Foundation
B-Ext-2 - A, B, C	EC	EA 1-4	Exterior_Caulk - on Brick Siding & Trim, Windows, Doors, Transitions, Seams
B-Ext-3 - A, B, C	BM	EA 1-4	Brick_Mortar- Orange - Foundation
B-Ext-4 - A, B, C	EC	EA 4	Exterior_Caulk - Around fan vents and Doors
B-Ext-5 - A, B, C	CC	EA 1-4	Concrete - Sidewalk around structure perimeters
B-Ext-6 - A, B, C	WG	EA 1-4	Window_Glaze - Metal Framed Windows, Basement, 1st, 2nd
B-Ext-7 - A, B, C	BM	EA 2	Block_Mortar - Patch & Repair of basement windows
B-Ext-8 - A, B, C	EC	EA 2	Exterior_Caulk - on Brick Siding, former awning

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Meeting Place PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED FEB 28 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077PHONE: (800) 220-3675
EMAIL: CinnAslab@EMSL.comEMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503659

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (Exterior)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
B-Ext-9 - A, B, C	CC	EA 4	Concrete - Base for electrical cable runs
B-Ext-10 - A, B, C	ASP	EA 1-4	Asphalt_Paving - Around structure perimeter
B-Ext-11 - A, B, C	RM	EA 2	Roofing_Material - Flashing
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-

RECEIVED FEB 28 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/26/2025
Received: 2/28/2025
Analyzed: 3/05/2025

Proj: IC-004 - 540 Tyler (Basement B) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-12-A **Lab Sample ID:** 042503657-0001

Sample Description: FS 1-11/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-12-B **Lab Sample ID:** 042503657-0002

Sample Description: FS 1-11/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-12-C **Lab Sample ID:** 042503657-0003

Sample Description: FS 1-11/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-13-A-Brick **Lab Sample ID:** 042503657-0004

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-13-A-Mortar **Lab Sample ID:** 042503657-0004A

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-13-B-Brick **Lab Sample ID:** 042503657-0005

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-13-B-Mortar **Lab Sample ID:** 042503657-0005A

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-13-C-Brick **Lab Sample ID:** 042503657-0006

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-13-C-Mortar **Lab Sample ID:** 042503657-0006A

Sample Description: FS 1-11/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-A-Block **Lab Sample ID:** 042503657-0007

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-A-Mortar **Lab Sample ID:** 042503657-0007A

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-B-Block **Lab Sample ID:** 042503657-0008

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-B-Mortar **Lab Sample ID:** 042503657-0008A

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-C-Block **Lab Sample ID:** 042503657-0009

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-14-C-Mortar **Lab Sample ID:** 042503657-0009A

Sample Description: FS 9/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-15-A **Lab Sample ID:** 042503657-0010
Sample Description: FS 4/Transite - Panel for electrical devices

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	70.0%	30% Chrysotile	

Client Sample ID: B-Base-15-B **Lab Sample ID:** 042503657-0011
Sample Description: FS 4/Transite - Panel for electrical devices

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-Base-15-C **Lab Sample ID:** 042503657-0012
Sample Description: FS 4/Transite - Panel for electrical devices

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-Base-16-A **Lab Sample ID:** 042503657-0013
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-16-B **Lab Sample ID:** 042503657-0014
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-16-C **Lab Sample ID:** 042503657-0015
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-17-A **Lab Sample ID:** 042503657-0016
Sample Description: FS 9/Ceiling_Panel - 2X2, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown	95.0%	5.0%	None Detected	

Client Sample ID: B-Base-17-B **Lab Sample ID:** 042503657-0017
Sample Description: FS 9/Ceiling_Panel - 2X2, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown	85.0%	15.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-17-C **Lab Sample ID:** 042503657-0018

Sample Description: FS 9/Ceiling_Panel - 2X2, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown	90.0%	10.0%	None Detected	

Client Sample ID: B-Base-18-A **Lab Sample ID:** 042503657-0019

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D.fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-18-B **Lab Sample ID:** 042503657-0020

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D.fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-18-C **Lab Sample ID:** 042503657-0021

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D.fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-19-A **Lab Sample ID:** 042503657-0022

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: B-Base-19-B **Lab Sample ID:** 042503657-0023

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	15.0%	85.0%	None Detected	

Client Sample ID: B-Base-19-C **Lab Sample ID:** 042503657-0024

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: B-Base-20-A **Lab Sample ID:** 042503657-0025

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	20.0%	80.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-20-B **Lab Sample ID:** 042503657-0026

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: B-Base-20-C **Lab Sample ID:** 042503657-0027

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" O.D Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: B-Base-21-A **Lab Sample ID:** 042503657-0028

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Muddled pipe fitting insulation on Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	25.0%	75.0%	None Detected	

Client Sample ID: B-Base-21-B **Lab Sample ID:** 042503657-0029

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Muddled pipe fitting insulation on Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: B-Base-21-C **Lab Sample ID:** 042503657-0030

Sample Description: FS 1-11/Pipe_Fitting - 0"-6" O.D. Muddled pipe fitting insulation on Mag SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	20.0%	80.0%	None Detected	

Client Sample ID: B-Base-22-A **Lab Sample ID:** 042503657-0031

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglasswith cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Tan/Yellow	50.0%	50.0%	None Detected	

Client Sample ID: B-Base-22-B **Lab Sample ID:** 042503657-0032

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglasswith cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	60.0%	40.0%	None Detected	

Client Sample ID: B-Base-22-C **Lab Sample ID:** 042503657-0033

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglasswith cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	60.0%	40.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-23-A **Lab Sample ID:** 042503657-0034

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	25.0%	75.0%	None Detected	

Client Sample ID: B-Base-23-B **Lab Sample ID:** 042503657-0035

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: B-Base-23-C **Lab Sample ID:** 042503657-0036

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: B-Base-24-A **Lab Sample ID:** 042503657-0037

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	80.0%	20.0%	None Detected	

Client Sample ID: B-Base-24-B **Lab Sample ID:** 042503657-0038

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-24-C **Lab Sample ID:** 042503657-0039

Sample Description: FS 1-11/Pipe_Insulation - 6"-12" O.D fiberglass with cloth SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-25-A **Lab Sample ID:** 042503657-0040

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: B-Base-25-B **Lab Sample ID:** 042503657-0041

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	30.0%	70.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-25-C **Lab Sample ID:** 042503657-0042

Sample Description: FS 1-11/Pipe_Fitting - 6"-12" O.D. Mudded pipe insulation on fiberglass SRPI

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray/Black	25.0%	75.0%	None Detected	

Client Sample ID: B-Base-26-A **Lab Sample ID:** 042503657-0043

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Gray	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-26-B **Lab Sample ID:** 042503657-0044

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-26-C **Lab Sample ID:** 042503657-0045

Sample Description: FS 1-11/Pipe_Insulation - 0"-6" Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown	70.0%	30.0%	None Detected	

Client Sample ID: B-Base-27-A **Lab Sample ID:** 042503657-0046

Sample Description: FS 1,9/Gasket_Material - Pipe Valves and Flanges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Gray/Black	0.0%	75.0%	25% Chrysotile	

Client Sample ID: B-Base-27-B **Lab Sample ID:** 042503657-0047

Sample Description: FS 1,9/Gasket_Material - Pipe Valves and Flanges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-Base-27-C **Lab Sample ID:** 042503657-0048

Sample Description: FS 1,9/Gasket_Material - Pipe Valves and Flanges

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-Base-28-A-Skim Coat **Lab Sample ID:** 042503657-0049

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-Base-28-A-Base Coat **Lab Sample ID:** 042503657-0049A

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-28-B-Skim Coat **Lab Sample ID:** 042503657-0050

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-28-B-Base Coat **Lab Sample ID:** 042503657-0050A

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-28-C-Skim Coat **Lab Sample ID:** 042503657-0051

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-Base-28-C-Base Coat **Lab Sample ID:** 042503657-0051A

Sample Description: FS 5,7/Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025		0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503657
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Allen Kuestner PLM (38)
Kevin Small PLM (18)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/05/2025 14:03:57



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503657

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75				
	Company Name:	Egis		Company Name:	Egis				
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones				
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street				
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:	USA	
Billing Information	Phone:	(248) 863-2934		Phone:	(248) 863-2762				
	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com				
Project Information									
Project Name/No:				IC-004 - 540 Tyler (Basement B)				Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)			
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample		2/26/2025		No. of Samples	52

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762203110

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
B-Base-12 - A, B, C	CC	FS 1-11	Concrete - Flooring
B-Base-13 - A, B, C	BM	FS 1-11	Brick_Mortar - Interior Walls
B-Base-14 - A, B, C	BM	FS 9	Block_Mortar - Interior Ceiling Block with Mortar
B-Base-15 - A, B, C	TS	FS 4	Transite - Panel for electrical devices
B-Base-16 - A, B, C	CC	FS 1-11	Concrete - Foundation Walls
B-Base-17 - A, B, C	CP	FS 9	Ceiling_Panel - 2X2, White with Indentations
B-Base-18 - A, B, C	PI	FS 1-11	Pipe_Insulation - 0"-6" O.D.fiberglass with cloth SRPI
B-Base-19 - A, B, C	PF	FS 1-11	Pipe_Fitting - 0"-6" O.D. Mudded pipe insulation on fiberglass SRPI

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED FEB 28 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675

EMAIL: CinnAsblab@EMSL.com

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

042503657

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
B-Base-20 - A, B, C	PI	FS 1-11	Pipe_Insulation - 0"-6" O.D Mag SRPI
B-Base-21 - A, B, C	PF	FS 1-11	Pipe_Fitting - 0"-6" O.D. Mudded pipe fitting insulation on Mag SRPI
B-Base-22 - A, B, C	PI	FS 1-11	Pipe_Insulation - 6"-12" O.D fiberglasswith cloth SRPI
B-Base-23 - A, B, C	PF	FS 1-11	Pipe_Fitting - 6"-12" Mudded on Fiberglass with Cloth Pipe Insulation
B-Base-24 - A, B, C	PI	FS 1-11	Pipe_Insulation - 6"-12"" O.D fiberglass with cloth SRPI
B-Base-25 - A, B, C	PF	FS 1-11	Pipe_Fitting - 6"-12" O.D. Mudded pipe insulation on fiberglass SRPI
B-Base-26 - A, B, C	PI	FS 1-11	Pipe_Insulation - 0"-6" Duplex Insulation
B-Base-27 - A, B, C	GM	FS 1,9	Gasket_Material - Pipe Valves and Flanges
B-Base-28 - A, B, C	PL	FS 5,7	Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls
(assumed - no sample)	PI	FS 1-11	Pipe_Insulation - Misc TSI Debris mixed with general debris
(assumed - no sample)	FD	FS 5,8	Fire_Door - Metal
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-
-	#N/A	0	-
-	(material)	0	-
-	(material)	0	-

RECEIVED FEB 28 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503817
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/27/2025
Received: 3/04/2025
Analyzed: 3/07/2025

Proj: IC-004 - 540 Tyler (B 1st Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-1-29-A **Lab Sample ID:** 042503817-0001

Sample Description: FS 15-18/Flooring - Linoleum with Paper White Backing- Stone pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Red	0.0%	100.0%	None Detected	

Client Sample ID: B-1-29-B **Lab Sample ID:** 042503817-0002

Sample Description: FS 15-18/Flooring - Linoleum with Paper White Backing- Stone pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Brown/Red	0.0%	100.0%	None Detected	

Client Sample ID: B-1-29-C **Lab Sample ID:** 042503817-0003

Sample Description: FS 15-18/Flooring - Linoleum with Paper White Backing- Stone pattern

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Brown/Tan/Red	0.0%	100.0%	None Detected	

Client Sample ID: B-1-30-A-Ceramic Tile **Lab Sample ID:** 042503817-0004

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-1-30-A-Grout **Lab Sample ID:** 042503817-0004A

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-1-30-B-Ceramic Tile **Lab Sample ID:** 042503817-0005

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-1-30-B-Grout **Lab Sample ID:** 042503817-0005A

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503817
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-1-30-C-Ceramic Tile **Lab Sample ID:** 042503817-0006

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: B-1-30-C-Grout **Lab Sample ID:** 042503817-0006A

Sample Description: FS 15-19/Ceramic_Tile_with_Grout - Building walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-1-31-A **Lab Sample ID:** 042503817-0007

Sample Description: FS 17-18/Interior_Caulk - Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Gray	0.0%	96.0%	4% Chrysotile	

Client Sample ID: B-1-31-B **Lab Sample ID:** 042503817-0008

Sample Description: FS 17-18/Interior_Caulk - Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-1-31-C **Lab Sample ID:** 042503817-0009

Sample Description: FS 17-18/Interior_Caulk - Doors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-1-32-A-Cove Base **Lab Sample ID:** 042503817-0010

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: B-1-32-A-Adhesive **Lab Sample ID:** 042503817-0010A

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/05/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: B-1-32-B-Cove Base **Lab Sample ID:** 042503817-0011

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503817
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-1-32-B-Adhesive **Lab Sample ID:** 042503817-0011A

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: B-1-32-C-Cove Base **Lab Sample ID:** 042503817-0012

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: B-1-32-C-Adhesive **Lab Sample ID:** 042503817-0012A

Sample Description: FS 15-18/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: B-1-33-A **Lab Sample ID:** 042503817-0013

Sample Description: FS 15-18/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray/White/Black	0.0%	100.0%	None Detected	

Client Sample ID: B-1-33-B **Lab Sample ID:** 042503817-0014

Sample Description: FS 15-18/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray/White/Black	0.0%	100.0%	None Detected	

Client Sample ID: B-1-33-C **Lab Sample ID:** 042503817-0015

Sample Description: FS 15-18/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray/White/Black	0.0%	100.0%	None Detected	

Client Sample ID: B-1-34-A **Lab Sample ID:** 042503817-0016

Sample Description: FS 15/Transite - Table Top

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	60.0%	20% Amosite 20% Chrysotile	

Client Sample ID: B-1-34-B **Lab Sample ID:** 042503817-0017

Sample Description: FS 15/Transite - Table Top

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503817
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-1-34-C **Lab Sample ID:** 042503817-0018

Sample Description: FS 15/Transite - Table Top

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-1-35-A **Lab Sample ID:** 042503817-0019

Sample Description: FS 17-18/Metal Pan Insulation - Insulated metal ceiling tiles- Bathroom

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown/White	90.0%	10.0%	None Detected	

Client Sample ID: B-1-35-B **Lab Sample ID:** 042503817-0020

Sample Description: FS 17-18/Metal Pan Insulation - Insulated metal ceiling tiles- Bathroom

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown/White	90.0%	10.0%	None Detected	

Client Sample ID: B-1-35-C **Lab Sample ID:** 042503817-0021

Sample Description: FS 17-18/Metal Pan Insulation - Insulated metal ceiling tiles- Bathroom

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Brown/Tan	90.0%	10.0%	None Detected	

Client Sample ID: B-1-36-A-Linoleum **Lab Sample ID:** 042503817-0022

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: B-1-36-A-White Paper Backing **Lab Sample ID:** 042503817-0022A

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	89.0%	11.0%	None Detected	

Client Sample ID: B-1-36-B-Linoleum **Lab Sample ID:** 042503817-0023

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: B-1-36-B-White Paper Backing **Lab Sample ID:** 042503817-0023A

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	90.0%	10.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503817
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-1-36-C-Linoleum

Lab Sample ID: 042503817-0024

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: B-1-36-C-White Paper Backing

Lab Sample ID: 042503817-0024A

Sample Description: FS 16/Flooring - Linoleum with White Paper Backing-TableTop

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	White	90.0%	10.0%	None Detected	

Client Sample ID: B-1-37-A

Lab Sample ID: 042503817-0025

Sample Description: FS 16/Insulator - Inside electrical box components

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	98.0%	2.0%	None Detected	

Client Sample ID: B-1-37-B

Lab Sample ID: 042503817-0026

Sample Description: FS 16/Insulator - Inside electrical box components

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Black	98.0%	2.0%	None Detected	

Client Sample ID: B-1-37-C

Lab Sample ID: 042503817-0027

Sample Description: FS 16/Insulator - Inside electrical box components

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Black	95.0%	5.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503817
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Allen Kuestner PLM (10)
Tahirrah Steele PLM (22)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/07/2025 14:37:24



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503817

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
Project Information							
Project Name/No:				IC-004 - 540 Tyler (B 1st Floor)			
Purchase Order:				240100-RDA Program			
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample	2/27/2025	No. of Samples	27

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762202147

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
B-1-29 - A, B, C	FLM	FS 15-18	Flooring - Linoleum with Paper White Backing- Stone pattern
B-1-30 - A, B, C	CTG	FS 15-19	Ceramic_Tile_with_Grout - Building walls
B-1-31 - A, B, C	IC	FS 17-18	Interior_Caulk - Doors
B-1-32 - A, B, C	CB	FS 15-18	Cove_Base - with Adhesive
B-1-33 - A, B, C	FLM	FS 15-18	Flooring - Terrazzo
B-1-34 - A, B, C	TS	FS 15	Transite - Table Top
B-1-35 - A, B, C	MP	FS 17-18	Metal Pan Insulation - Insulated metal ceiling tiles- Bathroom
B-1-36 - A, B, C	FLM	FS 16	Flooring - Linoleum with White Paper Backing-TableTop

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503817

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (1st Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)			
Sample Number	HA Number	Sample Location	Material Description
B-1-37 - A, B, C	IB	FS 16	Insulator - Inside electrical box components

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503818
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/27/2025
Received: 3/04/2025
Analyzed: 3/07/2025

Proj: IC-004 - 540 Tyler (B 2nd Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-2-38-A

Lab Sample ID: 042503818-0001

Sample Description: FS 20-23/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-38-B

Lab Sample ID: 042503818-0002

Sample Description: FS 20-23/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-38-C

Lab Sample ID: 042503818-0003

Sample Description: FS 20-23/Concrete - Flooring

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-A-Wallboard

Lab Sample ID: 042503818-0004

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-A-Mud

Lab Sample ID: 042503818-0004A

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-A-Tape

Lab Sample ID: 042503818-0004B

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	83.0%	17.0%	None Detected	

Client Sample ID: B-2-39-B-Wallboard

Lab Sample ID: 042503818-0005

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503818
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-2-39-B-Mud **Lab Sample ID:** 042503818-0005A

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-B-Tape **Lab Sample ID:** 042503818-0005B

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	White	86.0%	14.0%	None Detected	

Client Sample ID: B-2-39-C-Wallboard **Lab Sample ID:** 042503818-0006

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-C-Mud **Lab Sample ID:** 042503818-0006A

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: B-2-39-C-Tape **Lab Sample ID:** 042503818-0006B

Sample Description: FS 22/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	White	80.0%	20.0%	None Detected	

Client Sample ID: B-2-40-A **Lab Sample ID:** 042503818-0007

Sample Description: FS 23/Construction_Adhesive - Brown on paneling- White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025	Yellow	0.0%	97.0%	3% Chrysotile	

Client Sample ID: B-2-40-B **Lab Sample ID:** 042503818-0008

Sample Description: FS 23/Construction_Adhesive - Brown on paneling- White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-2-40-C **Lab Sample ID:** 042503818-0009

Sample Description: FS 23/Construction_Adhesive - Brown on paneling- White

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/06/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503818
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-2-41-A **Lab Sample ID:** 042503818-0010
Sample Description: FS 20-23/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	98.0%	2% Chrysotile	

Client Sample ID: B-2-41-B **Lab Sample ID:** 042503818-0011
Sample Description: FS 20-23/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-2-41-C **Lab Sample ID:** 042503818-0012
Sample Description: FS 20-23/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-2-42-A **Lab Sample ID:** 042503818-0013
Sample Description: FS 22/Rolled_In_Insulation - Yellow with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Yellow	95.0%	5.0%	None Detected	

Client Sample ID: B-2-42-B **Lab Sample ID:** 042503818-0014
Sample Description: FS 22/Rolled_In_Insulation - Yellow with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Yellow	95.0%	5.0%	None Detected	

Client Sample ID: B-2-42-C **Lab Sample ID:** 042503818-0015
Sample Description: FS 22/Rolled_In_Insulation - Yellow with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Brown	90.0%	10.0%	None Detected	

Client Sample ID: B-2-43-A **Lab Sample ID:** 042503818-0016
Sample Description: EA 5/Roofing_Material - Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Black	0.0%	98.0%	2% Chrysotile	

Client Sample ID: B-2-43-B **Lab Sample ID:** 042503818-0017
Sample Description: EA 5/Roofing_Material - Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503818
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-2-43-C **Lab Sample ID:** 042503818-0018
Sample Description: EA 5/Roofing_Material - Flat Roof Materials

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-2-44-A **Lab Sample ID:** 042503818-0019
Sample Description: EA 5/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Black	0.0%	85.0%	15% Chrysotile	

Client Sample ID: B-2-44-B **Lab Sample ID:** 042503818-0020
Sample Description: EA 5/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-2-44-C **Lab Sample ID:** 042503818-0021
Sample Description: EA 5/Roofing_Material - Flashing

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025					Positive Stop (Not Analyzed)

Client Sample ID: B-2-45-A **Lab Sample ID:** 042503818-0022
Sample Description: EA 5/Roofing_Material - Coping Brick

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-2-45-B **Lab Sample ID:** 042503818-0023
Sample Description: EA 5/Roofing_Material - Coping Brick

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-2-45-C **Lab Sample ID:** 042503818-0024
Sample Description: EA 5/Roofing_Material - Coping Brick

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: B-2-46-A **Lab Sample ID:** 042503818-0025
Sample Description: EA 5/Roofing_Material - Coping Seal

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503818
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: B-2-46-B **Lab Sample ID:** 042503818-0026

Sample Description: EA 5/Roofing_Material - Coping Seal

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-46-C **Lab Sample ID:** 042503818-0027

Sample Description: EA 5/Roofing_Material - Coping Seal

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-47-A **Lab Sample ID:** 042503818-0028

Sample Description: EA 5/Roofing_Material - Coping Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-47-B **Lab Sample ID:** 042503818-0029

Sample Description: EA 5/Roofing_Material - Coping Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-47-C **Lab Sample ID:** 042503818-0030

Sample Description: EA 5/Roofing_Material - Coping Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: B-2-48-A **Lab Sample ID:** 042503818-0031

Sample Description: EA 5/Exterior_Caulk - Door Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025	Gray	0.0%	98.0%	2% Chrysotile	

Client Sample ID: B-2-48-B **Lab Sample ID:** 042503818-0032

Sample Description: EA 5/Exterior_Caulk - Door Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025				Positive Stop (Not Analyzed)	

Client Sample ID: B-2-48-C **Lab Sample ID:** 042503818-0033

Sample Description: EA 5/Exterior_Caulk - Door Caulk

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/07/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503818
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Kevin Small PLM (8)
Tahirrah Steele PLM (21)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Report amended: 03/07/2025 14:36:22 Replaces initial report from: 03/07/2025 14:35:17 Reason Code: Client-Change to Appearance



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503818

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250 Country: USA	
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
	Project Information						
Project Name/No:				IC-004 - 540 Tyler (B 2nd Floor)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected:	MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name:		Keith Ventimiglia		Sampled By Signature:	Date Sample		2/27/2025 No. of Samples 33

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples ≤1% asbestos
Point Count NOB material samples ≤1% asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762203110

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
B-2-38 - A, B, C	CC	FS 20-23	Concrete - Flooring
B-2-39 - A, B, C	WB	FS 22	Wallboard - with Mud & Tape
B-2-40 - A, B, C	CA	FS 23	Construction_Adhesive - Brown on paneling- White
B-2-41 - A, B, C	WG	FS 20-23	Window_Glaze - Wood Framed Sliding Windows
B-2-42 - A, B, C	RI	FS 22	Rolled_In_Insulation - Yellow with Paper
B-2-43 - A, B, C	RM	EA 5	Roofing_Material - Flat Roof Materials
B-2-44 - A, B, C	RM	EA 5	Roofing_Material - Flashing
B-2-45 - A, B, C	RM	EA 5	Roofing_Material - Coping Brick

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED MAR - 4 2025

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

#042503818

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (2nd Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
B-2-46 - A, B, C	RM	EA 5	Roofing_Material - Coping Seal
B-2-47 - A, B, C	RM	EA 5	Roofing_Material - Coping Mortar
B-2-48 - A, B, C	EC	EA 5	Exterior_Caulk - Door Caulk

RECEIVED MAR - 4 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time

BUILDING C



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/24/2025
Received: 2/26/2025
Analyzed: 3/03/2025

Proj: IC-004 - Building C - Exterior & Basement / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-1-A-C-A-Brick **Lab Sample ID:** 042503448-0001

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-1-A-C-A-Mortar **Lab Sample ID:** 042503448-0001A

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-1-A-C-B-Brick **Lab Sample ID:** 042503448-0002

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-1-A-C-B-Mortar **Lab Sample ID:** 042503448-0002A

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-1-A-C-C-Brick **Lab Sample ID:** 042503448-0003

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-1-A-C-C-Mortar **Lab Sample ID:** 042503448-0003A

Sample Description: EA 1-4/Brick_Mortar - Exterior Facade

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-2-A-C-A **Lab Sample ID:** 042503448-0004

Sample Description: EA 1-4/Concrete - Window Sills, Concrete slab for foundation, perimeters if building

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	2/27/2025	Brown/Black	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-2-A-C-B **Lab Sample ID:** 042503448-0005

Sample Description: EA 1-4/Concrete - Window Sills, Concrete slab for foundation, perimeters if building

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Brown/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-2-A-C-C **Lab Sample ID:** 042503448-0006

Sample Description: EA 1-4/Concrete - Window Sills, Concrete slab for foundation, perimeters if building

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-3-A-C-A **Lab Sample ID:** 042503448-0007

Sample Description: EA 1-4/Exterior_Caulk - Around wood windows- 1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Brown/Black	0.0%	96.0%	4% Chrysotile	

Client Sample ID: C-Ext-3-A-C-B **Lab Sample ID:** 042503448-0008

Sample Description: EA 1-4/Exterior_Caulk - Around wood windows- 1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-Ext-3-A-C-C **Lab Sample ID:** 042503448-0009

Sample Description: EA 1-4/Exterior_Caulk - Around wood windows- 1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-Ext-4-A-C-A **Lab Sample ID:** 042503448-0010

Sample Description: EA 1-4/Exterior_Caulk - Around Aluminum Window Frames- 2nd floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/Black	0.0%	94.0%	6% Chrysotile	

Client Sample ID: C-Ext-4-A-C-B **Lab Sample ID:** 042503448-0011

Sample Description: EA 1-4/Exterior_Caulk - Around Aluminum Window Frames- 2nd floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-Ext-4-A-C-C **Lab Sample ID:** 042503448-0012

Sample Description: EA 1-4/Exterior_Caulk - Around Aluminum Window Frames- 2nd floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-5-A-C-A **Lab Sample ID:** 042503448-0013

Sample Description: EA 1-4/Window_Glaze - Wood Framed Sliding Windows-1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-5-A-C-B **Lab Sample ID:** 042503448-0014

Sample Description: EA 1-4/Window_Glaze - Wood Framed Sliding Windows-1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-5-A-C-C **Lab Sample ID:** 042503448-0015

Sample Description: EA 1-4/Window_Glaze - Wood Framed Sliding Windows-1st floor

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-6-A-C-A **Lab Sample ID:** 042503448-0016

Sample Description: EA 2 3/Glass_Block - Grout & Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-6-A-C-B **Lab Sample ID:** 042503448-0017

Sample Description: EA 2 3/Glass_Block - Grout & Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-6-A-C-C **Lab Sample ID:** 042503448-0018

Sample Description: EA 2 3/Glass_Block - Grout & Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-7-A-C-A **Lab Sample ID:** 042503448-0019

Sample Description: EA 2-4/Exterior_Caulk - Around Glass Block Windows, Exhaust Window

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/Tan	0.0%	96.0%	4% Chrysotile	

Client Sample ID: C-Ext-7-A-C-B **Lab Sample ID:** 042503448-0020

Sample Description: EA 2-4/Exterior_Caulk - Around Glass Block Windows, Exhaust Window

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-7-A-C-C **Lab Sample ID:** 042503448-0021

Sample Description: EA 2-4/Exterior_Caulk - Around Glass Block Windows, Exhaust Window

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-Ext-8-A-C-A **Lab Sample ID:** 042503448-0022

Sample Description: EA 2-3/Concrete - Concrete Slabs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-8-A-C-B **Lab Sample ID:** 042503448-0023

Sample Description: EA 2-3/Concrete - Concrete Slabs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-8-A-C-C **Lab Sample ID:** 042503448-0024

Sample Description: EA 2-3/Concrete - Concrete Slabs

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-9-A-C-A **Lab Sample ID:** 042503448-0025

Sample Description: EA 2/Exterior_Caulk - Around former bay door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-9-A-C-B **Lab Sample ID:** 042503448-0026

Sample Description: EA 2/Exterior_Caulk - Around former bay door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-9-A-C-C **Lab Sample ID:** 042503448-0027

Sample Description: EA 2/Exterior_Caulk - Around former bay door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White/Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-10-A-C-A **Lab Sample ID:** 042503448-0028

Sample Description: EA 1-4/Asphalt_Paving - Parking Lot, Approaches around perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Black	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-10-A-C-B **Lab Sample ID:** 042503448-0029
Sample Description: EA 1-4/Asphalt_Paving - Parking Lot, Approaches around perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-10-A-C-C **Lab Sample ID:** 042503448-0030
Sample Description: EA 1-4/Asphalt_Paving - Parking Lot, Approaches around perimeter

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-A-Block **Lab Sample ID:** 042503448-0031
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-A-Mortar **Lab Sample ID:** 042503448-0031A
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-B-Block **Lab Sample ID:** 042503448-0032
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray/Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-B-Mortar **Lab Sample ID:** 042503448-0032A
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-C-Block **Lab Sample ID:** 042503448-0033
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/Red	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-11-A-C-C-Mortar **Lab Sample ID:** 042503448-0033A
Sample Description: EA 4/Block_Mortar - Foundation Block with Mortar- Main Door

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-Ext-12-A-C-A **Lab Sample ID:** 042503448-0034

Sample Description: EA 3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-12-A-C-B **Lab Sample ID:** 042503448-0035

Sample Description: EA 3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-12-A-C-C **Lab Sample ID:** 042503448-0036

Sample Description: EA 3/Window_Glaze - Wood Framed Sliding Windows

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-13-A-C-A **Lab Sample ID:** 042503448-0037

Sample Description: EA 5/Roofing_Material - Shingled- Roof

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-13-A-C-B **Lab Sample ID:** 042503448-0038

Sample Description: EA 5/Roofing_Material - Shingled- Roof

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-Ext-13-A-C-C **Lab Sample ID:** 042503448-0039

Sample Description: EA 5/Roofing_Material - Shingled- Roof

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Black	19.0%	81.0%	None Detected	

Client Sample ID: C-B-14-A-C-A **Lab Sample ID:** 042503448-0040

Sample Description: FS 1/Concrete - Floor- Basement

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-14-A-C-B **Lab Sample ID:** 042503448-0041

Sample Description: FS 1/Concrete - Floor- Basement

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-14-A-C-C **Lab Sample ID:** 042503448-0042
Sample Description: FS 1/Concrete - Floor- Basement

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-A-Block **Lab Sample ID:** 042503448-0043
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-A-Mortar **Lab Sample ID:** 042503448-0043A
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-B-Block **Lab Sample ID:** 042503448-0044
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-B-Mortar **Lab Sample ID:** 042503448-0044A
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-C-Block **Lab Sample ID:** 042503448-0045
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-15-A-C-C-Mortar **Lab Sample ID:** 042503448-0045A
Sample Description: FS 1/Block_Mortar - Interior Wall Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-16-A-C-A **Lab Sample ID:** 042503448-0046
Sample Description: FS 1/Window_Glaze - Wood Framed Sliding Windows-Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-16-A-C-B **Lab Sample ID:** 042503448-0047

Sample Description: FS 1/Window_Glaze - Wood Framed Sliding Windows-Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-B-16-A-C-C **Lab Sample ID:** 042503448-0048

Sample Description: FS 1/Window_Glaze - Wood Framed Sliding Windows-Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-B-17-A-E-A **Lab Sample ID:** 042503448-0049

Sample Description: FS 1,7-8,11/Plaster - Plaster over Terra- Cotta Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-17-A-E-B **Lab Sample ID:** 042503448-0050

Sample Description: FS 1,7-8,11/Plaster - Plaster over Terra- Cotta Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/Tan	0.0%	100.0%	None Detected	

Client Sample ID: C-B-17-A-E-C **Lab Sample ID:** 042503448-0051

Sample Description: FS 1,7-8,11/Plaster - Plaster over Terra- Cotta Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-17-A-E-D **Lab Sample ID:** 042503448-0052

Sample Description: FS 1,7-8,11/Plaster - Plaster over Terra- Cotta Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-17-A-E-E **Lab Sample ID:** 042503448-0053

Sample Description: FS 1,7-8,11/Plaster - Plaster over Terra- Cotta Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-18-A-C-A **Lab Sample ID:** 042503448-0054

Sample Description: FS 1,7,11/Gasket_Material - Pipe Valves

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray/Tan	0.0%	50.0%	50% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-18-A-C-B **Lab Sample ID:** 042503448-0055
Sample Description: FS 1,7,11/Gasket_Material - Pipe Valves

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-B-18-A-C-C **Lab Sample ID:** 042503448-0056
Sample Description: FS 1,7,11/Gasket_Material - Pipe Valves

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-B-19-A-C-A **Lab Sample ID:** 042503448-0057
Sample Description: FS 11/Tank_Insulation - Fiberglass with Foil- Tank 1

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/White/Yellow	40.0%	60.0%	None Detected	

Client Sample ID: C-B-19-A-C-B **Lab Sample ID:** 042503448-0058
Sample Description: FS 11/Tank_Insulation - Fiberglass with Foil- Tank 1

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/White/Yellow	40.0%	60.0%	None Detected	

Client Sample ID: C-B-19-A-C-C **Lab Sample ID:** 042503448-0059
Sample Description: FS 11/Tank_Insulation - Fiberglass with Foil- Tank 1

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/White/Yellow	85.0%	15.0%	None Detected	

Client Sample ID: C-B-20-A-C-A **Lab Sample ID:** 042503448-0060
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 2

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	White	0.0%	81.0%	19% Chrysotile	

Client Sample ID: C-B-20-A-C-B **Lab Sample ID:** 042503448-0061
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 2

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-B-20-A-C-C **Lab Sample ID:** 042503448-0062
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 2

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025					Positive Stop (Not Analyzed)



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-21-A-C-A **Lab Sample ID:** 042503448-0063
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 3

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	70.0%	30.0%	None Detected	

Client Sample ID: C-B-21-A-C-B **Lab Sample ID:** 042503448-0064
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 3

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	70.0%	30.0%	None Detected	

Client Sample ID: C-B-21-A-C-C **Lab Sample ID:** 042503448-0065
Sample Description: FS 1/Tank_Insulation - Fiberglass with Foil Paper- Tank 3

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: C-B-22-A-C-A **Lab Sample ID:** 042503448-0066
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	82.0%	18% Amosite	

Client Sample ID: C-B-22-A-C-B **Lab Sample ID:** 042503448-0067
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	Not homogeneous to sample A

Client Sample ID: C-B-22-A-C-C **Lab Sample ID:** 042503448-0068
Sample Description: FS 1-11/Concrete - Foundation Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-B-23-A-C-A **Lab Sample ID:** 042503448-0069
Sample Description: FS 1-2/Pipe_Insulation - 10"Mag Block Type Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-23-A-C-B **Lab Sample ID:** 042503448-0070
Sample Description: FS 1-2/Pipe_Insulation - 10"Mag Block Type Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/27/2025	Gray	0.0%	52.0%	48% Amosite	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-23-A-C-C **Lab Sample ID:** 042503448-0071

Sample Description: FS 1-2/Pipe_Insulation - 10"Mag Block Type Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-B-24-A-C-A **Lab Sample ID:** 042503448-0072

Sample Description: FS 1-11/Pipe_Fitting - Mudded on Corrugated Paper Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan	50.0%	50.0%	None Detected	

Client Sample ID: C-B-24-A-C-B **Lab Sample ID:** 042503448-0073

Sample Description: FS 1-11/Pipe_Fitting - Mudded on Corrugated Paper Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/Yellow	60.0%	40.0%	None Detected	

Client Sample ID: C-B-24-A-C-C **Lab Sample ID:** 042503448-0074

Sample Description: FS 1-11/Pipe_Fitting - Mudded on Corrugated Paper Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	60.0%	30% Amosite 10% Chrysotile	

Client Sample ID: C-B-25-A-C-A **Lab Sample ID:** 042503448-0075

Sample Description: FS 1- 2/Pipe_Insulation - 8" Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/Yellow	70.0%	30.0%	None Detected	

Client Sample ID: C-B-25-A-C-B **Lab Sample ID:** 042503448-0076

Sample Description: FS 1- 2/Pipe_Insulation - 8" Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/Yellow	40.0%	60.0%	None Detected	

Client Sample ID: C-B-25-A-C-C **Lab Sample ID:** 042503448-0077

Sample Description: FS 1- 2/Pipe_Insulation - 8" Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White/Yellow	60.0%	40.0%	None Detected	

Client Sample ID: C-B-26-A-C-A **Lab Sample ID:** 042503448-0078

Sample Description: FS 1- 2/Pipe_Insulation - 6" Fiberglass with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Red/Yellow	40.0%	60.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-26-A-C-B **Lab Sample ID:** 042503448-0079

Sample Description: FS 1- 2/Pipe_Insulation - 6" Fiberglass with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan/Yellow	40.0%	60.0%	None Detected	

Client Sample ID: C-B-26-A-C-C **Lab Sample ID:** 042503448-0080

Sample Description: FS 1- 2/Pipe_Insulation - 6" Fiberglass with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Yellow	40.0%	60.0%	None Detected	

Client Sample ID: C-B-27-A-C-A-Brick **Lab Sample ID:** 042503448-0081

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan	0.0%	100.0%	None Detected	

Client Sample ID: C-B-27-A-C-A-Mortar **Lab Sample ID:** 042503448-0081A

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-27-A-C-B-Brick **Lab Sample ID:** 042503448-0082

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-B-27-A-C-B-Mortar **Lab Sample ID:** 042503448-0082A

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-27-A-C-C-Brick **Lab Sample ID:** 042503448-0083

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-B-27-A-C-C-Mortar **Lab Sample ID:** 042503448-0083A

Sample Description: FS 1,3-7/Brick_Mortar - Interior Columns and walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-28-A-C-A-Floor Tile **Lab Sample ID:** 042503448-0084

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-28-A-C-A-Glue **Lab Sample ID:** 042503448-0084A

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-28-A-C-B-Floor Tile **Lab Sample ID:** 042503448-0085

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-28-A-C-B-Glue **Lab Sample ID:** 042503448-0085A

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-28-A-C-C-Floor Tile **Lab Sample ID:** 042503448-0086

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-28-A-C-C-Mastic **Lab Sample ID:** 042503448-0086A

Sample Description: FS 4/Flooring - 12X12 Floor Tile with Glue- Gray

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-B-29-A-C-A-Flooring **Lab Sample ID:** 042503448-0087

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-B-29-A-C-A-Adhesive **Lab Sample ID:** 042503448-0087A

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Yellow	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-29-A-C-B-Flooring **Lab Sample ID:** 042503448-0088

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-B-29-A-C-B-Adhesive **Lab Sample ID:** 042503448-0088A

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-B-29-A-C-C-Flooring **Lab Sample ID:** 042503448-0089

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-B-29-A-C-C-Adhesive **Lab Sample ID:** 042503448-0089A

Sample Description: FS 4/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-B-30-A-C-A-Floor Tile **Lab Sample ID:** 042503448-0090

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-30-A-C-A-Mastic **Lab Sample ID:** 042503448-0090A

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-B-30-A-C-B-Floor Tile **Lab Sample ID:** 042503448-0091

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-30-A-C-B-Mastic **Lab Sample ID:** 042503448-0091A

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Tan	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-30-A-C-C-Floor Tile **Lab Sample ID:** 042503448-0092

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-30-A-C-C-Mastic **Lab Sample ID:** 042503448-0092A

Sample Description: FS 6/Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-A-Wallboard **Lab Sample ID:** 042503448-0093

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-A-Mud **Lab Sample ID:** 042503448-0093A

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-A-Tape **Lab Sample ID:** 042503448-0093B

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	98.0%	2.0%	None Detected	

Client Sample ID: C-B-31-A-C-B-Wallboard **Lab Sample ID:** 042503448-0094

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-B-Mud **Lab Sample ID:** 042503448-0094A

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-B-Tape **Lab Sample ID:** 042503448-0094B

Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	White	98.0%	2.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-31-A-C-C-Wallboard **Lab Sample ID:** 042503448-0095
Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-C-Mud **Lab Sample ID:** 042503448-0095A
Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-B-31-A-C-C-Tape **Lab Sample ID:** 042503448-0095B
Sample Description: FS 6/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	80.0%	20.0%	None Detected	

Client Sample ID: C-B-32-A-C-A **Lab Sample ID:** 042503448-0096
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	98.0%	2.0%	None Detected	

Client Sample ID: C-B-32-A-C-B **Lab Sample ID:** 042503448-0097
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	98.0%	2.0%	None Detected	

Client Sample ID: C-B-32-A-C-C **Lab Sample ID:** 042503448-0098
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	95.0%	5.0%	None Detected	

Client Sample ID: C-B-33-A-C-A **Lab Sample ID:** 042503448-0099
Sample Description: FS 1/Pipe_Insulation - Duplex pipe insulation debris

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Brown	98.0%	2.0%	None Detected	

Client Sample ID: C-B-33-A-C-B **Lab Sample ID:** 042503448-0100
Sample Description: FS 1/Pipe_Insulation - Duplex pipe insulation debris

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Brown	98.0%	2.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-33-A-C-C **Lab Sample ID:** 042503448-0101
Sample Description: FS 1/Pipe_Insulation - Duplex pipe insulation debris

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	98.0%	2.0%	None Detected	

Client Sample ID: C-B-34-A-C-A **Lab Sample ID:** 042503448-0102
Sample Description: FS 1/Boiler_Insulation - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	98.0%	2.0%	None Detected	

Client Sample ID: C-B-34-A-C-B **Lab Sample ID:** 042503448-0103
Sample Description: FS 1/Boiler_Insulation - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	98.0%	2.0%	None Detected	

Client Sample ID: C-B-34-A-C-C **Lab Sample ID:** 042503448-0104
Sample Description: FS 1/Boiler_Insulation - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	95.0%	5.0%	None Detected	

Client Sample ID: C-B-35-A-C-A **Lab Sample ID:** 042503448-0105
Sample Description: FS 1/Fire_Brick - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-35-A-C-B **Lab Sample ID:** 042503448-0106
Sample Description: FS 1/Fire_Brick - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-35-A-C-C **Lab Sample ID:** 042503448-0107
Sample Description: FS 1/Fire_Brick - Boiler Interior

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-B-36-A-C-A **Lab Sample ID:** 042503448-0108
Sample Description: FS 1/Boiler Cap - Insulating Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	30.0%	70.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-36-A-C-B **Lab Sample ID:** 042503448-0109
Sample Description: FS 1/Boiler Cap - Insulating Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	25.0%	75.0%	None Detected	

Client Sample ID: C-B-36-A-C-C **Lab Sample ID:** 042503448-0110
Sample Description: FS 1/Boiler Cap - Insulating Material

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	35.0%	65.0%	None Detected	

Client Sample ID: C-B-37-A-C-A **Lab Sample ID:** 042503448-0111
Sample Description: FS 1/Gasket_Material - Boiler Door Gaskets

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	40.0%	60% Chrysotile	

Client Sample ID: C-B-37-A-C-B **Lab Sample ID:** 042503448-0112
Sample Description: FS 1/Gasket_Material - Boiler Door Gaskets

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-B-37-A-C-C **Lab Sample ID:** 042503448-0113
Sample Description: FS 1/Gasket_Material - Boiler Door Gaskets

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-B-38-A-C-A **Lab Sample ID:** 042503448-0114
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	70.0%	30% Amosite	

Client Sample ID: C-B-38-A-C-B **Lab Sample ID:** 042503448-0115
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-B-38-A-C-C **Lab Sample ID:** 042503448-0116
Sample Description: FS 1/Boiler_Insulation - Fiberglass with Foil

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503448
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-B-39-A-C-A

Lab Sample ID: 042503448-0117

Sample Description: FS 1/Duct_Insulation - Fibrous Paper on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025	Gray	0.0%	75.0%	25% Amosite	

Client Sample ID: C-B-39-A-C-B

Lab Sample ID: 042503448-0118

Sample Description: FS 1/Duct_Insulation - Fibrous Paper on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-B-39-A-C-C

Lab Sample ID: 042503448-0119

Sample Description: FS 1/Duct_Insulation - Fibrous Paper on Ducts

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	2/28/2025					Positive Stop (Not Analyzed)

Analyst(s):

Allen Kuestner PLM (34)
Kevin Small PLM (45)
Tahirrah Steele PLM (48)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/03/2025 13:23:19



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503448

PHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country: USA	City, State, Zip:	Indianapolis, IN 46250	Country: USA	
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
	Project Information						
Project Name/No:				IC-004 - (Building C- Exterior & Basement)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample	2/24/2025	No. of Samples	119

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples ≤1% asbestos
Point Count NOB material samples ≤1% asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762199673

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
C-Ext-1-A-C - A, B, C	BM	EA 1-4	Brick_Mortar - Exterior Facade
C-Ext-2-A-C - A, B, C	CC	EA 1-4	Concrete - Window Sills, Concrete slab for foundation, perimeters if building
C-Ext-3-A-C - A, B, C	EC	EA 1-4	Exterior_Caulk - Around wood windows- 1st floor
C-Ext-4-A-C - A, B, C	EC	EA 1-4	Exterior_Caulk - Around Aluminum Window Frames- 2nd floor
C-Ext-5-A-C - A, B, C	WG	EA 1-4	Window_Glaze - Wood Framed Sliding Windows-1st floor
C-Ext-6-A-C - A, B, C	GB	EA 2 3	Glass_Block - Grout & Mortar
C-Ext-7-A-C - A, B, C	EC	EA 2-4	Exterior_Caulk - Around Glass Block Windows, Exhaust Window
C-Ext-8-A-C - A, B, C	CC	EA 2-3	Concrete - Concrete Slabs

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED FEB 26 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503448

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - (Building C- Exterior & Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
C-Ext-9-A-C - A, B, C	EC	EA 2	Exterior_Caulk - Around former bay door
C-Ext-10-A-C - A, B, C	ASP	EA 1-4	Asphalt_Paving - Parking Lot, Approaches around perimeter
C-Ext-11-A-C - A, B, C	BM	EA 4	Block_Mortar - Foundation Block with Mortar- Main Door
C-Ext-12-A-C - A, B, C	WG	EA 3	Window_Glaze - Wood Framed Sliding Windows
C-Ext-13-A-C - A, B, C	RM	EA 5	Roofing_Material - Shingled- Roof
C-B-14-A-C - A, B, C	CC	FS 1	Concrete - Floor- Basement
C-B-15-A-C - A, B, C	BM	FS 1	Block_Mortar - Interior Wall Block with Mortar
C-B-16-A-C - A, B, C	WG	FS 1	Window_Glaze - Wood Framed Sliding Windows-Interior
C-B-177-A-E - A, B, C, D, E	PL	FS 1,7-8,11	Plaster - Plaster over Terra- Cotta Walls
C-B-18-A-C - A, B, C	GM	FS 1,7,11	Gasket_Material - Pipe Valves
C-B-19-A-C - A, B, C	TI	FS 11	Tank_Insulation - Fiberglass with Foil- Tank 1
C-B-20-A-C - A, B, C	TI	FS 1	Tank_Insulation - Fiberglass with Foil Paper- Tank 2
C-B-21-A-C - A, B, C	TI	FS 1	Tank_Insulation - Fiberglass with Foil Paper- Tank 3
C-B-22-A-C - A, B, C	CC	FS 1-11	Concrete - Foundation Walls
C-B-23-A-C - A, B, C	PI	FS 1-2	Pipe_Insulation - 10"Mag Block Type Insulation
C-B-24-A-C - A, B, C	PF	FS 1-11	Pipe_Fitting - Mudded on Corrugated Paper Pipe Insulation
C-B-25-A-C - A, B, C	PI	FS 1-2	Pipe_Insulation - 8" Fiberglass with Foil
C-B-26-A-C - A, B, C	PI	FS 1-2	Pipe_Insulation - 6" Fiberglass with Paper
C-B-27-A-C - A, B, C	BM	FS 1,3-7	Brick_Mortar - Interior Columns and walls
C-B-28-A-C - A, B, C	FLM	FS 4	Flooring - 12X12 Floor Tile with Glue- Gray
C-B-29-A-C - A, B, C	FLM	FS 4	Flooring - Stair Treads & Adhesives
C-B-30-A-C - A, B, C	FLM	FS 6	Flooring - 12X12 Floor Tile with Glue, Gray with White Splotchess
C-B-31-A-C - A, B, C	WB	FS 6	Wallboard - with Mud & Tape
C-B-32-A-C - A, B, C	BI	FS 1	Boiler_Insulation - Fiberglass with Foil
C-B-33 A-C - A, B, C	PI	FS 1	Pipe_Insulation - Duplex pipe insulation debris

RECEIVED FEB 26 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

#042503448

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - (Building C- Exterior & Basement)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
C-B-34-A-C - A, B, C	BI	FS 1	Boiler_Insulation - Boiler Interior
C-B-35-A-C - A, B, C	FB	FS 1	Fire_Brick - Boiler Interior
C-B-36-A-C - A, B, C	#N/A	FS 1	Boiler Cap - Insulating Material
C-B-37-A-C - A, B, C	GM	FS 1	Gasket_Material - Boiler Door Gaskets
C-B-38-A-C - A, B, C	BI	FS 1	Boiler_Insulation - Fiberglass with Foil
C-B-39-A-C - A, B, C	DI	FS 1	Duct_Insulation - Fibrous Paper on Ducts
(assumed - no sample)	PI	FS 1-11	Pipe_Insulation - Misc Debris
(assumed - no sample)	VI	EA 4	Vermiculite - Assumed - No Sample
-	(material)	0	-
-	(material)	0	-
-	(material)	0	-

RECEIVED FEB 26 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/25/2025
Received: 2/27/2025
Analyzed: 3/04/2025

Proj: IC-004 - 540 Tyler (1st Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-40-A-Floor Tile **Lab Sample ID:** 042503556-0001

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-40-A-Mastic

Lab Sample ID: 042503556-0001A

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	97.0%	3% Chrysotile	

Client Sample ID: C-1-40-B-Floor Tile

Lab Sample ID: 042503556-0002

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-40-B-Mastic

Lab Sample ID: 042503556-0002A

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-1-40-C-Floor Tile

Lab Sample ID: 042503556-0003

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	98.0%	2% Chrysotile	40C (floor tile) is not homogenous to 40A and 40B

Client Sample ID: C-1-40-C-Mastic

Lab Sample ID: 042503556-0003A

Sample Description: FS 36-39/Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-1-41-A

Lab Sample ID: 042503556-0004

Sample Description: FS 37-38/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown/Gray/Tan	20.0%	80.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-41-B **Lab Sample ID:** 042503556-0005

Sample Description: FS 37-38/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown/Gray/Tan	20.0%	80.0%	None Detected	

Client Sample ID: C-1-41-C **Lab Sample ID:** 042503556-0006

Sample Description: FS 37-38/Flooring - Carpet Glue Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown/Gray/Tan	23.0%	77.0%	None Detected	

Client Sample ID: C-1-42-A **Lab Sample ID:** 042503556-0007

Sample Description: FS 34-43/Concrete - Floors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-42-B **Lab Sample ID:** 042503556-0008

Sample Description: FS 34-43/Concrete - Floors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-42-C **Lab Sample ID:** 042503556-0009

Sample Description: FS 34-43/Concrete - Floors

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-43-A-Block **Lab Sample ID:** 042503556-0010

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-43-A-Mortar **Lab Sample ID:** 042503556-0010A

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-43-B-Block **Lab Sample ID:** 042503556-0011

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnaslab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-43-B-Mortar **Lab Sample ID:** 042503556-0011A

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-43-C-Block **Lab Sample ID:** 042503556-0012

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-43-C-Mortar **Lab Sample ID:** 042503556-0012A

Sample Description: FS 34-43/Block_Mortar - Interior Ceiling Block with Mortar

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-44-A **Lab Sample ID:** 042503556-0013

Sample Description: FS 37/Window_Glaze - Wood Framed Sliding Windows- Interior Wood

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-44-B **Lab Sample ID:** 042503556-0014

Sample Description: FS 37/Window_Glaze - Wood Framed Sliding Windows- Interior Wood

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-44-C **Lab Sample ID:** 042503556-0015

Sample Description: FS 37/Window_Glaze - Wood Framed Sliding Windows- Interior Wood

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-45-A-Floor Tile **Lab Sample ID:** 042503556-0016

Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	98.0%	2% Chrysotile	

Client Sample ID: C-1-45-A-Mastic **Lab Sample ID:** 042503556-0016A

Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	96.0%	4% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-45-B-Floor Tile **Lab Sample ID:** 042503556-0017
Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-45-B-Mastic **Lab Sample ID:** 042503556-0017A
Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-45-C-Floor Tile **Lab Sample ID:** 042503556-0018
Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-45-C-Mastic **Lab Sample ID:** 042503556-0018A
Sample Description: FS 41/Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-46-A **Lab Sample ID:** 042503556-0019
Sample Description: FS 37/Interior_Caulk - Windows, Door openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray/White	0.0%	97.0%	3% Chrysotile	

Client Sample ID: C-1-46-B **Lab Sample ID:** 042503556-0020
Sample Description: FS 37/Interior_Caulk - Windows, Door openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-46-C **Lab Sample ID:** 042503556-0021
Sample Description: FS 37/Interior_Caulk - Windows, Door openings

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-1-47-A-Brick **Lab Sample ID:** 042503556-0022
Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Red	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-47-A-Mortar **Lab Sample ID:** 042503556-0022A

Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-47-B-Brick **Lab Sample ID:** 042503556-0023

Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-1-47-B-Mortar **Lab Sample ID:** 042503556-0023A

Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-47-C-Brick **Lab Sample ID:** 042503556-0024

Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-1-47-C-Mortar **Lab Sample ID:** 042503556-0024A

Sample Description: FS 4,33-43/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-48-A-Cove Base **Lab Sample ID:** 042503556-0025

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-1-48-A-Mastic **Lab Sample ID:** 042503556-0025A

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-1-48-B-Cove Base **Lab Sample ID:** 042503556-0026

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-48-B-Mastic **Lab Sample ID:** 042503556-0026A

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-1-48-C-Cove Base **Lab Sample ID:** 042503556-0027

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-1-48-C-Mastic **Lab Sample ID:** 042503556-0027A

Sample Description: FS 36-38,41/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-1-49-A **Lab Sample ID:** 042503556-0028

Sample Description: FS 39/Flooring - Linoleum with Paper Backing on work bench

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-49-B **Lab Sample ID:** 042503556-0029

Sample Description: FS 39/Flooring - Linoleum with Paper Backing on work bench

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-49-C **Lab Sample ID:** 042503556-0030

Sample Description: FS 39/Flooring - Linoleum with Paper Backing on work bench

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-50-A-Ceramic Tile **Lab Sample ID:** 042503556-0031

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-50-A-Grout **Lab Sample ID:** 042503556-0031A

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-50-B-Ceramic Tile **Lab Sample ID:** 042503556-0032

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-50-B-Grout **Lab Sample ID:** 042503556-0032A

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-50-C-Ceramic Tile **Lab Sample ID:** 042503556-0033

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-50-C-Grout **Lab Sample ID:** 042503556-0033A

Sample Description: FS 38/Ceramic_Tile_with_Grout- Beige - Storage Area

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-51-A **Lab Sample ID:** 042503556-0034

Sample Description: FS 38/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: C-1-51-B **Lab Sample ID:** 042503556-0035

Sample Description: FS 38/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	30.0%	70.0%	None Detected	

Client Sample ID: C-1-51-C **Lab Sample ID:** 042503556-0036

Sample Description: FS 38/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	42.0%	58.0%	None Detected	

Client Sample ID: C-1-52-A **Lab Sample ID:** 042503556-0037

Sample Description: FS 33-43/Pipe_Insulation - Fiberglass with Cloth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	70.0%	30.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-52-B **Lab Sample ID:** 042503556-0038

Sample Description: FS 33-43/Pipe_Insulation - Fiberglass with Cloth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: C-1-52-C **Lab Sample ID:** 042503556-0039

Sample Description: FS 33-43/Pipe_Insulation - Fiberglass with Cloth

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	79.0%	21.0%	None Detected	

Client Sample ID: C-1-53-A **Lab Sample ID:** 042503556-0040

Sample Description: FS 33-43/Pipe_Fitting - Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: C-1-53-B **Lab Sample ID:** 042503556-0041

Sample Description: FS 33-43/Pipe_Fitting - Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	60.0%	40.0%	None Detected	

Client Sample ID: C-1-53-C **Lab Sample ID:** 042503556-0042

Sample Description: FS 33-43/Pipe_Fitting - Mudded on Fiberglass with Cloth Pipe Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	70.0%	30.0%	None Detected	

Client Sample ID: C-1-54-A **Lab Sample ID:** 042503556-0043

Sample Description: FS 34,37/Pipe_Insulation - Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown/Gray/Black	0.0%	85.0%	15% Chrysotile	

Client Sample ID: C-1-54-B **Lab Sample ID:** 042503556-0044

Sample Description: FS 34,37/Pipe_Insulation - Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-1-54-C **Lab Sample ID:** 042503556-0045

Sample Description: FS 34,37/Pipe_Insulation - Duplex Insulation

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503556
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-1-55-A-Base Coat **Lab Sample ID:** 042503556-0046

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-55-A-Skim Coat **Lab Sample ID:** 042503556-0046A

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-55-B-Base Coat **Lab Sample ID:** 042503556-0047

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh
Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-55-B-Skim Coat **Lab Sample ID:** 042503556-0047A

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh
Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-1-55-C-Base Coat **Lab Sample ID:** 042503556-0048

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-1-55-C-Skim Coat **Lab Sample ID:** 042503556-0048A

Sample Description: FS 4,33-36/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503556
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Allen Kuestner PLM (41)
Tahirrah Steele PLM (18)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/04/2025 14:37:11



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503556

PHONE (800) 220-3675
EMAIL CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250	Country:
Phone:	(248) 863-2934		Phone:	(248) 863-2762			
Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com			
Project Information							
Project Name/No:				IC-004 - 540 Tyler (1st Floor)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☒ Residential (Non-Taxable)	
Sampled By Name:		Keith Ventimiglia		Sampled By Signature:		Date Sample	2/25/2025
						No. of Samples	48

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)
☒ PLM EPA 600/R-93/116 (<1%)

TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762202434

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
C-1-40 - A, B, C	FLM	FS 36-39	Flooring - 12X12 Floor Tile with Mastic- White with Brown Speckles
C-1-41 - A, B, C	FLM	FS 37-38	Flooring - Carpet Glue Yellow
C-1-42 - A, B, C	CC	FS 34-43	Concrete - Floors
C-1-43 - A, B, C	BM	FS 34-43	Block_Mortar - Interior Ceiling Block with Mortar
C-1-44 - A, B, C	WG	FS 37	Window_Glaze - Wood Framed Sliding Windows- Interior Wood
C-1-45 - A, B, C	FLM	FS 41	Flooring - 12X12 Floor Tile with Mastic- Brown with Beige Speckles
C-1-46 - A, B, C	IC	FS 37	Interior_Caulk - Windows, Door openings
C-1-47 - A, B, C	BM	FS 4,33-43	Brick_Mortar - Interior Walls

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED FEB 27 2025



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503556

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (1st Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
C-1-48 - A, B, C	CB	FS 36-38,41	Cove_Base - with Adhesive
C-1-49 - A, B, C	FLM	FS 39	Flooring - Linoleum with Paper Backing on work bench
C-1-50 - A, B, C	#N/A	FS 38	Ceramic_Tile_with_Grout- Beige - Storage Area
C-1-5 - A, B, C	CP	FS 38	Ceiling_Panel - 2X4, White with Indentations
C-1-52 - A, B, C	PI	FS 33-43	Pipe_Insulation - Fiberglass with Cloth
C-1-53 - A, B, C	PF	FS 33-43	Pipe_Fitting - Mudded on Fiberglass with Cloth Pipe Insulation
C-1-54 - A, B, C	PI	FS 34,37	Pipe_Insulation - Duplex Insulation
C-1-55 - A, B, C	PL	FS 4,33-36	Plaster - Skim & Base Coat Ceilings on Wire Mesh
-	(material)	0	-
-	(material)	0	-

RECEIVED FEB 27 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/25/2025
Received: 2/27/2025
Analyzed: 3/04/2025

Proj: IC-004 - 540 Tyler (2nd Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-56-A-Base Coat **Lab Sample ID:** 042503554-0001

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-A-Skim Coat **Lab Sample ID:** 042503554-0001A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-B-Base Coat **Lab Sample ID:** 042503554-0002

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-B-Skim Coat **Lab Sample ID:** 042503554-0002A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-C-Base Coat **Lab Sample ID:** 042503554-0003

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-C-Skim Coat **Lab Sample ID:** 042503554-0003A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-D-Base Coat **Lab Sample ID:** 042503554-0004

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed	Color	Non-Asbestos		Asbestos	Comment
	Date		Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-56-D-Skim Coat **Lab Sample ID:** 042503554-0004A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-E-Base Coat **Lab Sample ID:** 042503554-0005

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-56-E-Skim Coat **Lab Sample ID:** 042503554-0005A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-57-A-Floor Tile **Lab Sample ID:** 042503554-0006

Sample Description: FS 16- 17,19,21/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	97.0%	3% Chrysotile	

Client Sample ID: C-2-57-A-Mastic **Lab Sample ID:** 042503554-0006A

Sample Description: FS 16- 17,19,21/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	95.0%	5% Chrysotile	

Client Sample ID: C-2-57-B **Lab Sample ID:** 042503554-0007

Sample Description: FS 16- 17,19,21/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-2-57-C **Lab Sample ID:** 042503554-0008

Sample Description: FS 16- 17,19,21/Flooring - 12X12 Floor Tile with Mastic- Beige with Brown

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-2-58-A-Cove Base **Lab Sample ID:** 042503554-0009

Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-58-A-Mastic **Lab Sample ID:** 042503554-0009A
Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-58-B-Cove Base **Lab Sample ID:** 042503554-0010
Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-2-58-B-Mastic **Lab Sample ID:** 042503554-0010A
Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-58-C-Cove Base **Lab Sample ID:** 042503554-0011
Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-2-58-C-Mastic **Lab Sample ID:** 042503554-0011A
Sample Description: FS 17,25,16,/Cove_Base - with Adhesive

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-59-A **Lab Sample ID:** 042503554-0012
Sample Description: FS 9,13, 18,20,22,26,/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-59-B **Lab Sample ID:** 042503554-0013
Sample Description: FS 9,13, 18,20,22,26,/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray/White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-59-C **Lab Sample ID:** 042503554-0014
Sample Description: FS 9,13, 18,20,22,26,/Flooring - Terrazzo

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-60-A **Lab Sample ID:** 042503554-0015

Sample Description: FS 13-28/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	93.0%	7.0%	None Detected	

Client Sample ID: C-2-60-B **Lab Sample ID:** 042503554-0016

Sample Description: FS 13-28/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	92.0%	8.0%	None Detected	

Client Sample ID: C-2-60-C **Lab Sample ID:** 042503554-0017

Sample Description: FS 13-28/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	80.0%	20.0%	None Detected	

Client Sample ID: C-2-61-A-Linoleum **Lab Sample ID:** 042503554-0018

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-61-A-Paper Backing **Lab Sample ID:** 042503554-0018A

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	85.0%	15.0%	None Detected	

Client Sample ID: C-2-61-B-Linoleum **Lab Sample ID:** 042503554-0019

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-61-B-Paper Backing **Lab Sample ID:** 042503554-0019A

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	85.0%	15.0%	None Detected	

Client Sample ID: C-2-61-C-Linoleum **Lab Sample ID:** 042503554-0020

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-61-C-Paper backing **Lab Sample ID:** 042503554-0020A

Sample Description: FS 14-15/Flooring - Linoleum with Paper Backing- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Black	80.0%	20.0%	None Detected	

Client Sample ID: C-2-62-A-Stair Tread **Lab Sample ID:** 042503554-0021

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-62-A-Adhesive **Lab Sample ID:** 042503554-0021A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-2-62-B-Stair Tread **Lab Sample ID:** 042503554-0022

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-62-B-Adhesive **Lab Sample ID:** 042503554-0022A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-2-62-C-Stair Tread **Lab Sample ID:** 042503554-0023

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-62-C-Adhesive **Lab Sample ID:** 042503554-0023A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-2-63-A **Lab Sample ID:** 042503554-0024

Sample Description: FS 13/Pipe_Insulation - Corrugated Paper (AirCell)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	85.0%	15% Chrysotile	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-63-B **Lab Sample ID:** 042503554-0025

Sample Description: FS 13/Pipe_Insulation - Corrugated Paper (AirCell)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-2-63-C **Lab Sample ID:** 042503554-0026

Sample Description: FS 13/Pipe_Insulation - Corrugated Paper (AirCell)

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025					Positive Stop (Not Analyzed)

Client Sample ID: C-2-64-A-Wallboard **Lab Sample ID:** 042503554-0027

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-A-Mud **Lab Sample ID:** 042503554-0027A

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-A-Tape **Lab Sample ID:** 042503554-0027B

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	60.0%	40.0%	None Detected	

Client Sample ID: C-2-64-B-Wallboard **Lab Sample ID:** 042503554-0028

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-B-Mud **Lab Sample ID:** 042503554-0028A

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-B-Tape **Lab Sample ID:** 042503554-0028B

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	60.0%	40.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-64-C-Wallboard **Lab Sample ID:** 042503554-0029

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-C-Mud **Lab Sample ID:** 042503554-0029A

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-64-C-Tape **Lab Sample ID:** 042503554-0029B

Sample Description: FS 23-25/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	50.0%	50.0%	None Detected	

Client Sample ID: C-2-65-A-Skim Coat **Lab Sample ID:** 042503554-0030

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-A-Base Coat **Lab Sample ID:** 042503554-0030A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-B-Skim Coat **Lab Sample ID:** 042503554-0031

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-B-Base Coat **Lab Sample ID:** 042503554-0031A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-C-Skim Coat **Lab Sample ID:** 042503554-0032

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-65-C-Base Coat **Lab Sample ID:** 042503554-0032A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-D-Skim Coat **Lab Sample ID:** 042503554-0033

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-D-Base Coat **Lab Sample ID:** 042503554-0033A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-E-Skim Coat **Lab Sample ID:** 042503554-0034

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-2-65-E-Base Coat **Lab Sample ID:** 042503554-0034A

Sample Description: FS 13-28/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-2-66-A **Lab Sample ID:** 042503554-0035

Sample Description: FS 17/Transite - Transite Table

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	90.0%	10% Chrysotile	

Client Sample ID: C-2-66-B **Lab Sample ID:** 042503554-0036

Sample Description: FS 17/Transite - Transite Table

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	

Client Sample ID: C-2-66-C **Lab Sample ID:** 042503554-0037

Sample Description: FS 17/Transite - Transite Table

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025				Positive Stop (Not Analyzed)	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503554
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-2-67-A **Lab Sample ID:** 042503554-0038

Sample Description: FS 23/Rolled_In_Insulation - Pink with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Pink	98.0%	2.0%	None Detected	

Client Sample ID: C-2-67-B **Lab Sample ID:** 042503554-0039

Sample Description: FS 23/Rolled_In_Insulation - Pink with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Pink	98.0%	2.0%	None Detected	

Client Sample ID: C-2-67-C **Lab Sample ID:** 042503554-0040

Sample Description: FS 23/Rolled_In_Insulation - Pink with Paper

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Pink	98.0%	2.0%	None Detected	

Client Sample ID: C-2-68-A **Lab Sample ID:** 042503554-0041

Sample Description: FS 23-25/Construction_Adhesive - Brown on Wallboard walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-68-B **Lab Sample ID:** 042503554-0042

Sample Description: FS 23-25/Construction_Adhesive - Brown on Wallboard walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	

Client Sample ID: C-2-68-C **Lab Sample ID:** 042503554-0043

Sample Description: FS 23-25/Construction_Adhesive - Brown on Wallboard walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/04/2025	Yellow	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503554
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Allen Kuestner PLM (21)
Tahirrah Steele PLM (42)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/04/2025 14:33:07



Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

#042503554

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250 Country: USA	
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
	Project Information						
Project Name/No:				IC-004 - 540 Tyler (2nd Floor)		Purchase Order:	240100-RDA Program
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN		State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)	
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample	2/25/2025	No. of Samples	43

Turn-Around-Time (TAT)

☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples $\leq 1\%$ asbestos
Point Count NOB material samples $\leq 1\%$ asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 28576220243

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
C-2-56 - A, B, C, D, E	PL	FS 13-28	Plaster - Skim & Base Coat Ceilings and Walls on Brick/Block
C-2-57 - A, B, C	FLM	FS 16- 17,19,21	Flooring - 12X12 Floor Tile with Mastic- Beige with Brown
C-2-58 - A, B, C	CB	FS 17,25,16,	Cove_Base - with Adhesive
C-2-59 - A, B, C	FLM	FS 9,13, 18,20,22,26,	Flooring - Terrazzo
C-2-60 - A, B, C	CP	FS 13-28	Ceiling_Panel - 2X4, White with indentations
C-2-61 - A, B, C	FLM	FS 14-15	Flooring - Linoleum with Paper Backing- Yellow
C-2-62 - A, B, C	FLM	FS 9	Flooring - Stair Treads & Adhesives
C-2-63 - A, B, C	PI	FS 13	Pipe_Insulation - Corrugated Paper (AirCell)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format

Method of Shipment:		Lab Location Plymouth Meeting PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:
Relinquished by:	Date/Time:	Received by:	Date/Time:	Received by:	Date/Time:

RECEIVED FEB 27 2023

EMSL ANALYTICAL, INC.
TESTING LABS • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

#042503554

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample

IC-004 - 540 Tyler (2nd Floor)

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
C-2-64 - A, B, C	WB	FS 23-25	Wallboard - with Mud & Tape
C-2-65 - A, B, C, D, E	PL	FS 13-28	Plaster - Skim & Base Coat Ceilings on Wire Mesh
C-2-66 - A, B, C	TS	FS 17	Transite - Transite Table
C-2-67 - A, B, C	RI	FS 23	Rolled_In_Insulation - Pink with Paper
C-2-68 - A, B, C	CA	FS 23-25	Construction_Adhesive - Brown on Wallboard walls
-	(material) 0		-
-	(material) 0		-
-	(material) 0		-
-	(material) 0		-

RECEIVED FEB 27 2025

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503553
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Attn: Detroit Project Group
Egis BLN USA Inc
51151 W. Pontiac Trail
Wixom, MI 48393

Phone: (313) 408-4893
Fax:
Collected: 2/25/2025
Received: 2/27/2025
Analyzed: 3/03/2025

Proj: IC-004 - 540 Tyler (3rd Floor) / RDA Program

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-3-69-A

Lab Sample ID: 042503553-0001

Sample Description: FS 29-32/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-69-B

Lab Sample ID: 042503553-0002

Sample Description: FS 29-32/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-69-C

Lab Sample ID: 042503553-0003

Sample Description: FS 29-32/Wallboard - with Mud & Tape

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-3-70-A

Lab Sample ID: 042503553-0004

Sample Description: FS 29-32/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	30.0%	70.0%	None Detected	

Client Sample ID: C-3-70-B

Lab Sample ID: 042503553-0005

Sample Description: FS 29-32/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	30.0%	70.0%	None Detected	

Client Sample ID: C-3-70-C

Lab Sample ID: 042503553-0006

Sample Description: FS 29-32/Ceiling_Panel - 2X4, White with Indentations

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	35.0%	65.0%	None Detected	

Client Sample ID: C-3-71-A-Flooring

Lab Sample ID: 042503553-0007

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503553
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-3-71-A-Mastic **Lab Sample ID:** 042503553-0007A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-3-71-B-Flooring **Lab Sample ID:** 042503553-0008

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown/Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-71-B-Mastic **Lab Sample ID:** 042503553-0008A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-3-71-C-Flooring **Lab Sample ID:** 042503553-0009

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Brown	0.0%	100.0%	None Detected	

Client Sample ID: C-3-71-C-Mastic **Lab Sample ID:** 042503553-0009A

Sample Description: FS 9/Flooring - Stair Treads & Adhesives

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	0.0%	100.0%	None Detected	

Client Sample ID: C-3-72-A-Brick **Lab Sample ID:** 042503553-0010

Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Tan/Red	0.0%	100.0%	None Detected	

Client Sample ID: C-3-72-A-Mortar **Lab Sample ID:** 042503553-0010A

Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-72-B-Brick **Lab Sample ID:** 042503553-0011

Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Tan/Red	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503553
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-3-72-B-Mortar **Lab Sample ID:** 042503553-0011A
Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-72-C-Brick **Lab Sample ID:** 042503553-0012
Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Red	0.0%	100.0%	None Detected	

Client Sample ID: C-3-72-C-Mortar **Lab Sample ID:** 042503553-0012A
Sample Description: FS 30,32/Brick_Mortar - Interior Walls

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-73-A **Lab Sample ID:** 042503553-0013
Sample Description: FS 30/Vibration_Dampener - Plastic/Rubber Coated Fabric

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White/Black	15.0%	85.0%	None Detected	

Client Sample ID: C-3-73-B **Lab Sample ID:** 042503553-0014
Sample Description: FS 30/Vibration_Dampener - Plastic/Rubber Coated Fabric

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White/Black	25.0%	75.0%	None Detected	

Client Sample ID: C-3-73-C **Lab Sample ID:** 042503553-0015
Sample Description: FS 30/Vibration_Dampener - Plastic/Rubber Coated Fabric

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Black	30.0%	70.0%	None Detected	

Client Sample ID: C-3-74-A **Lab Sample ID:** 042503553-0016
Sample Description: FS 30/Duct_Insulation - Fiberglass with Foil- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	70.0%	30.0%	None Detected	

Client Sample ID: C-3-74-B **Lab Sample ID:** 042503553-0017
Sample Description: FS 30/Duct_Insulation - Fiberglass with Foil- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	70.0%	30.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID: 042503553
Customer ID: BLNL75
Customer PO: 240100
Project ID:

Summary Test Report for Asbestos Analysis of Bulk Material

Client Sample ID: C-3-74-C **Lab Sample ID:** 042503553-0018

Sample Description: FS 30/Duct_Insulation - Fiberglass with Foil- Yellow

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Yellow	80.0%	20.0%	None Detected	

Client Sample ID: C-3-75-A-Skim Coat **Lab Sample ID:** 042503553-0019

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-3-75-A-Base Coat **Lab Sample ID:** 042503553-0019A

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-75-B-Skim Coat **Lab Sample ID:** 042503553-0020

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	

Client Sample ID: C-3-75-B-Base Coat **Lab Sample ID:** 042503553-0020A

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-75-C-Base Coat **Lab Sample ID:** 042503553-0021

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	Gray	0.0%	100.0%	None Detected	

Client Sample ID: C-3-75-C-Skim Coat **Lab Sample ID:** 042503553-0021A

Sample Description: FS 9/Plaster - Skim & Base Coat Ceilings on Wire Mesh

TEST	Analyzed Date	Color	Non-Asbestos		Asbestos	Comment
			Fibrous	Non-Fibrous		
PLM	3/03/2025	White	0.0%	100.0%	None Detected	



EMSL Analytical, Inc.

200 Route 130 North Cinnaminson, NJ 08077
Phone/Fax: (800) 220-3675 / (856) 786-5974
<http://www.EMSL.com> / cinnasblab@EMSL.com

EMSL Order ID:	042503553
Customer ID:	BLNL75
Customer PO:	240100
Project ID:	

Summary Test Report for Asbestos Analysis of Bulk Material

Analyst(s):

Allen Kuestner PLM (20)
Kevin Small PLM (10)

Reviewed and approved by:

Samantha Rundstrom, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This is a summary report; official reports are available on LabConnect or upon request and relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Plymouth Meeting, PA NVLAP Lab Code 200699-0, Philadelphia ALL-292, VA 3333000315, AIHA LAP, LLC-IHLAP Accredited #178659

Initial report from: 03/04/2025 14:39:55

**Asbestos Bulk Building Materials - Chain of Custody**

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077**EMSL ANALYTICAL, INC.**
TESTING LABS • PRODUCTS • TRAINING

#042503553

PHONE: (800) 220-3675
EMAIL: CinnAsblab@EMSL.com

Customer Information	Customer ID:	BLNL75		Billing ID:	BLNL75		
	Company Name:	Egis		Company Name:	Egis		
	Contact Name:	Craig Willey		Billing Contact:	Ryan Jones		
	Street Address:	48797 Alpha Drive		Street Address:	8320 Craig Street		
	City, State, Zip:	Wixom, MI 48393	Country:	USA	City, State, Zip:	Indianapolis, IN 46250 Country: USA	
	Phone:	(248) 863-2934		Phone:	(248) 863-2762		
Billing Information	Email(s) for Report:	DETROIT-DEMO-EDD-EMPLOYEES.EGIS-US@egis-group.com		Email(s) for Invoice:	Ryan.JONES@egis-group.com; Beth.Senn@egis-group.com		
Project Information							
Project Name/No: IC-004 - 540 Tyler (3rd Floor)				Purchase Order: 240100-RDA Program			
EMSL LIMS Project ID: (If applicable, EMSL will provide)				US State where samples collected: MICHIGAN			
				State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)			
Sampled By Name: Keith Ventimiglia		Sampled By Signature:		Date Sample	2/25/2025	No. of Samples	21

Turn-Around-Time (TAT)☒ 72 Hours

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test SelectionPLM - Bulk (reporting limit)☒ PLM EPA 600/R-93/116 (<1%)TEM - Bulk

Other Tests (please specify)

Point Count all samples ≤1% asbestos
Point Count NOB material samples ≤1% asbestos by PLM EPA
NOB-EPA/600/R-93/116 w/ Gravimetric Reduction (TRL 0.5%)

FedEx # 285762202434

☒ Positive Stop - Clearly Identified Homogeneous Areas

Sample Number	HA Number	Sample Location	Material Description
C-3-69 - A, B, C	WB	FS 29-32	Wallboard - with Mud & Tape
C-3-70 - A, B, C	CP	FS 29-32	Ceiling_Panel - 2X4, White with Indentations
C-3-71 - A, B, C	FLM	FS 9	Flooring - Stair Treads & Adhesives
C-3-72 - A, B, C	BM	FS 30,32	Brick_Mortar - Interior Walls
C-3-73 - A, B, C	VD	FS 30	Vibration_Dampener - Plastic/Rubber Coated Fabric
C-3-74 - A, B, C	DI	FS 30	Duct_Insulation - Fiberglass with Foil- Yellow
C-3-75 - A, B, C	PL	FS 9	Plaster - Skim & Base Coat Ceilings on Wire Mesh
-	(material) 0		-

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Please provide EDD in CSV format


Method of Shipment: Lab Location Meeting Place PA		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by:	Date/Time
Relinquished by:	Date/Time:	Received by:	Date/Time

RECEIVED FEB 27 2025


ATTACHMENT 2 – FIGURES

BUILDING A

Document Path: P:\240100-NW Indiana RDA - DORC Services\GIS\Map_Files\540 Tyler-Saint Mary Mercy Hospital\Demo\540 Tyler Demo Figure.aprx

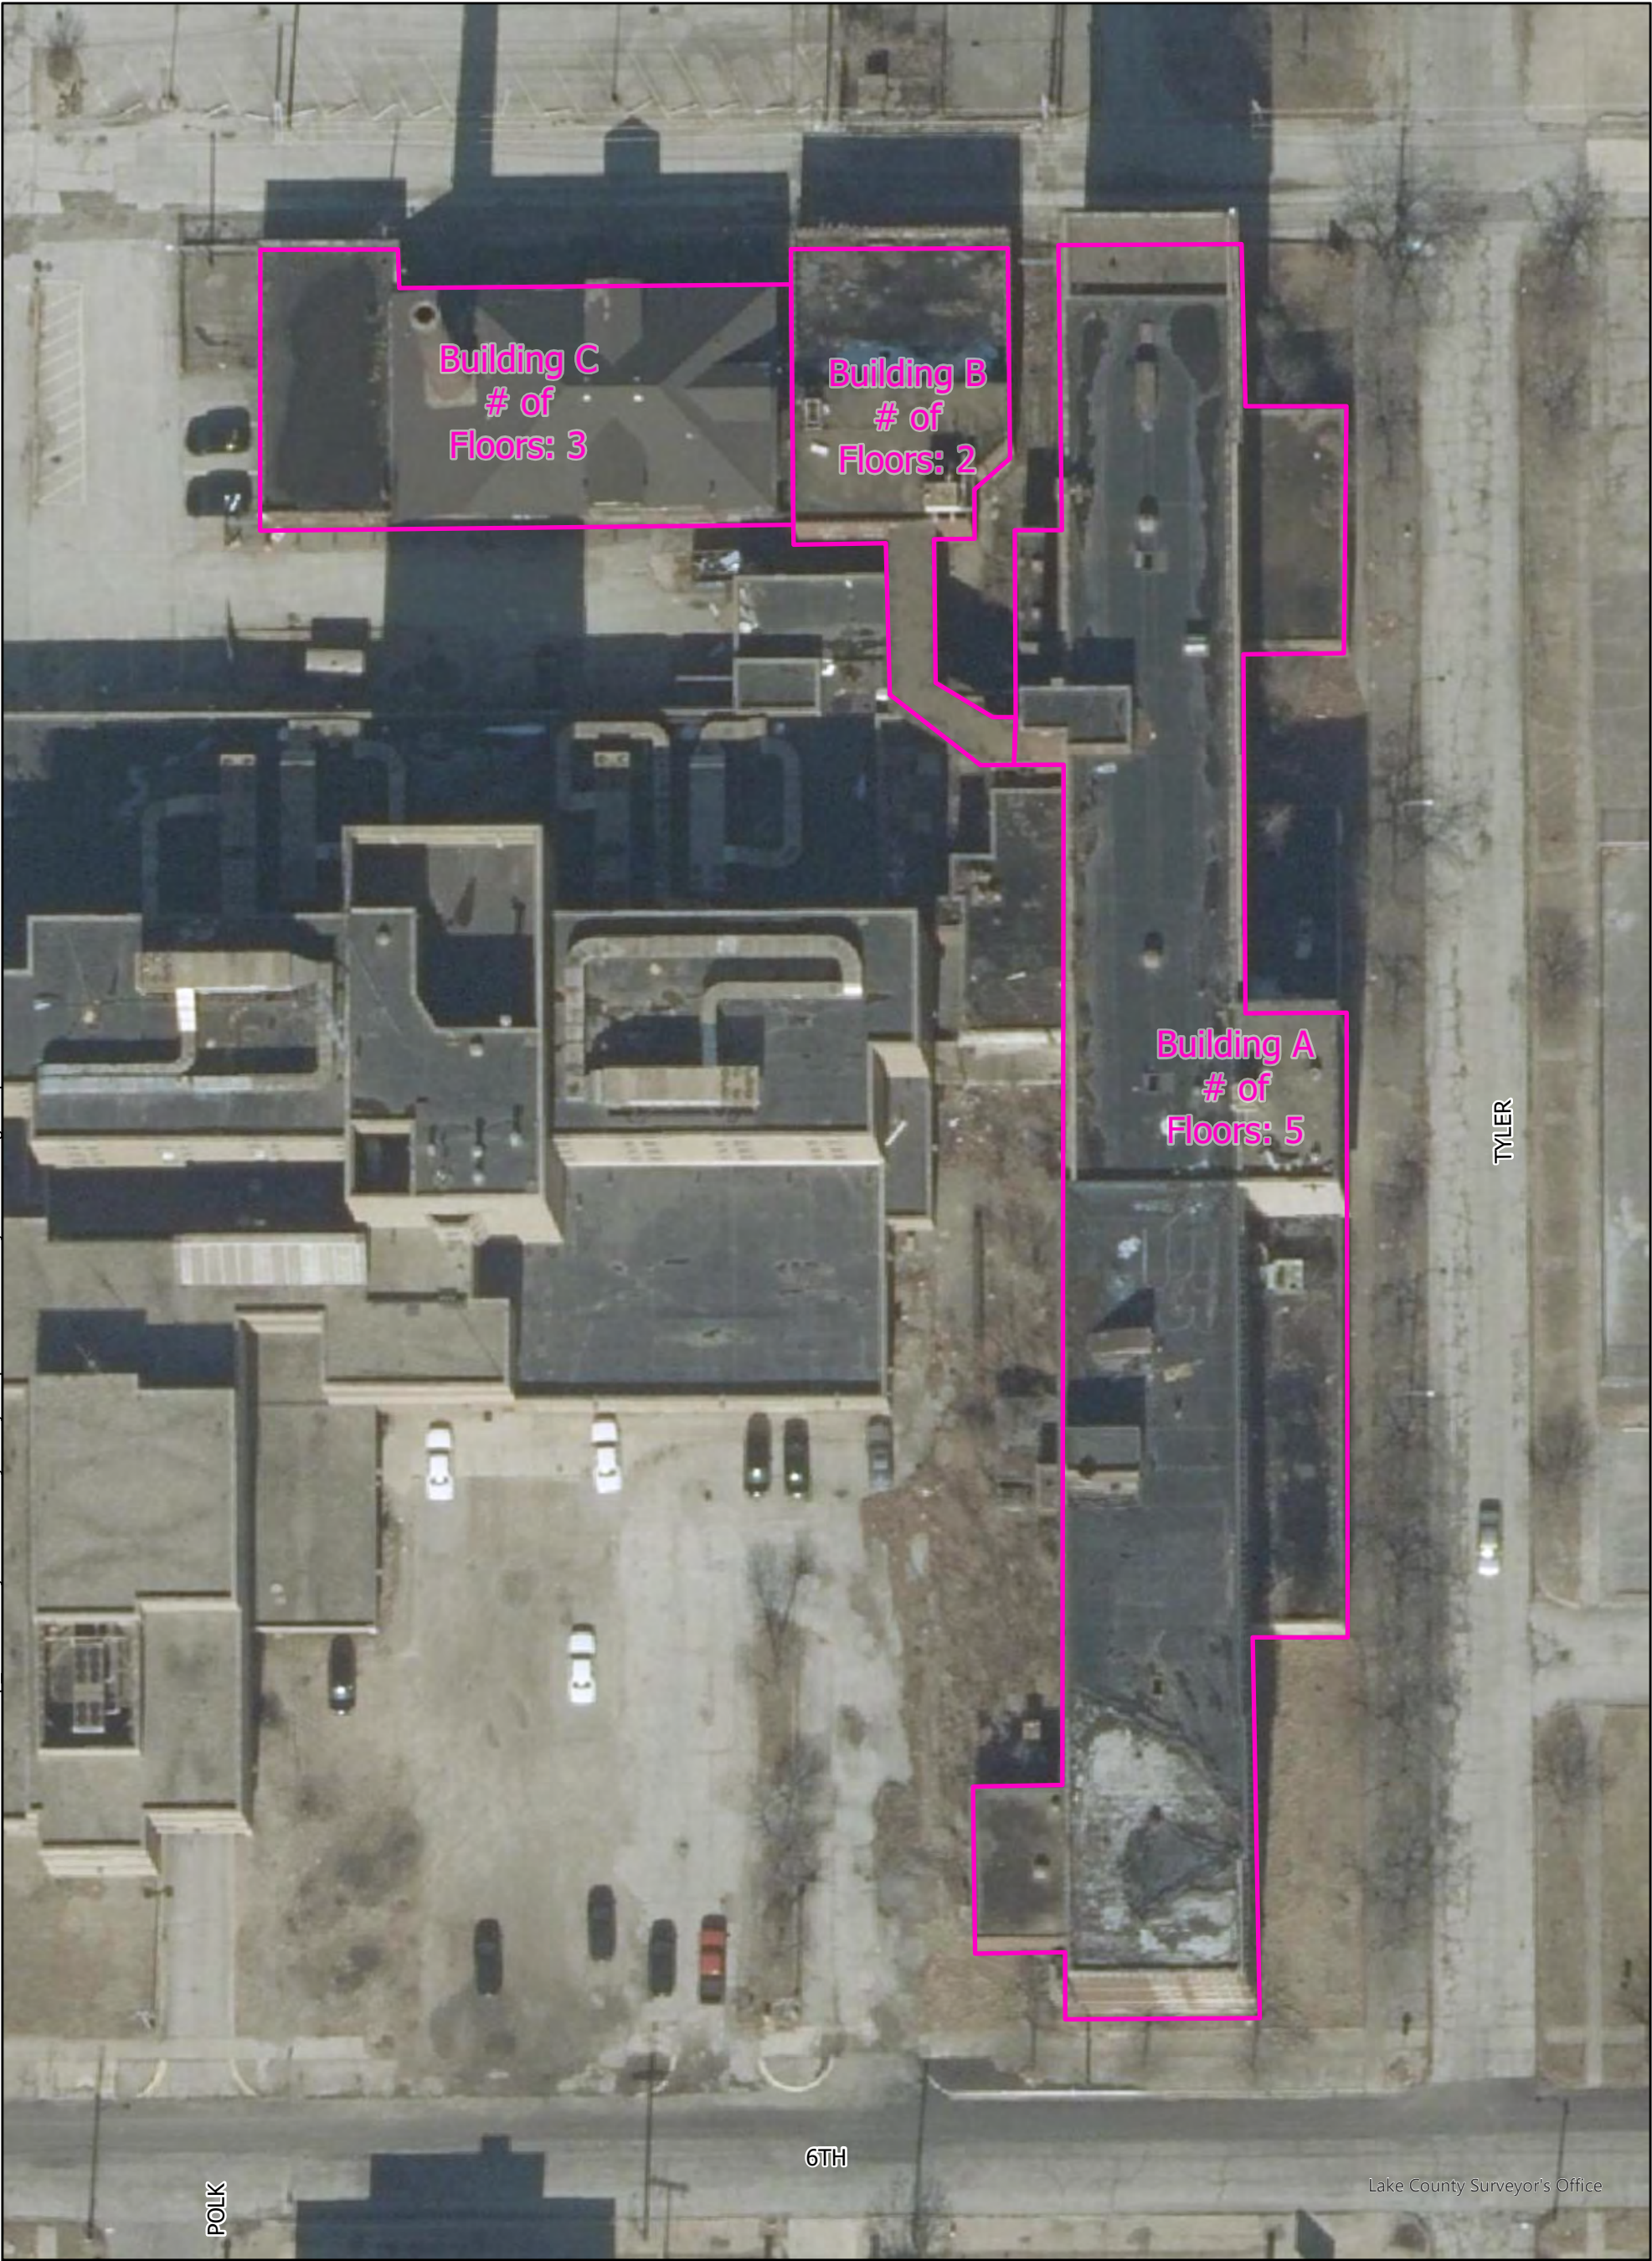

Lake County Surveyor's Office



 Building Sections

0 40 80
 Feet
1 inch equals 40 feet




Structure Layout

549 Washington
Former City Methodist Church
Gary, IN

DATE	DRAWN BY	CHECKED BY	PROJECT NO.
4-21-25	CCM	CW	240100


Assumed Materials

Pipe Insulation- TSI debris throughout the basement flooring; FS1-FS64
Fire Door- Metal; FS2; FS10; FS11; FS18; FS39; FS44; FS67; FS69

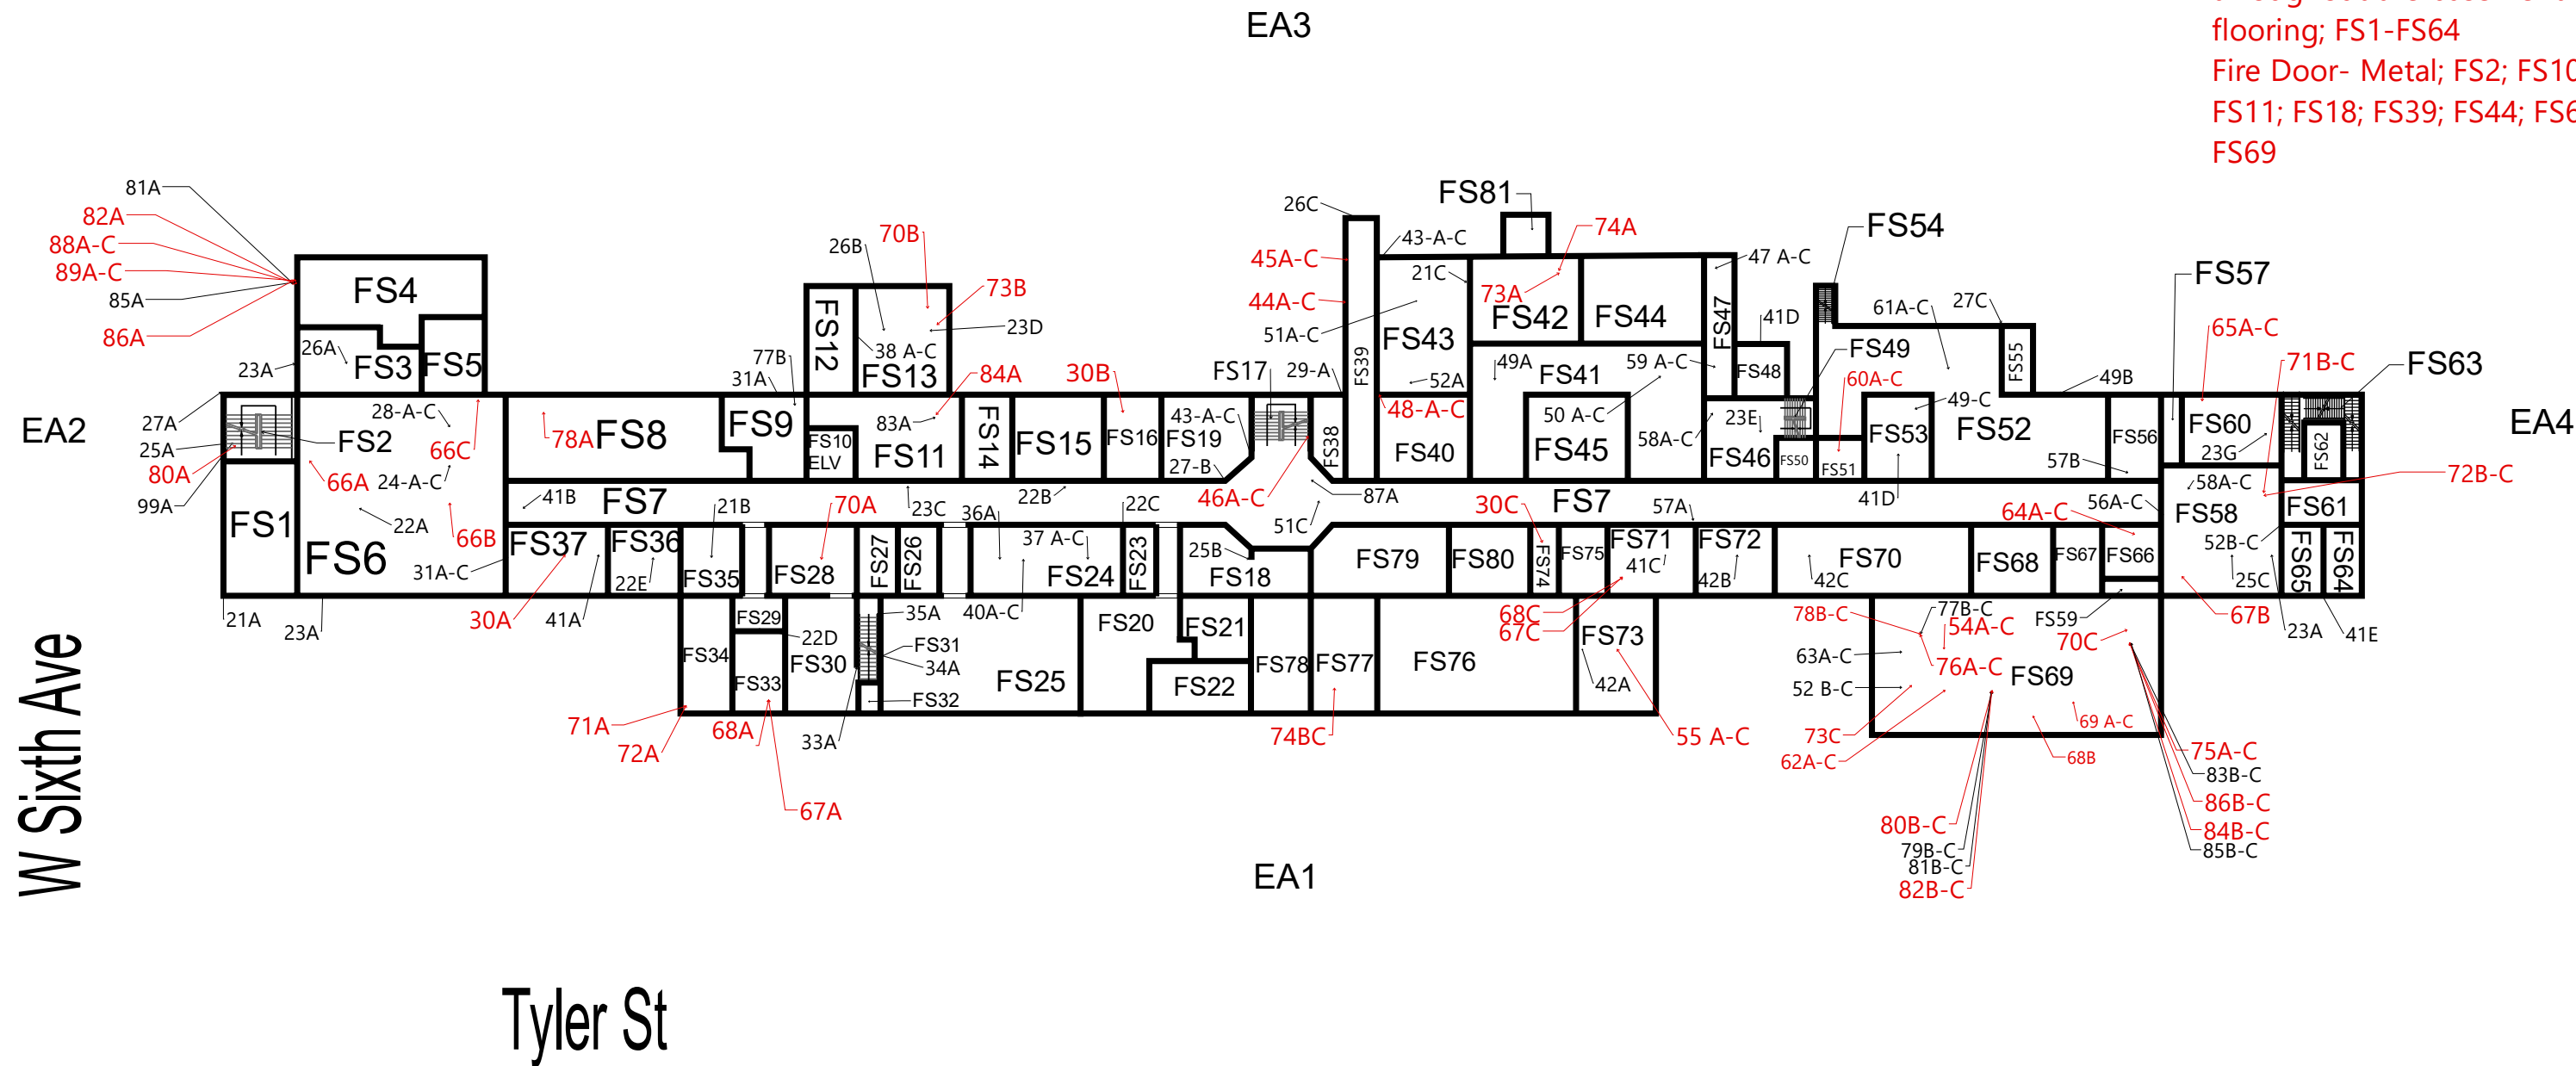


Fire Door- Metal; FS184;
FS131; FS154; FS155; FS157;
FS179; FS180; FS183

 Sample location
 ACM Sample location



Approximate Building Area 28,972 SF

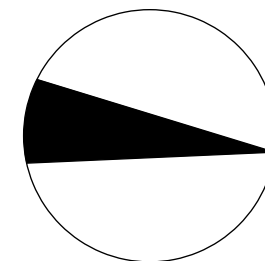

N



Figure 2 - First Floor
540 Tyler Street - Building A
Gary, IN 46402


DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100

Assumed Materials


Fire Door-Metal;
FS17; FS194

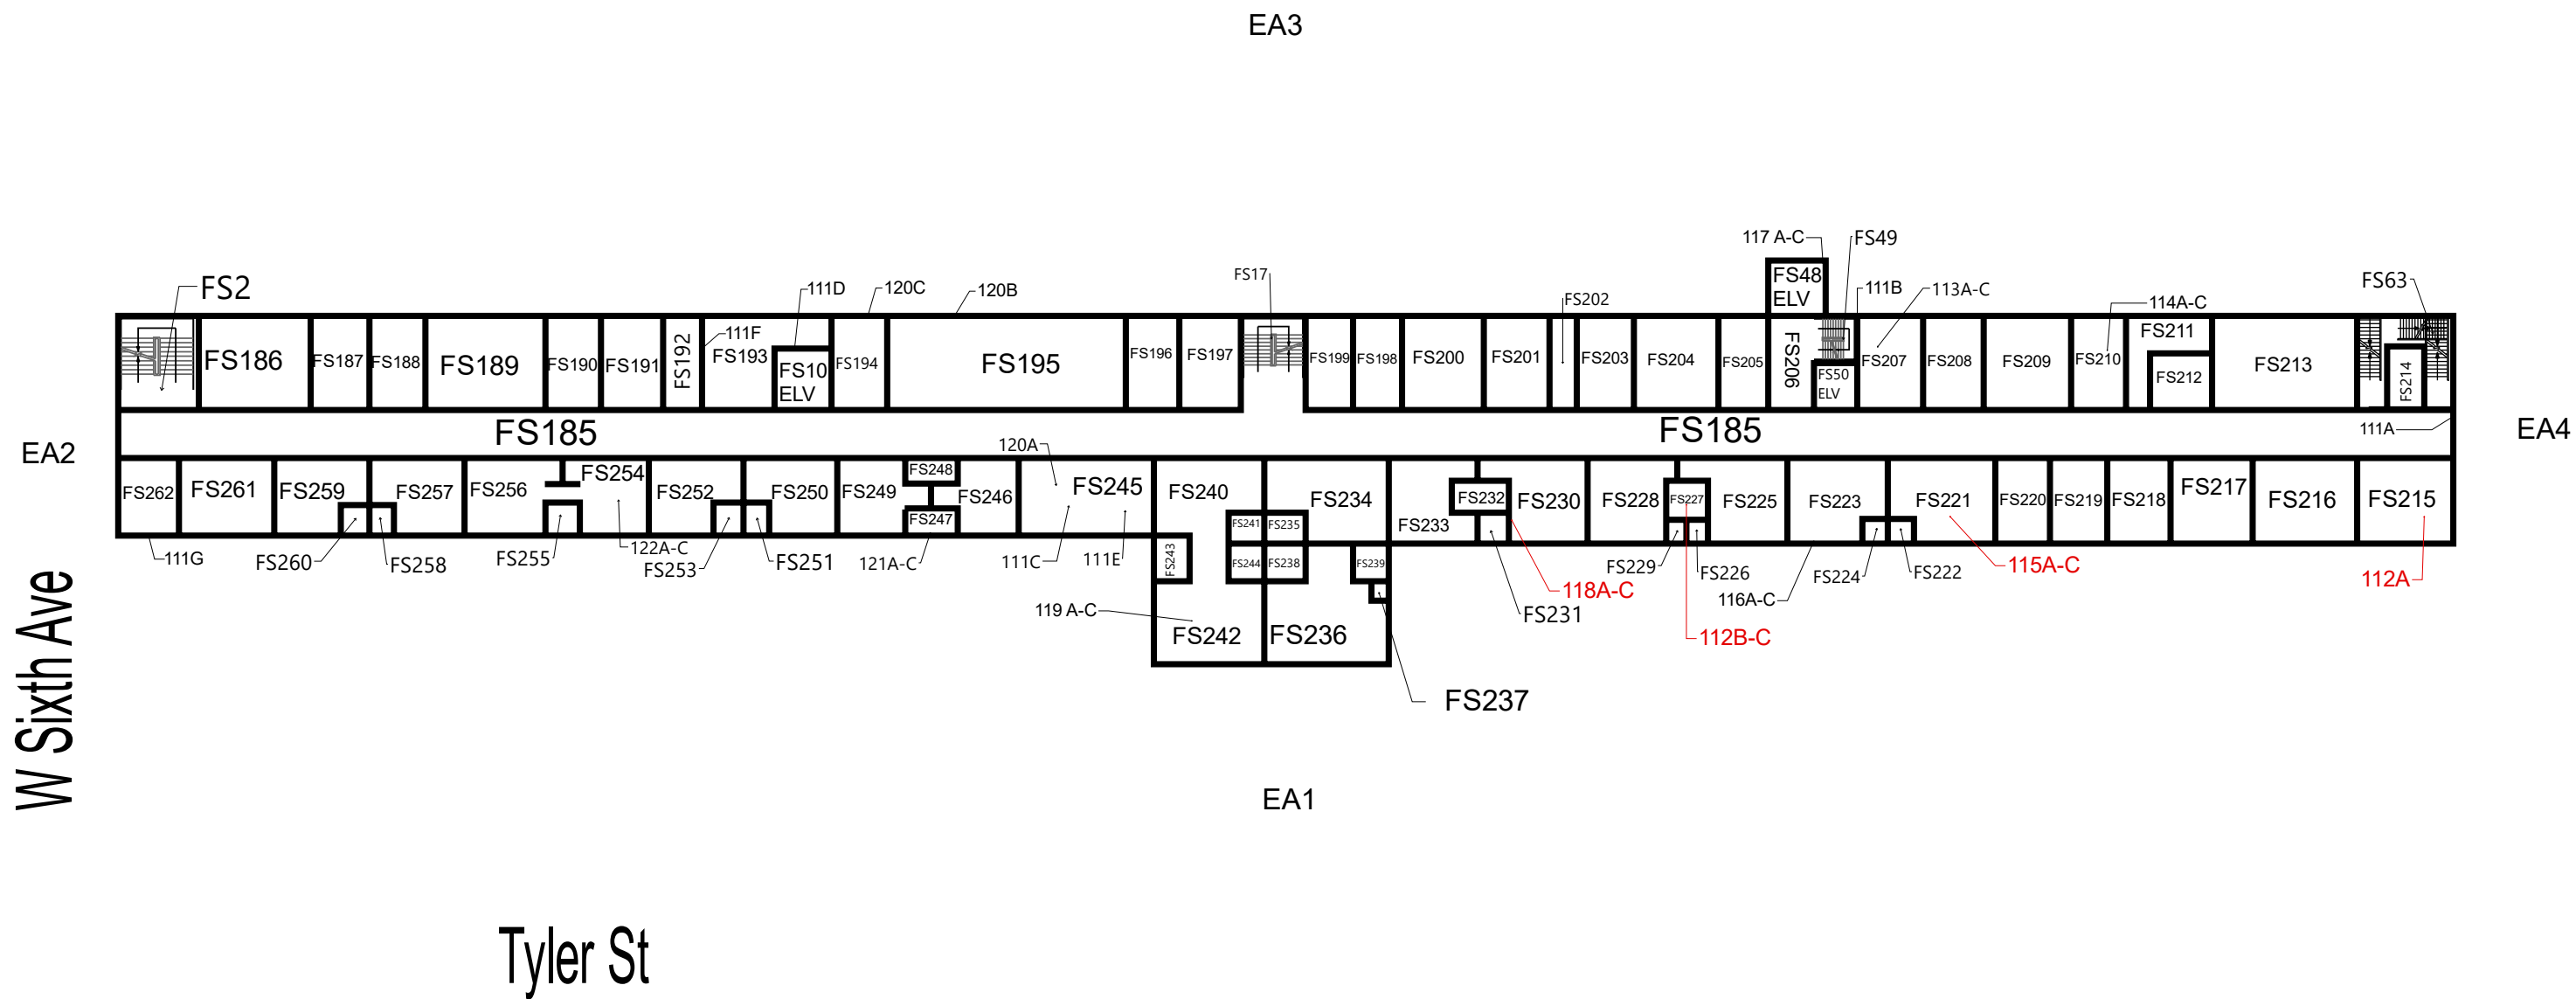

Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 19,401 SF

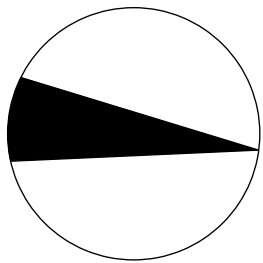

N

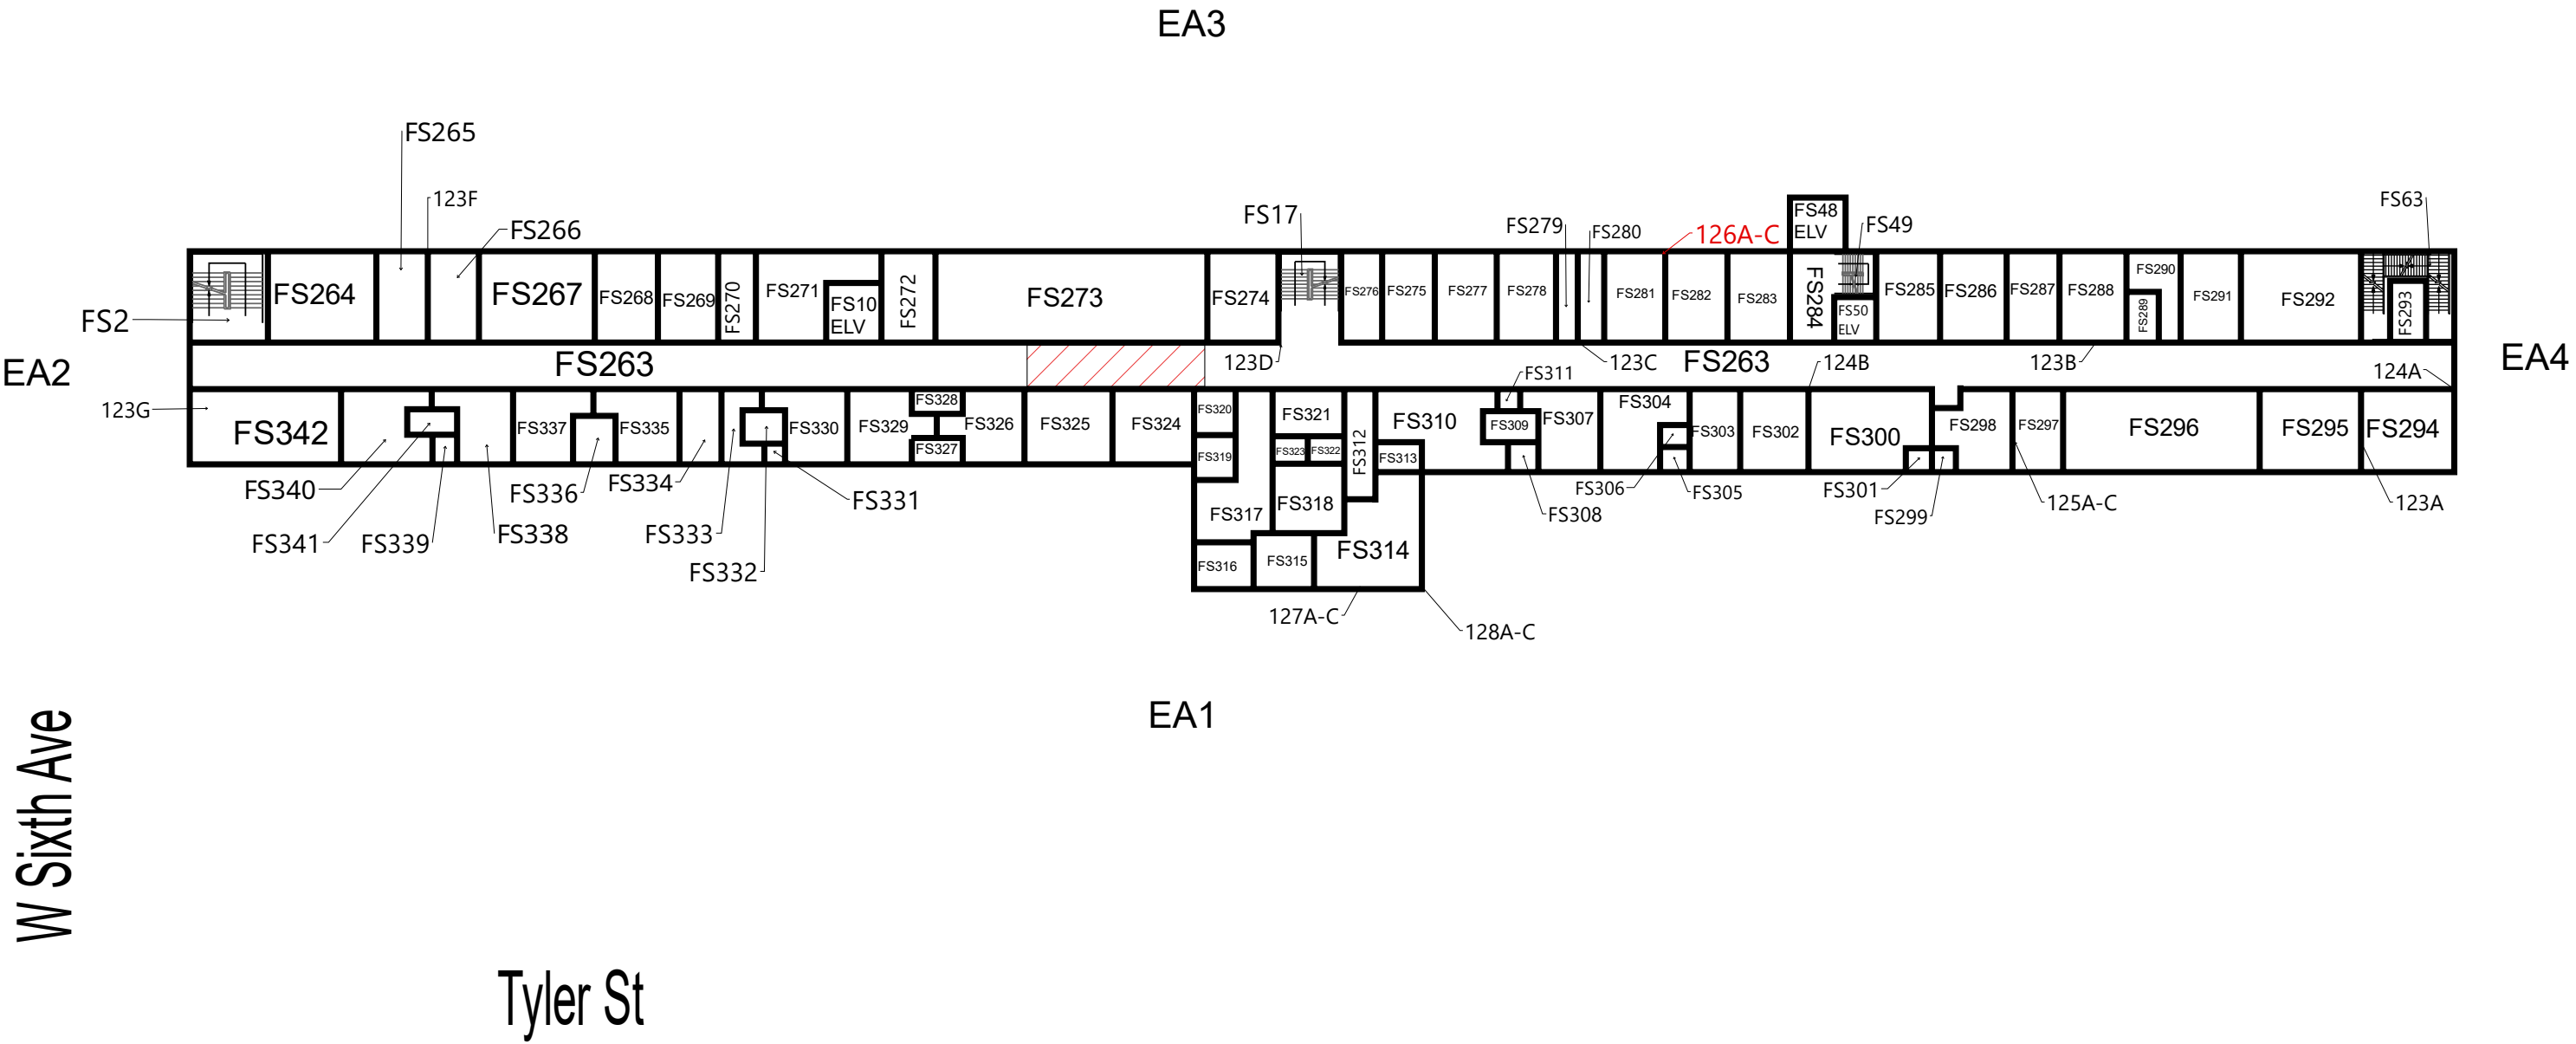


Figure 3 - Second Floor
540 Tyler Street - Building A
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: LC	PROJECT NO. 240100
-------------------	-----------------	-----------------------

Assumed Materials


Fire Door- Metal; FS276



Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 19,401 SF

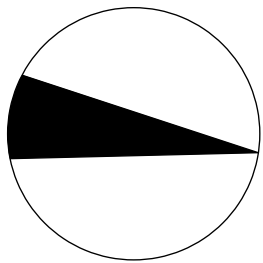

N

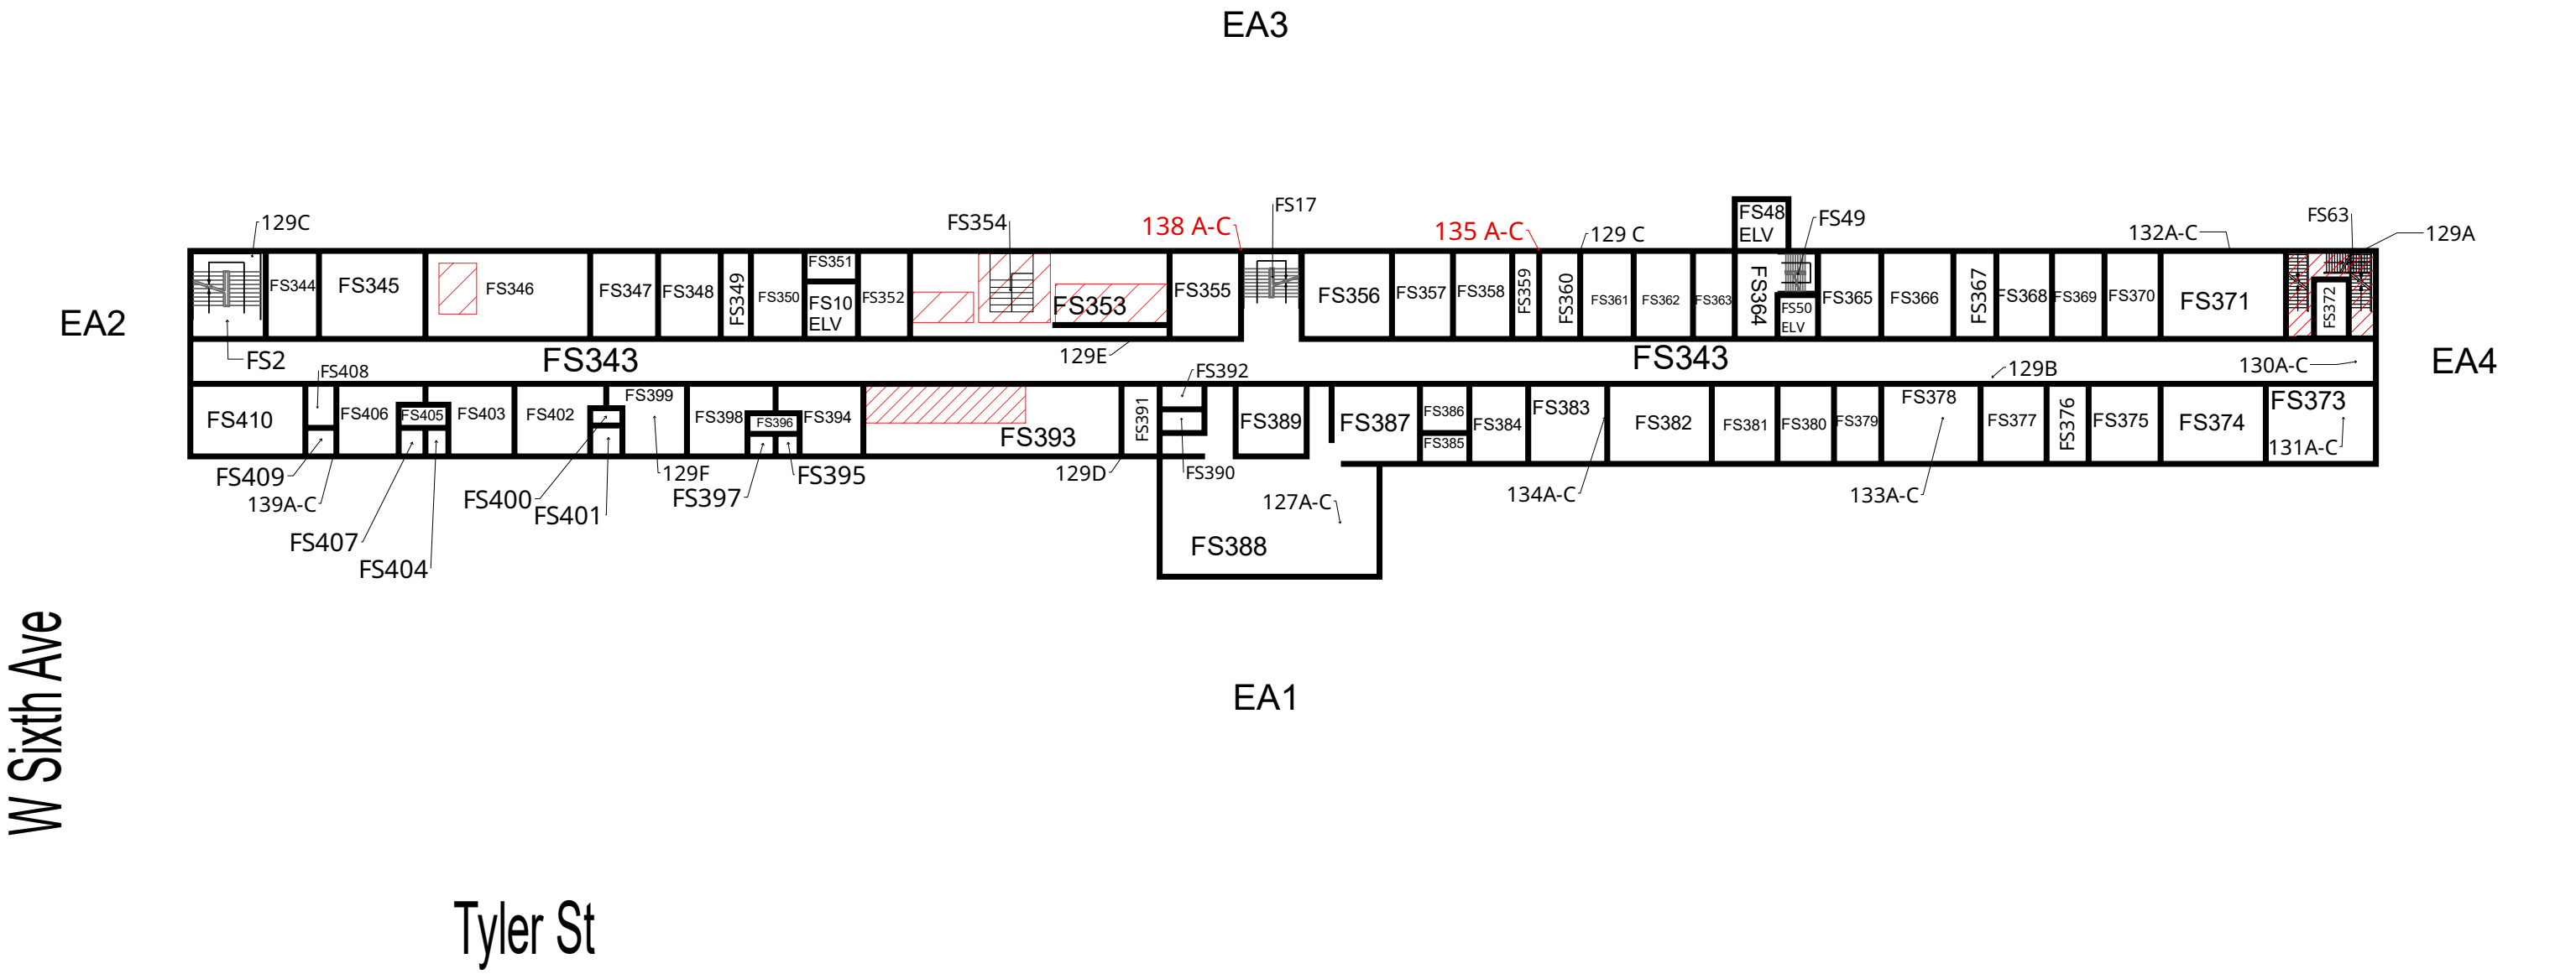


Figure 4 - Third Floor
540 Tyler Street - Building A
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: LC	PROJECT NO. 240100
-------------------	-----------------	-----------------------

Assumed Materials

Fire Door-Metal; FS50; FS370




W Sixth Ave

Tyler St

Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 19,401 SF

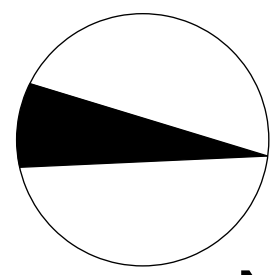

N

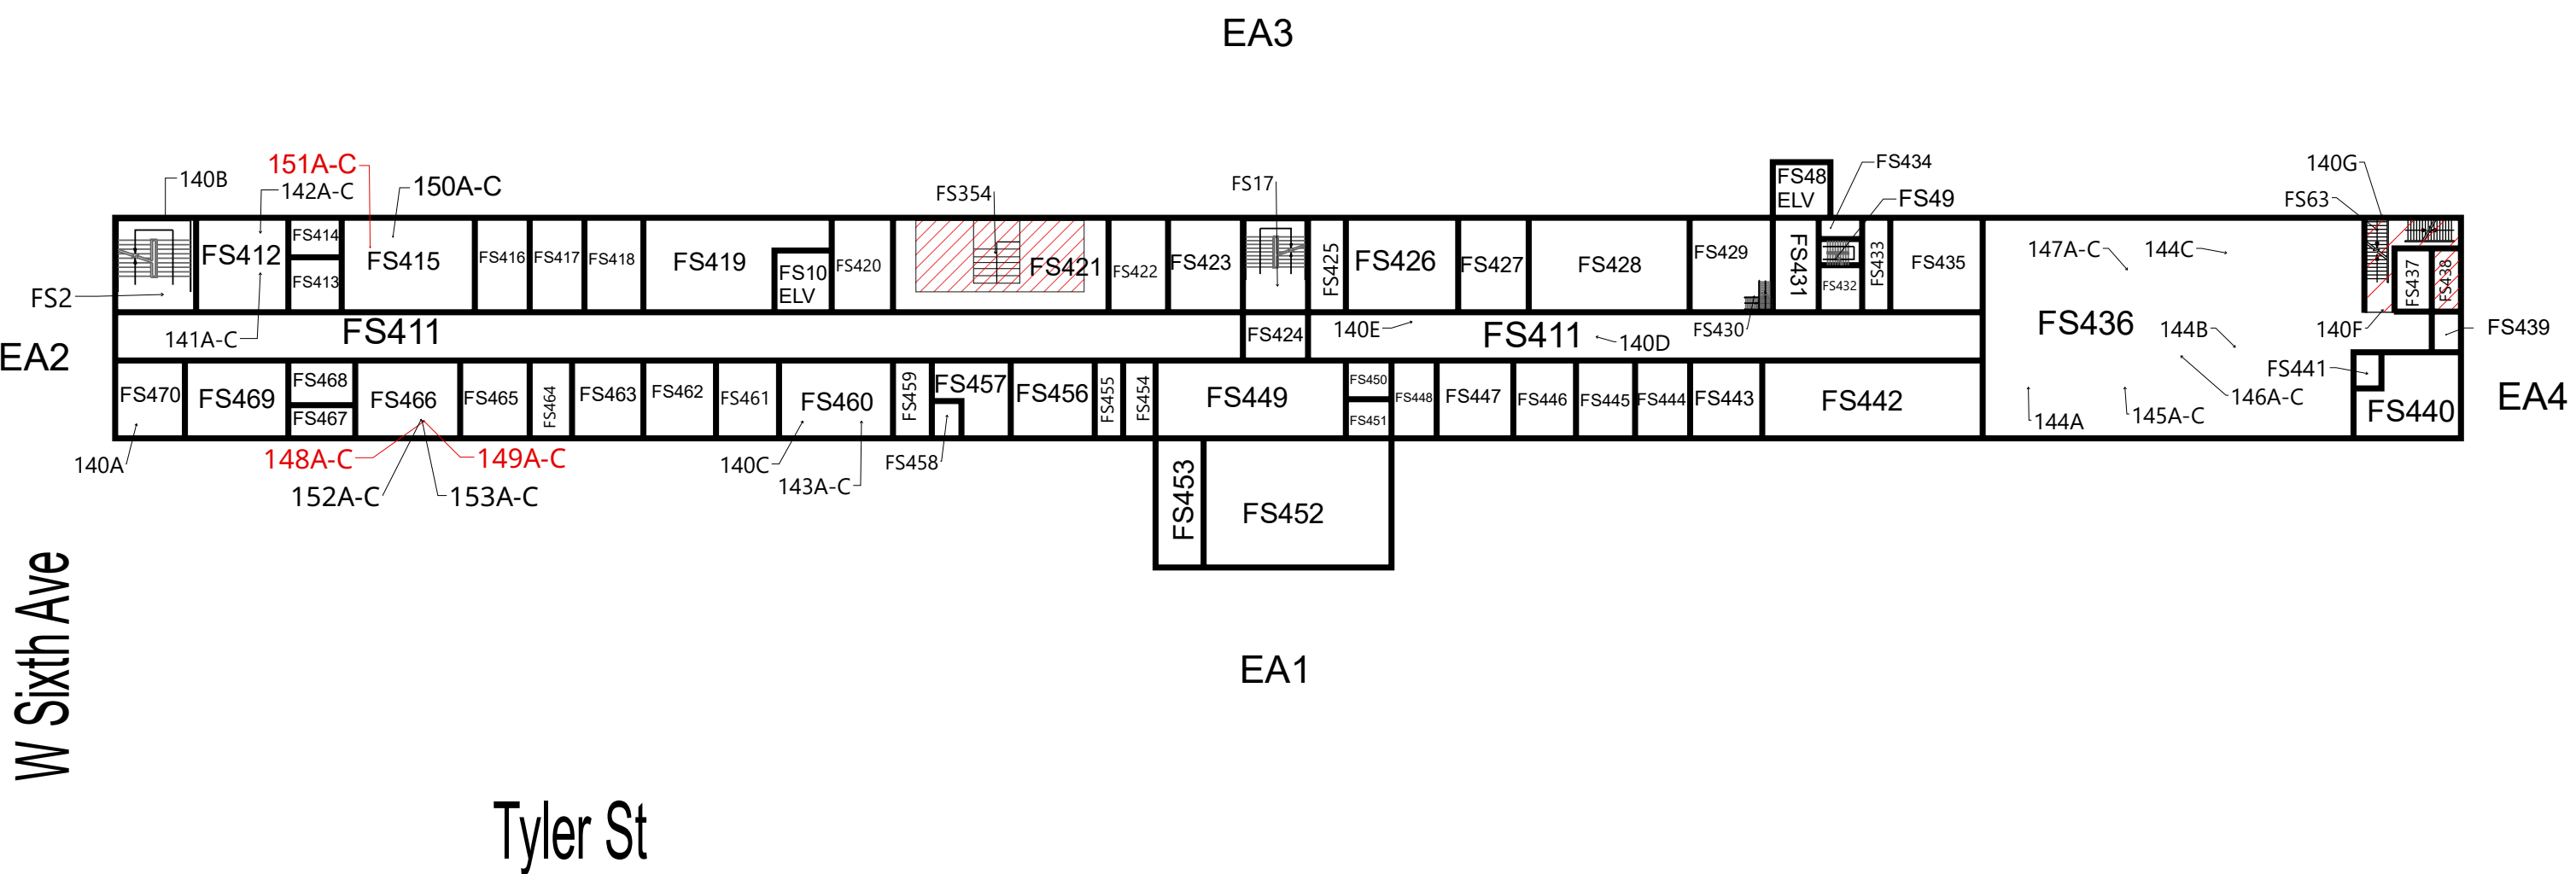


Figure 5 - Fourth Floor
540 Tyler Street - Building A
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: LC	PROJECT NO. 240100
-------------------	-----------------	-----------------------

Assumed
Materials

Fire Door- Metal;
FS48; FS424;
FS442; FS449;
FS438; FS439



Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase


Approximate Building Area 19,401 SF

N

egis

Figure 6 - Fifth Floor
540 Tyler Street - Building A
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: LC	PROJECT NO. 240100
-------------------	-----------------	-----------------------

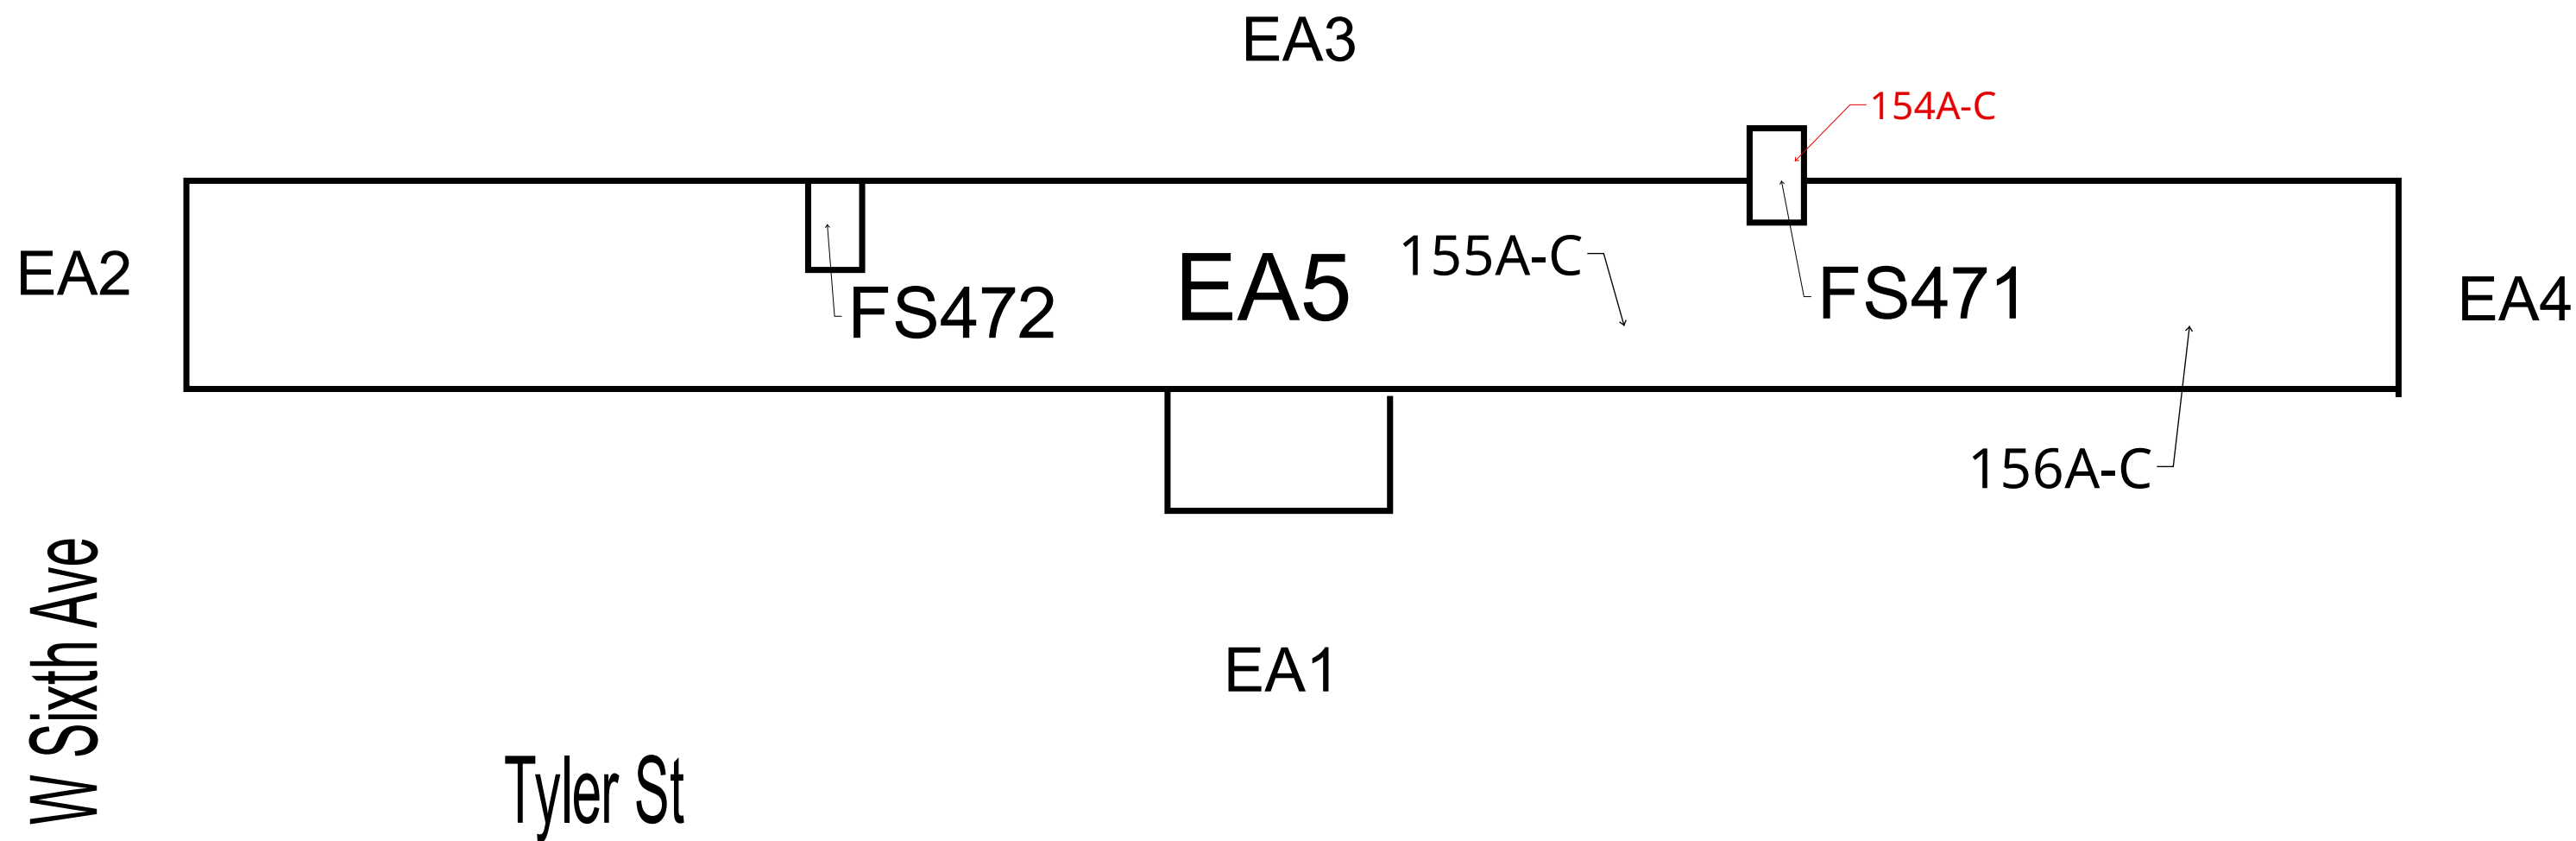


Legend

— Sample location
— ACM Sample location

 Functional space inaccessible

 Staircase

Approximate Building Area 19,401 SF

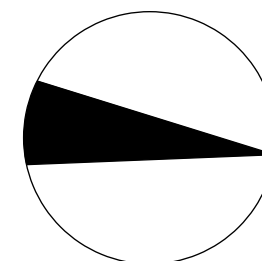

N



Figure 7 - Roof
540 Tyler Street - Building A
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC


PROJECT NO.
240100

BUILDING B

FS2 underground
Hallway leads to
Building C Basement

Assumed
Materials


Pipe Insulation-
Misc TSI debris
mixed with
general debris;
FS1-FS11
Fire Door- Metal;
FS5; FS8

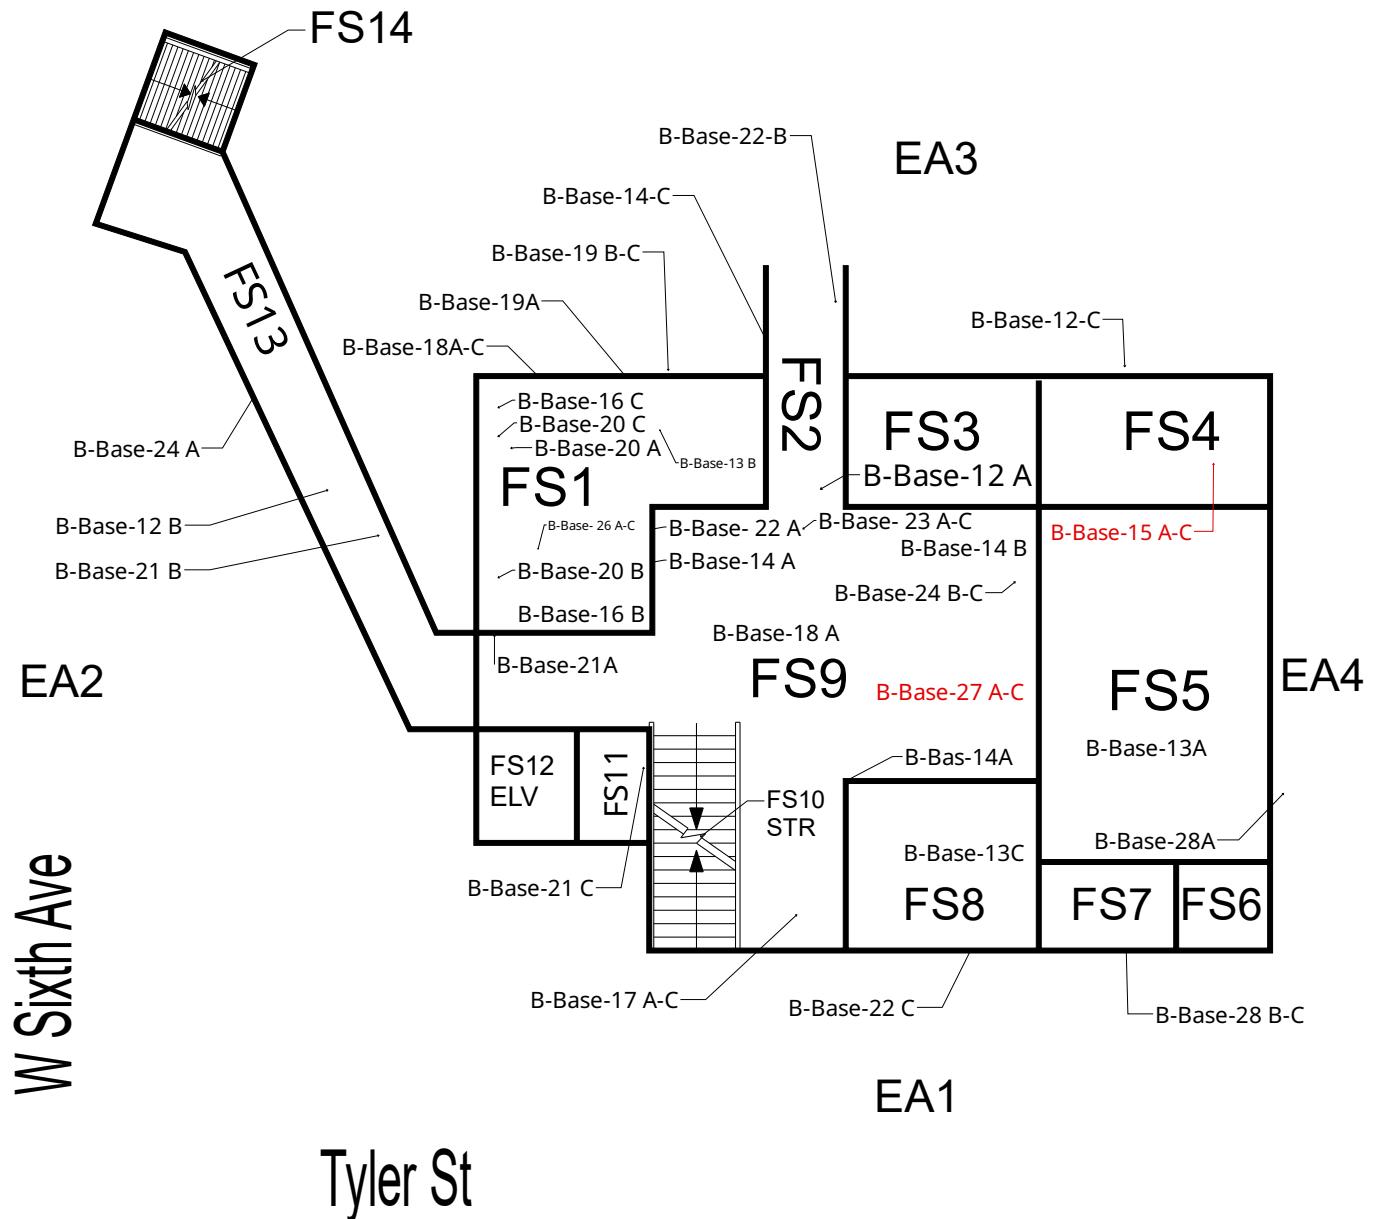

Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 4,486 SF

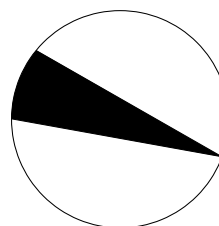

N

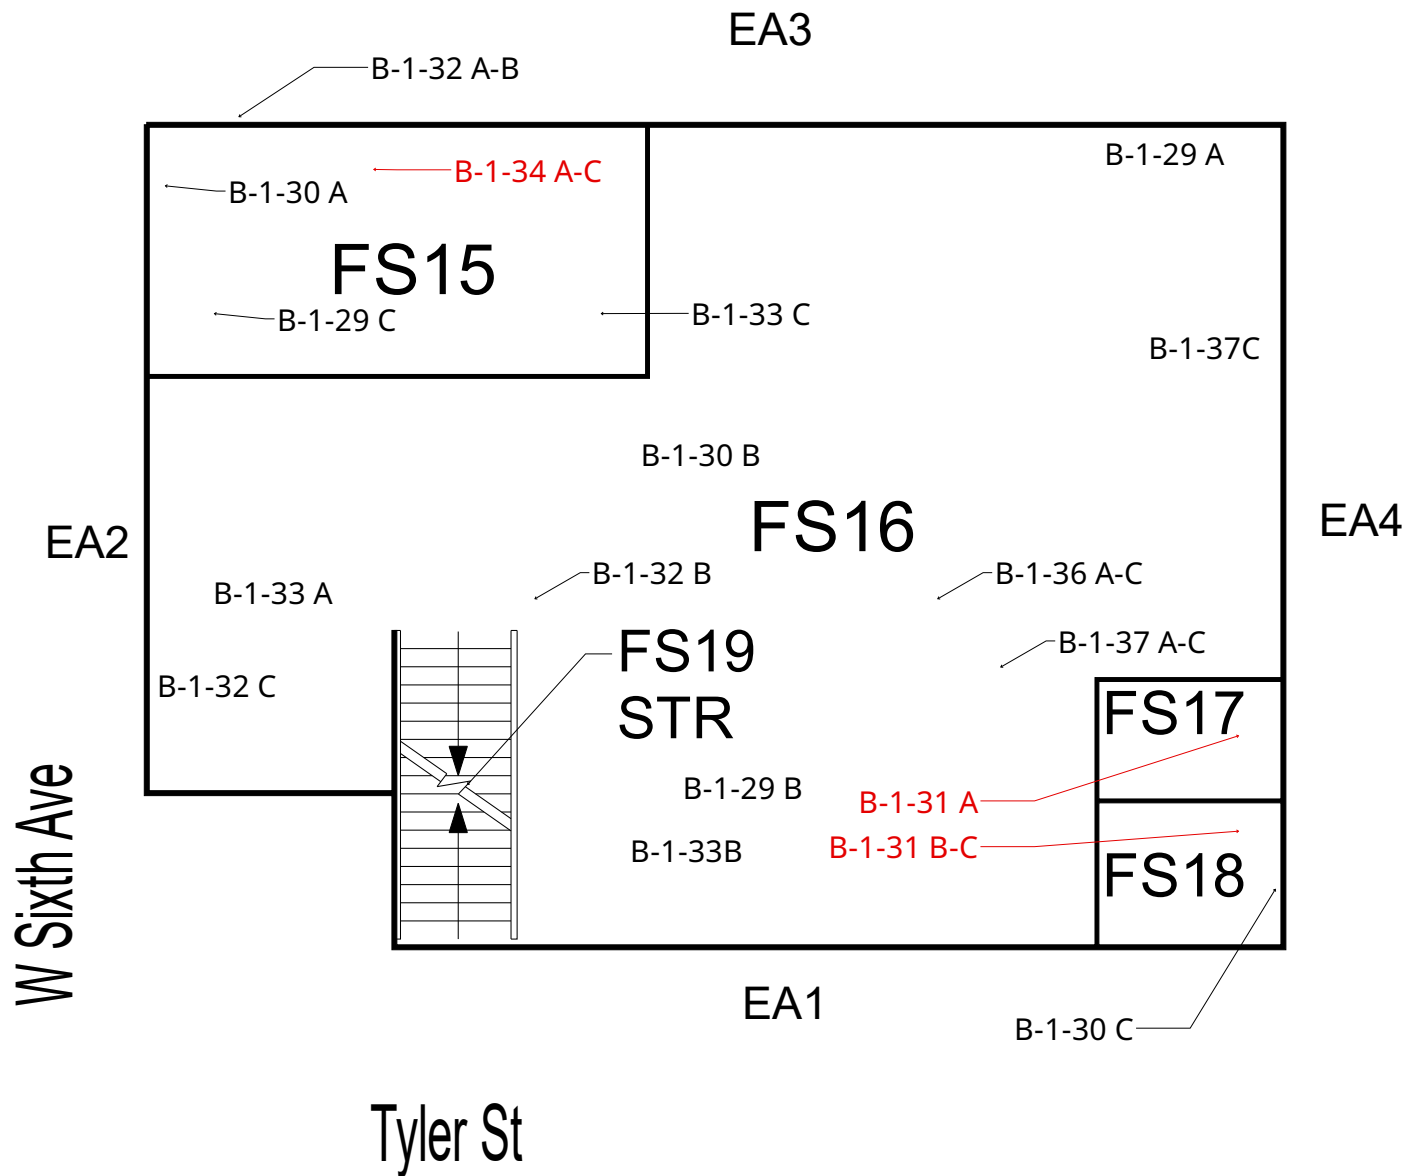


Figure 1 - Basement
540 Tyler Street - Building B
Gary, IN 46402

DATE: 04-15-25	DRAWN BY: LC	PROJECT NO. 240100
-------------------	-----------------	-----------------------

Assumed Materials

Pipe Insulation- TSI debris
mixed with general debris
throughout; FS15; FS16; FS17
Fire Door- Metal; FS16



Legend

— Sample location
— ACM Sample location




Functional space
inaccessible



Staircase

Approximate Building Area 3,627 SF

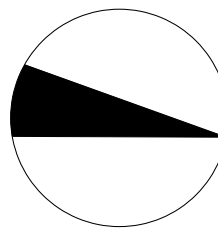

N

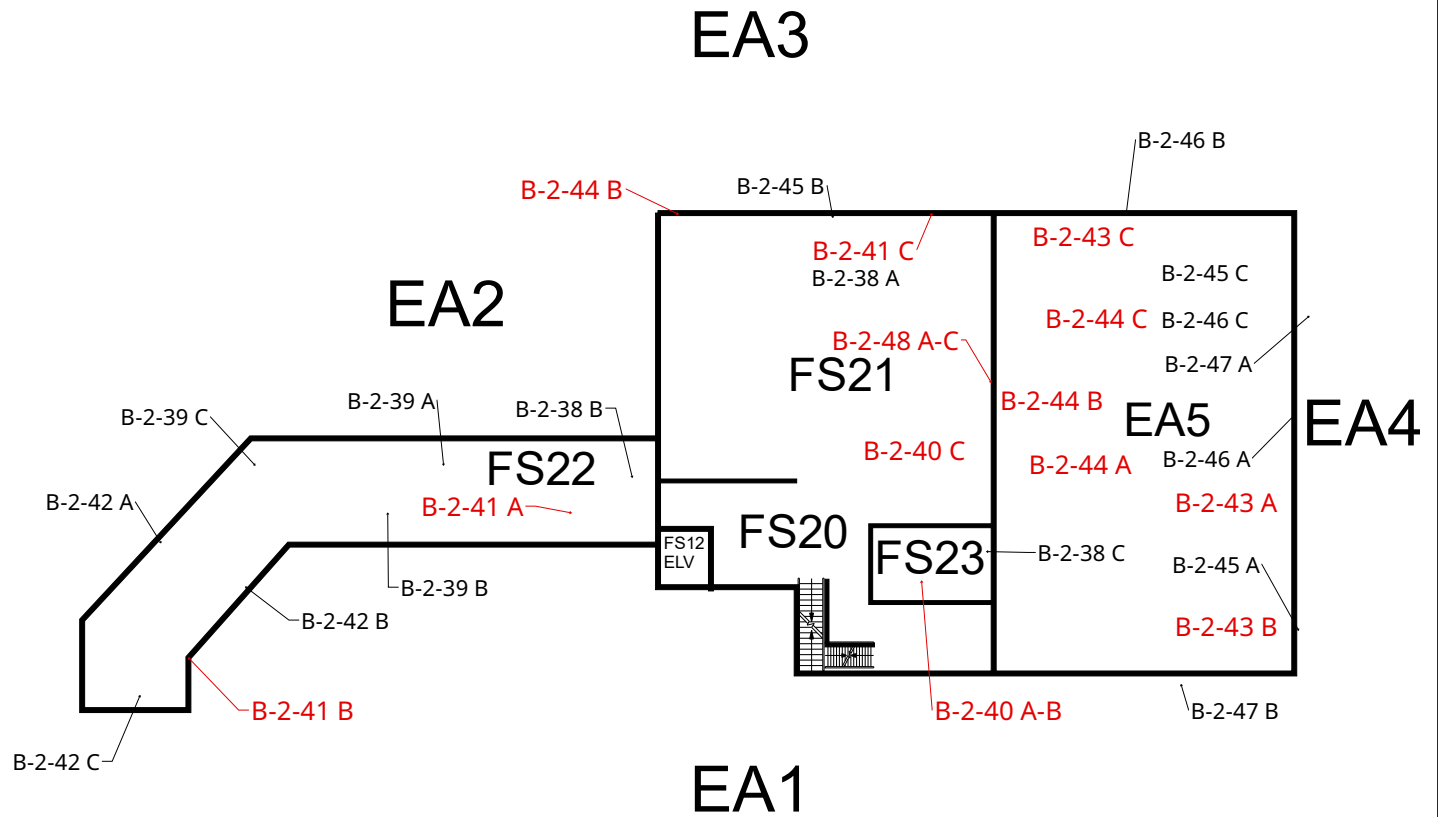


Figure 2 - First Floor
540 Tyler Street - Building B
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100



Legend


- Sample location
- ACM Sample location



Functional space
inaccessible



Staircase

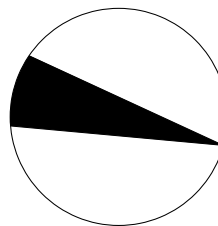

N

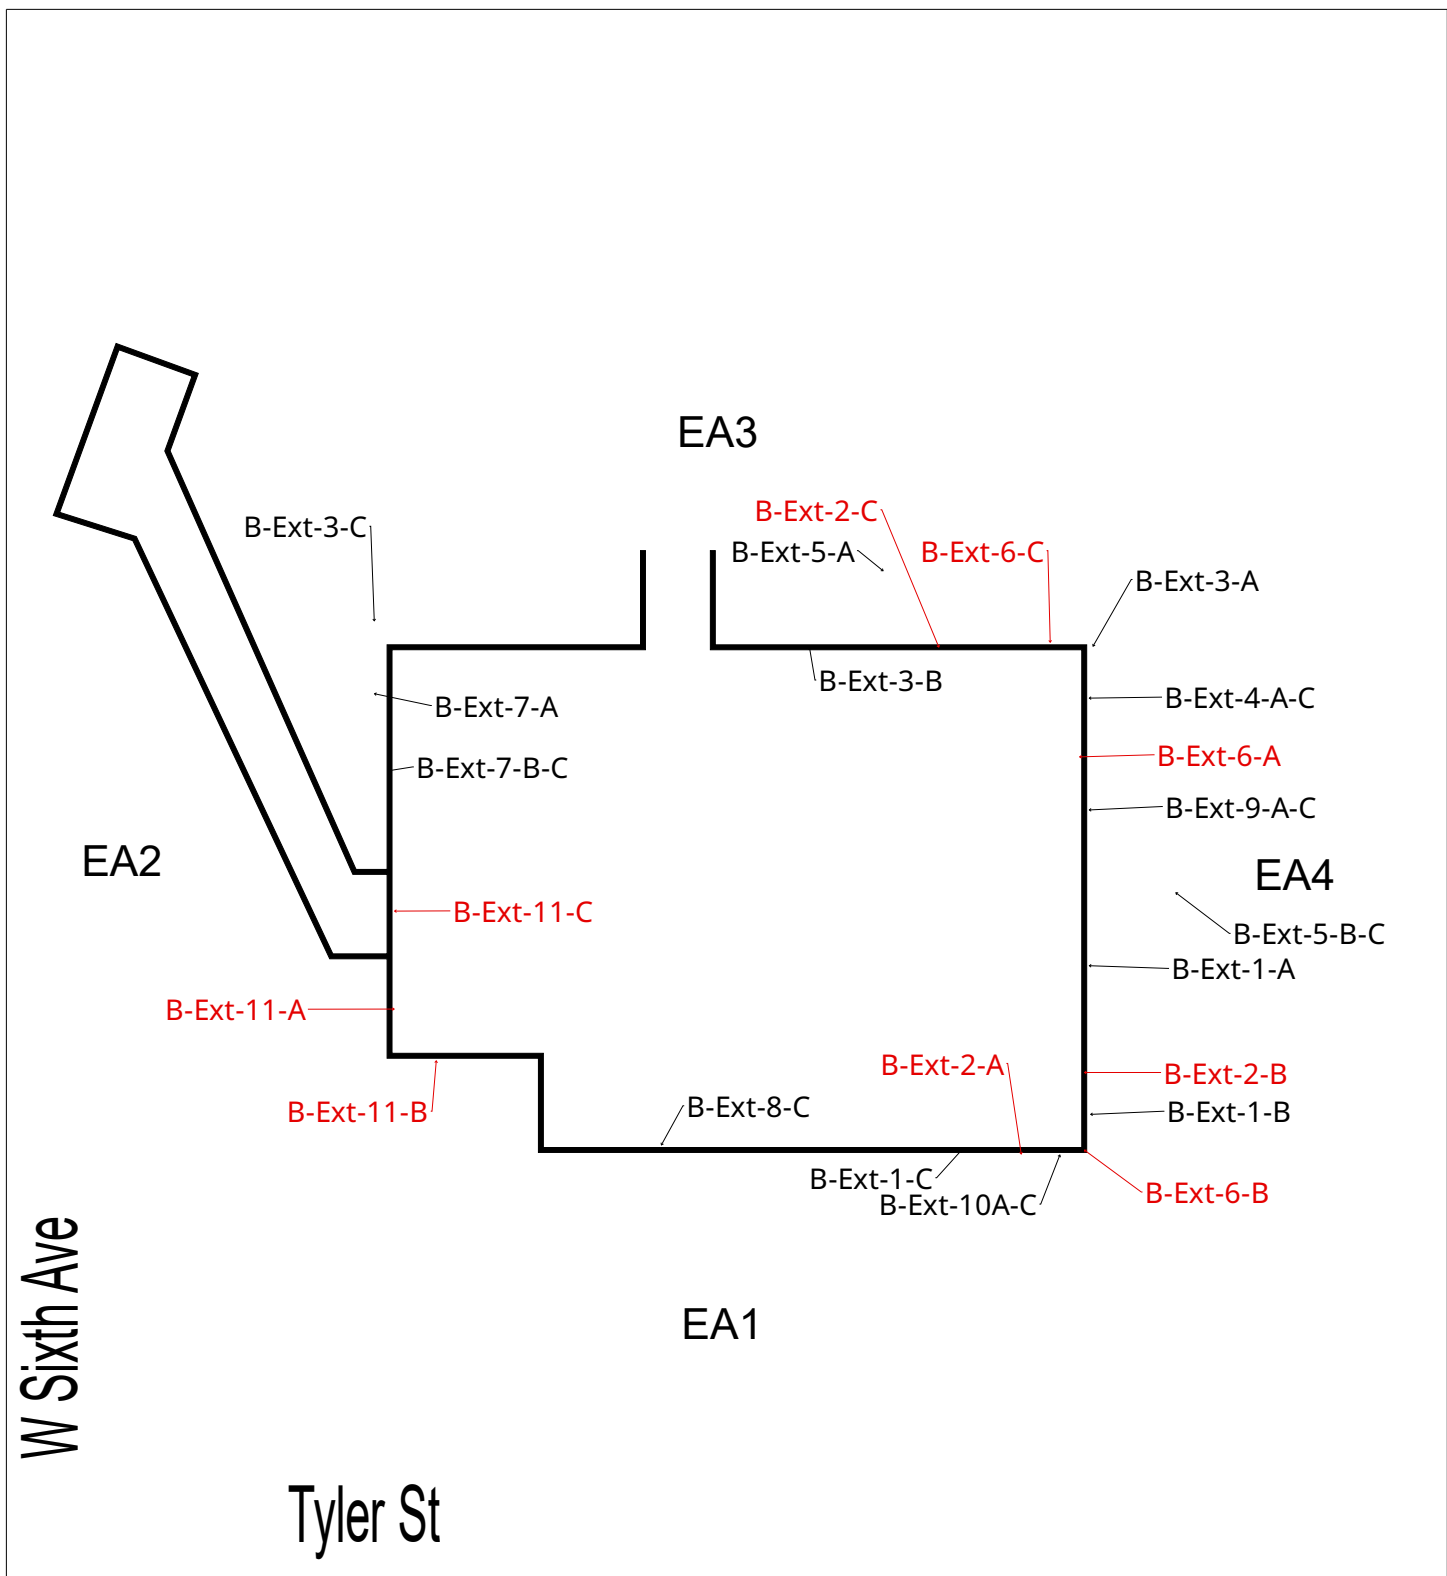


Figure 3 - Second Floor
540 Tyler Street - Building B
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100



Legend

- Sample location
- ACM Sample location




Functional space
inaccessible



Staircase

Approximate Building Area 4,486 SF

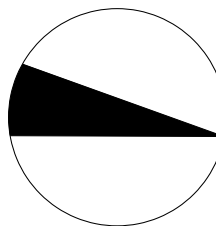

N



Figure 4 - Exterior
540 Tyler Street - Building B
Gray, IN 46402

DATE:
04-15-25


DRAWN BY:
LC

PROJECT NO.
240100

BUILDING C

Assumed Materials

Pipe Insulation- Misc Debris; FS1-FS11

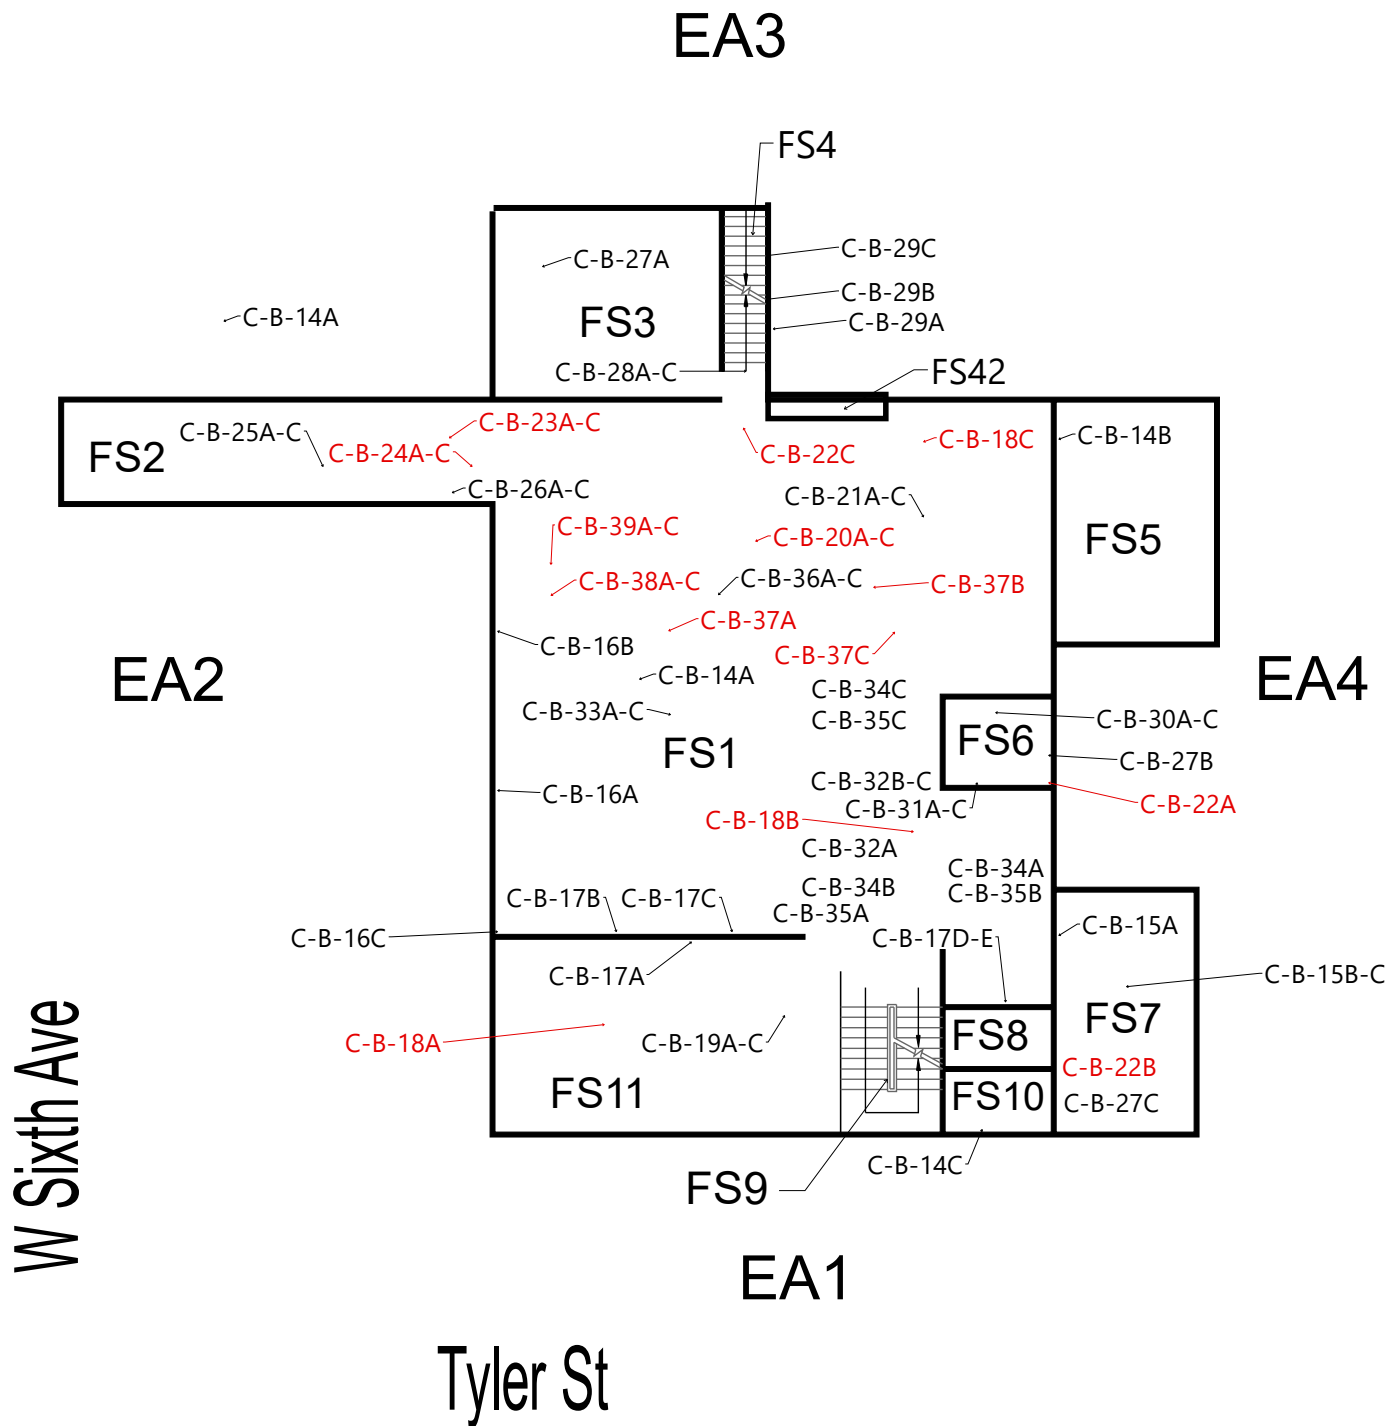

Legend


— Sample location
— ACM Sample location



Functional space
inaccessible



Staircase

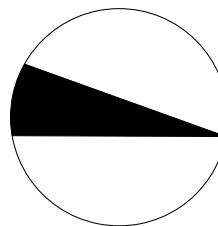

N

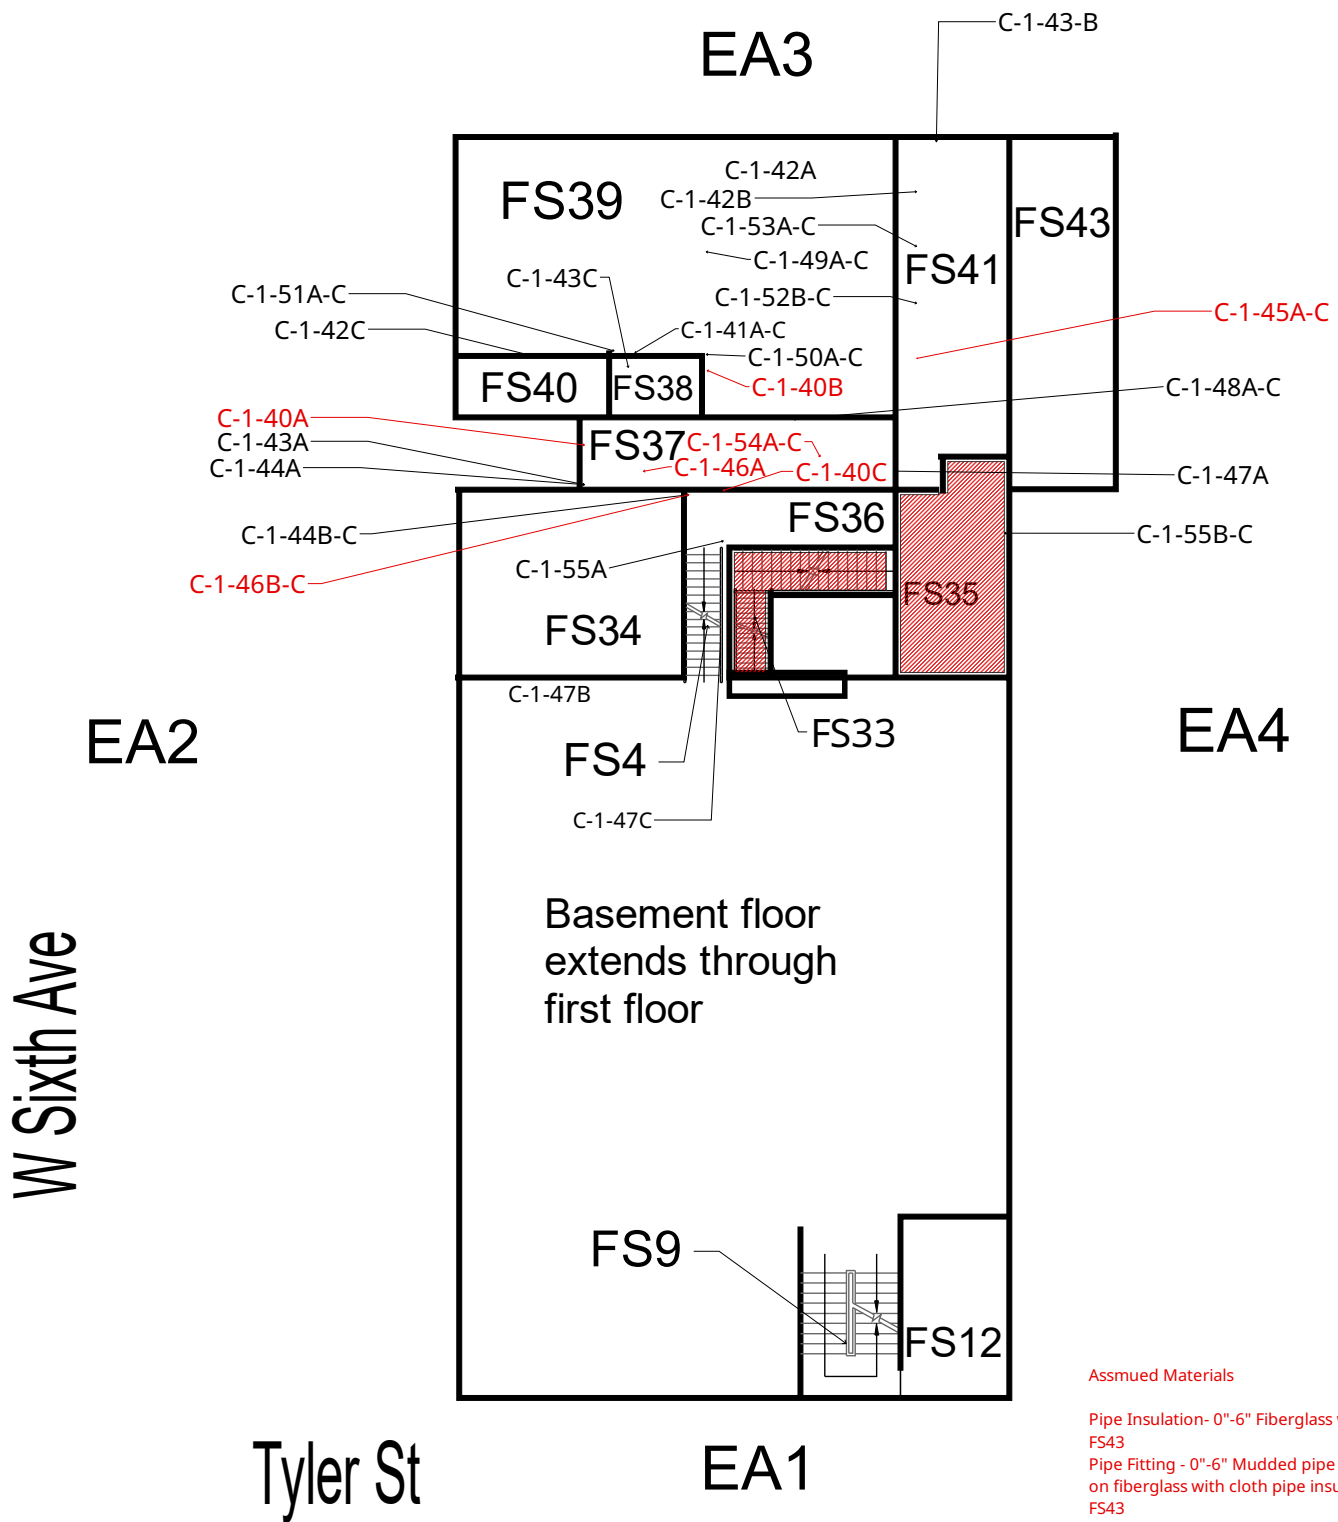


Figure 1 - Basement
540 Tyler Street - Building C
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100



Assmued Materials

Pipe Insulation- 0"-6" Fiberglass with cloth;
FS43
Pipe Fitting - 0"-6" Mudded pipe insulation
on fiberglass with cloth pipe insulation;
FS43

Legend

— Sample location
— ACM Sample location




Functional space
inaccessible



Staircase

Approximate Building Area 3,864 SF

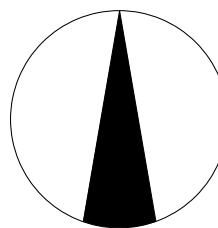

N

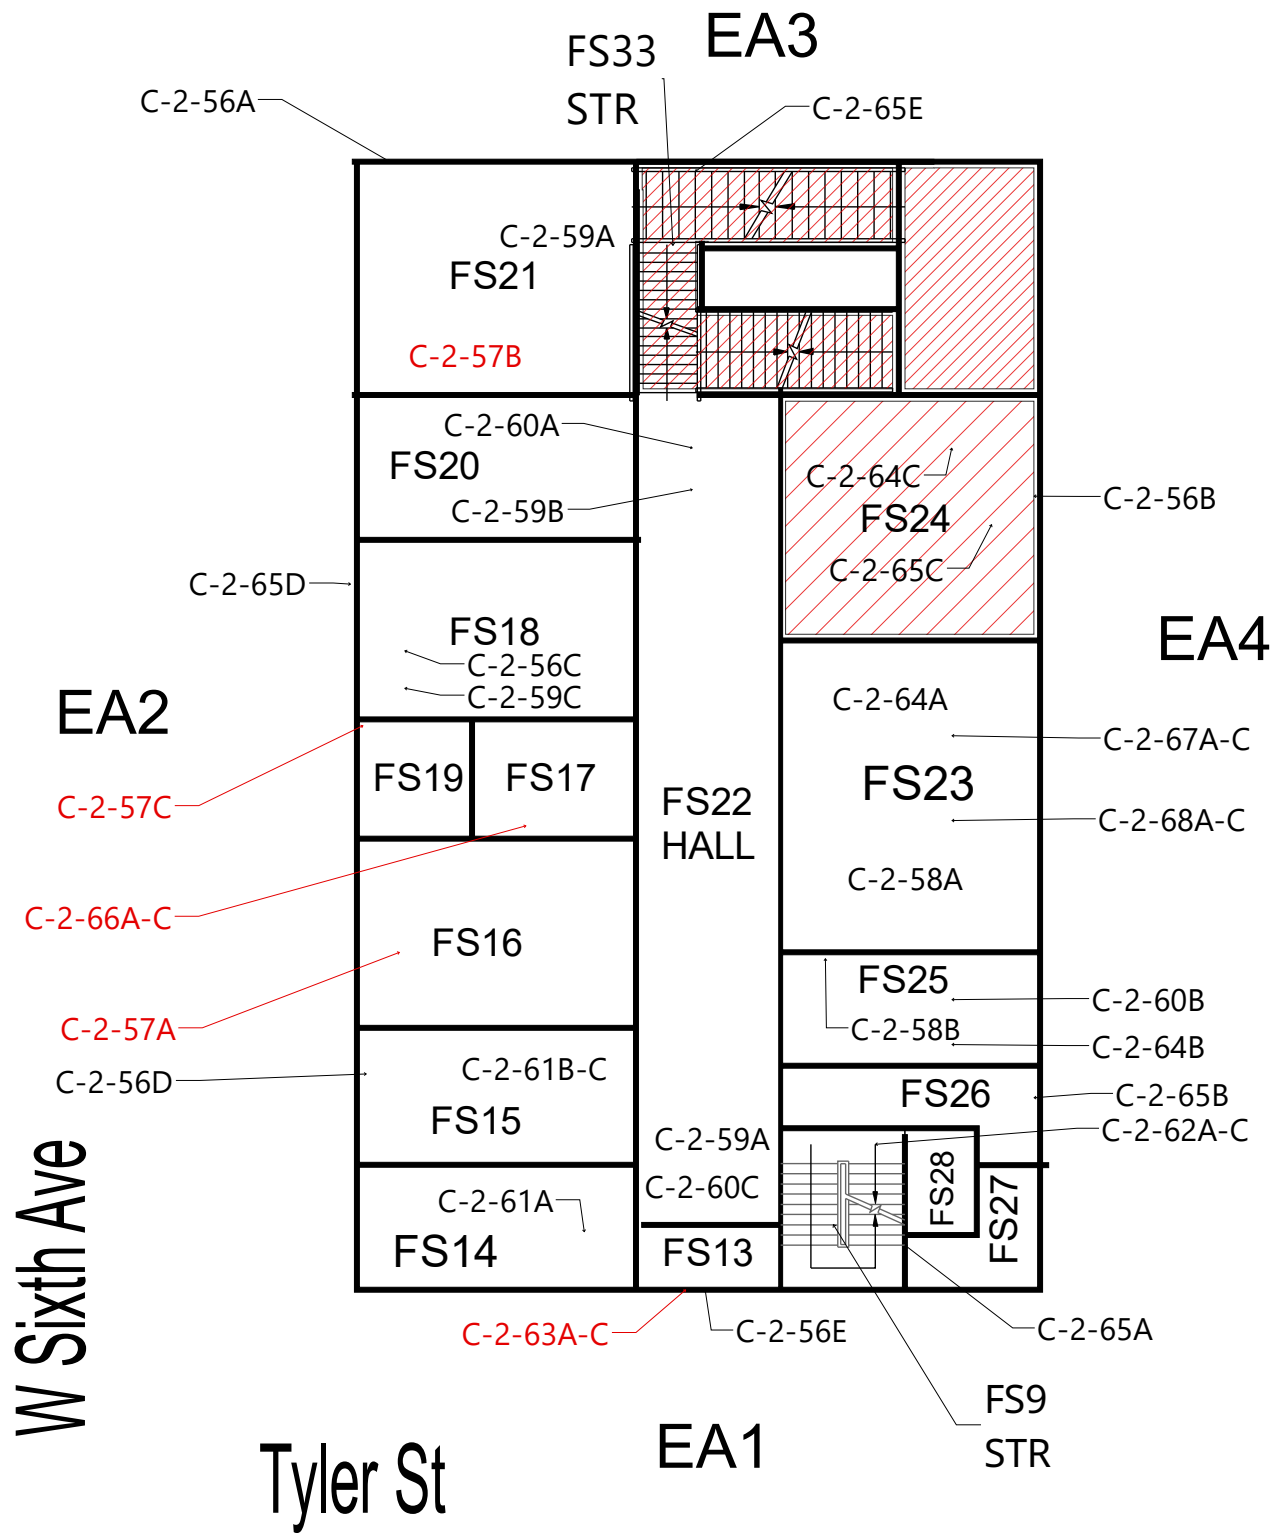


Figure 2 - First Floor
540 Tyler Street - Building C
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC


PROJECT NO.
240100



Legend

- Sample location
- ACM Sample location
- Functional space inaccessible
- Staircase

Approximate Building Area 4,032 SF

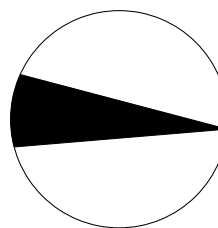

N

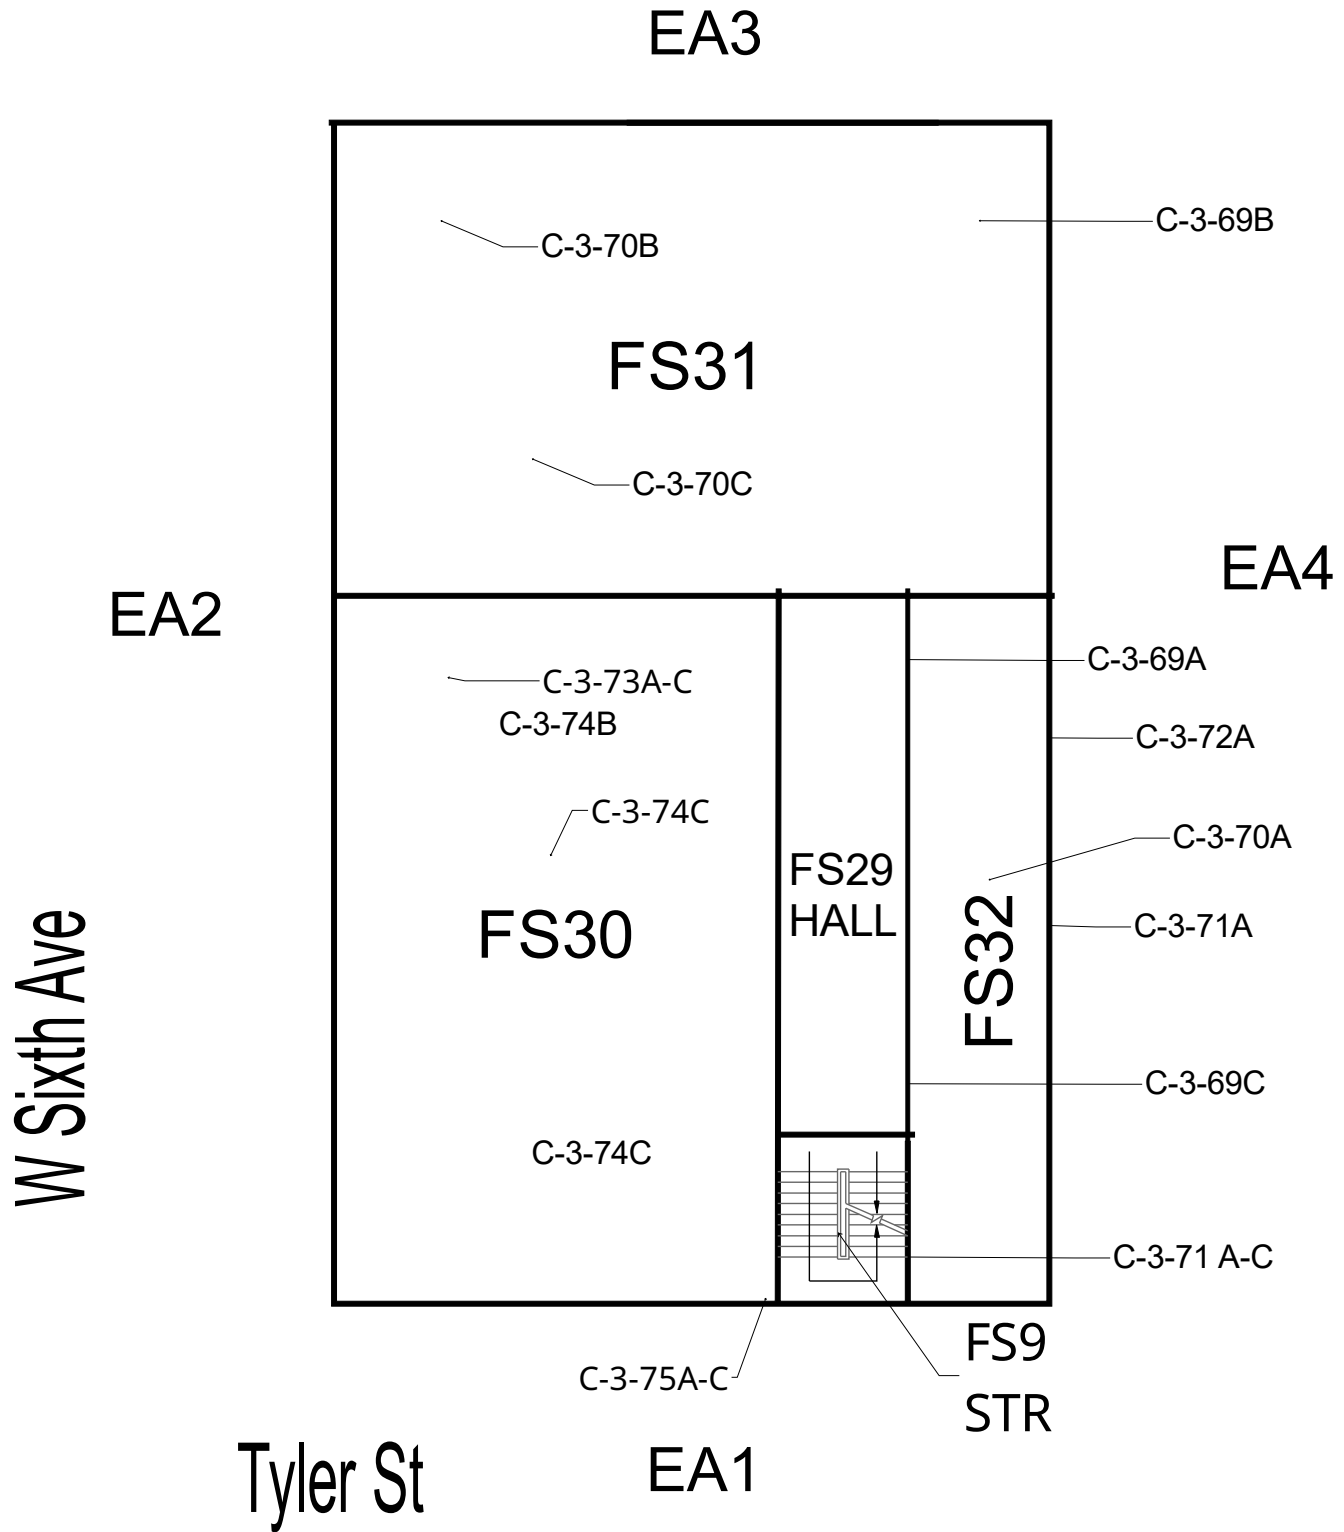


Figure 3 - Second Floor
540 Tyler Street - Building C
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100



Legend

— Sample location
— ACM Sample location




Functional space
inaccessible



Staircase

Approximate Building Area 4,032 SF

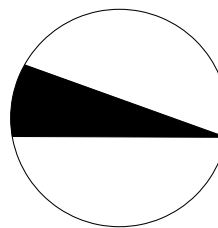

N



Figure 4 - Third Floor
540 Tyler Street - Building C
Gary, IN 46402


DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100

Assumed
Material

Vermiculite-
Behind Block
Mortar; EA4

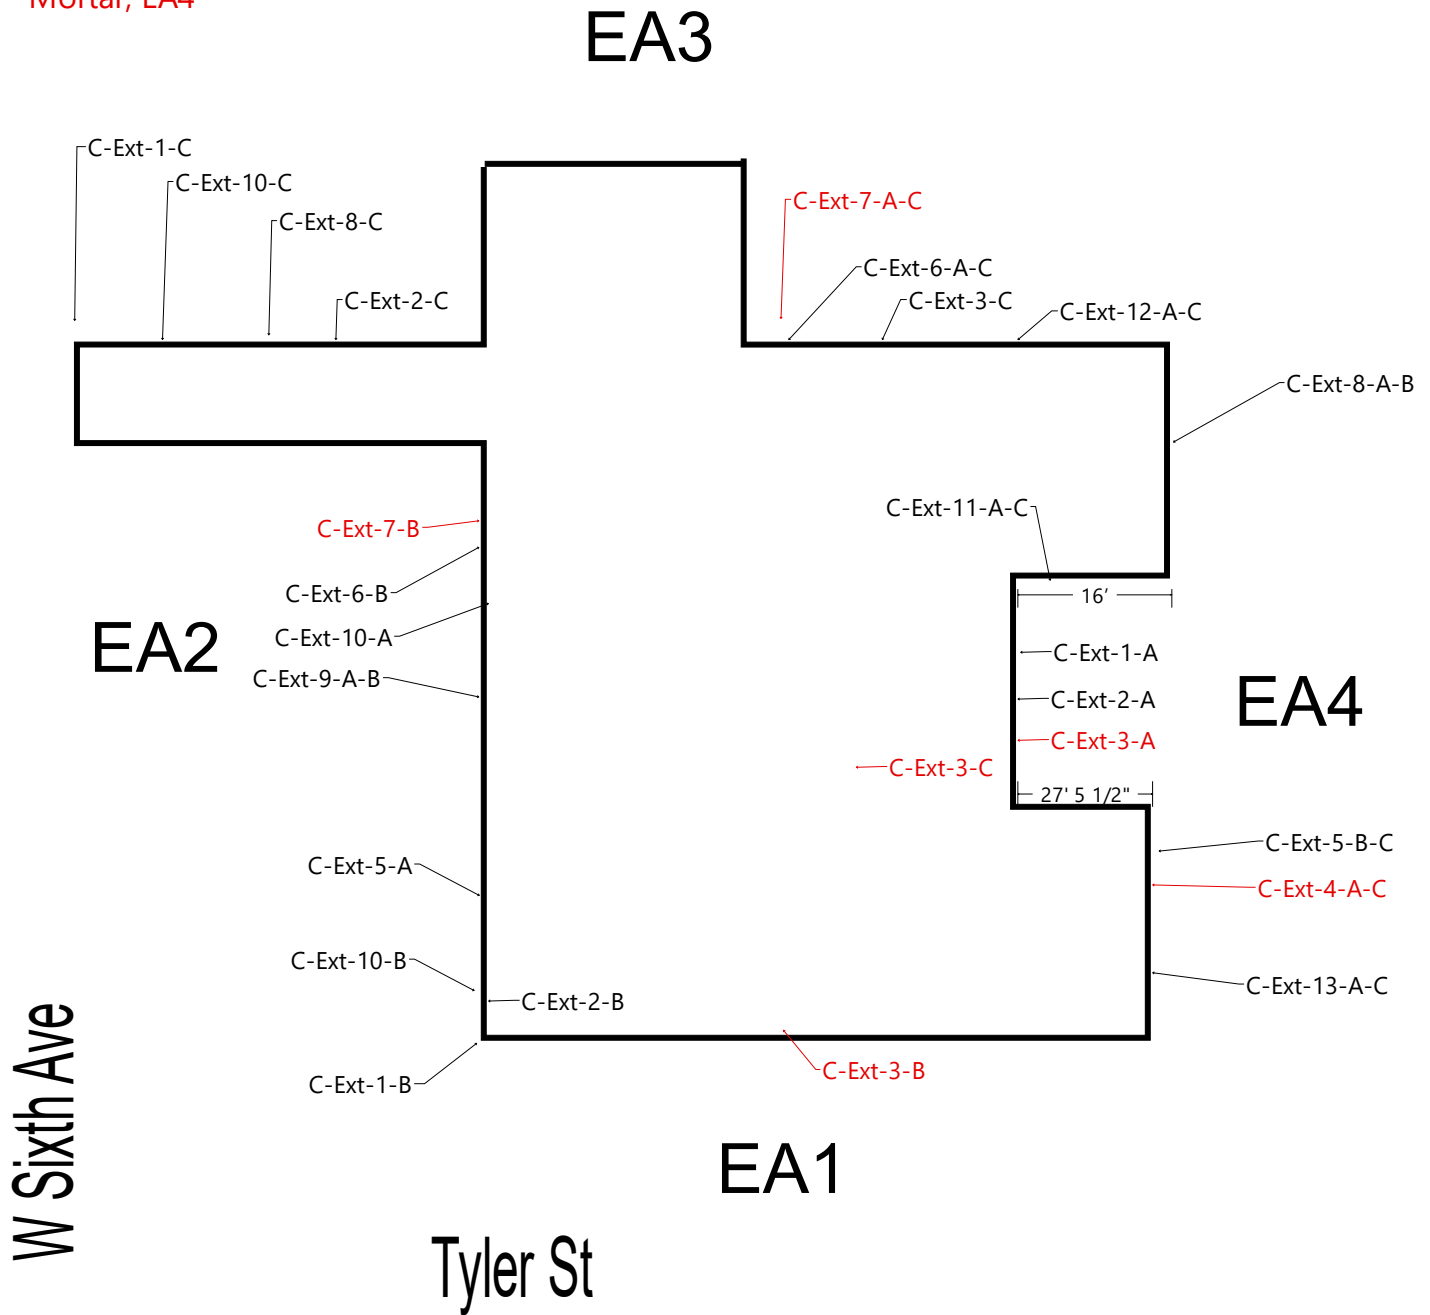

Legend

— Sample location
— ACM Sample location




Functional space
inaccessible



Staircase

Approximate Building Area 5,670 SF

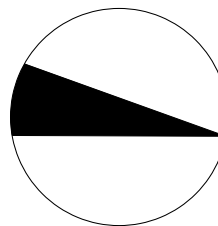

N



Figure 5 - Exterior
540 Tyler Street - Building C
Gary, IN 46402

DATE:
04-15-25

DRAWN BY:
LC

PROJECT NO.
240100

ATTACHMENT 3 – PHOTOGRAPHIC LOG

BUILDING A

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



EA-1 Exterior



EA-1 (B) Exterior



EA-1 (C) Exterior



EA-2 Exterior

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



EA-3 Exterior



EA-3 (B) Exterior



EA-3 (C) Exterior



EA-3 (D) Exterior

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


540 Tyler Street Gary, IN - Building A



EA-3 (E) Exterior



EA-4 Exterior

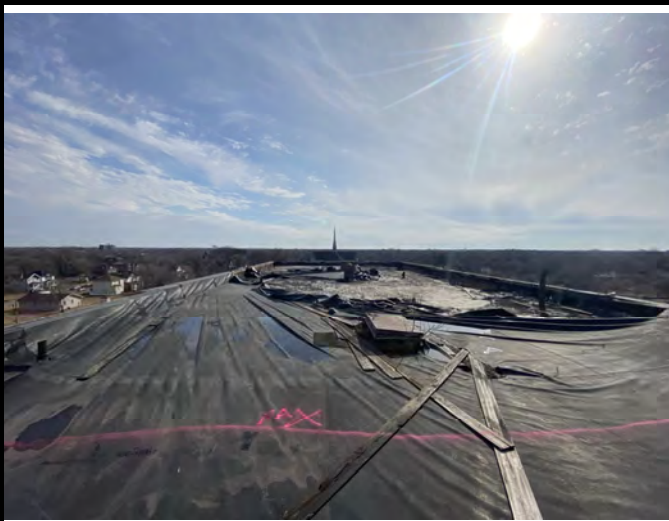

EA-5 Roof



EA-5 (B) Roof

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


540 Tyler Street Gary, IN - Building A



EA-5 (C) Roof



EA-5 (D) Roof

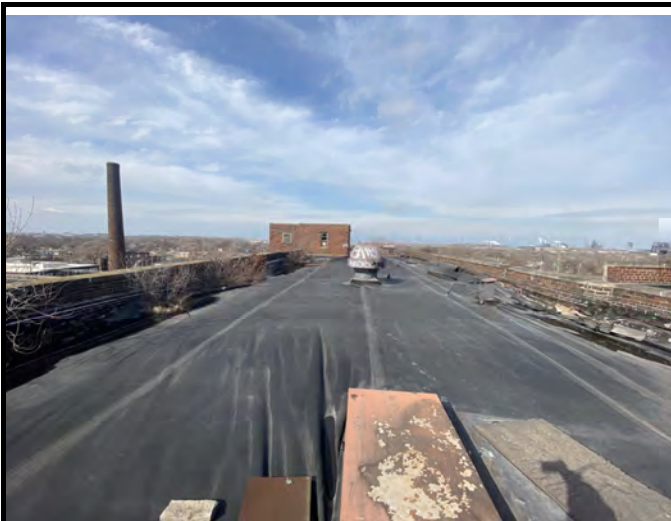

EA-5 (E) Roof



EA-5 (F) Roof

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-1 Basement



FS-2 Basement



FS-3 Basement

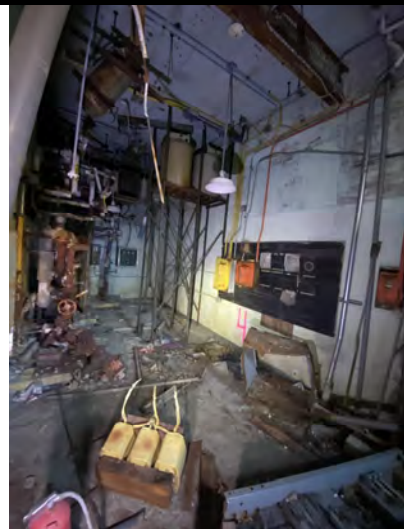

FS-4 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-5 Basement



FS-6 Basement



FS-7 Basement



FS-8 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-9 Basement



FS-10 Basement




FS-11 Basement



FS-12 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A

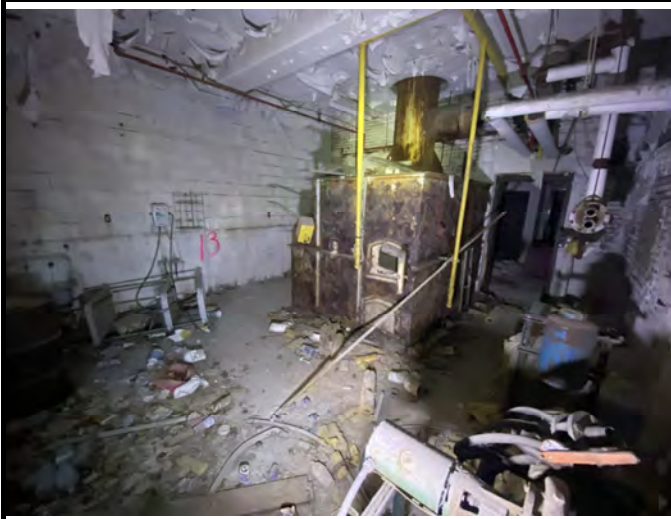

FS-13 Basement



FS-14 Basement



FS-15 Basement



FS-16 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-17 Basement



FS-18 Basement



FS-19 Basement

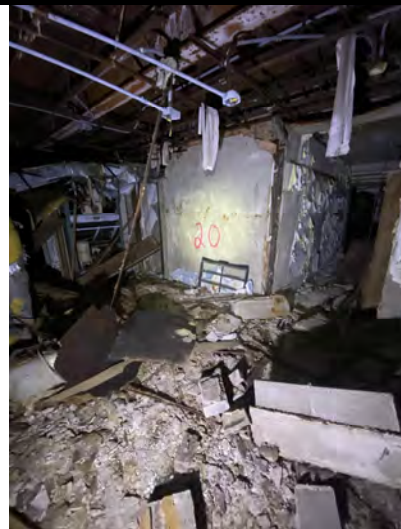

FS-20 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-21 Basement



FS-22 Basement



FS-23 Basement

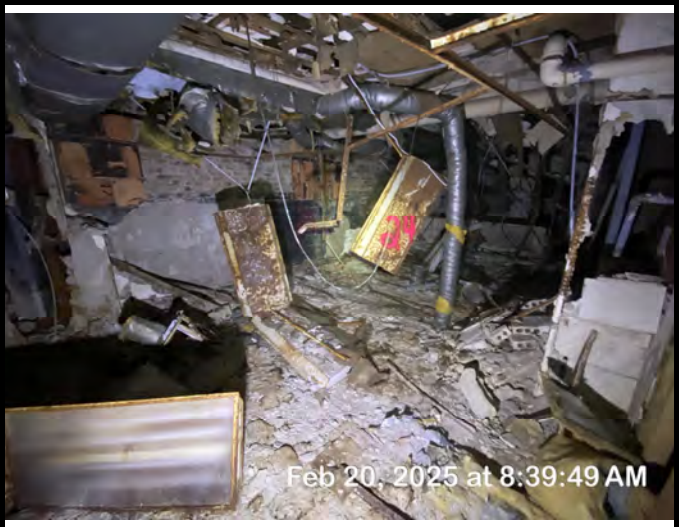

FS-24 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-25 Basement



FS-26 Basement



FS-27 Basement



FS-28 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-29 Basement



FS-30 Basement



FS-31 Basement



FS-32 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-33 Basement



FS-34 Basement



FS-35 Basement



FS-36 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-37 Basement



FS-38 Basement



FS-39 Basement



FS-40 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-41 Basement



FS-41(2) Basement



FS-42 Basement



FS-43 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-44 Basement



FS-45 Basement



FS-46 Basement



FS-47 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-48 Basement



FS-49 Basement



FS-50 Basement



FS-51 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-52 Basement



FS-53 Basement



FS-54 Basement



FS-55 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-56 Basement



FS-57 Basement



FS-58 Basement



FS-59 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-60 Basement



FS-61 Basement



FS-62 Basement



FS-63 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-64 Basement



FS-65 Basement



FS-66 Basement

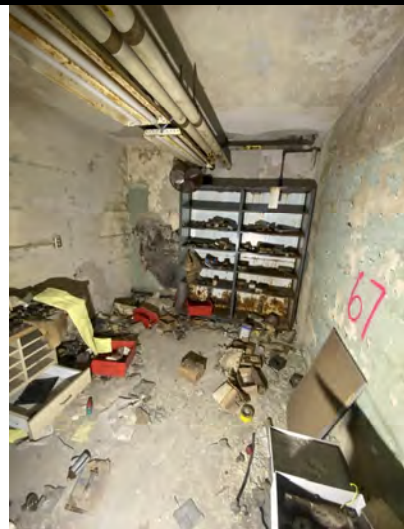

FS-67 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-68 Basement



FS-69 Basement



FS-70 Basement

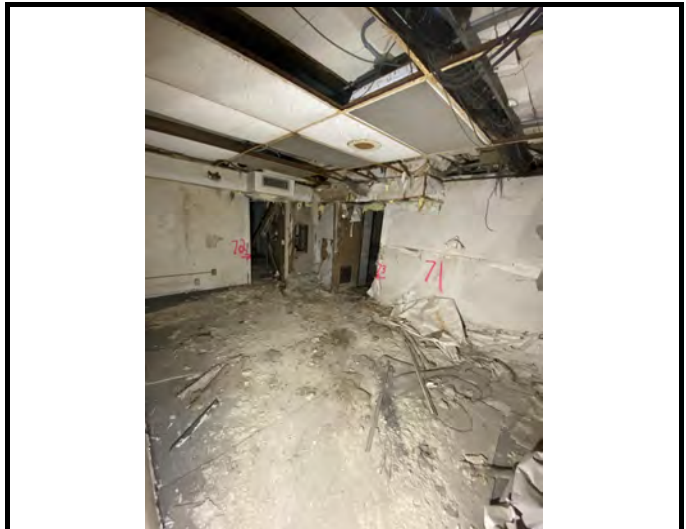


FS-71 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


540 Tyler Street Gary, IN - Building A



FS-72 Basement

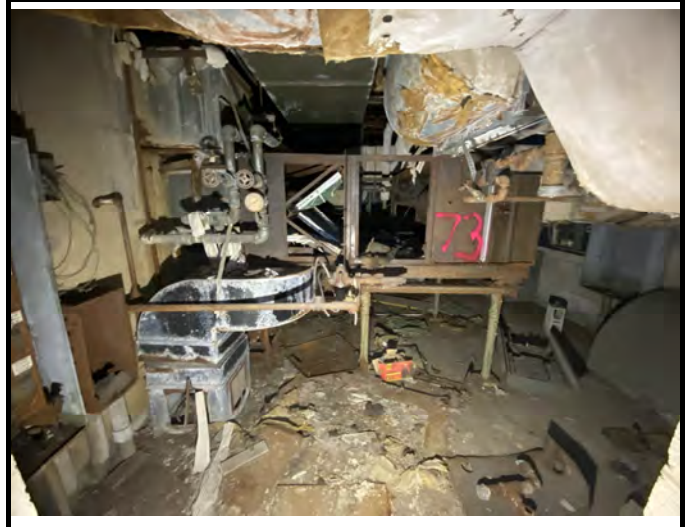

FS-73 Basement

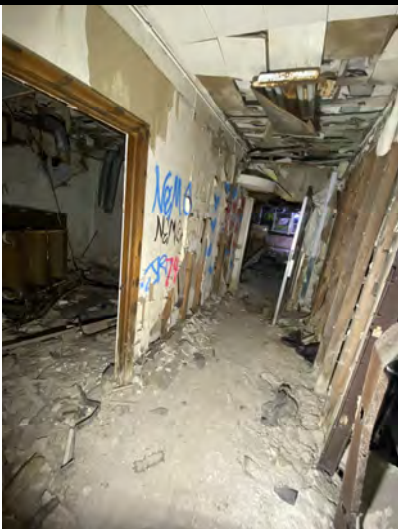

FS-74 Basement



FS-75 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


540 Tyler Street Gary, IN - Building A



FS-76 Basement



FS-77 Basement

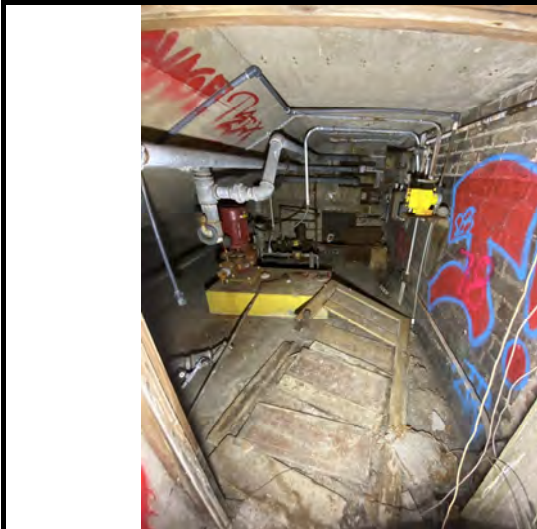

FS-78 Basement



FS-79 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-80 Basement



FS-81 Basement



FS-82 1st Floor



FS-83 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-84 1st Floor



FS-85 1st Floor



FS-86 1st Floor



FS-87 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-88 1st Floor



FS-89 1st Floor



FS-90 1st Floor




FS-91 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-92 1st Floor

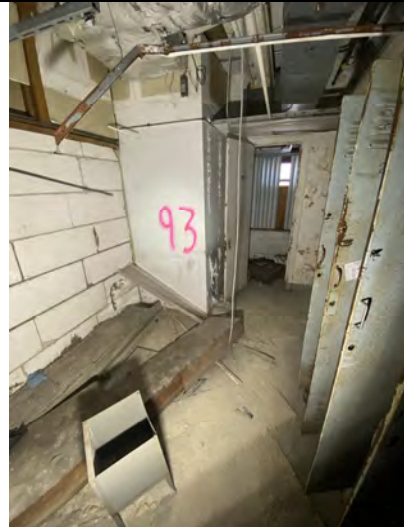

FS-93 1st Floor



FS-94 1st Floor



FS-95 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-96 1st Floor



FS-97 1st Floor



FS-98 1st Floor



FS-99 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-100 1st Floor



FS-101 1st Floor



FS-102 1st Floor



FS-103 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-104 1st Floor



FS-105 1st Floor



FS-106 1st Floor



FS-107 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-108 1st Floor



FS-109 1st Floor



FS-110 1st Floor



FS-111 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-112 1st Floor



FS-113 1st Floor



FS-114 1st Floor



FS-115 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-116 1st Floor



FS-117 1st Floor



FS-118 1st Floor

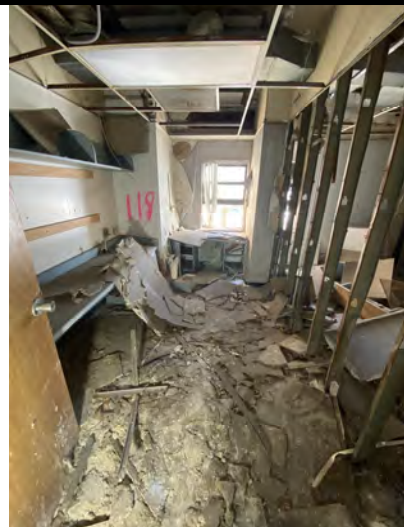


FS-119 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-120 1st Floor

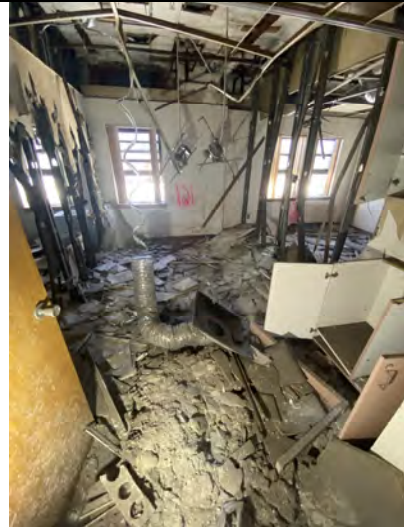

FS-121 1st Floor



FS-122 1st Floor



FS-123 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-124 1st Floor



FS-125 1st Floor



FS-126 1st Floor



FS-127 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-128 1st Floor



FS-129 1st Floor



FS-130 1st Floor



FS-131 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-132 1st Floor



FS-133 1st Floor



FS-134 1st Floor




FS-135 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-136 1st Floor

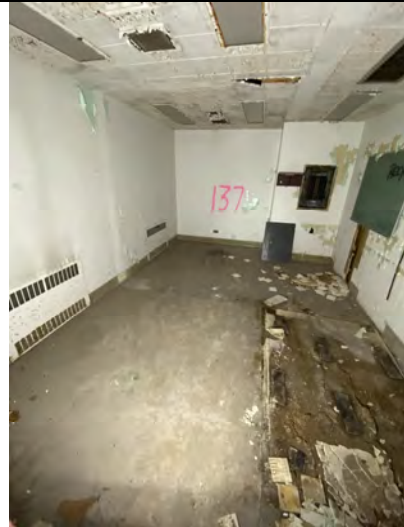

FS-137 1st Floor



FS-138 1st Floor

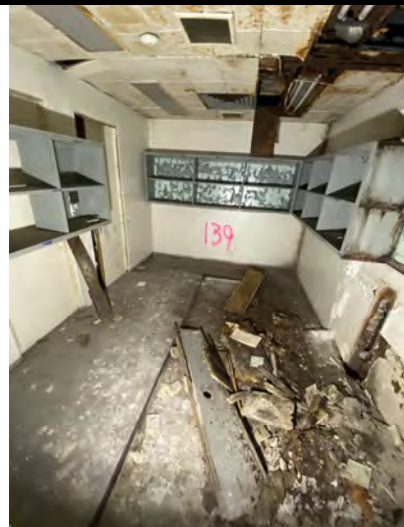

FS-139 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-140 1st Floor



FS-141 1st Floor



FS-142 1st Floor



FS-143 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-144 1st Floor



FS-145 1st Floor



FS-146 1st Floor

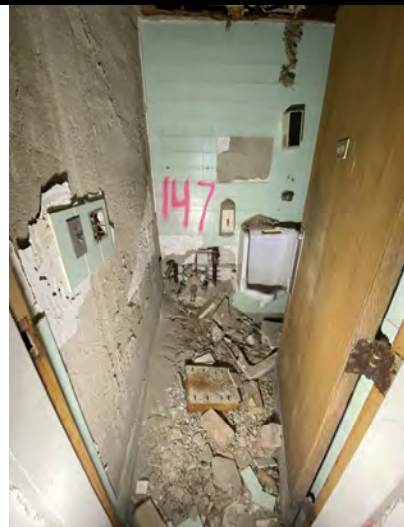

FS-147 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-148 1st Floor



FS-149 1st Floor



FS-150 1st Floor



FS-151 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-152 1st Floor



FS-153 1st Floor



FS-154 1st Floor



FS-155 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-156 1st Floor



FS-157 1st Floor



FS-158 1st Floor




FS-159 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-160 1st Floor

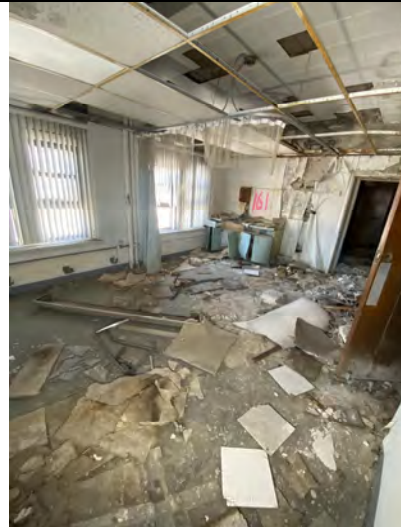

FS-161 1st Floor



FS-162 1st Floor

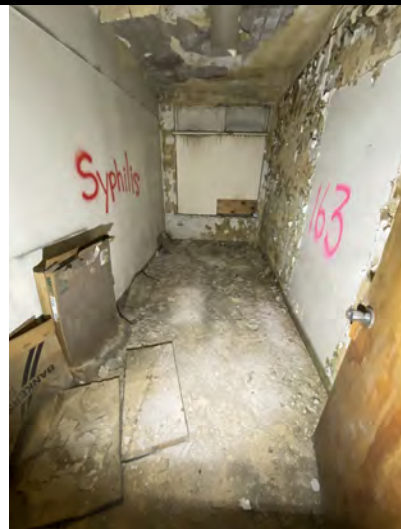

FS-163 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-164 1st Floor



FS-165 1st Floor



FS-166 1st Floor



FS-167 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-168 1st Floor



FS-169 1st Floor



FS-170 1st Floor



FS-171 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-172 1st Floor



FS-173 1st Floor



FS-174 1st Floor



FS-175 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-176 1st Floor



FS-177 1st Floor



FS-178 1st Floor



FS-178(2) 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-179 1st Floor



FS-180 1st Floor



FS-180(2) 1st Floor



FS-180(3) 1st Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-181 1st Floor



FS-182 1st Floor



FS-183 1st Floor



FS-184 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


540 Tyler Street Gary, IN - Building A




FS-185 2nd Floor



FS-186 2nd Floor

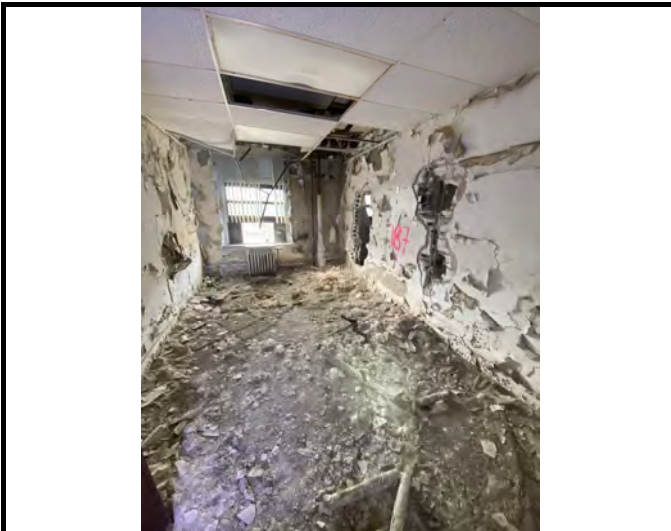

FS-187 2nd Floor

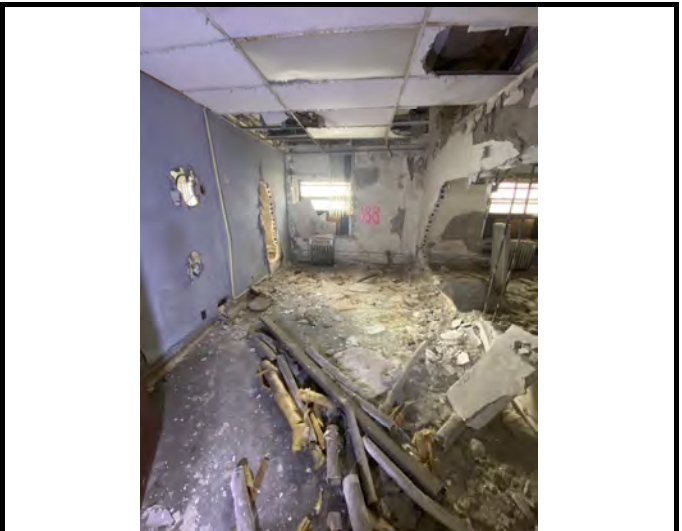


FS-188 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-189 2nd Floor

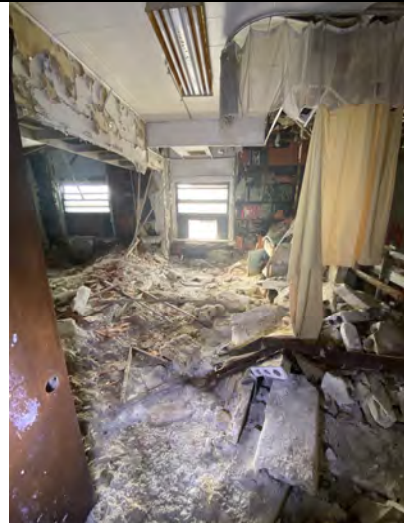

FS-190 2nd Floor



FS-191 2nd Floor



FS-192 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-193 2nd Floor



FS-194 2nd Floor



FS-195 2nd Floor



FS-196 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-197 2nd Floor



FS-198 2nd Floor



FS-199 2nd Floor

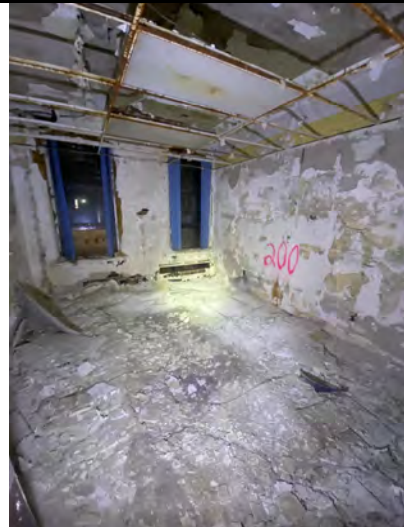

FS-200 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-201 2nd Floor



FS-202 2nd Floor



FS-203 2nd Floor



FS-204 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-205 2nd Floor



FS-206 2nd Floor




FS-207 2nd Floor




FS-208 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A

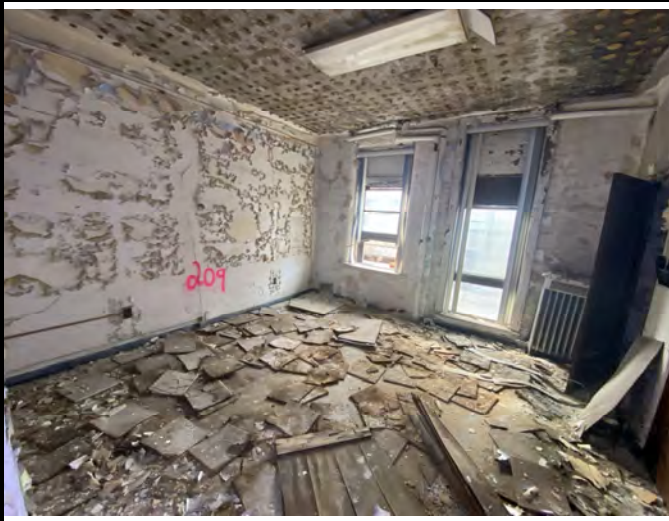

FS-209 2nd Floor

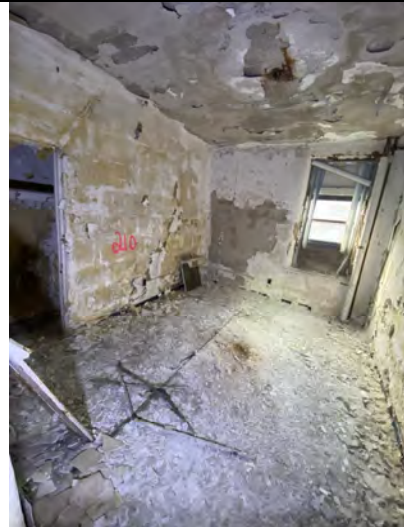

FS-210 2nd Floor



FS-211 2nd Floor



FS-212 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-213 2nd Floor



FS-214 2nd Floor



FS-215 2nd Floor



FS-216 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-217 2nd Floor



FS-218 2nd Floor



FS-219 2nd Floor




FS-220 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-221 2nd Floor

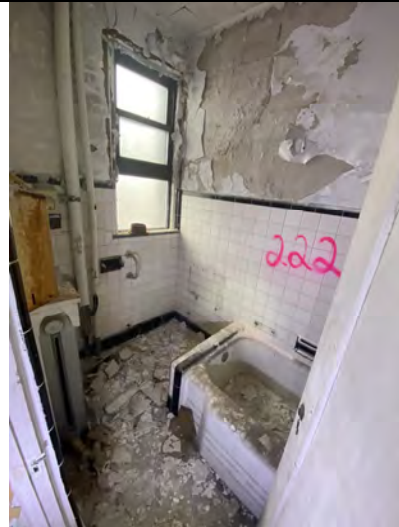

FS-222 2nd Floor




FS-223 2nd Floor



FS-224 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A

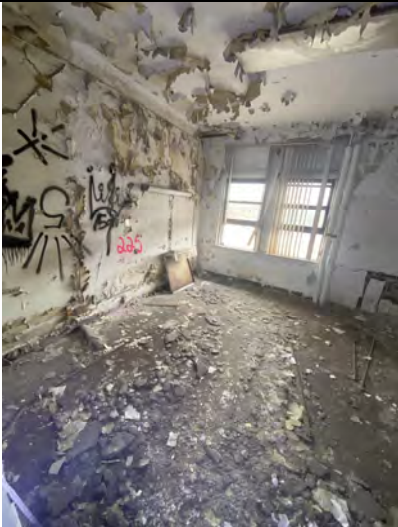


FS-225 2nd Floor



FS-226 2nd Floor



FS-227 2nd Floor

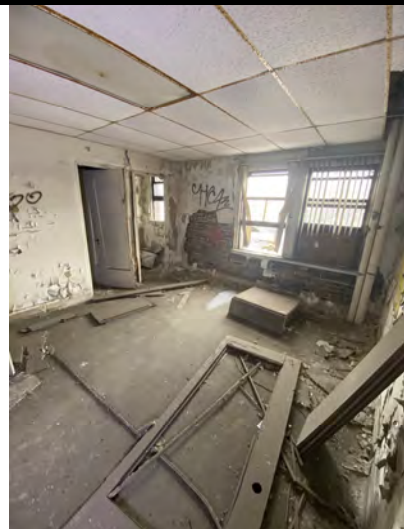

FS-228 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-229 2nd Floor



FS-230 2nd Floor



FS-231 2nd Floor



FS-232 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-233 2nd Floor



FS-234 2nd Floor



FS-235 2nd Floor



FS-236 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


540 Tyler Street Gary, IN - Building A




FS-237 2nd Floor



FS-238 2nd Floor

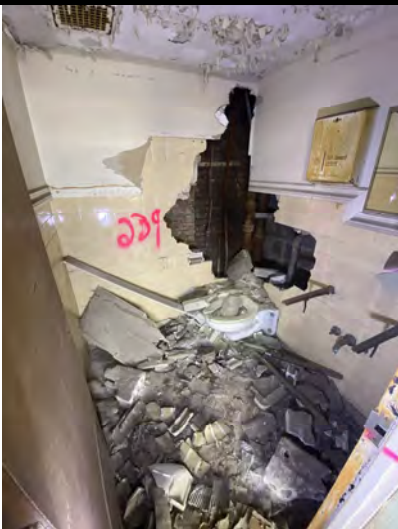

FS-239 2nd Floor

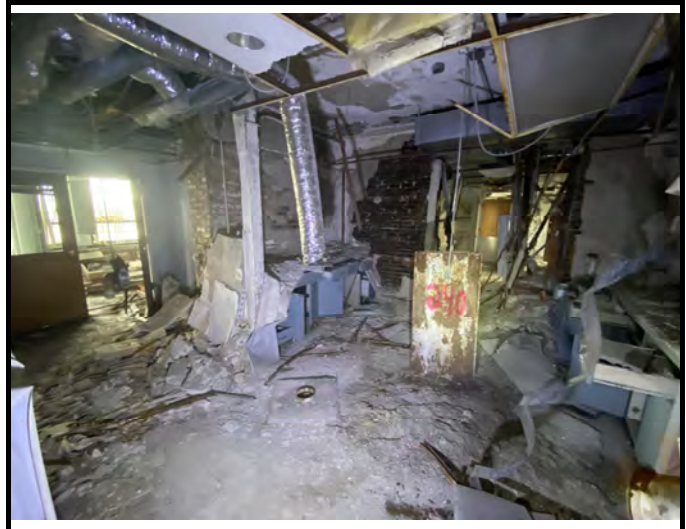

FS-240 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-241 2nd Floor



FS-242 2nd Floor



FS-243 2nd Floor



FS-244 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-245 2nd Floor



FS-246 2nd Floor



FS-247 2nd Floor



FS-248 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-249 2nd Floor



FS-250 2nd Floor



FS-251 2nd Floor

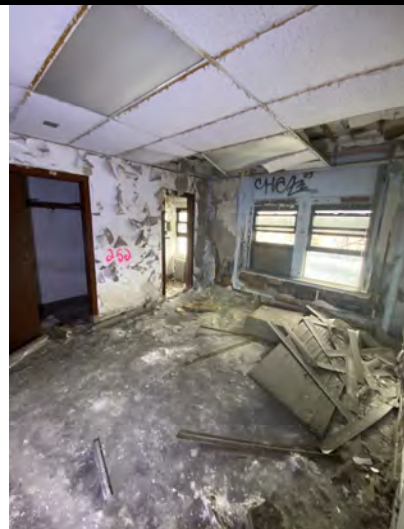

FS-252 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-253 2nd Floor



FS-254 2nd Floor



FS-255 2nd Floor



FS-256 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-257 2nd Floor



FS-258 2nd Floor



FS-259 2nd Floor




FS-260 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-261 2nd Floor

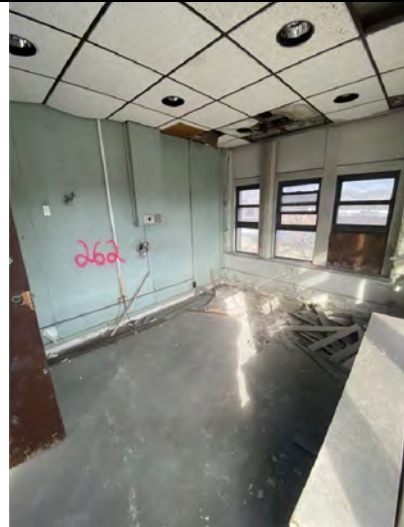

FS-262 2nd Floor



FS-263 3rd Floor



FS-264 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-265 3rd Floor



FS-266 3rd Floor



FS-267 3rd Floor



FS-268 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-269 3rd Floor



FS-270 3rd Floor



FS-271 3rd Floor




FS-272 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-273 3rd Floor

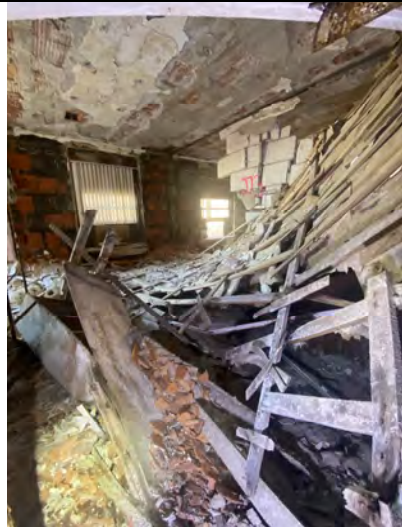

FS-273(2) 3rd Floor



FS-274 3rd Floor

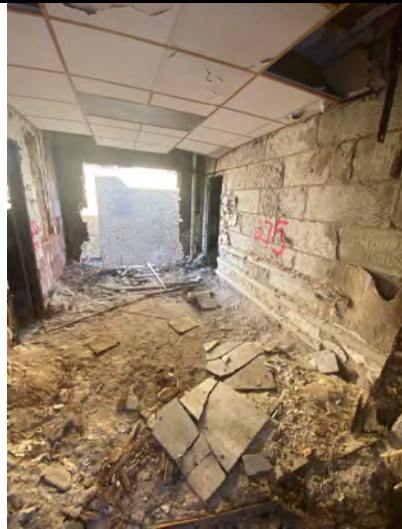

FS-275 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-276 3rd Floor



FS-277 3rd Floor



FS-278 3rd Floor




FS-279 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-280 3rd Floor

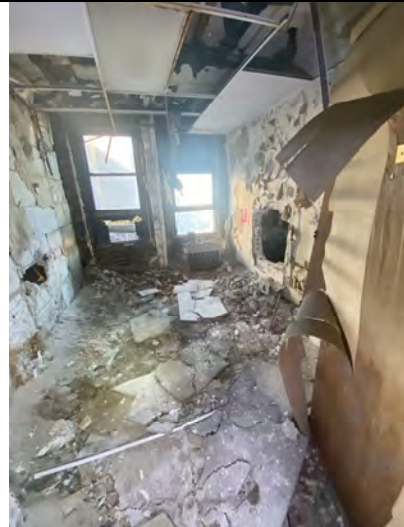

FS-281 3rd Floor



FS-282 3rd Floor

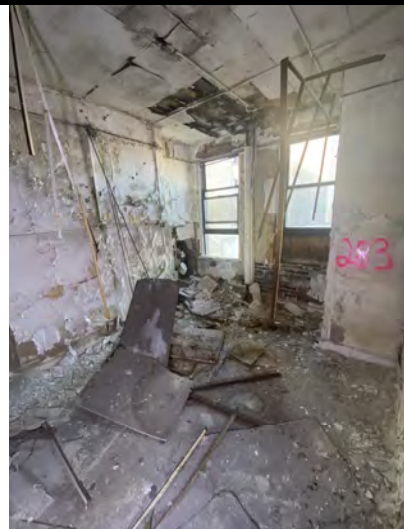

FS-283 3rd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-284 3rd Floor



FS-285 3rd Floor



FS-286 3rd Floor



FS-287 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-288 3rd Floor



FS-289 3rd Floor



FS-290 3rd Floor



FS-291 3rd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-292 3rd Floor



FS-293 3rd Floor



FS-294 3rd Floor



FS-295 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-296 3rd Floor



FS-297 3rd Floor



FS-298 3rd Floor



FS-299 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-300 3rd Floor



FS-301 3rd Floor



FS-302 3rd Floor



FS-303 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-304 3rd Floor



FS-305 3rd Floor



FS-306 3rd Floor



FS-307 3rd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces


540 Tyler Street Gary, IN - Building A



FS-308 3rd Floor



FS-309 3rd Floor

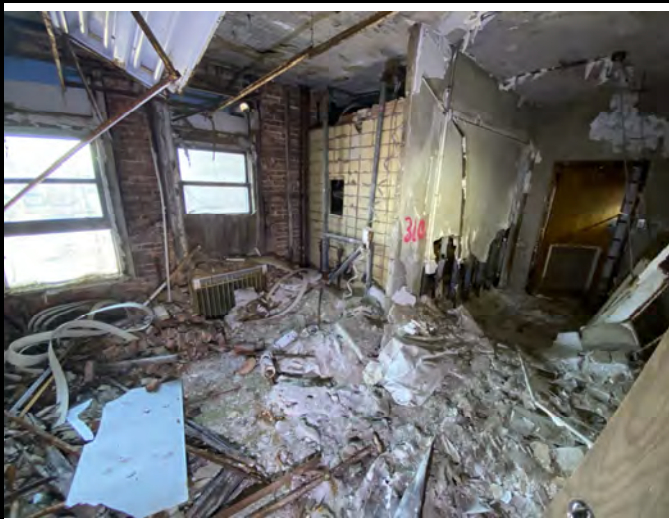

FS-310 3rd Floor



FS-311 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-312 3rd Floor



FS-313 3rd Floor



FS-314 3rd Floor



FS-315 3rd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-316 3rd Floor



FS-317 3rd Floor



FS-318 3rd Floor



FS-319 3rd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-320 3rd Floor



FS-321 3rd Floor



FS-322 3rd Floor



FS-323 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-324 3rd Floor



FS-325 3rd Floor



FS-326 3rd Floor



FS-327 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-328 3rd Floor



FS-329 3rd Floor



FS-330 3rd Floor



FS-331 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-332 3rd Floor



FS-333 3rd Floor



FS-334 3rd Floor



FS-335 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-336 3rd Floor



FS-337 3rd Floor



FS-338 3rd Floor



FS-339 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-340 3rd Floor



FS-341 3rd Floor



FS-342 3rd Floor



FS-343 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-344 4th Floor



FS-345 4th Floor



FS-346 4th Floor



FS-347 4th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-348 4th Floor



FS-349 4th Floor



FS-350 4th Floor



FS-351 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-352 4th Floor



FS-353 4th Floor



FS-354 4th Floor



FS-355 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-356 4th Floor



FS-357 4th Floor



FS-358 4th Floor

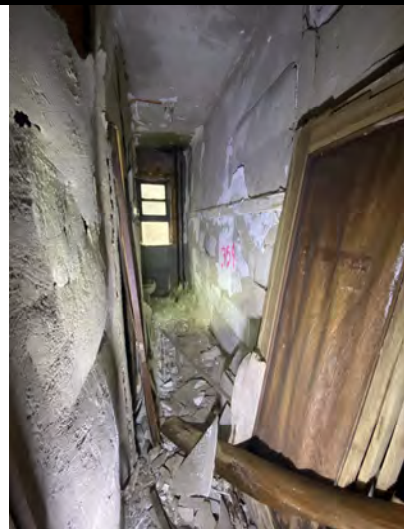

FS-359 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-360 4th Floor



FS-361 4th Floor



FS-362 4th Floor



FS-363 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-364 4th Floor



FS-365 4th Floor



FS-366 4th Floor



FS-367 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-368 4th Floor



FS-369 4th Floor



FS-370 4th Floor




FS-371 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-372 4th Floor

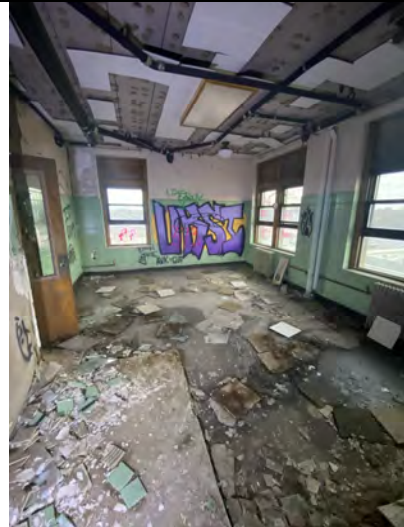

FS-373 4th Floor



FS-374 4th Floor



FS-375 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-376 4th Floor



FS-377 4th Floor



FS-378 4th Floor



FS-379 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-380 4th Floor



FS-381 4th Floor



FS-382 4th Floor



FS-383 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-384 4th Floor



FS-385 4th Floor



FS-386 4th Floor



FS-387 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-388 4th Floor



FS-389 4th Floor



FS-390 4th Floor



FS-391 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-392 4th Floor



FS-393 4th Floor



FS-394 4th Floor



FS-395 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-396 4th Floor



FS-397 4th Floor



FS-398 4th Floor

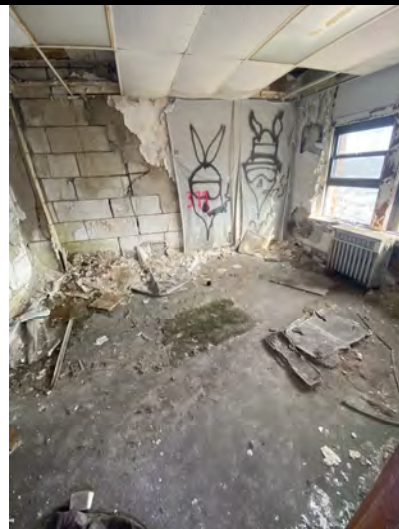

FS-399 4th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-400 4th Floor



FS-401 4th Floor



FS-402 4th Floor



FS-403 4th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-404 4th Floor



FS-405 4th Floor



FS-406 4th Floor



FS-407 4th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-408 4th Floor



FS-409 4th Floor



FS-410 4th Floor



FS-411 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-412 5th Floor



FS-413 5th Floor



FS-414 5th Floor

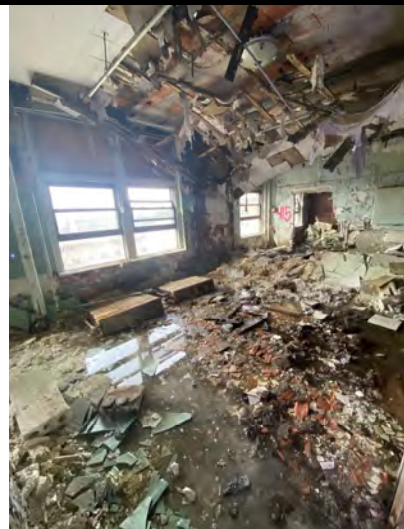


FS-415 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-416 5th Floor

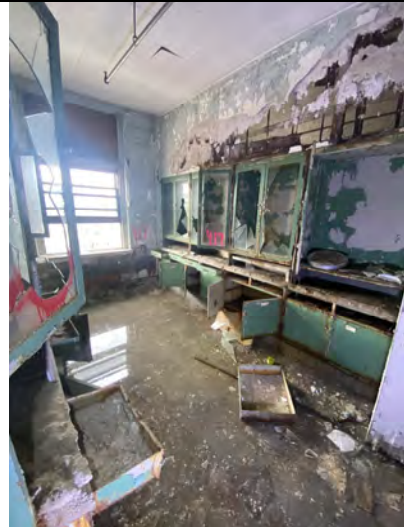

FS-417 5th Floor



FS-418 5th Floor

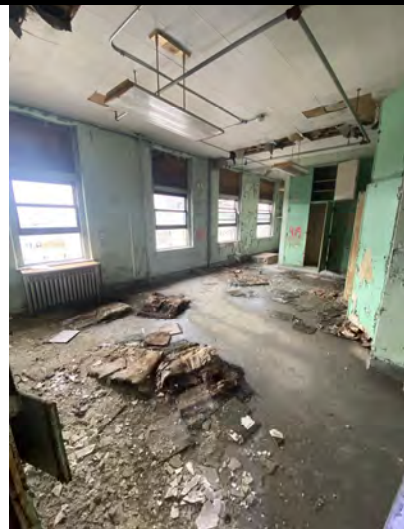

FS-419 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-420 5th Floor



FS-421 5th Floor




FS-422 5th Floor



FS-423 5th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A

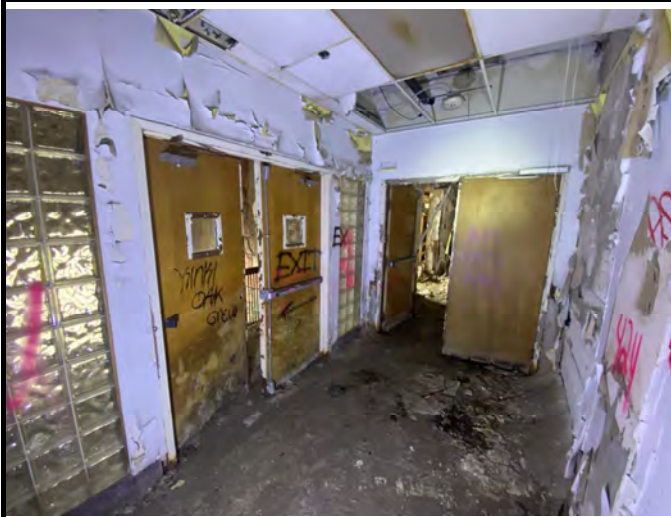


FS-424 5th Floor



FS-425 5th Floor



FS-426 5th Floor

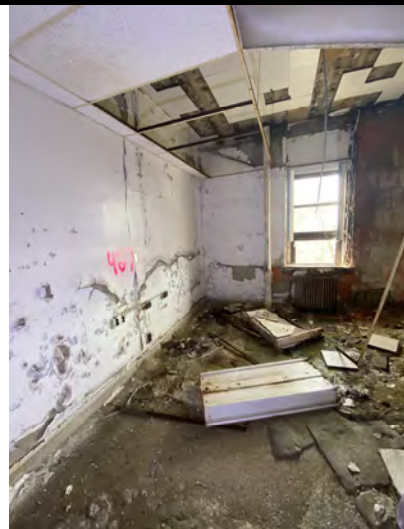

FS-427 5th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-428 5th Floor



FS-429 5th Floor



FS-430 5th Floor



FS-431 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-432 5th Floor



FS-433 5th Floor



FS-434 5th Floor

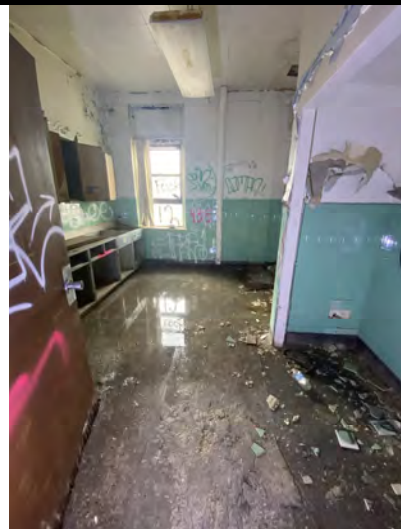


FS-435 5th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-436 5th Floor

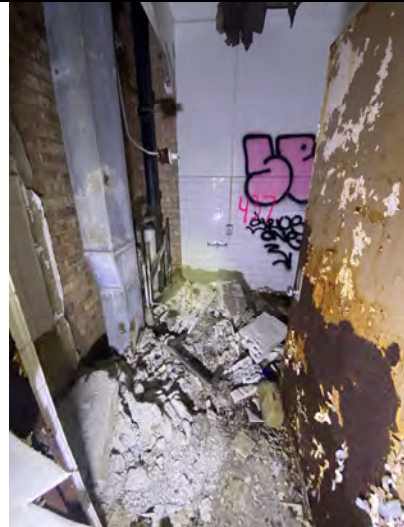

FS-437 5th Floor



FS-438 5th Floor



FS-439 5th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A




FS-440 5th Floor



FS-441 5th Floor



FS-442 5th Floor

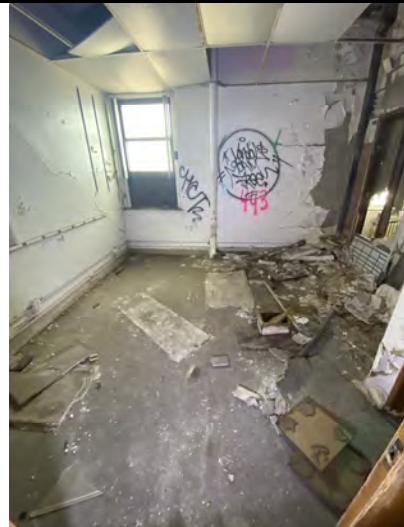


FS-443 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-444 5th Floor

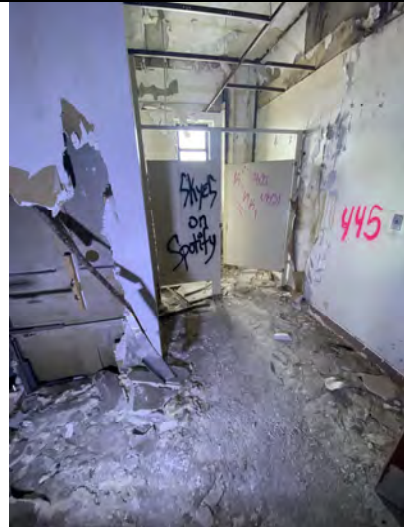

FS-445 5th Floor



FS-446 5th Floor



FS-447 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A




FS-448 5th Floor



FS-449 5th Floor



FS-450 5th Floor

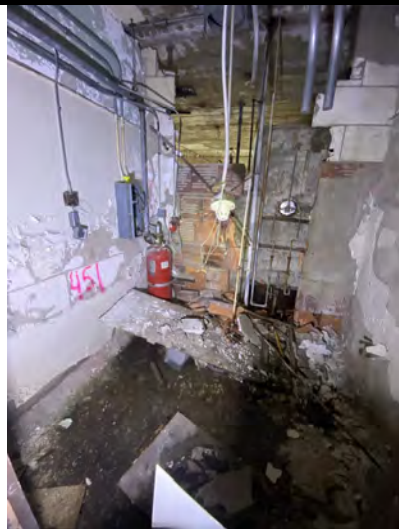

FS-451 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-452 5th Floor



FS-453 5th Floor



FS-454 5th Floor




FS-455 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-456 5th Floor

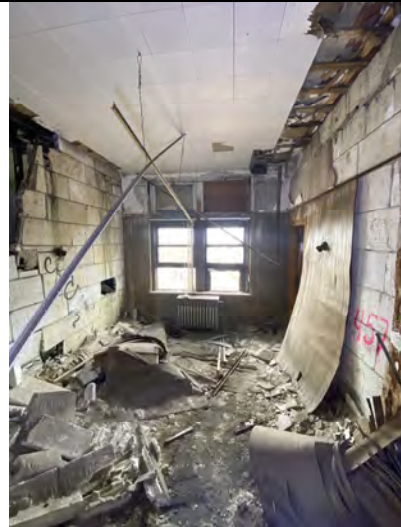

FS-457 5th Floor



FS-458 5th Floor



FS-459 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


540 Tyler Street Gary, IN - Building A




FS-460 5th Floor



FS-461 5th Floor

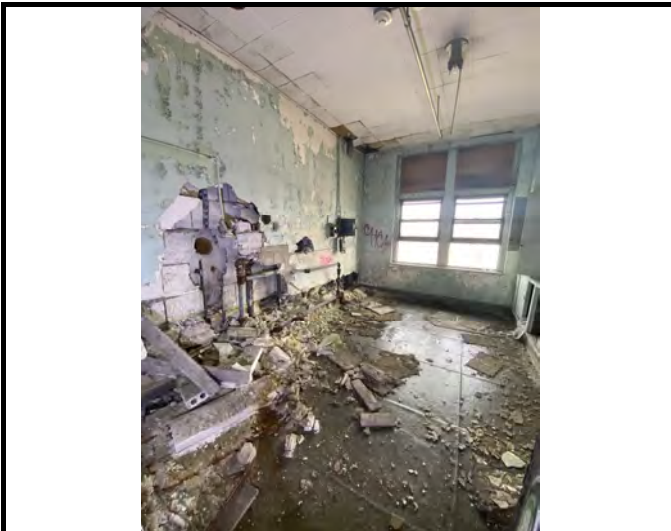

FS-462 5th Floor

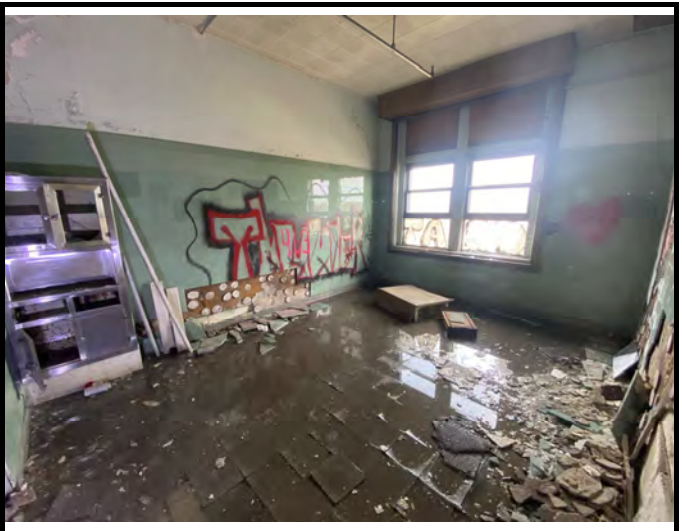


FS-463 5th Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building A



FS-464 5th Floor

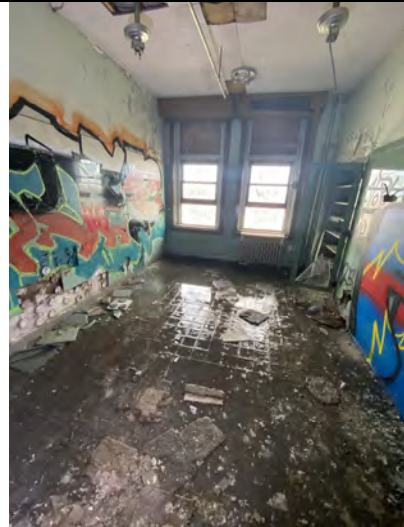

FS-465 5th Floor



FS-466 5th Floor



FS-467 5th Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building A



FS-468 5th Floor



FS-469 5th Floor



FS-470 5th Floor



FS-471 Roof

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**



540 Tyler Street Gary, IN - Building A



FS-472 Roof



FS-472(2) Roof



Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A



Sample
A-Ext-4

Exterior Caulk - On Metal Framed Windows



Sample
A-Ext-9

Exterior Caulk - Metal Framed Wall
Caulk, Large Windows



Sample
A-Ext-10

Exterior Caulk - Metal Pan Seam Sealant



Sample
A-Ext-11

Gasket Material - Air Handling Units

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A




Sample # A-Ext-12 Exterior Caulk-Vent Sealant - On Vents



Sample # A-Ext-16 Window Glaze - Wood Framed Sliding Windows






Sample # A-30-Bas Ceiling Tile - 1X1 w/Glue Pod, White with Dot pattern

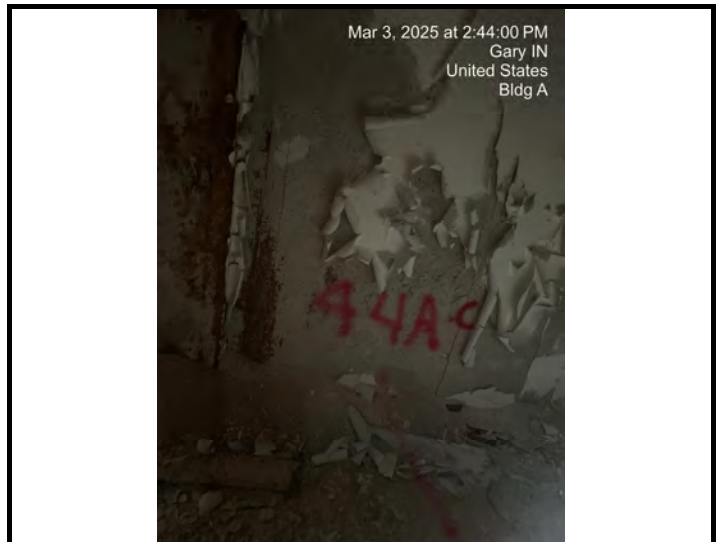

Sample # A-44-Bas Flooring - 12X12 Floor Tile with Mastic-Beige with Brown and White pattern





Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

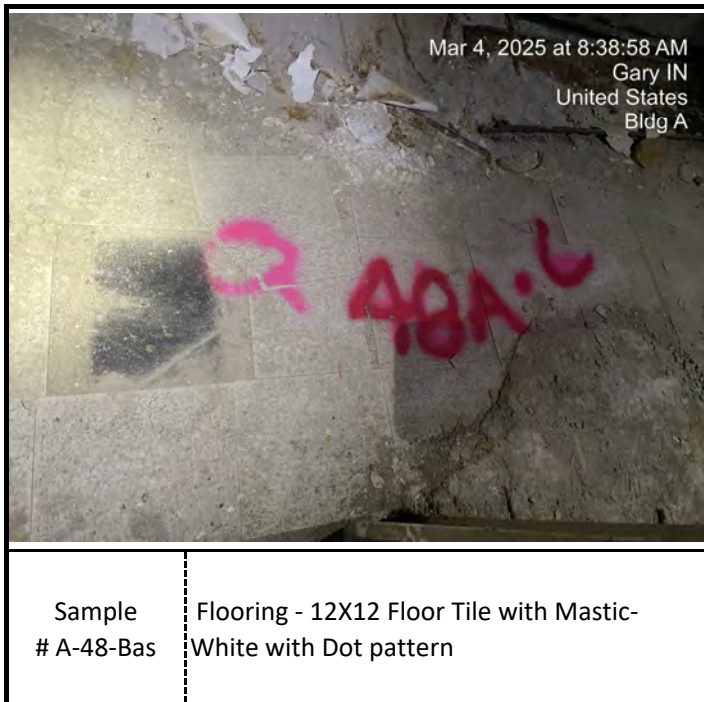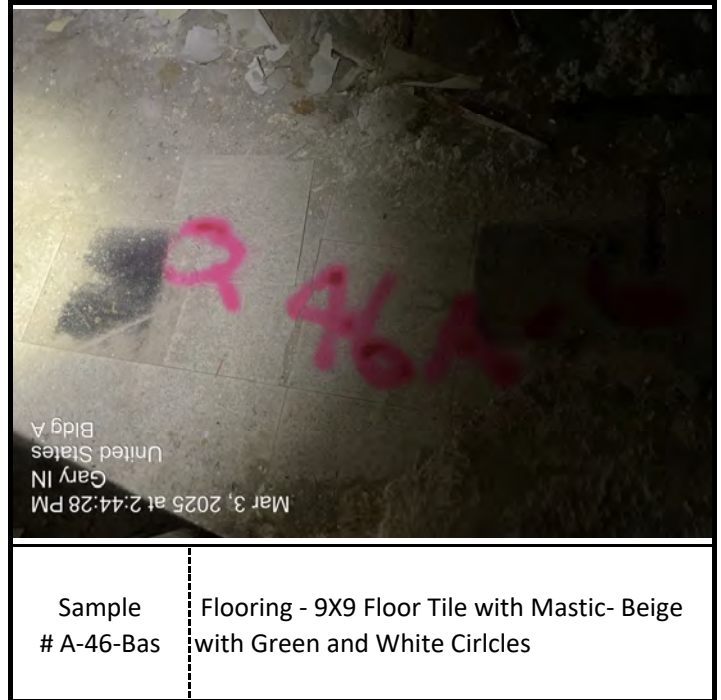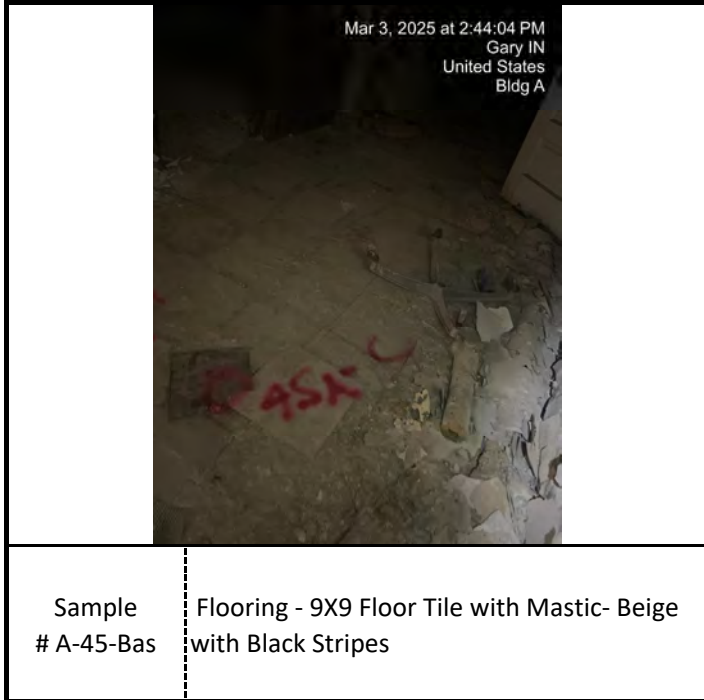

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

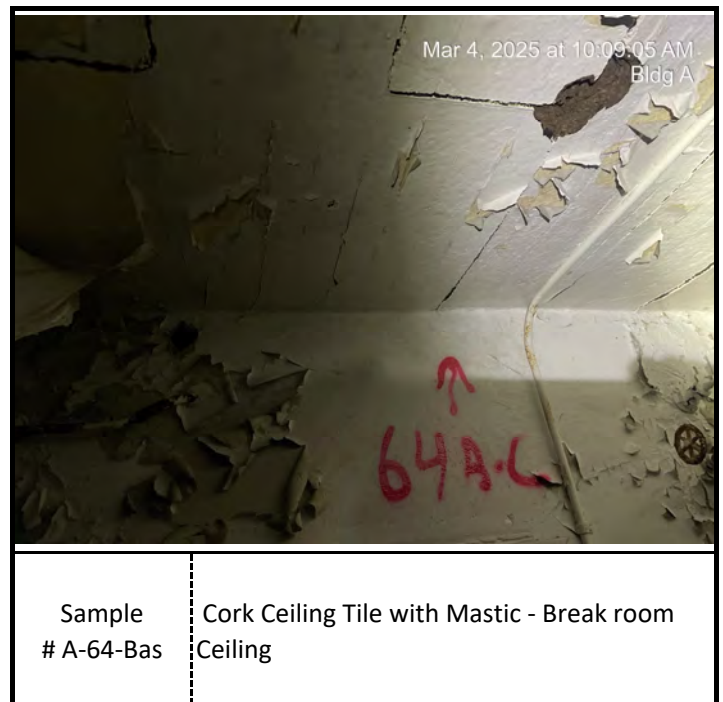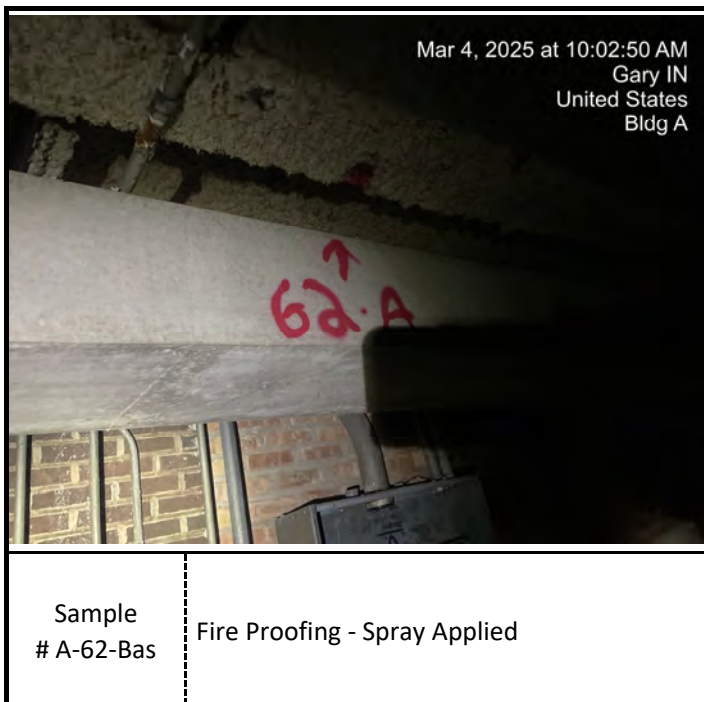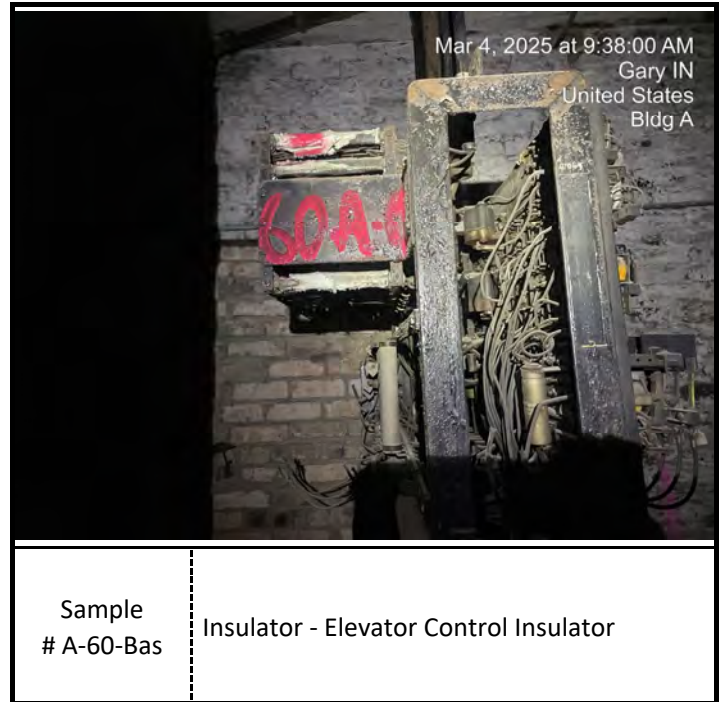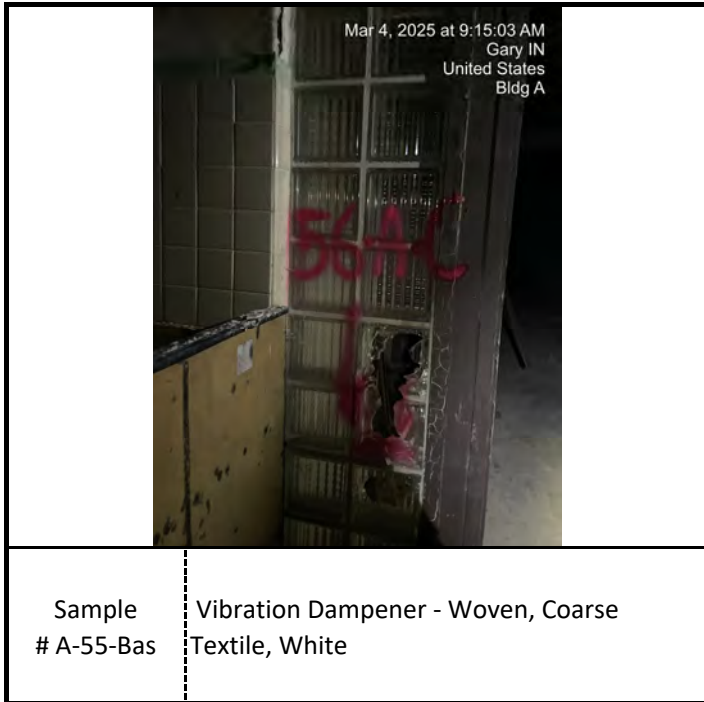

Gary Commercial Blight Elimination Program Positive Materials


540 Tyler Street Gary, IN - Building A



Sample # A-65-Bas	Window Glaze - Wood Framed Fixed Windows
----------------------	--



Sample # A-66-Bas	Flooring - 12X12 Floor Tile with Mastic, White
----------------------	--

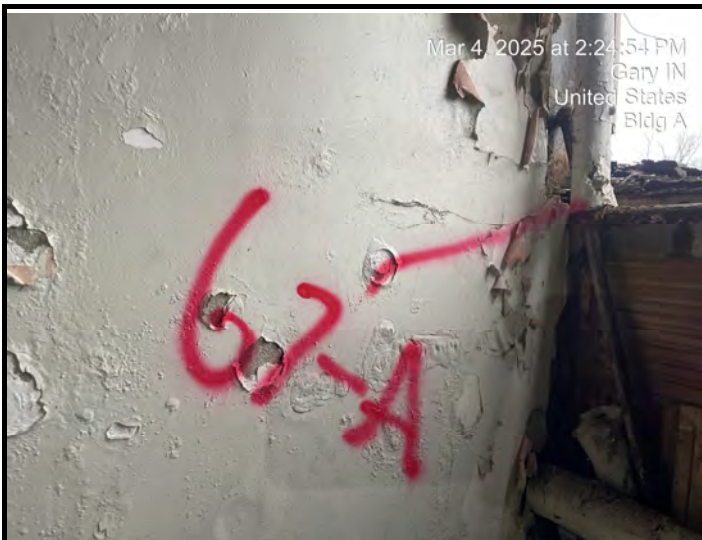

Sample # A-67-Bas	Pipe Insulation - 0"-6" O.D. Air Cell SRPI
----------------------	--



Sample # A-68-Bas	Pipe Fitting - 0" -6" O.D. Mudded pipe fitting Insulation on Air Cell SRPI
----------------------	--

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A



Sample
A-69-Bas

Pipe Insulation - 0"-6" O.D.Air Cell SRPI



Sample
A-70-Bas

Pipe Fitting - 0" -6" O.D.Mudded pipe fitting insulation on Air Cell SRPI



Sample
A-71-Bas

Pipe Insulation - 0"-6" O.D.Air Cell SRPI




Sample
A-72-Bas

Pipe Fitting - 0" -6" O.D.Mudded pipe fitting insulation on Air Cell SRPI





Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

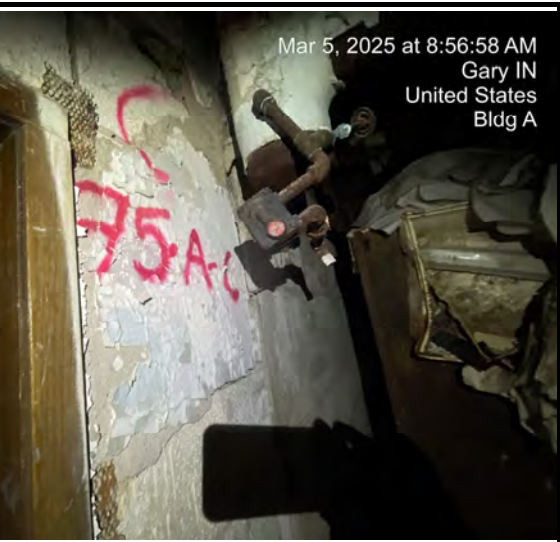			
Sample # A-73-Bas	Pipe Insulation - 6"-12"O.D. Air Cell SRPI	Sample # A-74-Bas	Pipe Fitting - 6"-12" O.D. Mudded pipe insulation on Air Cell SRPI
			
Sample # A-75-Bas	Pipe Insulation - 6"-12"O.D. Air Cell SRPI	Sample # A-76-Bas	Pipe Fitting - 6"-12" O.D. Mudded pipe insulation on Air Cell SRPI

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

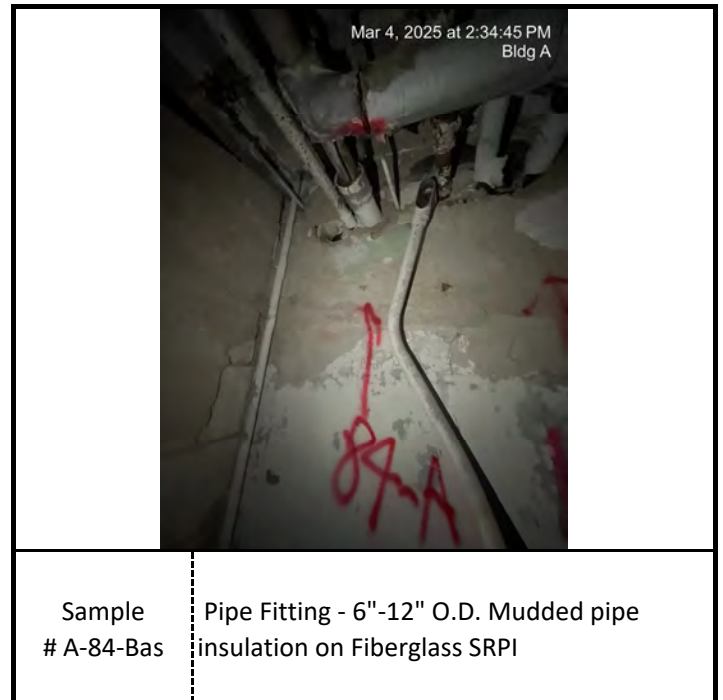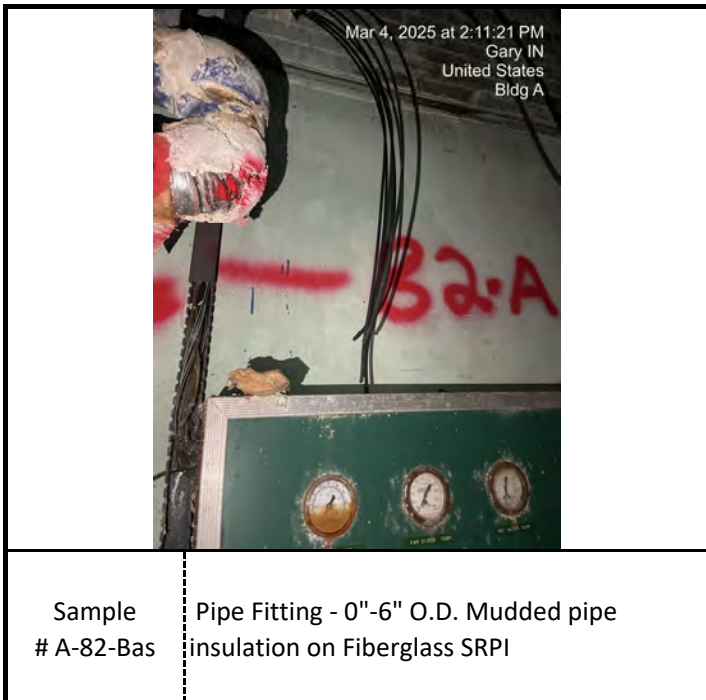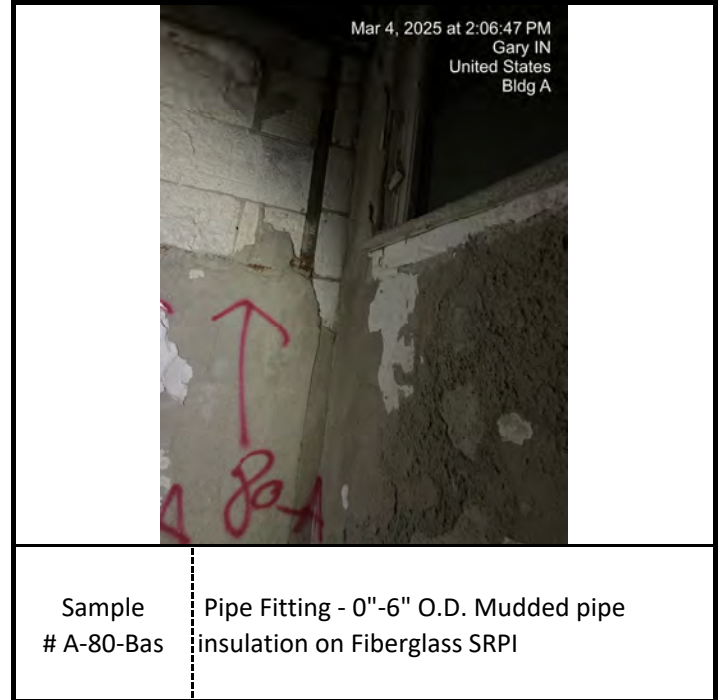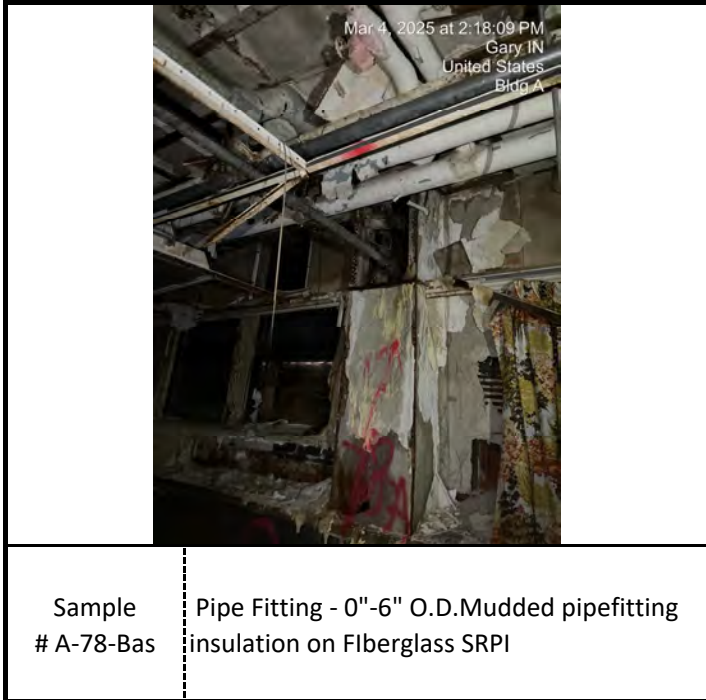


Gary Commercial Blight Elimination Program Positive Materials


540 Tyler Street Gary, IN - Building A




Sample # A-86-Bas	Pipe Fitting - 6"-12" O.D. Mudded pipe insulation on Fiberglass SRPI
----------------------	---

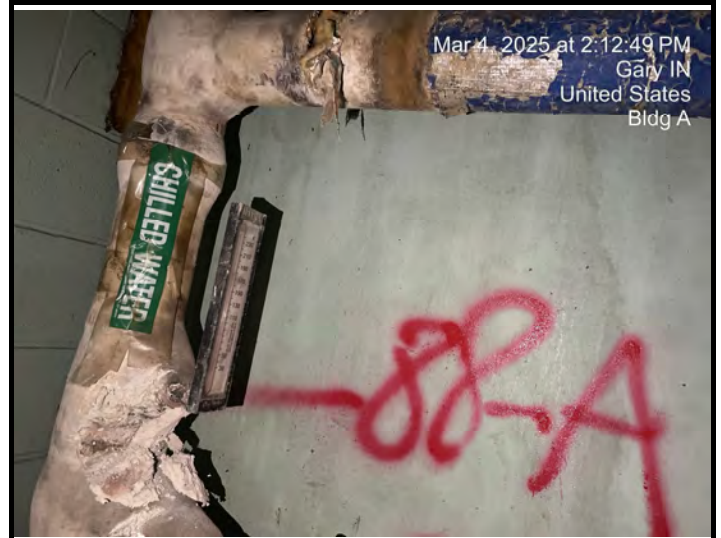

Sample # A-88-Bas	Pipe Insulation - 0"-6" O.D. Mag SRPI
----------------------	---------------------------------------

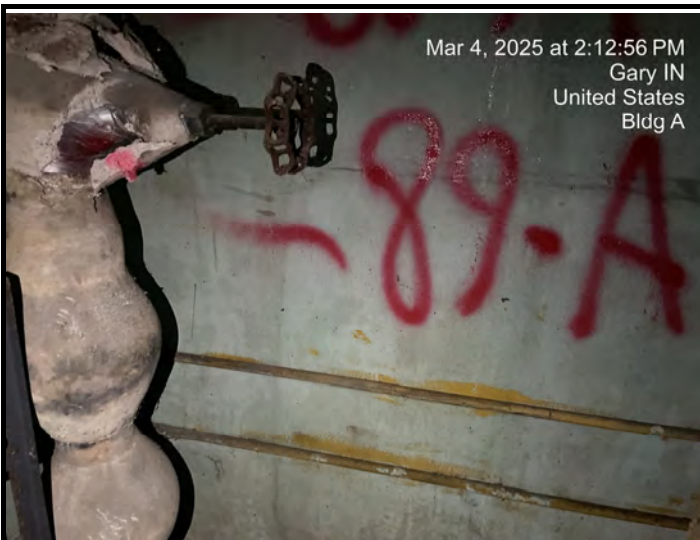



Sample # A-89-Bas	Pipe Fitting - 0"-6" O.D. Mudded pipe fitting insulation on Mag on SRPI
----------------------	--

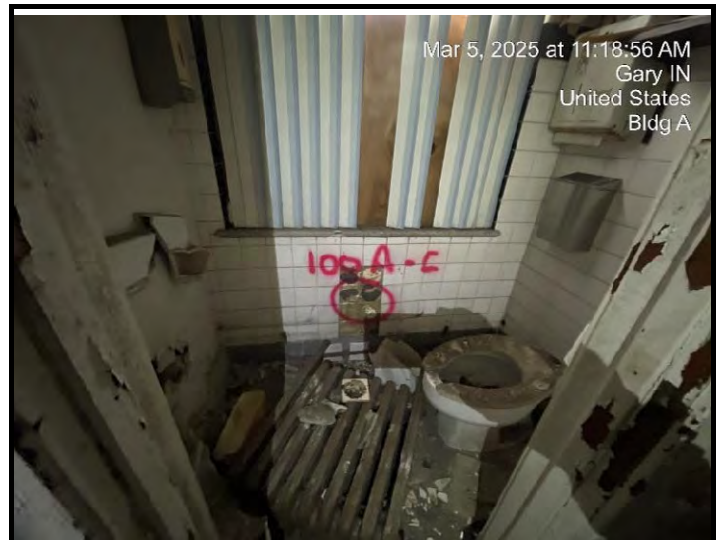

Sample # A-1-100	Ceramic Tile with Grout and Adhesive - Bathroom Walls
---------------------	--





Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

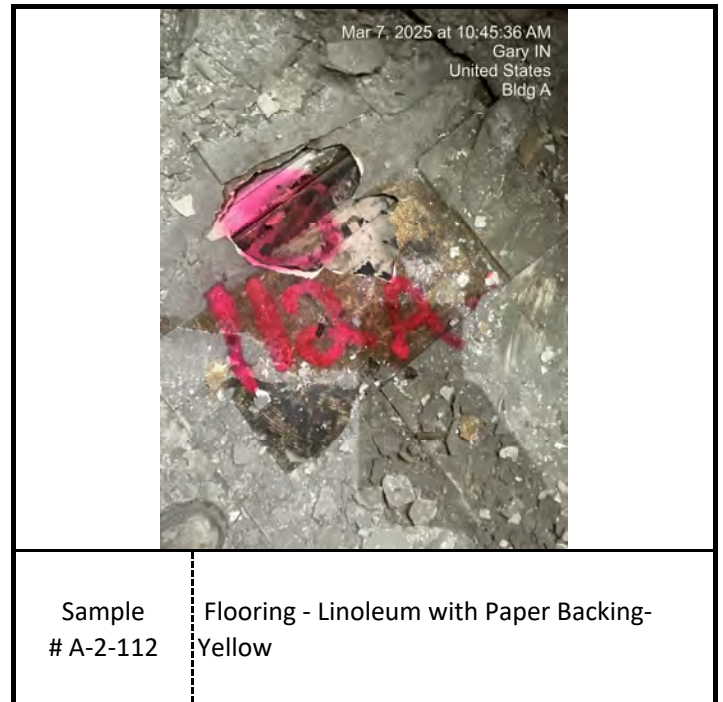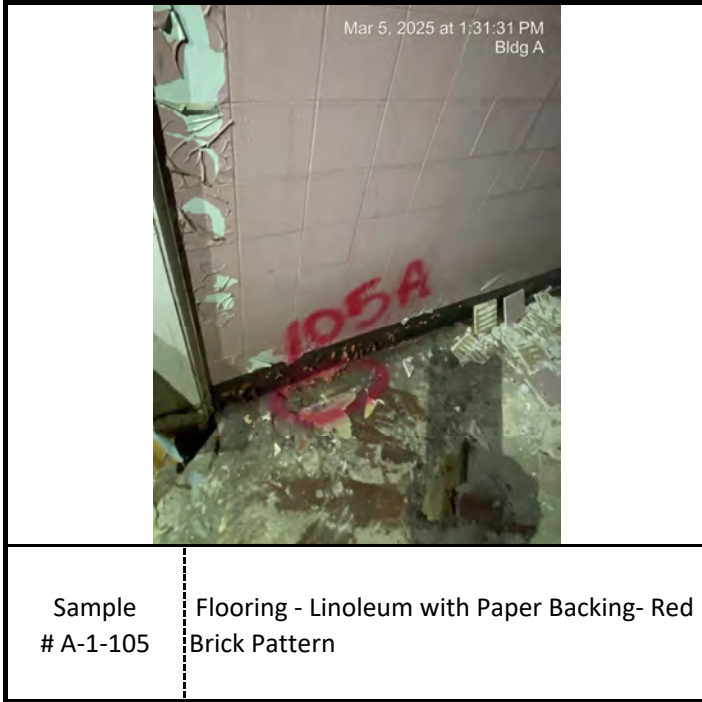





Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

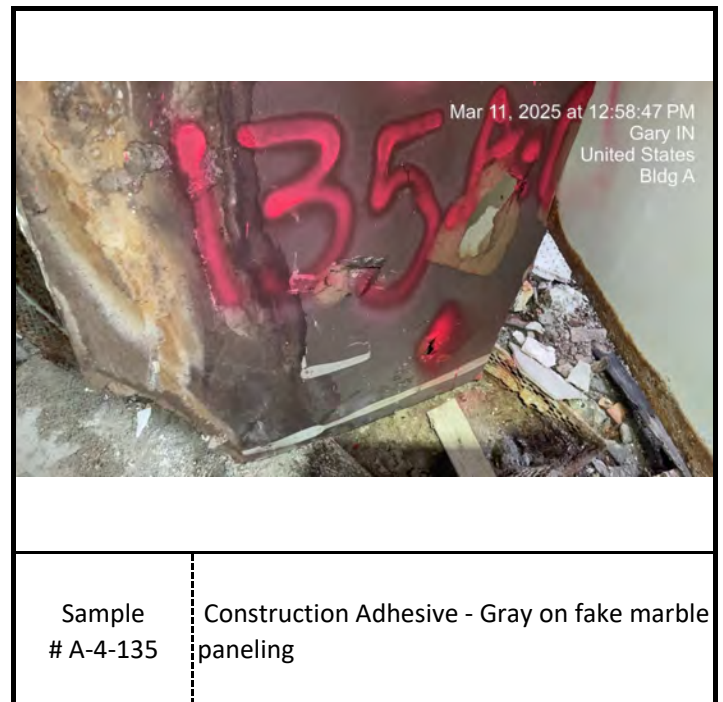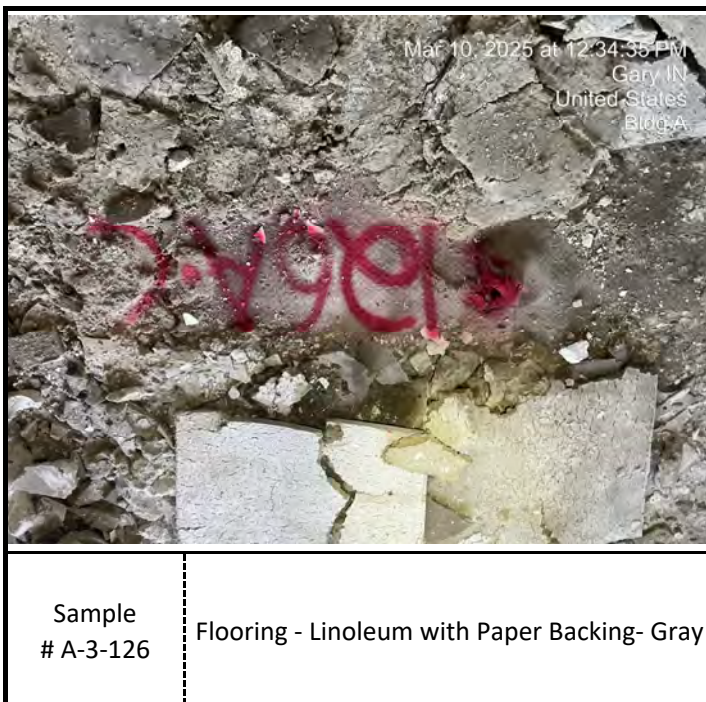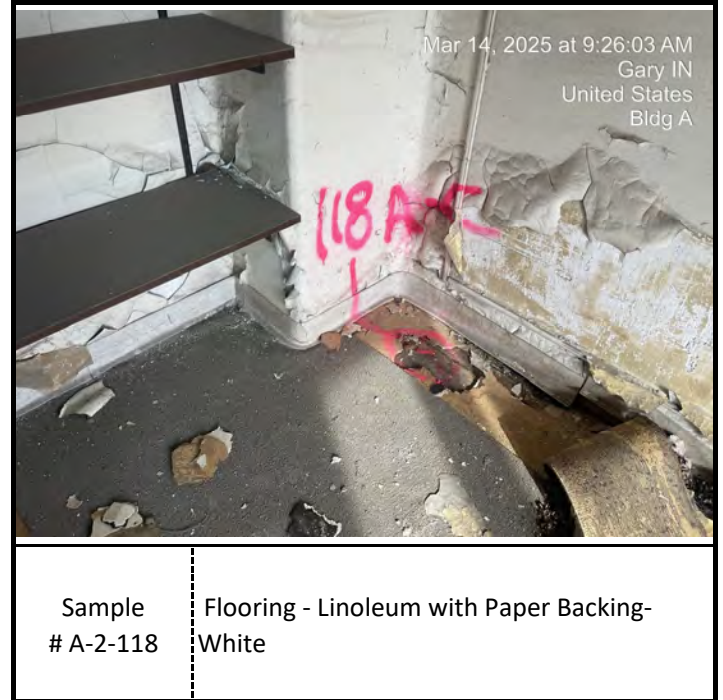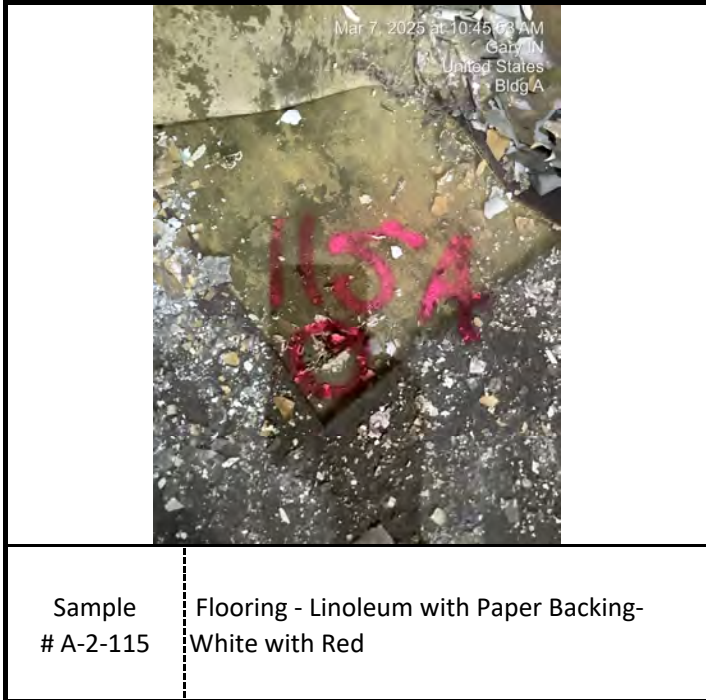

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A

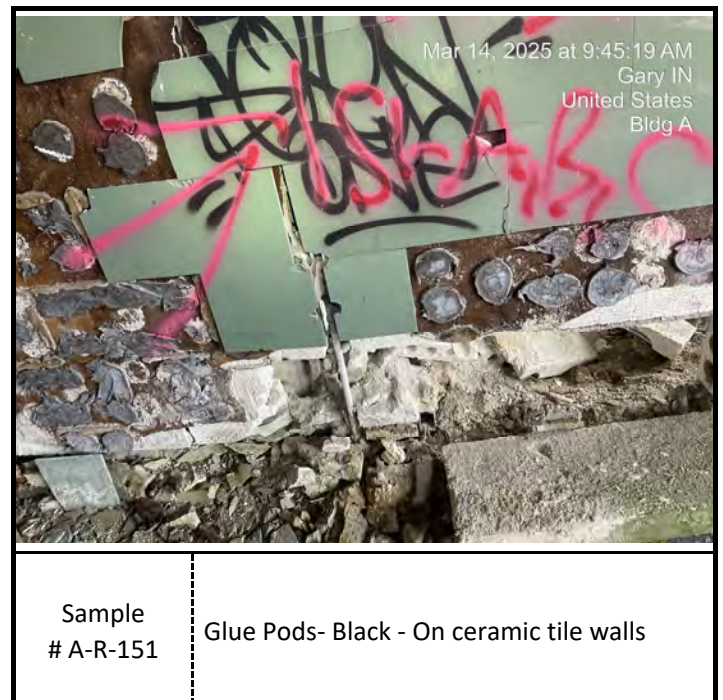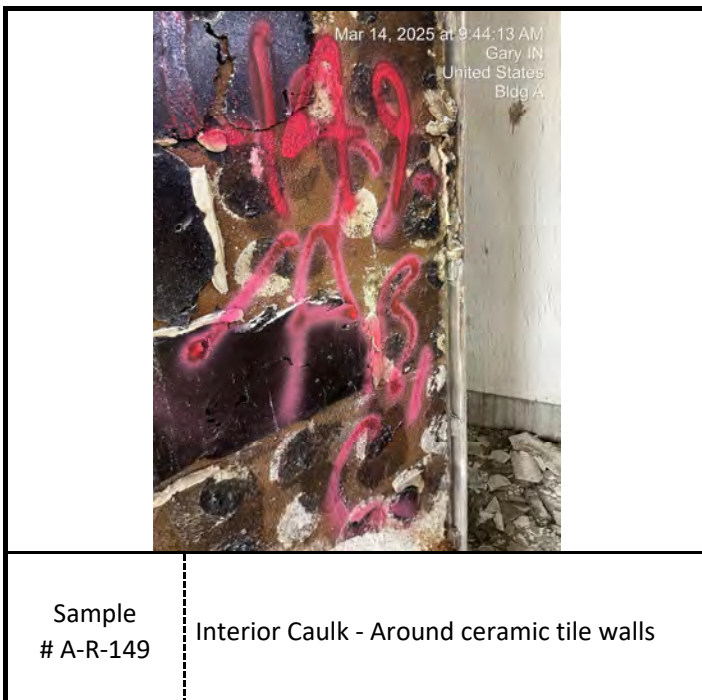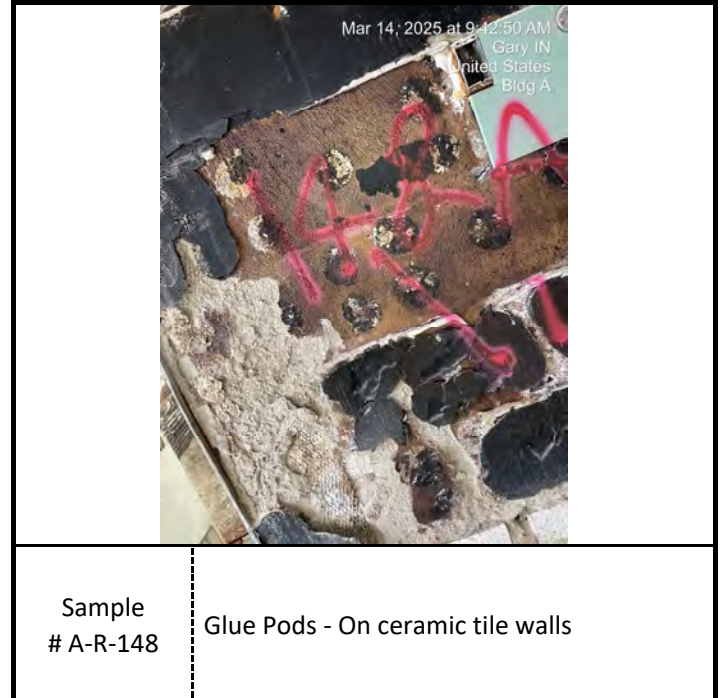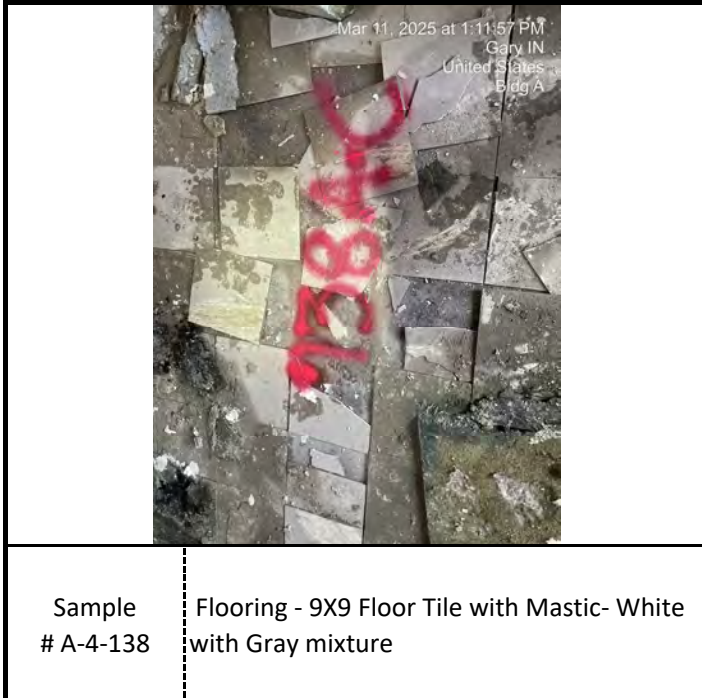

Gary Commercial Blight Elimination Program Positive Materials

540 Tyler Street Gary, IN - Building A



Sample
A-R-154

Exterior Caulk - Around sliding Windows

Gary Commercial Blight Elimination Program Non-Detect Samples



540 Tyler Street Gary, IN - Building A

	
Sample # A-Ext-1	Sample # A-Ext-2
Concrete - Foundation Walls	Brick Mortar - Brick Siding

	
Sample # A-Ext-3	Sample # A-Ext-5
Concrete - Parking Lot	Concrete - Window and Door Sills, Borders




Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

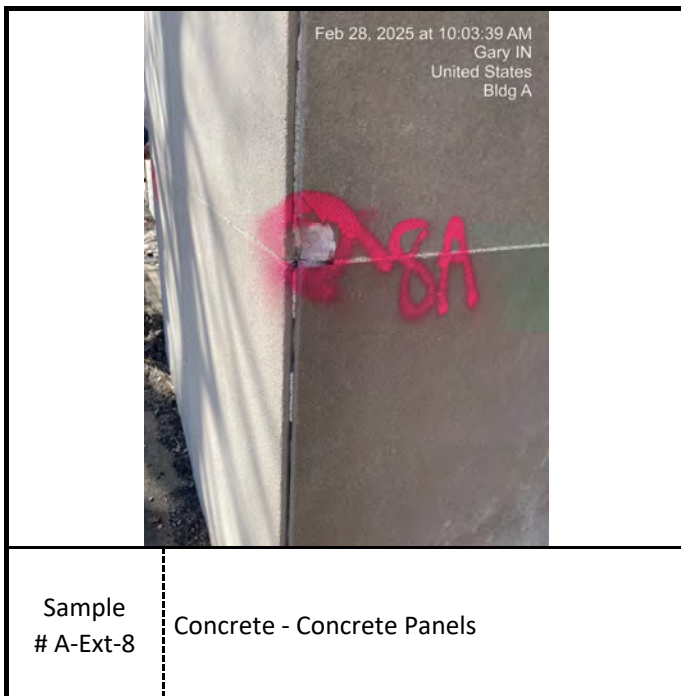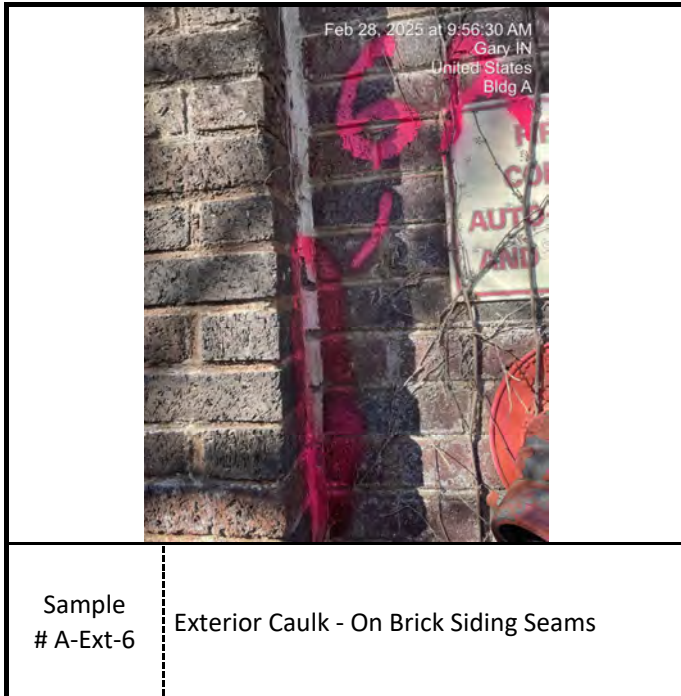


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

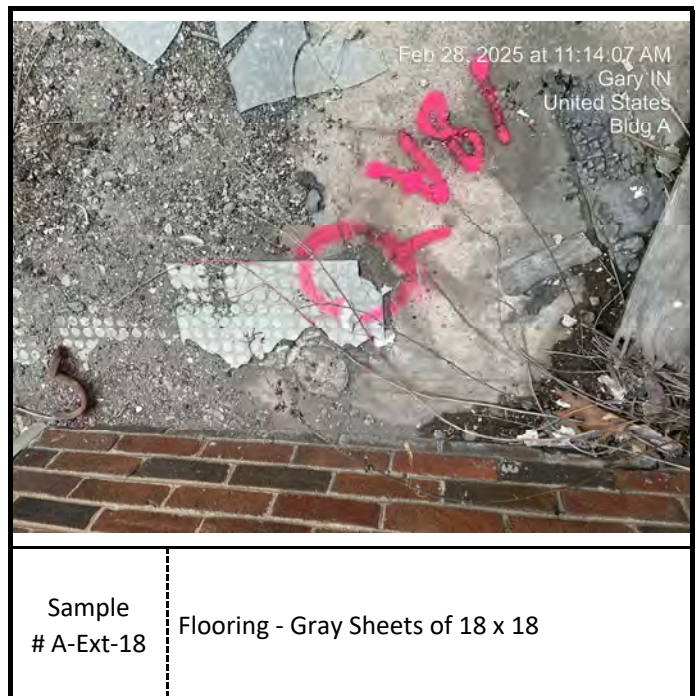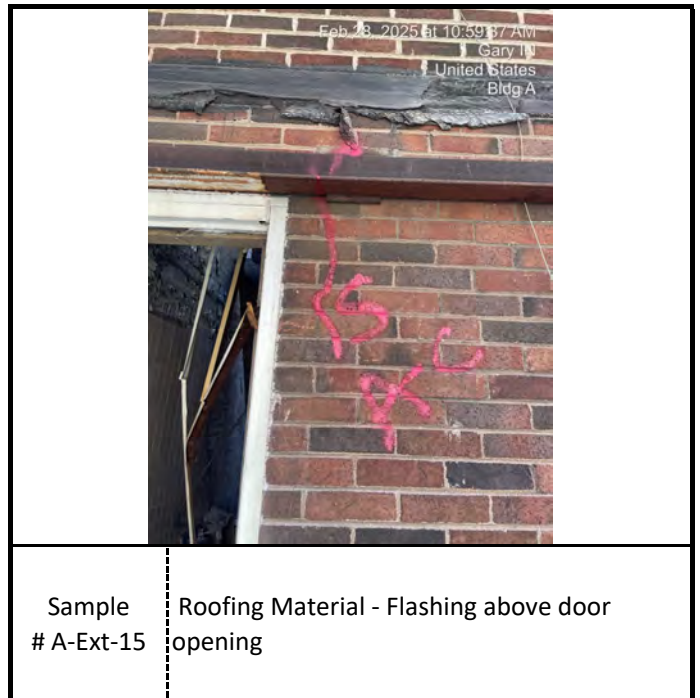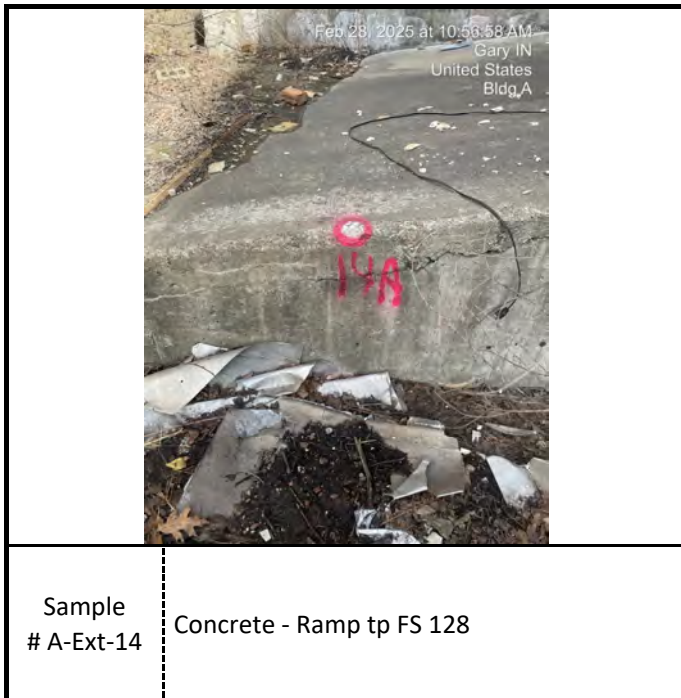


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

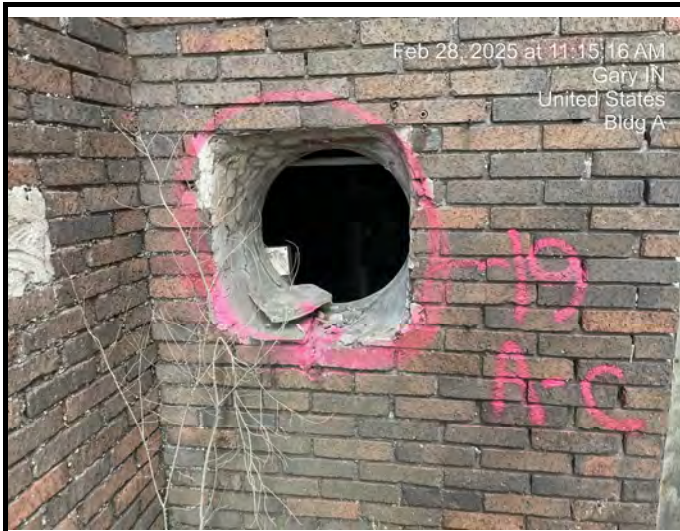

Sample # A-Ext-19	Stack Cement - Chimney at Mechanical Exhausts
----------------------	--

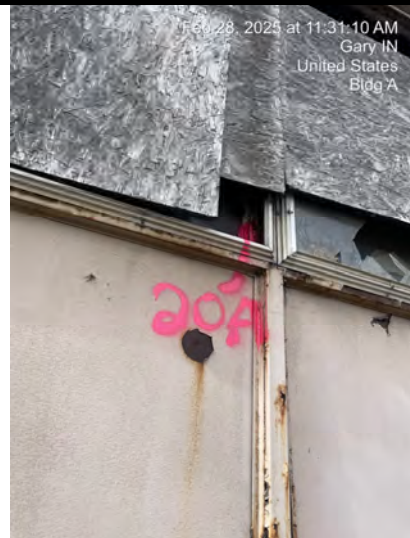

Sample # A-Ext-20	Window Glaze - On Metal Pan Large Windows
----------------------	--





Sample # A-21-Bas	Concrete - Walls-Foundation
----------------------	-----------------------------



Sample # A-22-Bas	Pyro Bar with Mortar - Interior and Exterior Walls
----------------------	---

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

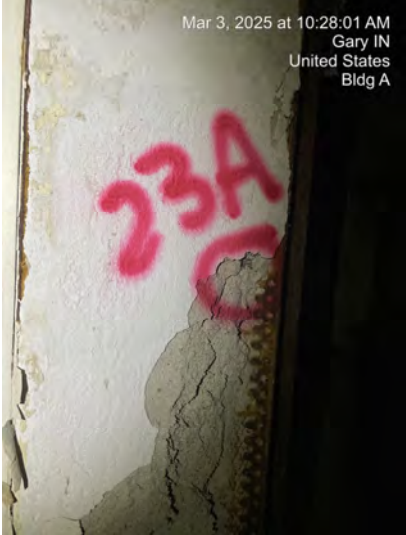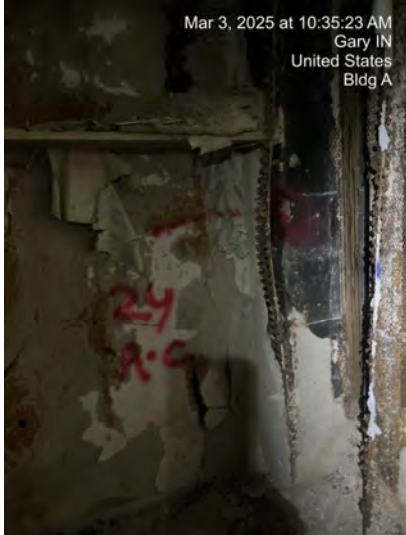	
Sample # A-23-Bas	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh Sample # A-24-Bas Concrete - Columns
	
Sample # A-25-Bas	Cove Base - with Adhesive Sample # A-26-Bas Block Mortar - Interior Wall Block with Mortar

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A




Sample
A-27-Bas Flooring - Terrazzo Flooring



Sample
A-28-Bas Ceramic Tile with Glue - Bathroom Walls

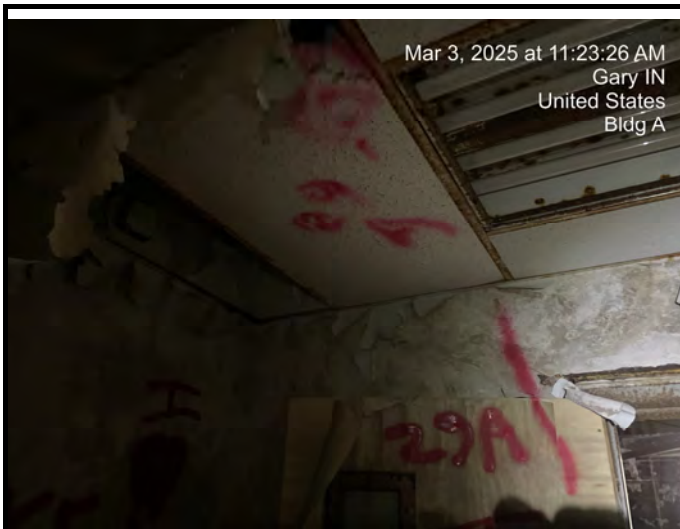

Sample
A-29-Bas Ceiling Panel - 2X4, White w/ indentations

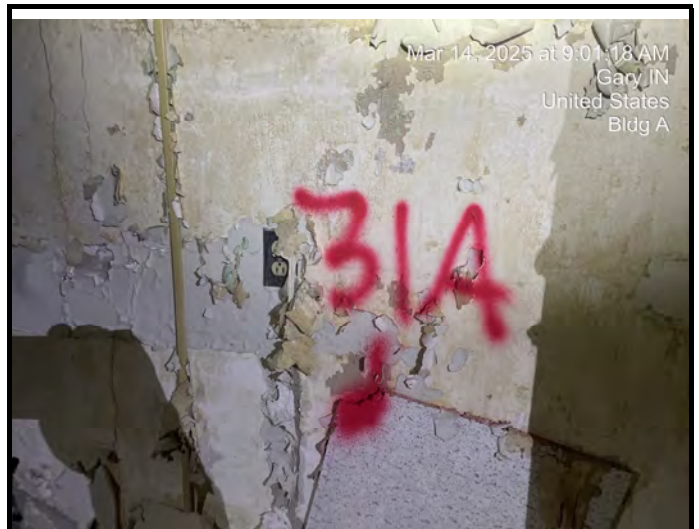


Sample
A-31-Bas Ceiling Panel - 2X4, White and Smooth

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A



Sample
A-32-Bas Ceiling Tile - 1X1, Smooth with White

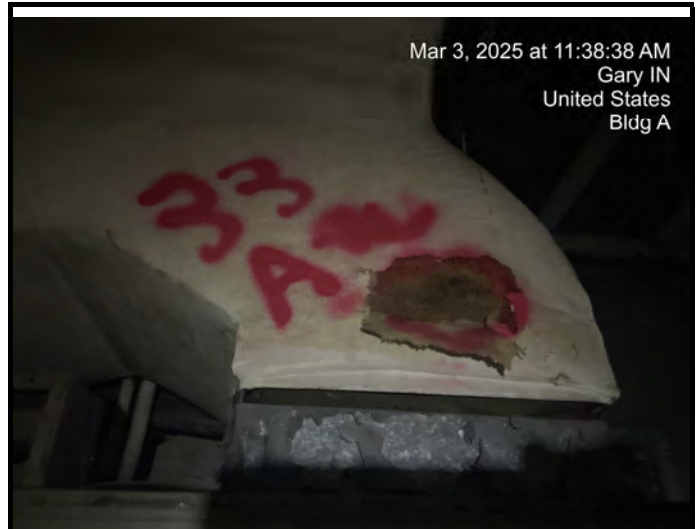

Sample
A-33-Bas Duct Insulation - Canvas on Ducts

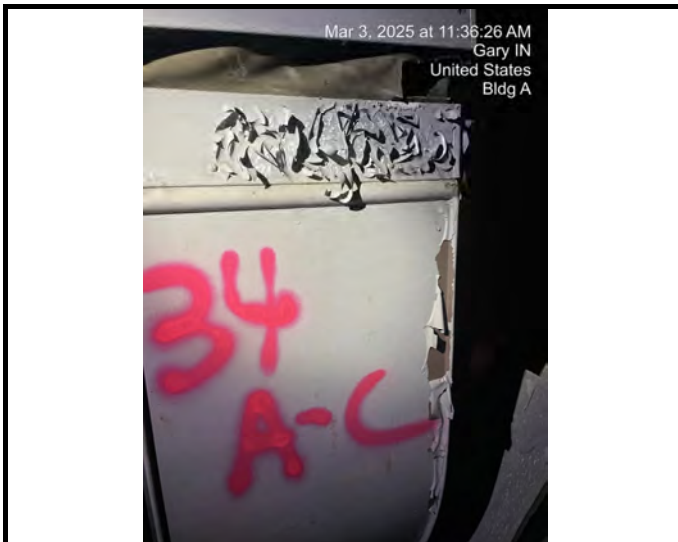


Sample
A-34-Bas Vibration Dampener - Woven, Coarse Textile,
White



Sample
A-35-Bas Duct Insulation - Interior of Ductwork

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

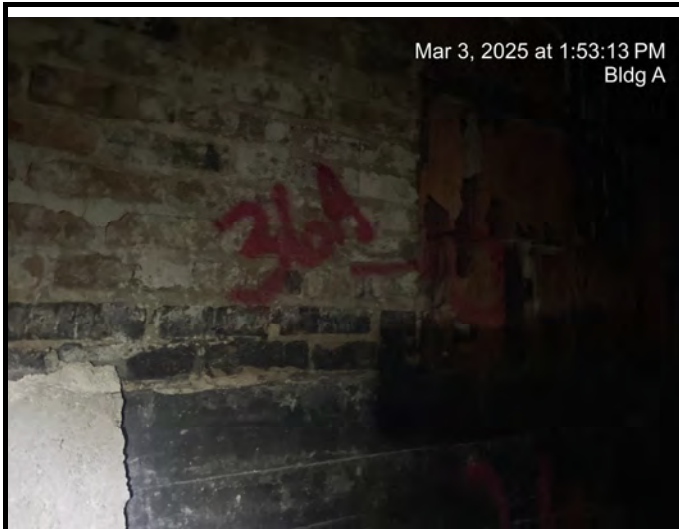

Sample # A-36-Bas Terra-Cotta - Interior and Exterior,Ceilings Walls



Sample # A-37-Bas Ceiling Panel - 2X2, White with Swirl patter





Sample # A-38-Bas Fire Brick - Inside incinerator



Sample # A-39-Bas Ceramic Tile with Grout - Interior Walls



Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

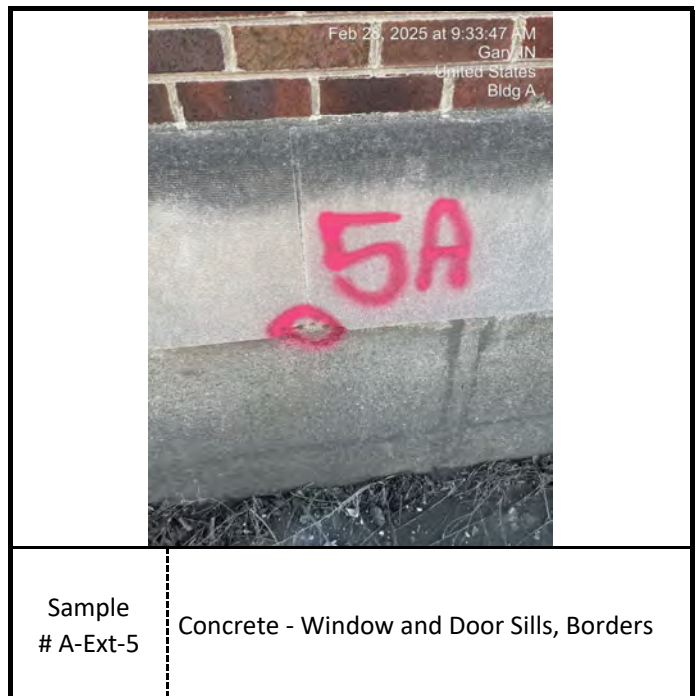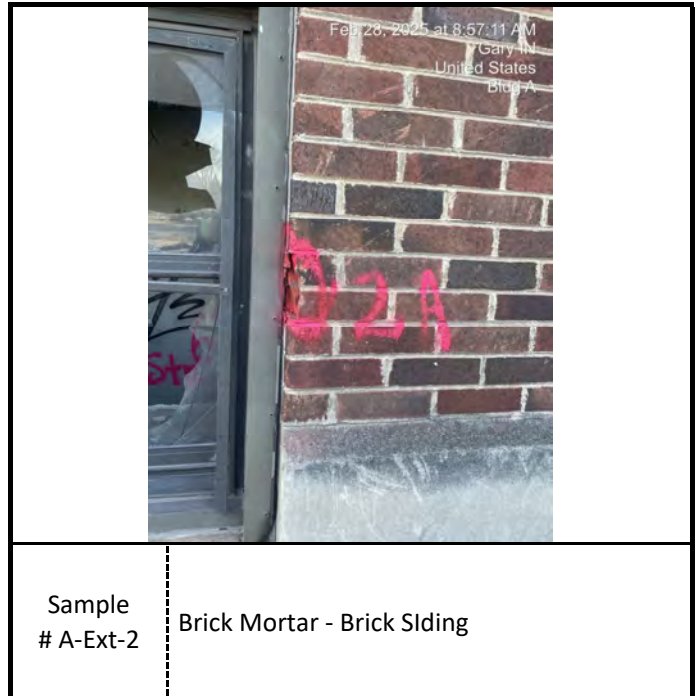

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

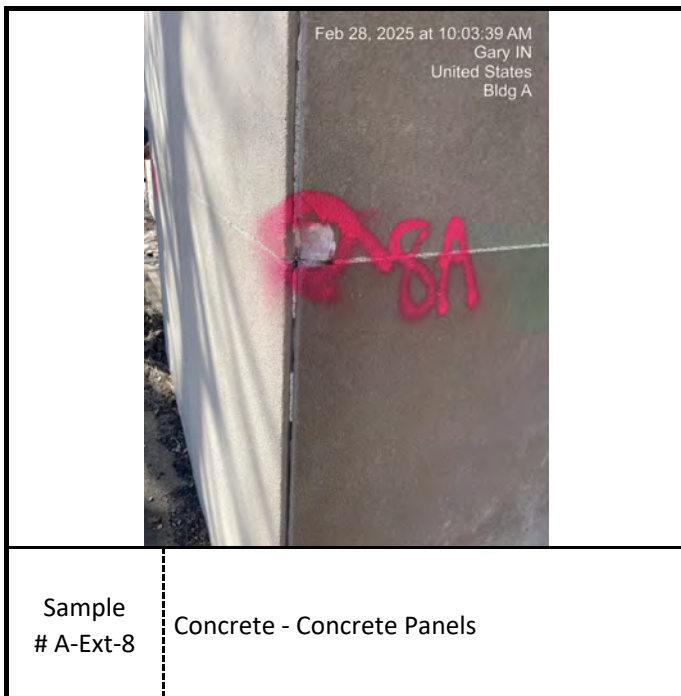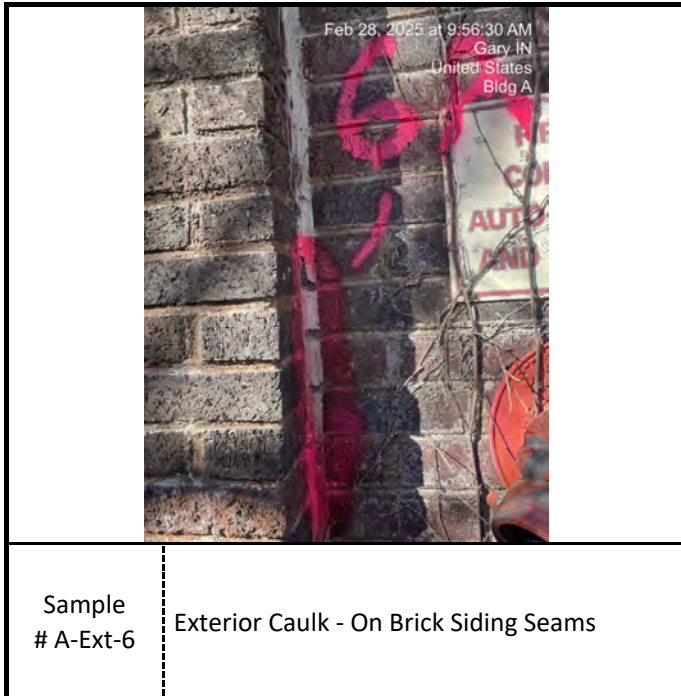

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A



Sample
A-Ext-14

Concrete - Ramp tp FS 128



Sample
A-Ext-15

Roofing Material - Flashing above door opening



Sample
A-Ext-17

Block Mortar - Patch & Repair




Sample
A-Ext-18

Flooring - Gray Sheets of 18 x 18

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

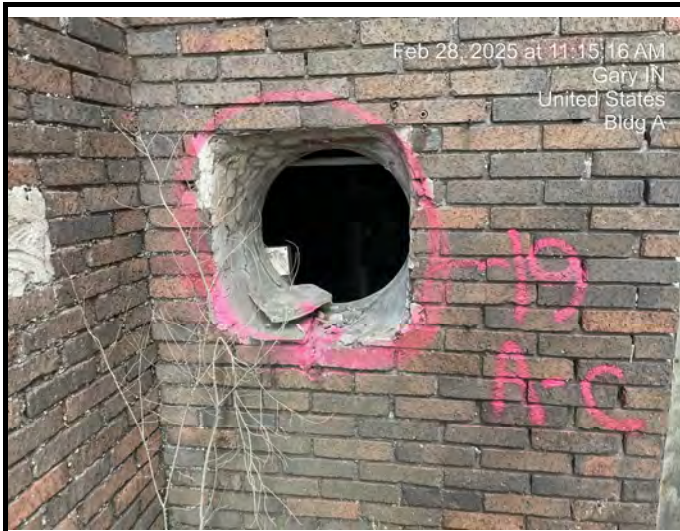

Sample # A-Ext-19	Stack Cement - Chimney at Mechanical Exhausts
----------------------	---



Sample # A-Ext-20	Window Glaze - On Metal Pan Large Windows
----------------------	---





Sample # A-21-Bas	Concrete - Walls-Foundation
----------------------	-----------------------------



Sample # A-22-Bas	Pyro Bar with Mortar - Interior and Exterior Walls
----------------------	--

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

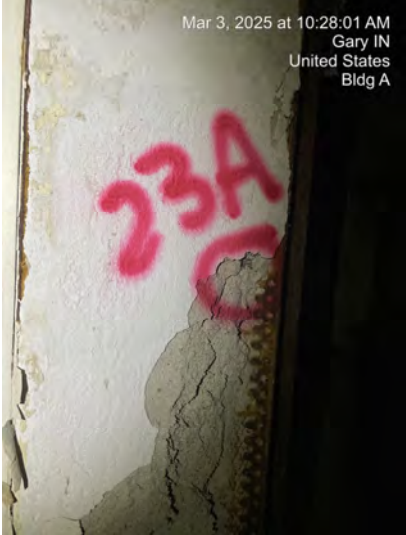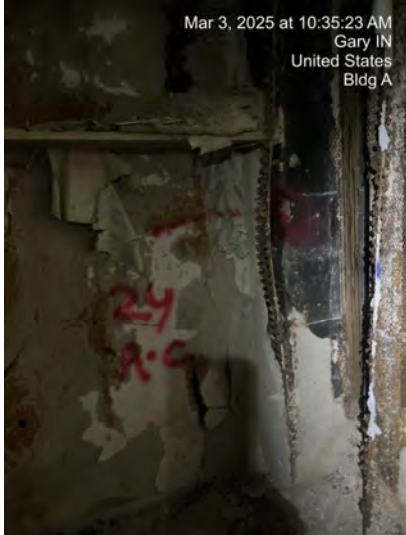	
Sample # A-23-Bas	Plaster - Skim & Base Coat Ceilings and Walls on Wire Mesh Sample # A-24-Bas Concrete - Columns
	
Sample # A-25-Bas	Cove Base - with Adhesive Sample # A-26-Bas Block Mortar - Interior Wall Block with Mortar

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A




Sample
A-27-Bas Flooring - Terrazzo Flooring



Sample
A-28-Bas Ceramic Tile with Glue - Bathroom Walls

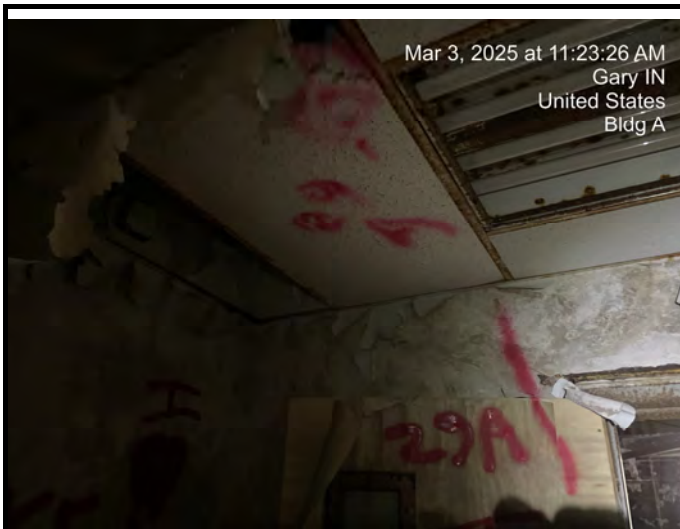

Sample
A-29-Bas Ceiling Panel - 2X4, White w/ indentations

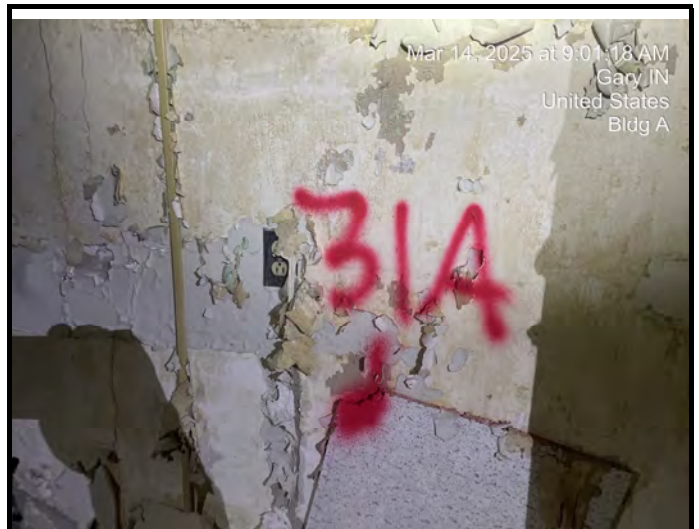


Sample
A-31-Bas Ceiling Panel - 2X4, White and Smooth

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A



Sample # A-32-Bas
Ceiling Tile - 1X1, Smooth with White

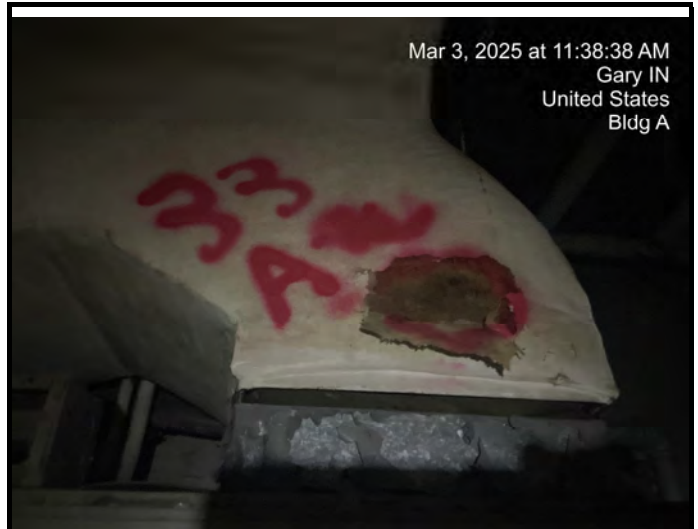

Sample # A-33-Bas
Duct Insulation - Canvas on Ducts

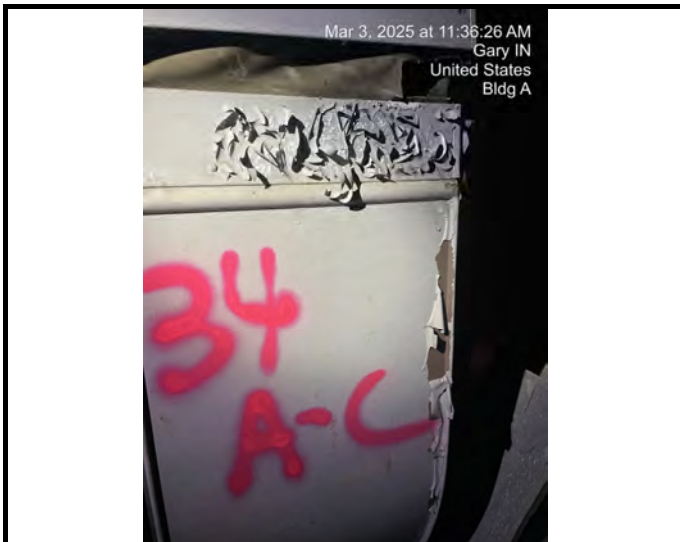

Sample # A-34-Bas
Vibration Dampener - Woven, Coarse Textile, White



Sample # A-35-Bas
Duct Insulation - Interior of Ductwork

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A



Sample # A-36-Bas	Terra-Cotta - Interior and Exterior,Ceilings Walls
----------------------	---



Sample # A-37-Bas	Ceiling Panel - 2X2, White with Swirl patter
----------------------	--






Sample # A-38-Bas	Fire Brick - Inside incinerator
----------------------	---------------------------------



Sample # A-39-Bas	Ceramic Tile with Grout - Interior Walls
----------------------	--


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

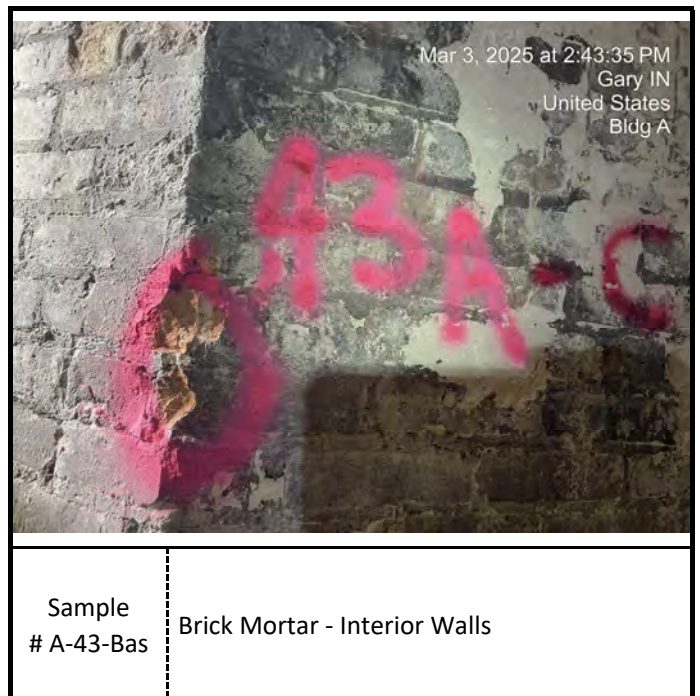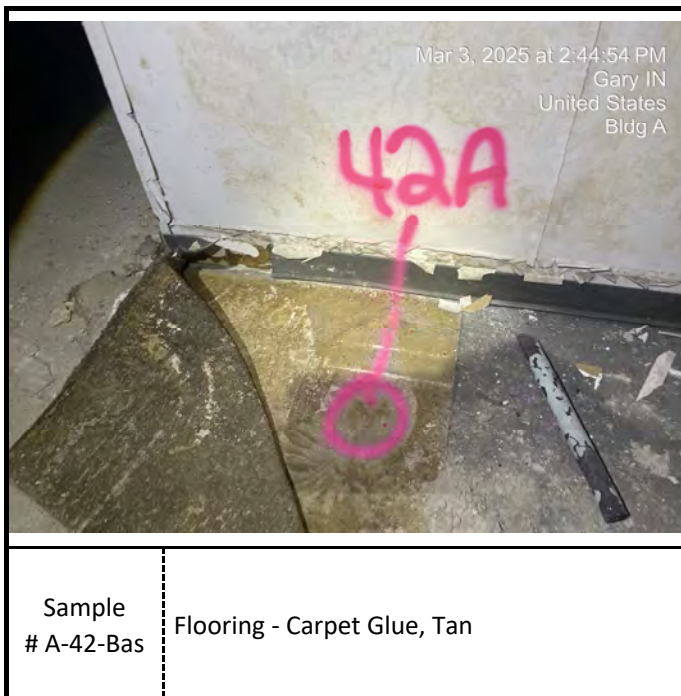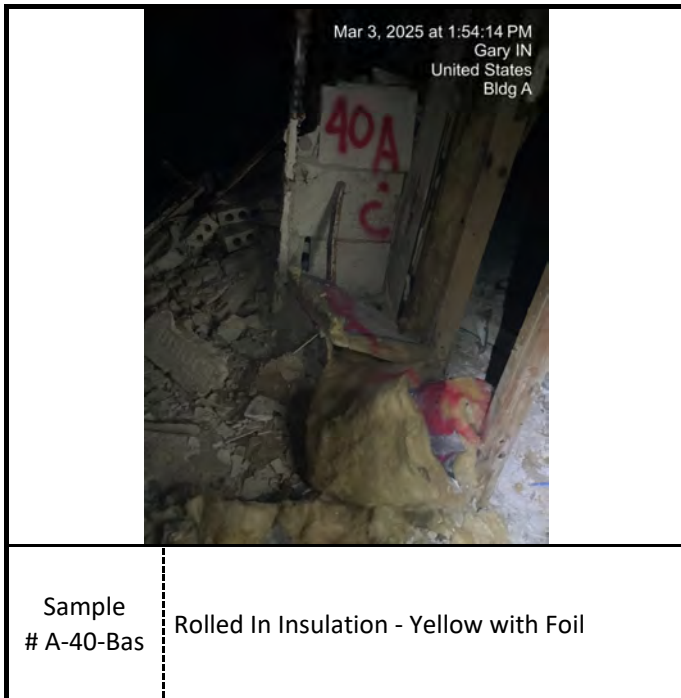


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

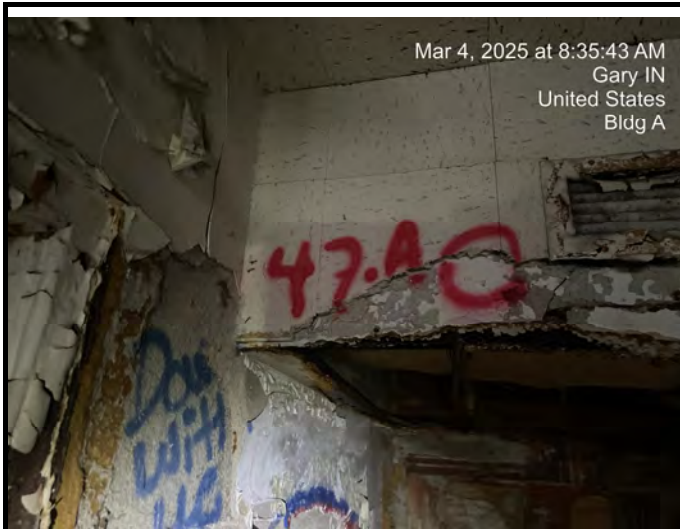


Sample # A-47-Bas	Ceiling Panel - 1x1 White with Indentions and Glue Pods
----------------------	---

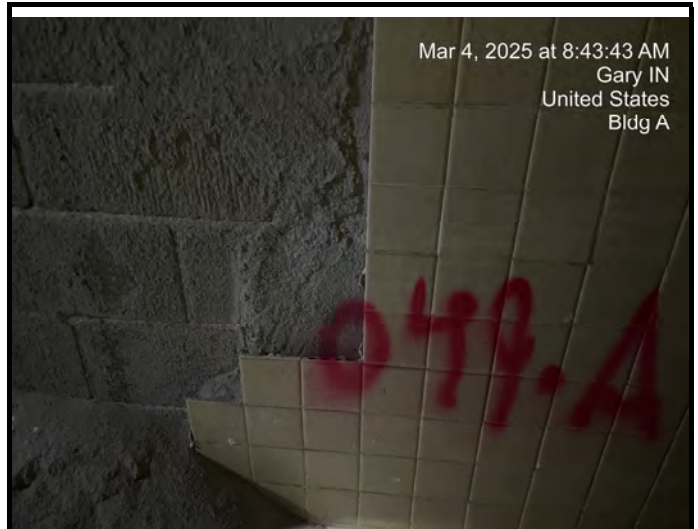

Sample # A-49-Bas	Ceramic Tile with Glue and Grout - Walls, 2"x2" Yellow
----------------------	---



Sample # A-50-Bas	Ceramic Tile with Grout and Mortar - Walls, 2"x4" Dark Red and Beige
----------------------	---

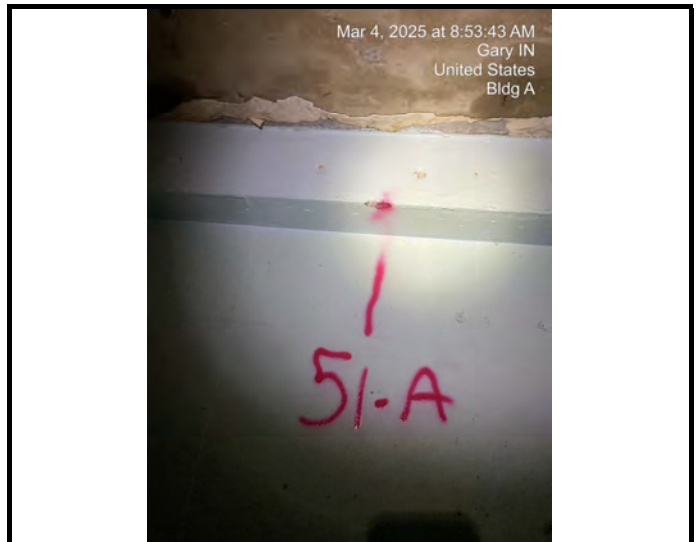

Sample # A-51-Bas	Concrete - Foundation Wall
----------------------	----------------------------

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A



Sample # A-52-Bas	Flooring - Linoleum with Paper Backing
----------------------	--



Sample # A-53-Bas	Ceiling Tile - 2x2, White with Indentations
----------------------	---

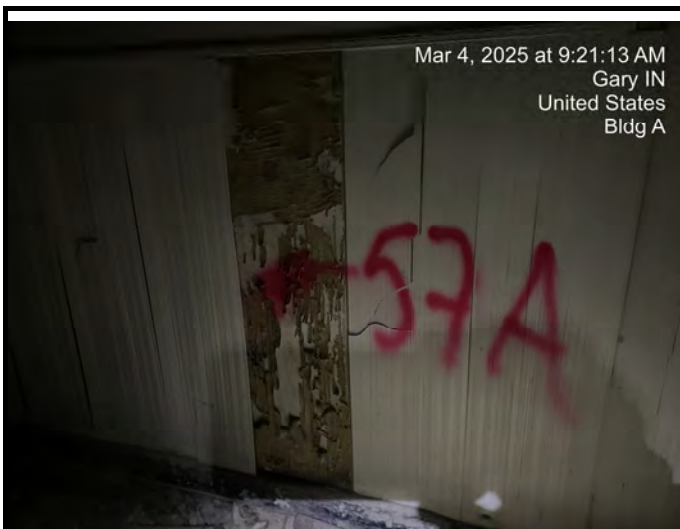


Sample # A-56-Bas	Glass Block - Mortar
----------------------	----------------------



Sample # A-57-Bas	Construction Adhesive - Brown on White Panels
----------------------	---

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

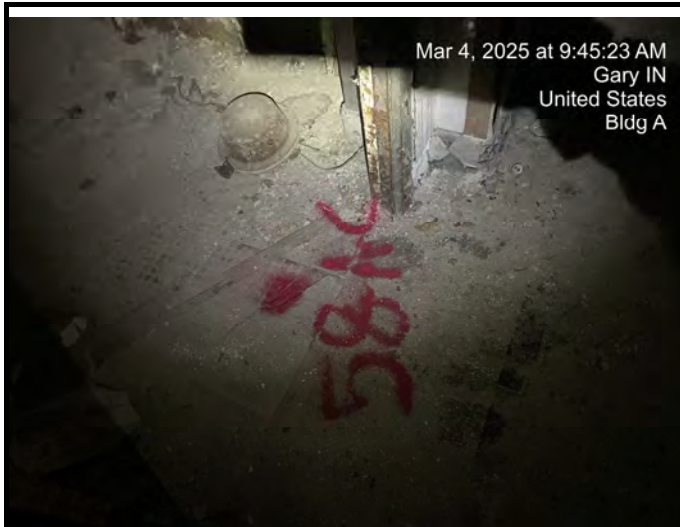


Sample
A-58-Bas

Flooring - 18 x 18 Gray Squares




Sample
A-59-Bas

Flooring - Black Dot Pattern floor sheeting

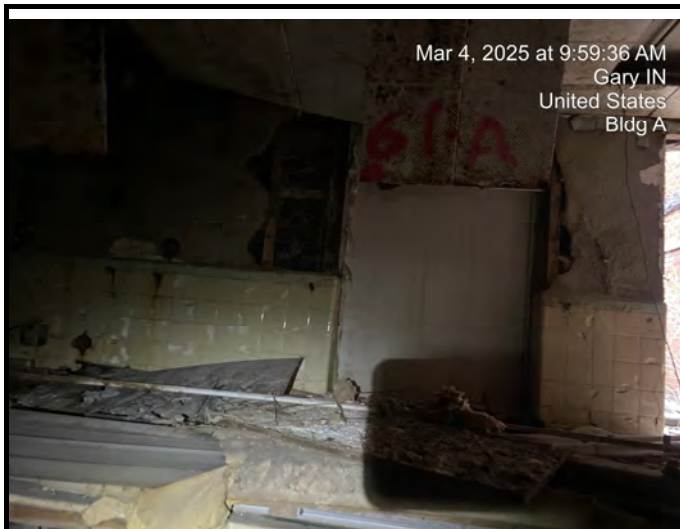

Sample
A-61-Bas

Metal Pan Ceiling Insulation - Ceiling with
2x2 metal panels with Dots

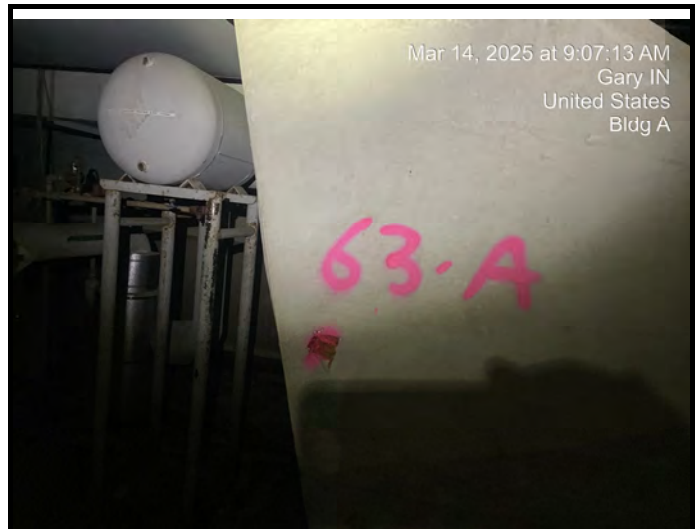

Sample
A-63-Bas

Duct Insulation - Fibrous Paper on Air
Handler





Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

	Mar 4, 2025 at 2:16:38 PM Gary IN United States Bldg A
Sample # A-77-Bas	Pipe Insulation - 0"-6" O.D.Fiberglass SRPI
	Mar 4, 2025 at 2:06:39 PM Gary IN United States Bldg A
Sample # A-79-Bas	Pipe Insulation - 0"-6"O.D. Fiberglass SRPI
	Mar 4, 2025 at 2:11:16 PM Gary IN United States Bldg A
Sample # A-81-Bas	Pipe Insulation - 0"-6" O.D.Fiberglass SRPI
	Mar 4, 2025 at 2:34:37 PM Bldg A
Sample # A-83-Bas	Pipe Insulation - 6"-12" O.D. on Fiberglass SRPI


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

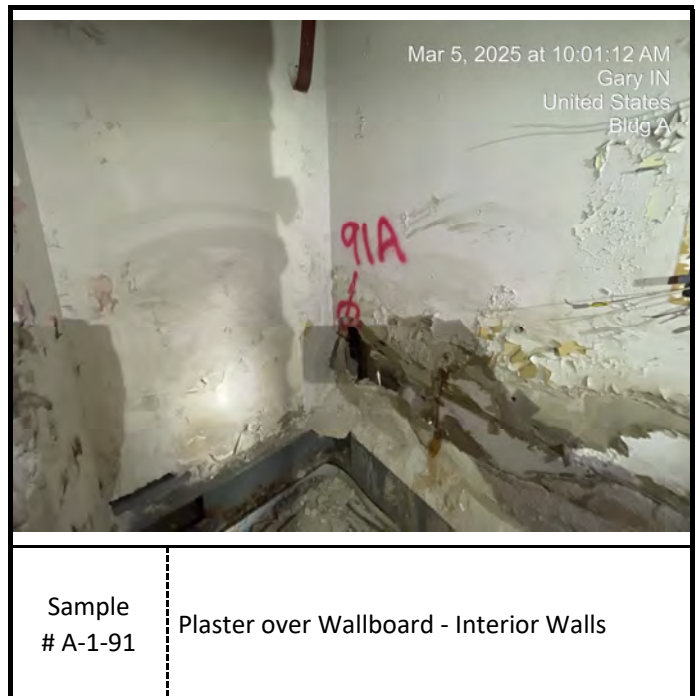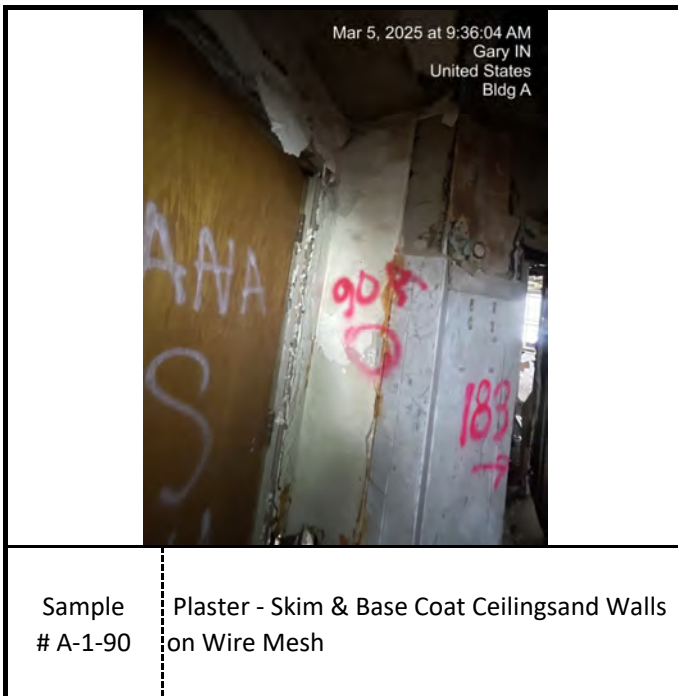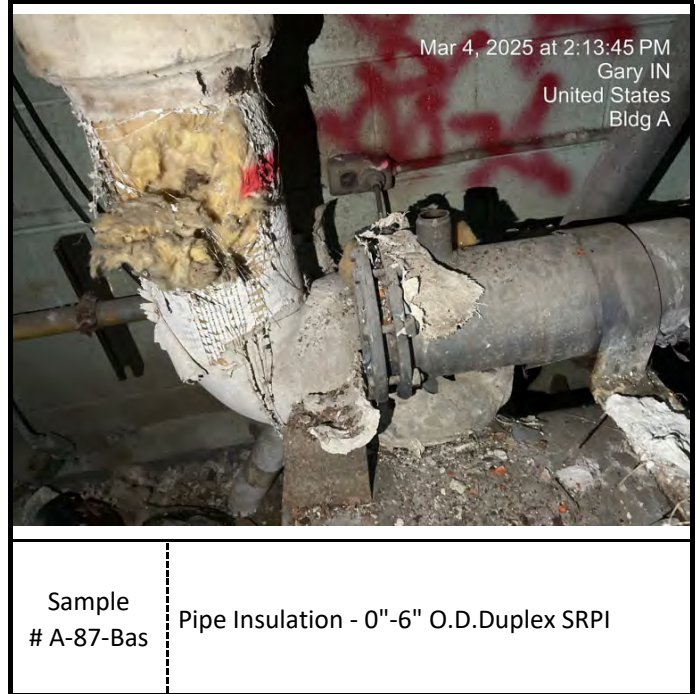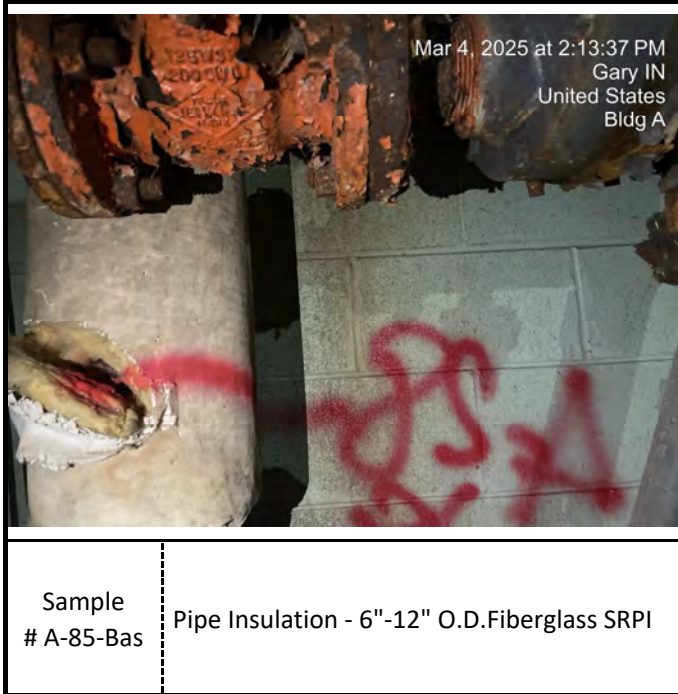

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

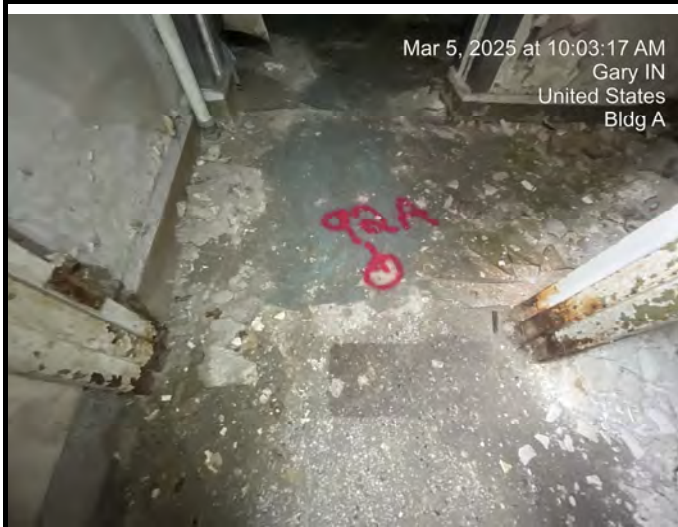

Sample
A-1-92

Flooring - Linoleum with Paper Backing- Blue



Sample
A-1-93

Construction Adhesive - Yellow on paneling



Sample
A-1-94

Flooring - Carpet Glue Yellow







Sample
A-1-95

Ceramic Tile with Glue - Interior Walls


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

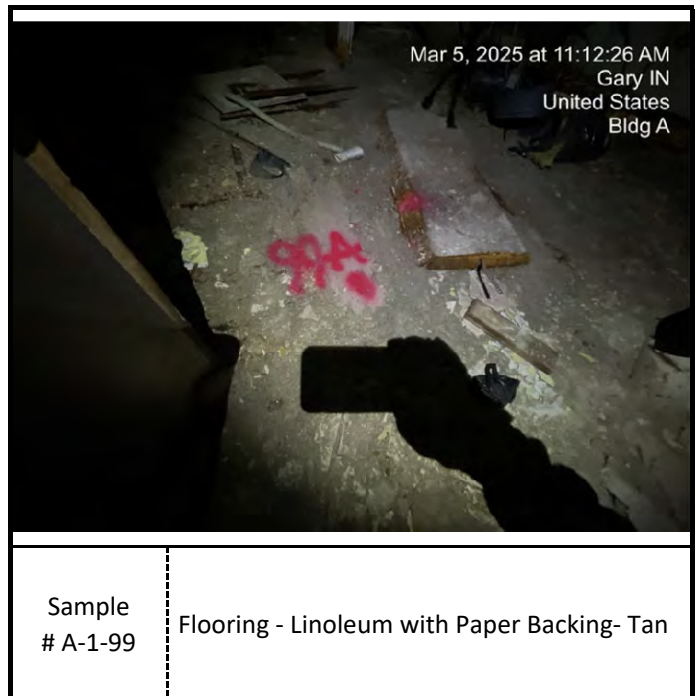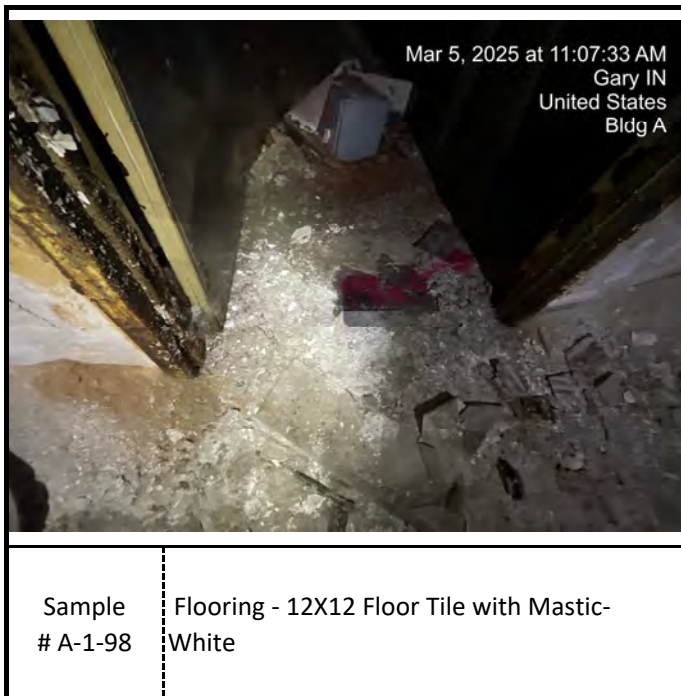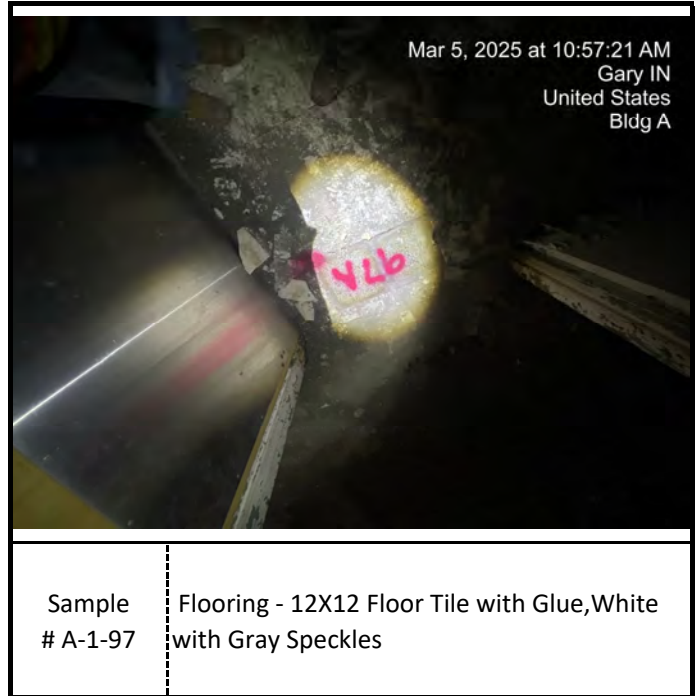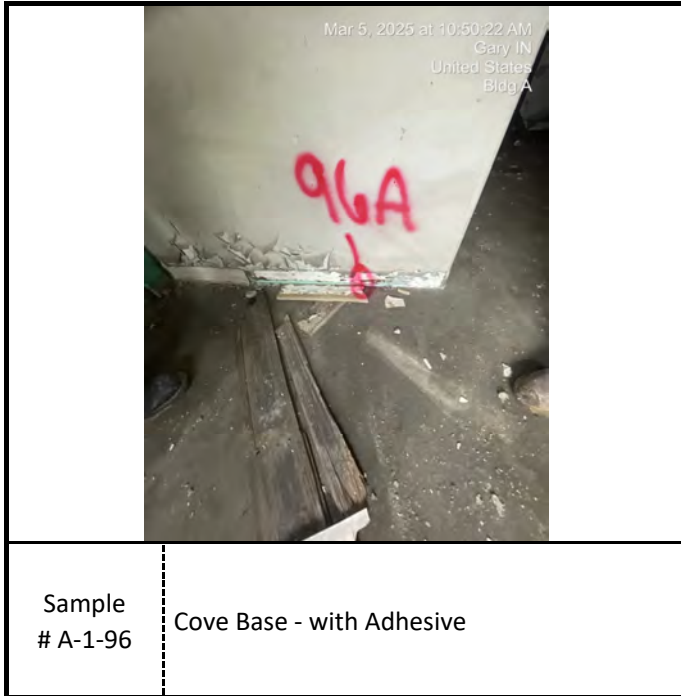

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

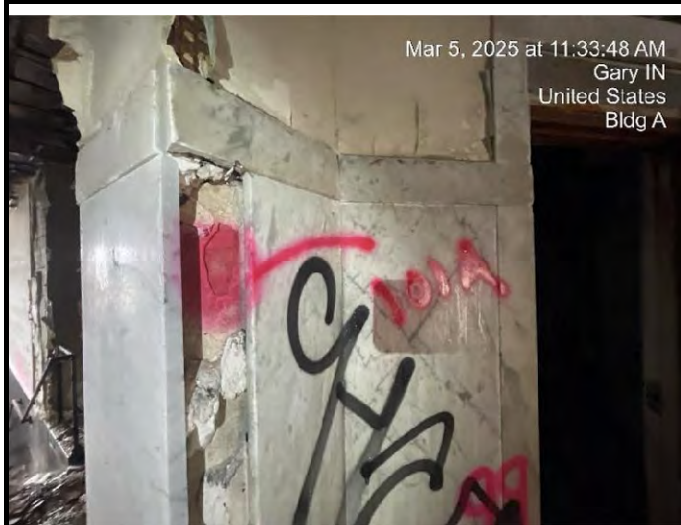

Sample # A-1-101	Marble Mortar - Interior Walls
---------------------	--------------------------------



Sample # A-1-102	Marble Grout - Stairway Walls
---------------------	-------------------------------







Sample # A-1-103	Ceiling Panel - 2X2, White with Indentations
---------------------	--



Sample # A-1-104	Construction Adhesive, Grout on ceramic tile - Wall Foundations
---------------------	--




Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

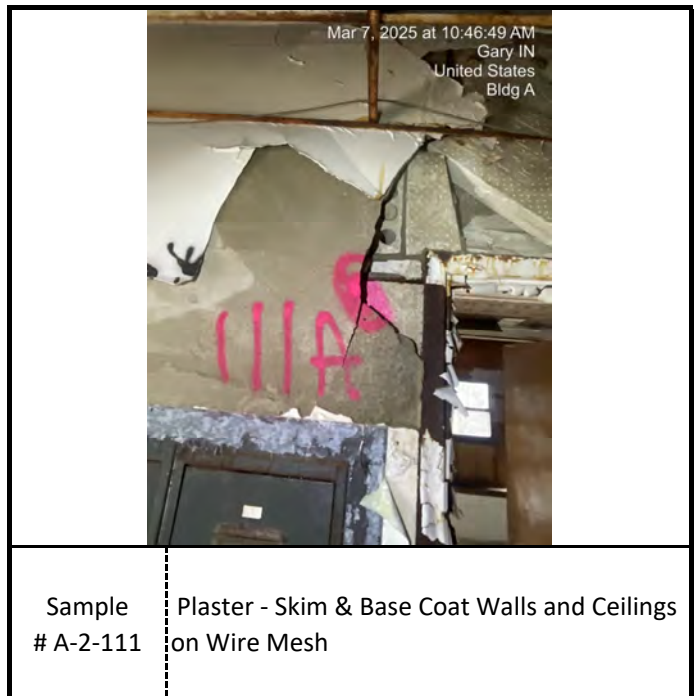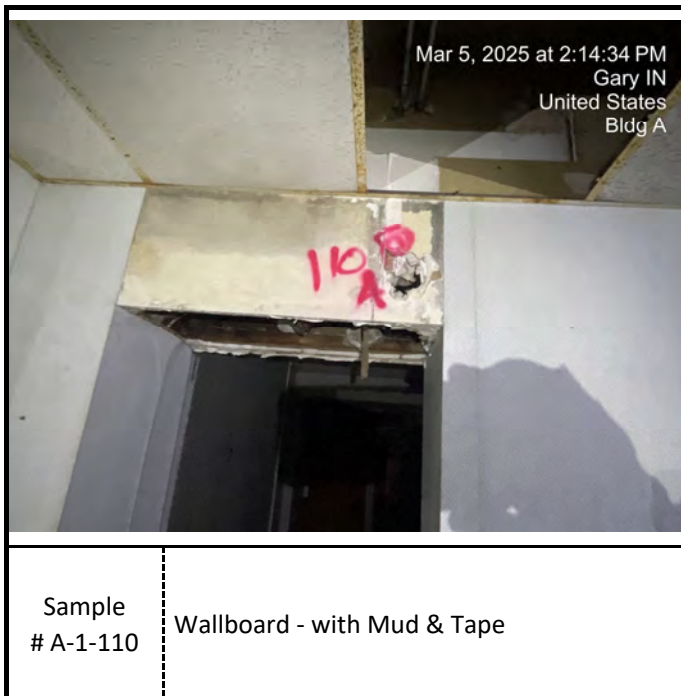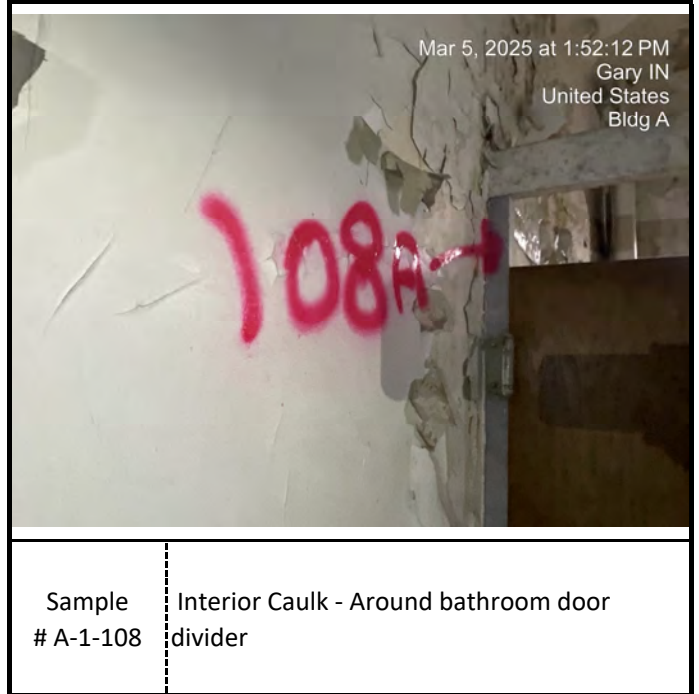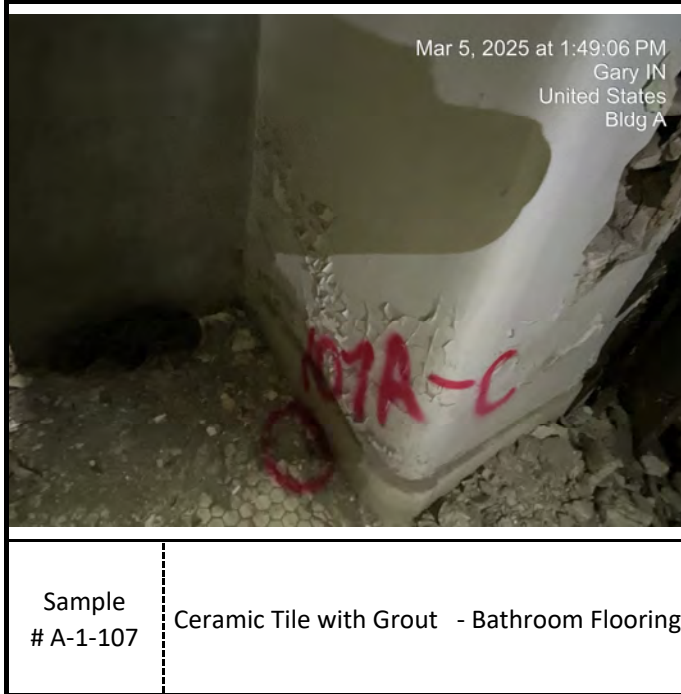

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

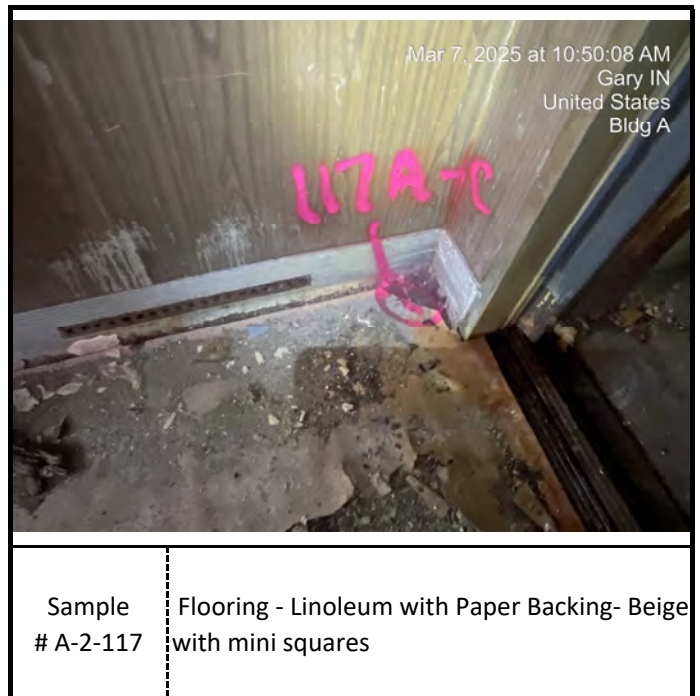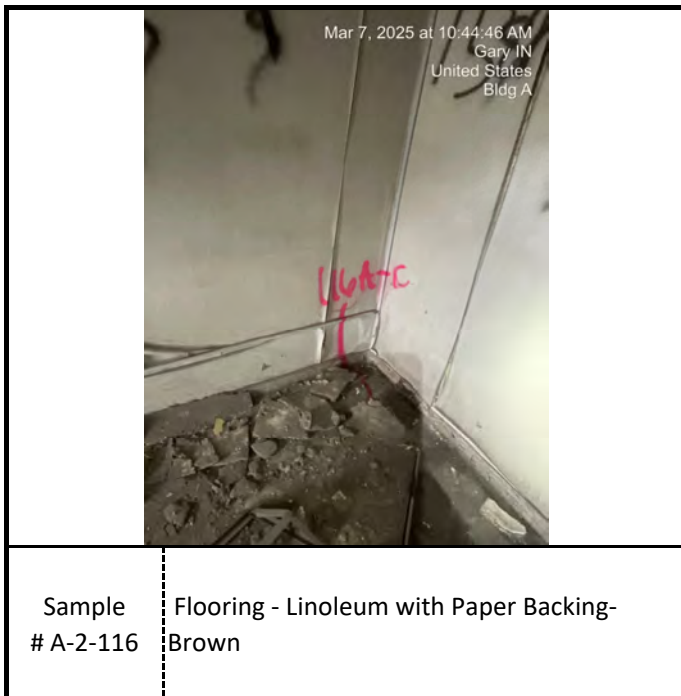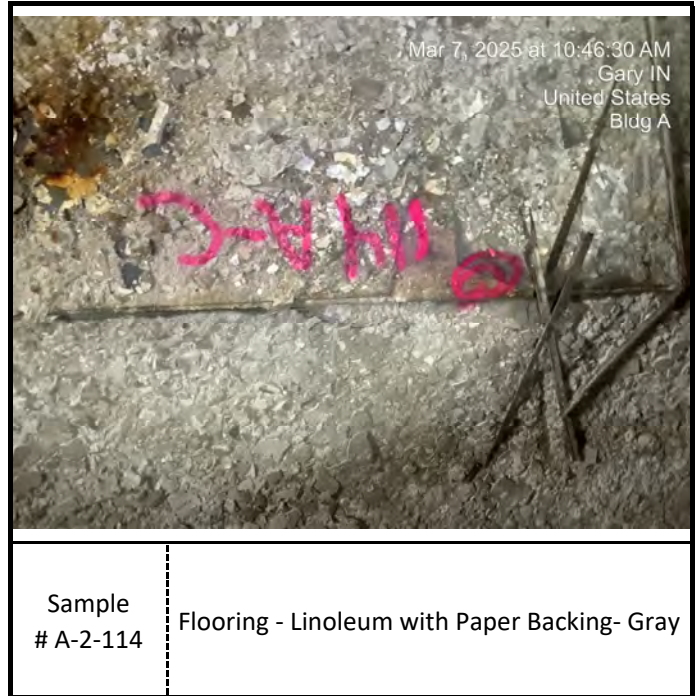

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building A



Sample # A-2-119 Flooring - Linoleum with Paper Backing- Blue with mini Squares



Sample # A-2-120 Wallboard - with Mud & Tape

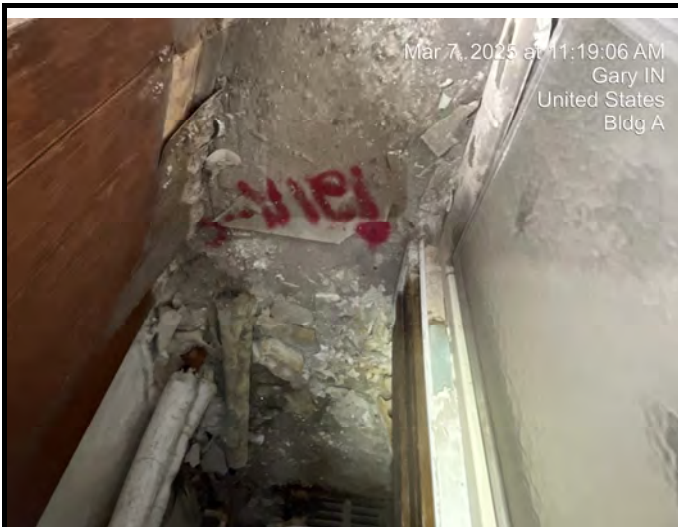


Sample # A-2-121 Flooring - Linoleum with Paper Backing- Light Blue with Speckles



Sample # A-2-122 Flooring - Linoleum with Paper Backing- Green mini Squares

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

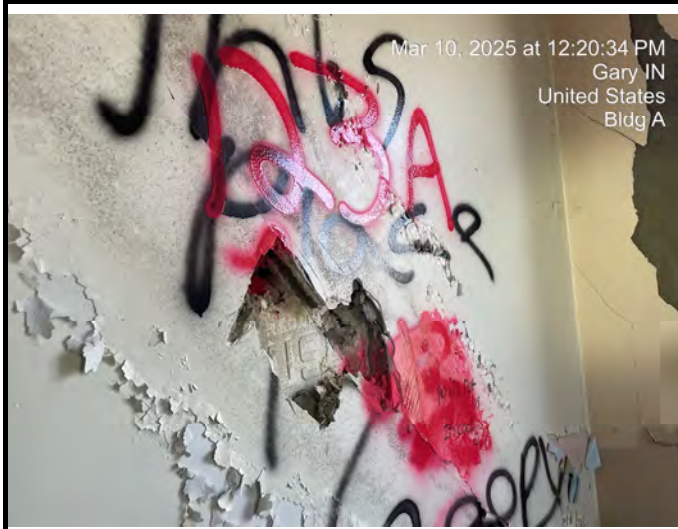

Sample # A-3-123 Plaster - Skim & Base Coat Ceilings and walls on Wire Mesh



Sample # A-3-124 Flooring - Linoleum with Paper Backing-Beige with Red, White, Blue Speckles






Sample # A-3-125 Flooring - Linoleum with Paper Backing-White



Sample # A-3-127 Ceiling Panel - 2X2, White with Squares

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

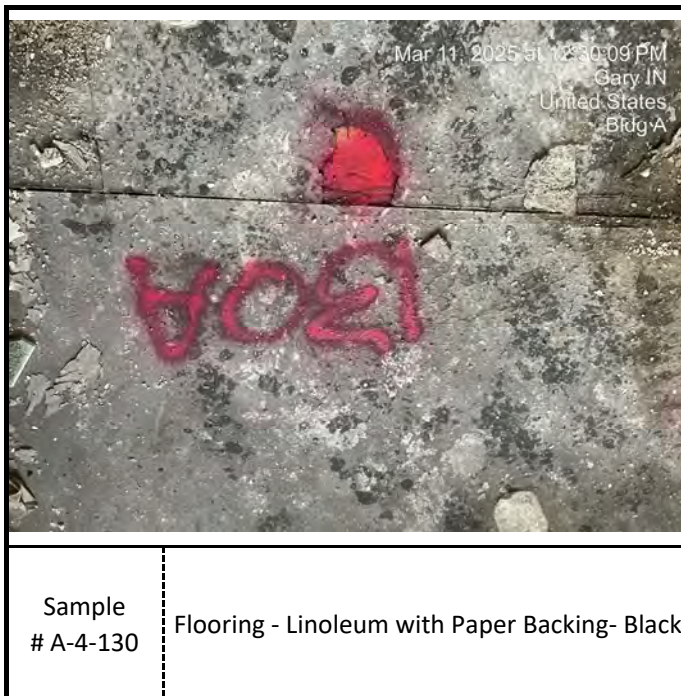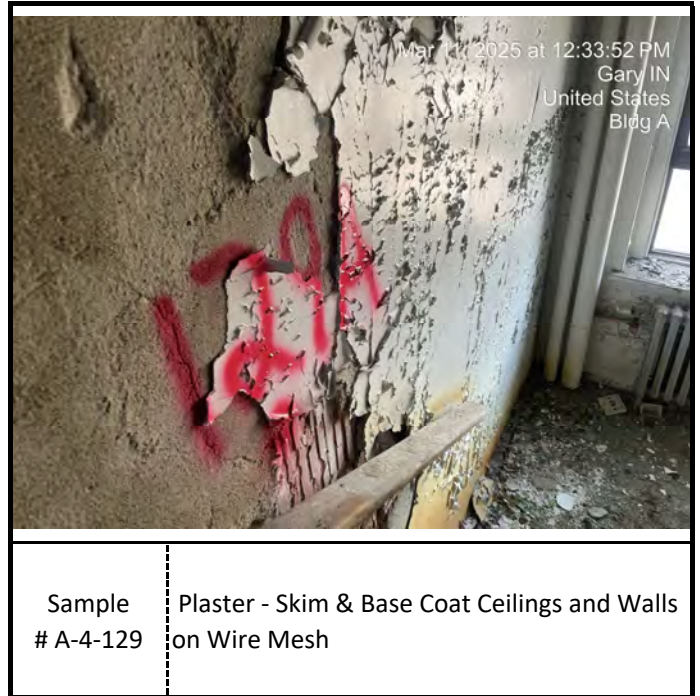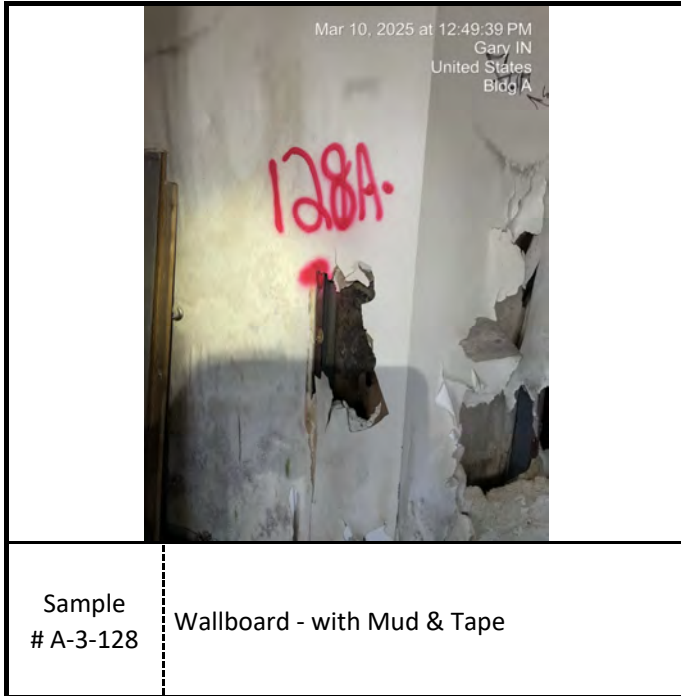

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A




Sample # A-4-132	Flooring - 9X9 Floor Tile with Mastic- Green with Black Dots
---------------------	--



Sample # A-4-133	Ceiling Panel - 2X2, White with Gouges
---------------------	--




Sample # A-4-134	Flooring - Linoleum with Paper Backing- Brown
---------------------	---

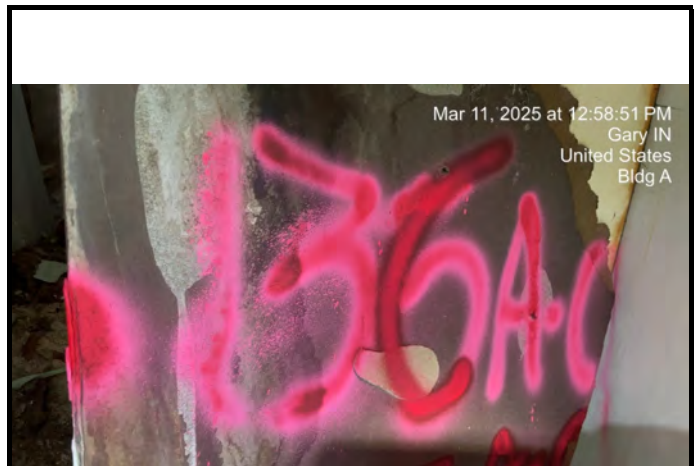

Sample # A-4-136	Interior Caulk - Interior Wood Trim, marble paneling
---------------------	--




Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

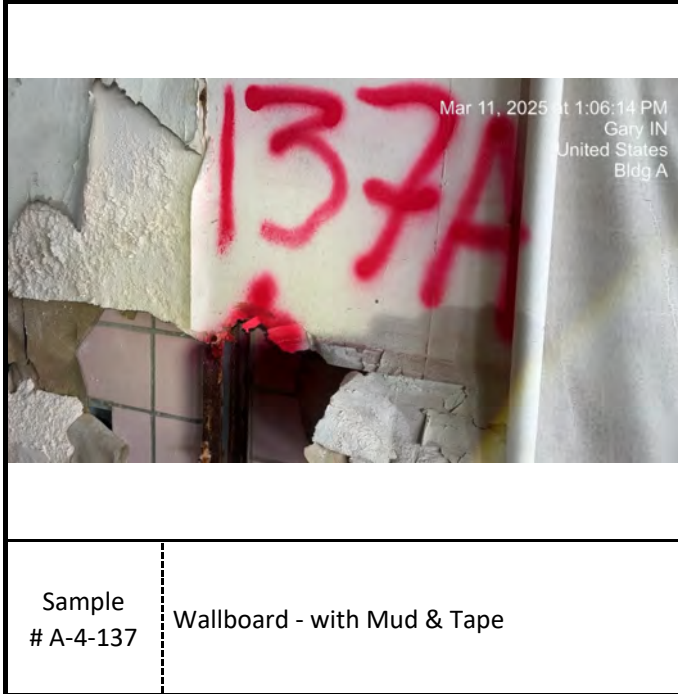

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A

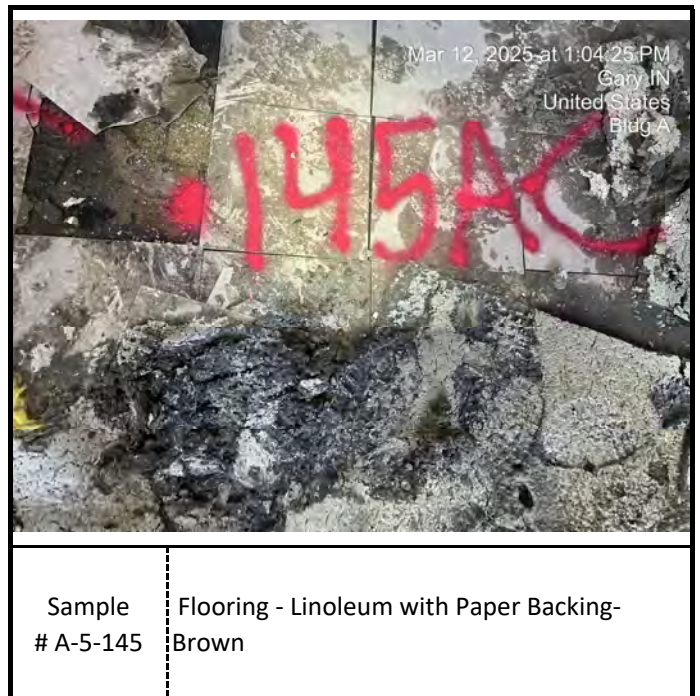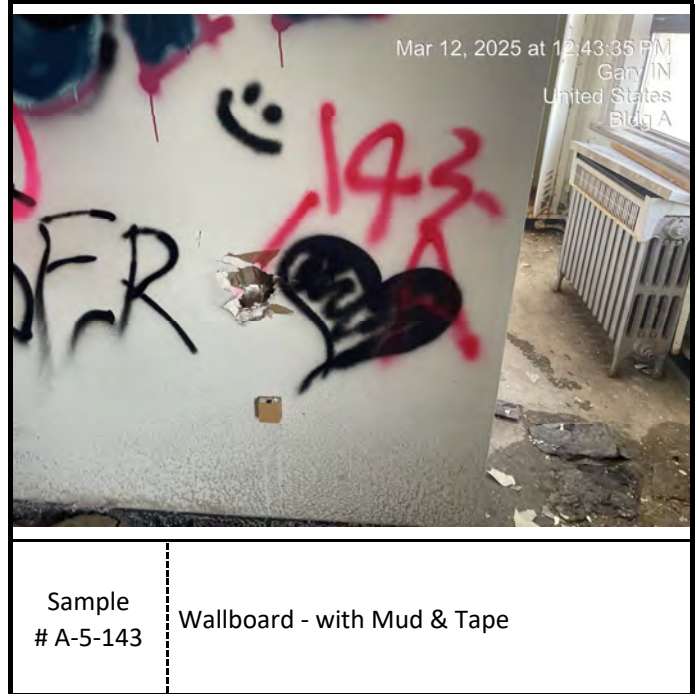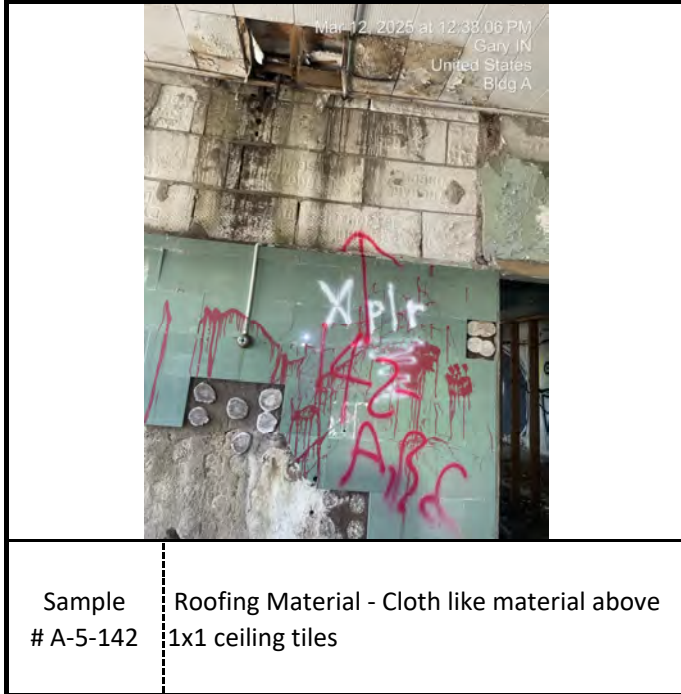

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A




Sample
A-5-146

Flooring - Underlayment



Sample
A-5-147

Wall Sheeting - Layered Paper on walls

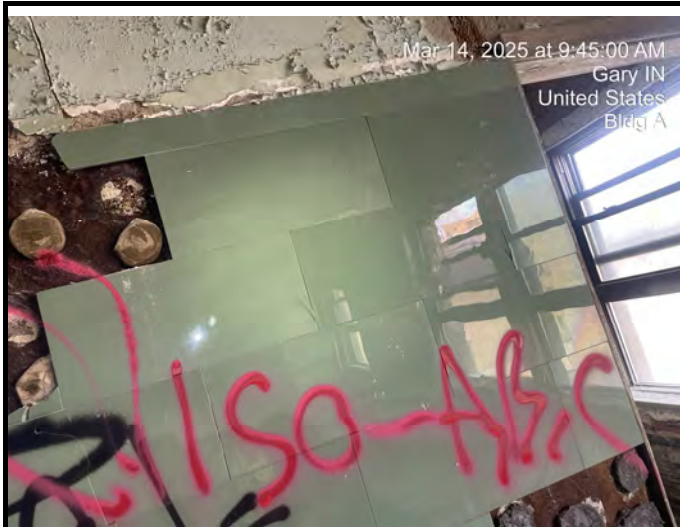

Sample
A-R-150

Glue Pods- Beige - On ceramic tile walls



Sample
A-R-152

Flooring- Black with Green Dots - 12X12 Floor Tile with Glue

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building A



Sample # A-R-153	Construction Adhesive - Yellow on ceramic tile walls
---------------------	--



Sample # A-R-155	Roofing Material - Flat Roof Materials
---------------------	--



Sample # A-R-156	Roofing Material - Flashing
---------------------	-----------------------------



BUILDING B

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building B



EA-1 Exterior



EA-2 Exterior



EA-3 Exterior



EA-4 Exterior

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building B



EA-5 Exterior



EA-6 Catwalk



EA-6 (B) Catwalk



EA-6 (C) Catwalk Catwalk

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building B




FS-1 Basement



FS-2 Basement



FS-3 Basement

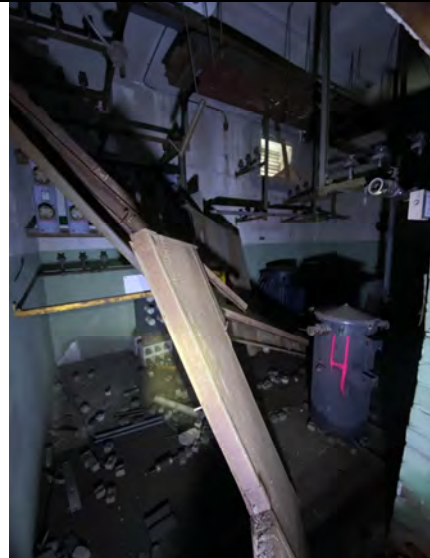

FS-4 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building B



FS-5 Basement



FS-6 Basement



FS-7 Basement



FS-8 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building B



FS-9 Basement



FS-10 Basement



FS-11 Basement



FS-12 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building B




FS-13 Basement



FS-14 Basement



FS-14 (B) Basement

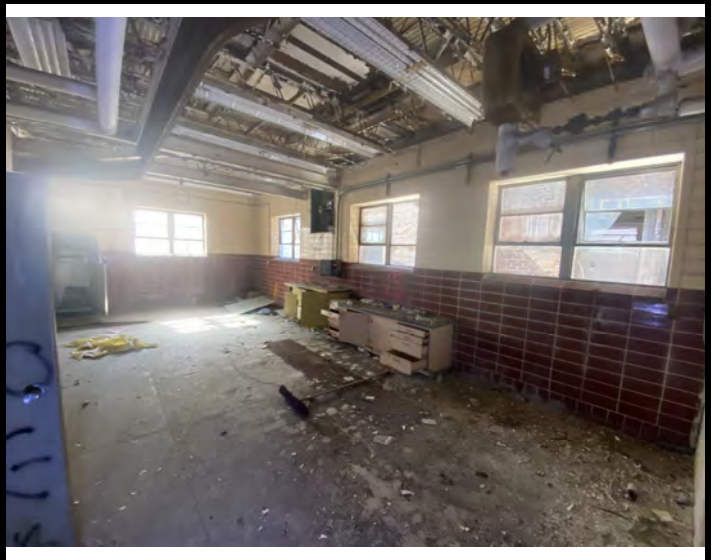

FS-15 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


540 Tyler Street Gary, IN - Building B



FS-16 1st Floor



FS-16 (B) 1st Floor

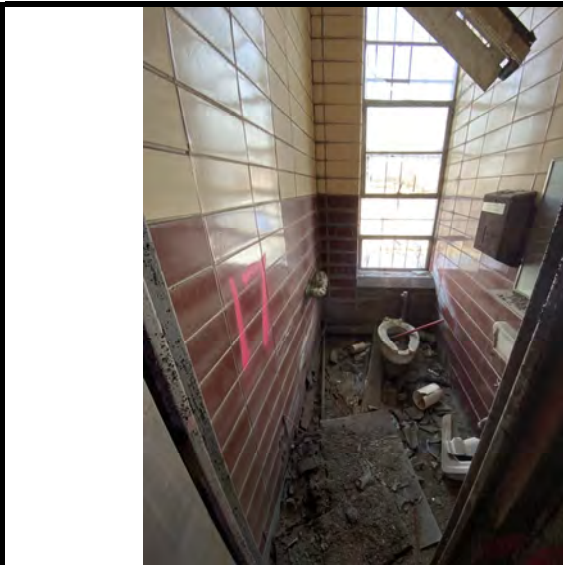

FS-17 1st Floor



FS-18 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**


540 Tyler Street Gary, IN - Building B



FS-19 1st Floor



FS-20 2nd Floor

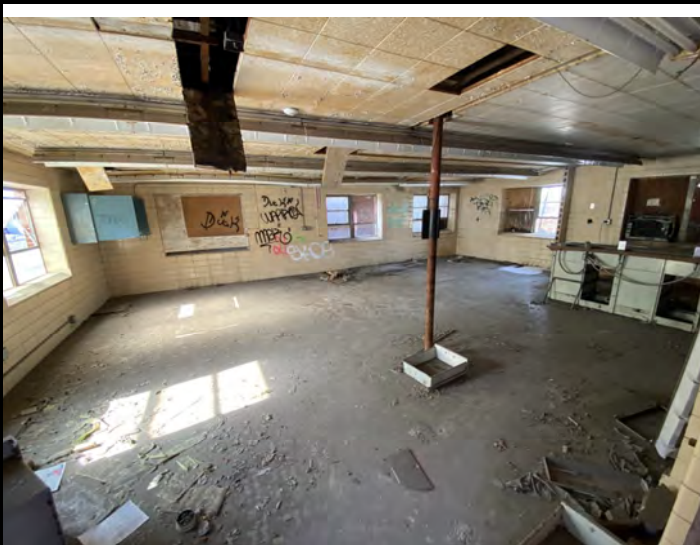

FS-21 2nd Floor



FS-22 2nd Floor

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building B



FS-23 2nd Floor

Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building B




Sample # B-Ext-2	Exterior Caulk - on Brick Siding & Trim, Windows, Doors, Transitions, Seams
---------------------	--



Sample # B-Ext-6	Window Glaze - Metal Framed Windows, Basement, 1st, 2nd
---------------------	--



Sample # B-Ext-11	Roofing Material - Flashing
----------------------	-----------------------------

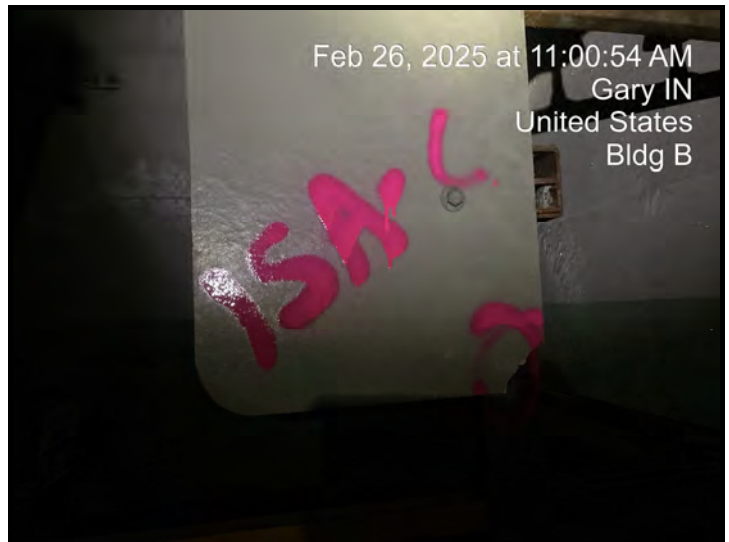

Sample # B-Base-15	Transite - Panel for electrical devices
-----------------------	---

Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building B



Sample
B-Base-27

Gasket Material - Pipe Valves and Flanges



Sample
B-1-31

Interior Caulk - Doors



Sample
B-1-34

Transite - Table Top



Sample
B-2-40

Construction Adhesive - Brown on paneling-
White

Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building B



Sample # B-2-41	Window Glaze - Wood Framed Sliding Windows
--------------------	---



Sample # B-2-43	Roofing Material - Flat Roof Materials
--------------------	--



Sample # B-2-44	Roofing Material - Flashing
--------------------	-----------------------------



Sample # B-2-48	Exterior Caulk - Door Caulk
--------------------	-----------------------------

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B



Sample
B-Ext-1

Brick Mortar- Brown - Foundation



Sample
B-Ext-3

Brick Mortar- Orange - Foundation



Sample
B-Ext-4

Exterior Caulk - Around fan vents and Doors



Sample
B-Ext-5

Concrete - Sidewalk around structure
perimeters

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B



Sample # B-Ext-7	Block Mortar - Patch & Repair of basement windows
---------------------	---



Sample # B-Ext-8	Exterior Caulk - on Brick Siding, former awning
---------------------	---






Sample # B-Ext-9	Concrete - Base for electrical cable runs
---------------------	---



Sample # B-Ext-10	Asphalt Paving - Around structure perimeter
----------------------	---


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B

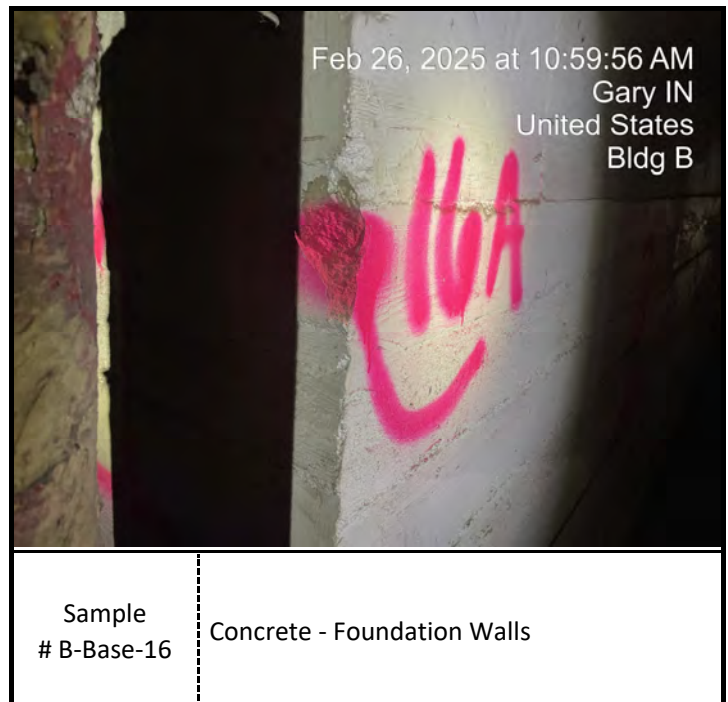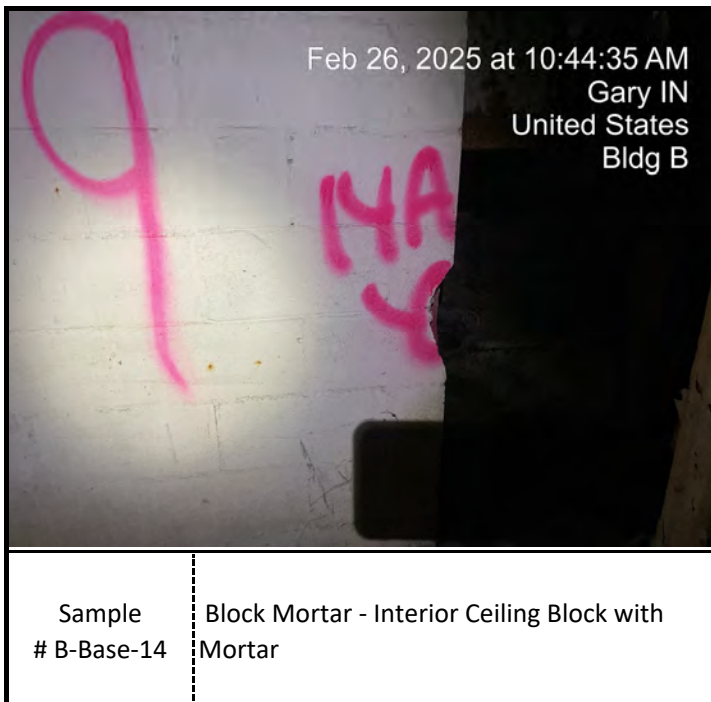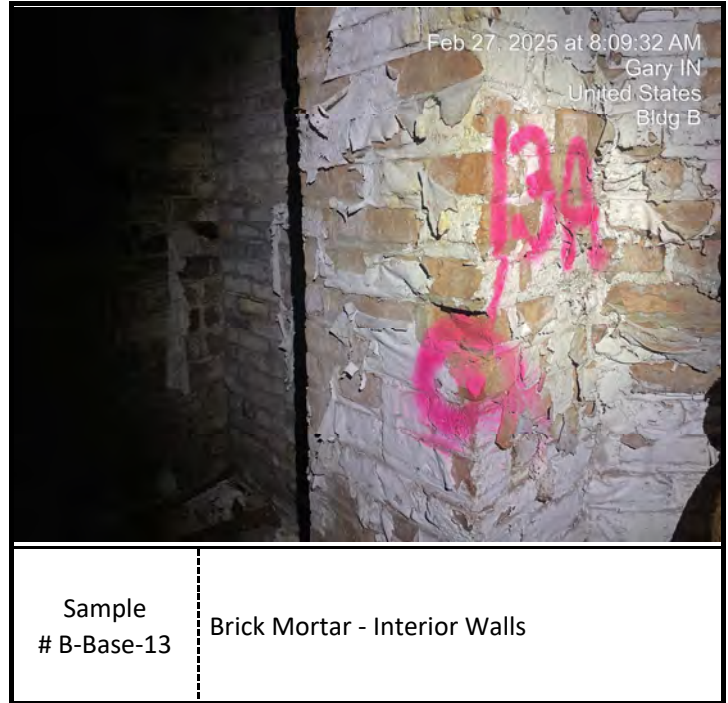


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B

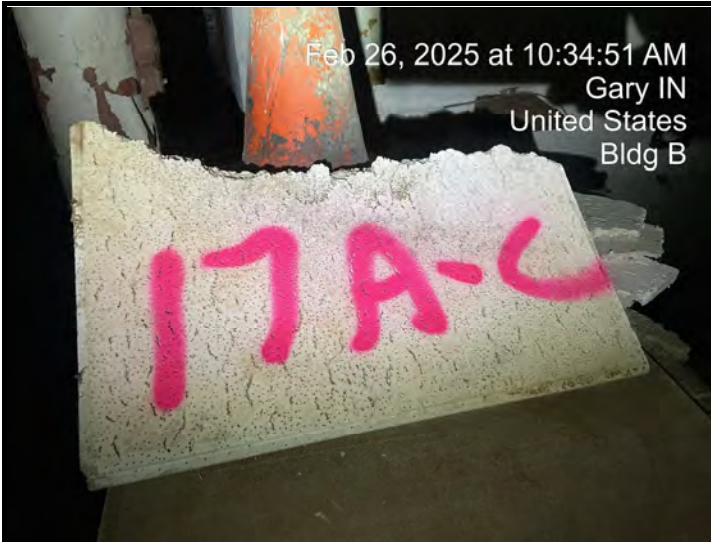


Sample
B-Base-17

Ceiling Panel - 2X2, White with Indentations

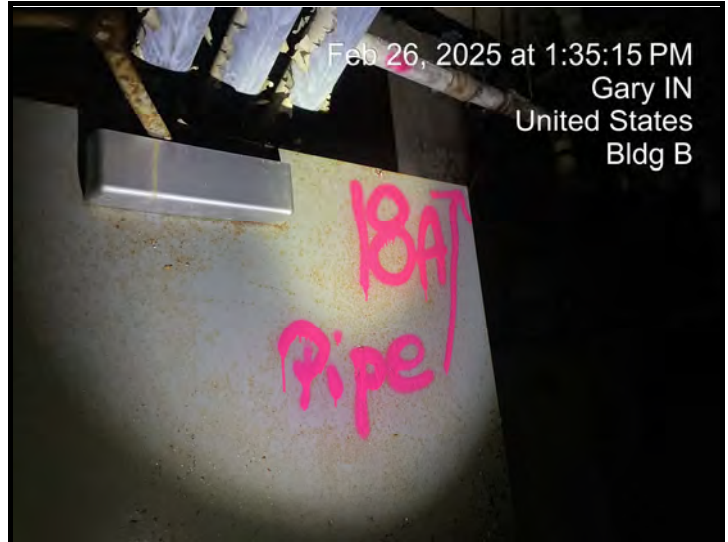


Sample
B-Base-18

Pipe Insulation - 0"-6" O.D.fiberglass with
cloth SRPI

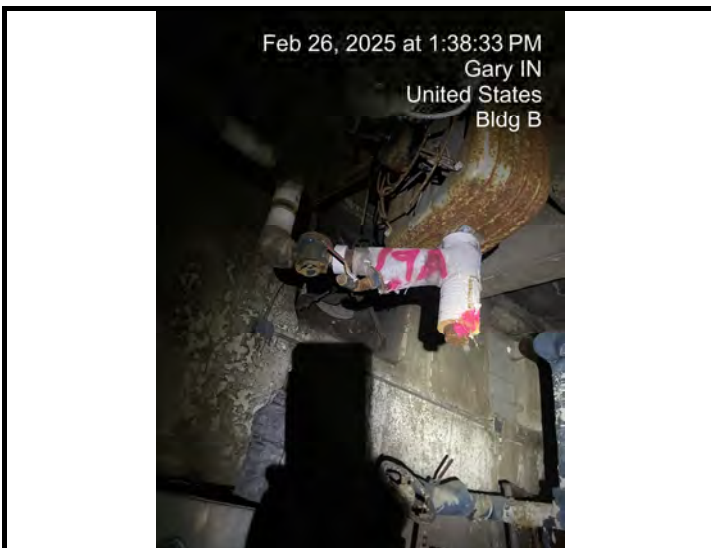

Sample
B-Base-19

Pipe Fitting - 0"-6" O.D. Mudded pipe
insulation on fiberglass SRPI

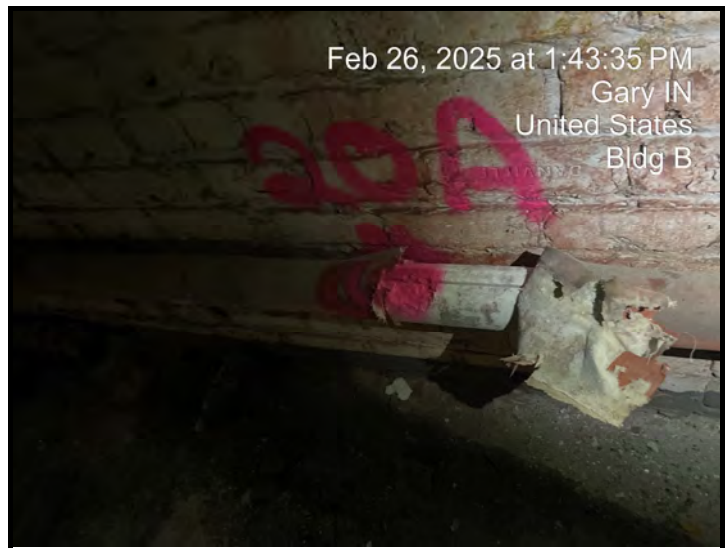


Sample
B-Base-20


Pipe Insulation - 0"-6" O.D Mag SRPI

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B

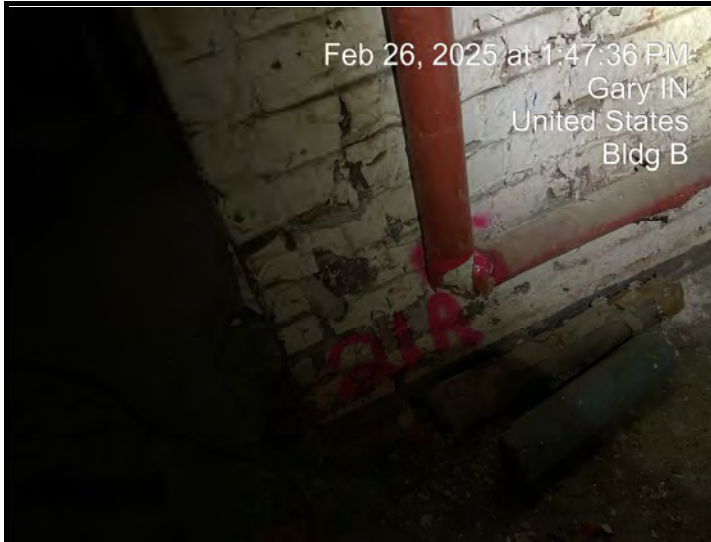

Sample # B-Base-21	Pipe Fitting - 0"-6" O.D. Mudded pipe fitting insulation on Mag SRPI
-----------------------	--

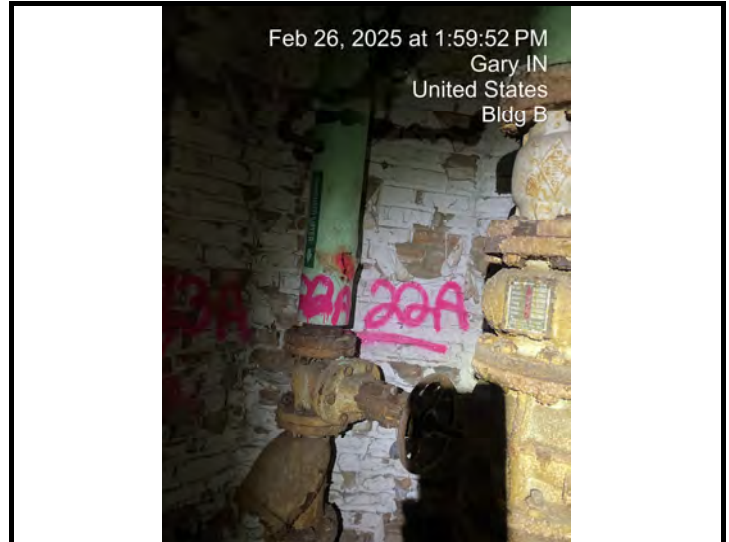

Sample # B-Base-22	Pipe Insulation - 6"-12" O.D fiberglass with cloth SRPI
-----------------------	---



Sample # B-Base-23	Pipe Fitting - 6"-12" Mudded on Fiberglass with Cloth Pipe Insulation
-----------------------	---



Sample # B-Base-24	Pipe Insulation - 6"-12" O.D fiberglass with cloth SRPI
-----------------------	---

Gary Commercial Blight Elimination Program Non-Detect Samples


540 Tyler Street Gary, IN - Building B



Sample # B-Base-25	Pipe Fitting - 6"-12" O.D. Mudded pipe insulation on fiberglass SRPI
-----------------------	---



Sample # B-Base-26	Pipe Insulation - 0"-6" Duplex Insulation
-----------------------	---

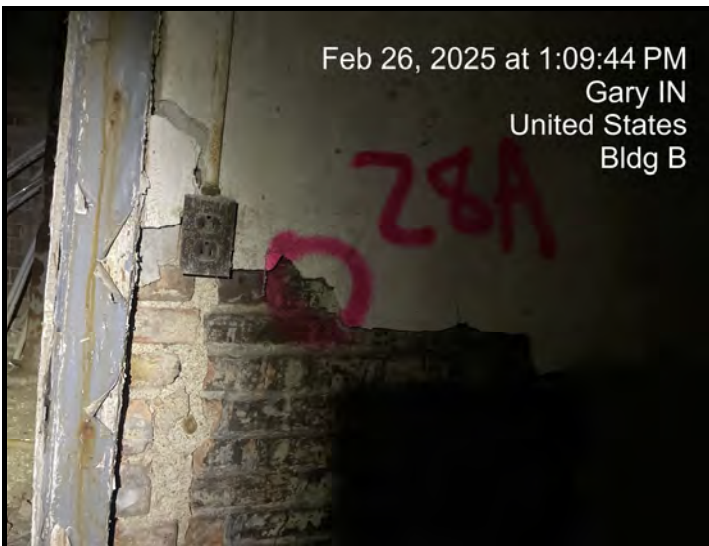

Sample # B-Base-28	Plaster - Skim & Base Coat Ceilings on Brick/Block- Interior Walls
-----------------------	---



Sample # B-1-29	Flooring - Linoleum with Paper White Backing- Stone pattern
--------------------	--

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B



Sample
B-1-30

Ceramic Tile with Grout - Building walls



Sample
B-1-32

Cove Base - with Adhesive



Sample
B-1-33

Flooring - Terrazzo



Sample
B-1-35

Metal Pan Insulation - Insulated metal
ceiling tiles- Bathroom

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B




Sample # B-1-36	Flooring - Linoleum with White Paper Backing-TableTop
--------------------	--



Sample # B-1-37	Insulator - Inside electrical box components
--------------------	--



Sample # B-2-38	Concrete - Flooring
--------------------	---------------------

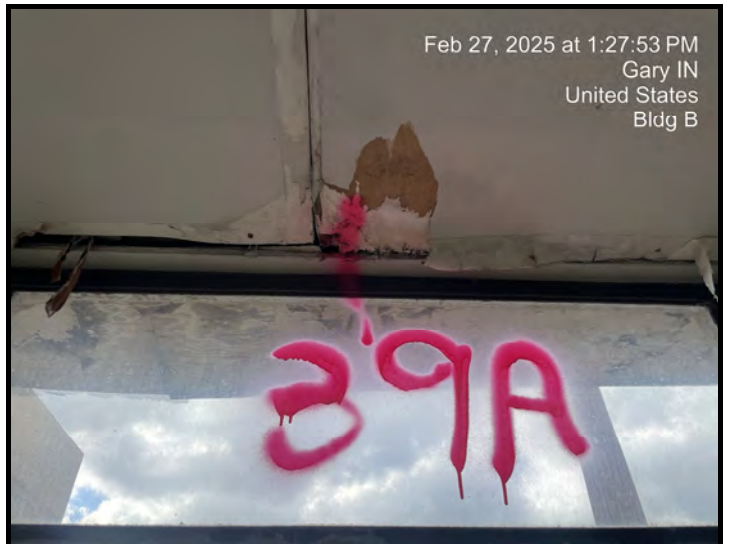

Sample # B-2-39	Wallboard - with Mud & Tape
--------------------	-----------------------------

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building B



Sample
B-2-42

Rolled In Insulation - Yellow with Paper



Sample
B-2-45

Roofing Material - Coping Brick



Sample
B-2-46

Roofing Material - Coping Seal



Sample
B-2-47

Roofing Material - Coping Mortar

BUILDING C

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



EA-1 Exterior



EA-2 Exterior



EA-3 Exterior



EA-4 Exterior

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building C



EA-4 (B) Exterior



FS-1 Basement



FS-2 Basement



FS-3 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-4 Basement



FS-5 Basement



FS-6 Basement



FS-7 Basement

Gary Commercial Blight Elimination Program Exterior & Functional Spaces

540 Tyler Street Gary, IN - Building C



FS-8 Basement



FS-9 Basement



FS-10 Basement



FS-11 Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-12 1st Floor



FS-13 2nd Floor



FS-14 2nd Floor



FS-15 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C




FS-16 2nd Floor



FS-17 2nd Floor



FS-18 2nd Floor

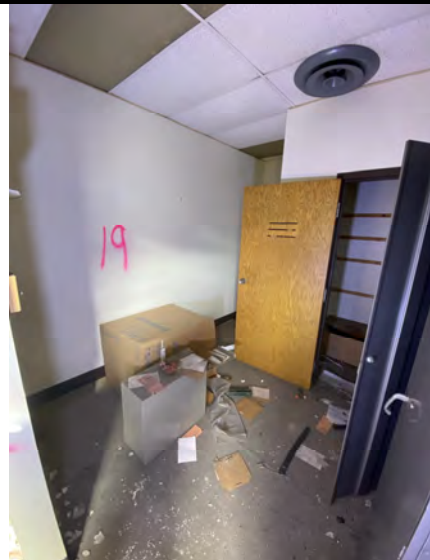

FS-19 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-20 2nd Floor



FS-21 2nd Floor



FS-22 2nd Floor



FS-23 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C




FS-24 2nd Floor



FS-25 2nd Floor



FS-26 2nd Floor

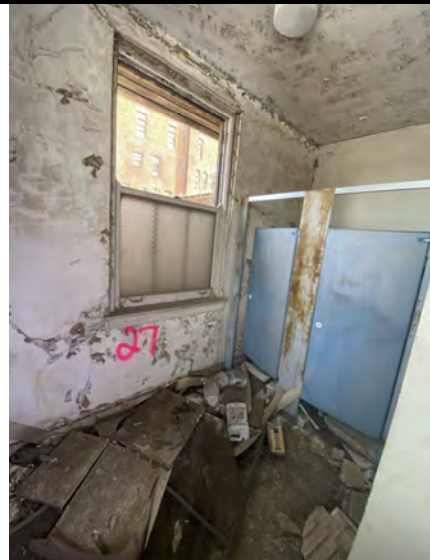

FS-27 2nd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-28 2nd Floor



FS-29 3rd Floor



FS-30 3rd Floor



FS-31 3rd Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-32 3rd Floor



FS-33 1st Floor



FS-34 1st Floor



FS-35 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-36 1st Floor



FS-37 1st Floor



FS-38 1st Floor



FS-39 1st Floor

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-40 1st Floor



FS-41 1st Floor



FS-42 Basement



FS-42 (B) Basement

**Gary Commercial Blight Elimination Program
Exterior & Functional Spaces**

540 Tyler Street Gary, IN - Building C



FS-43 1st Floor

Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building C



Sample
C-Ext-3-A-C

Exterior Caulk - Around wood windows-
1st floor



Sample
C-Ext-4-A-C

Exterior Caulk - Around Aluminum Window
Frames- 2nd floor



Sample
C-Ext-7-A-C

Exterior Caulk - Around Glass Block
Windows, Exhaust Window




Sample
C-B-18-A-C

Gasket Material - Pipe Valves


Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building C

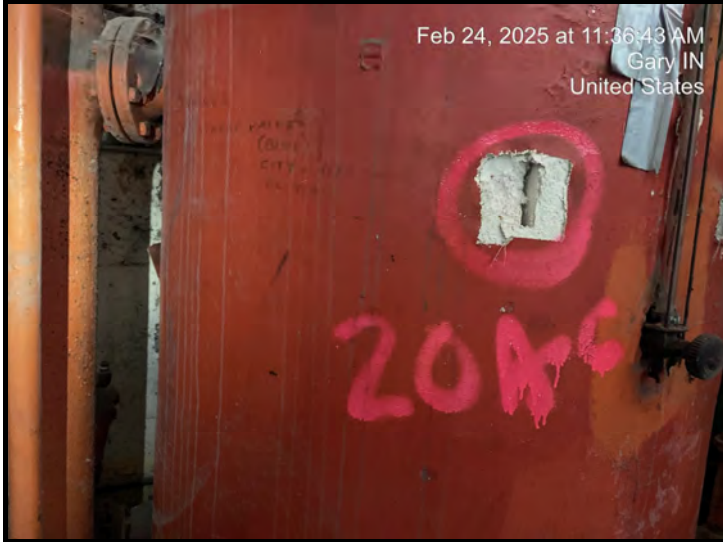

Sample
C-B-20-A-C

Tank Insulation - Fiberglass with Foil Paper-
Tank 2

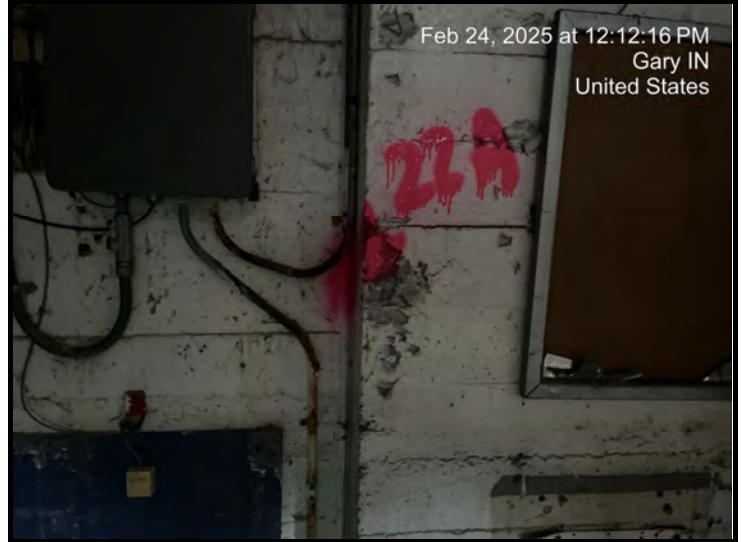

Sample
C-B-22-A-C

Concrete - Foundation Walls



Sample
C-B-23-A-C

Pipe Insulation - 10" Mag Block Type
Insulation



Sample
C-B-24-A-C

Pipe Fitting - Mudded on Corrugated Paper
Pipe Insulation


Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building C




Sample
C-B-37-A-C

Gasket Material - Boiler Door Gaskets

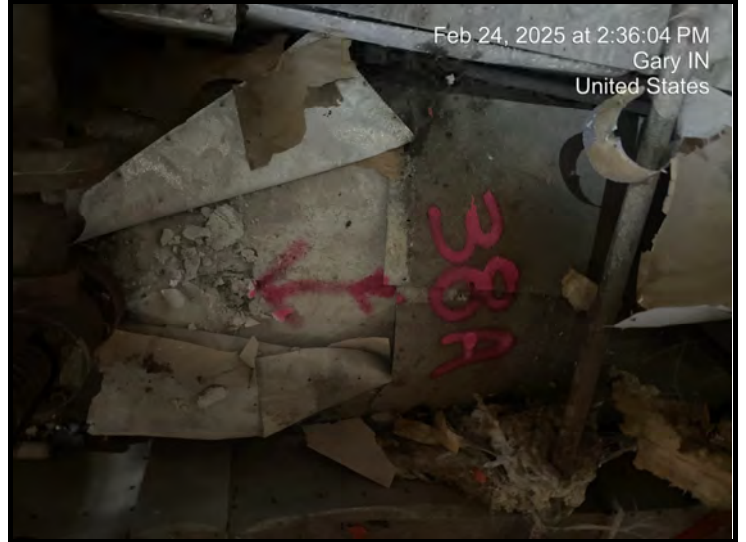

Sample
C-B-38-A-C

Boiler Insulation - Fiberglass with Foil

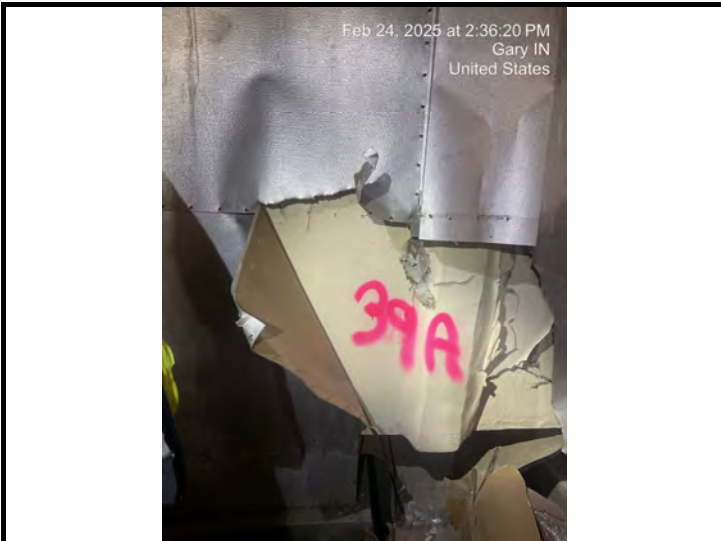

Sample
C-B-39-A-C

Duct Insulation - Fibrous Paper on Ducts




Sample
C-1-40

Flooring - 12X12 Floor Tile with Mastic-
White with Brown Speckles

Gary Commercial Blight Elimination Program Asbestos Containing Samples

540 Tyler Street Gary, IN - Building C

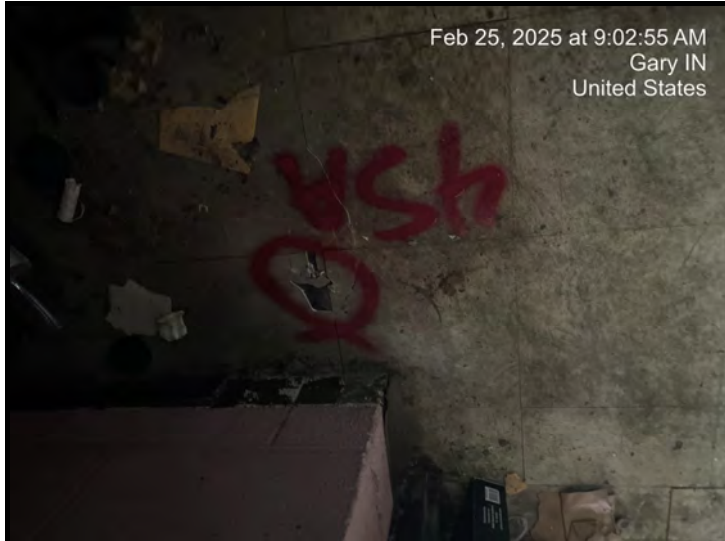

Sample
C-1-45

Flooring - 12X12 Floor Tile with Mastic-
Brown with Beige Speckles



Sample
C-1-46

Interior Caulk - Windows, Door openings



Sample
C-1-54

Pipe Insulation - Duplex Insulation



Sample
C-2-57

Flooring - 12X12 Floor Tile with Mastic-
Beige with Brown


**Gary Commercial Blight Elimination Program
Asbestos Containing Samples**

540 Tyler Street Gary, IN - Building C



Sample
C-2-63

Pipe Insulation - Corrugated Paper (AirCell)



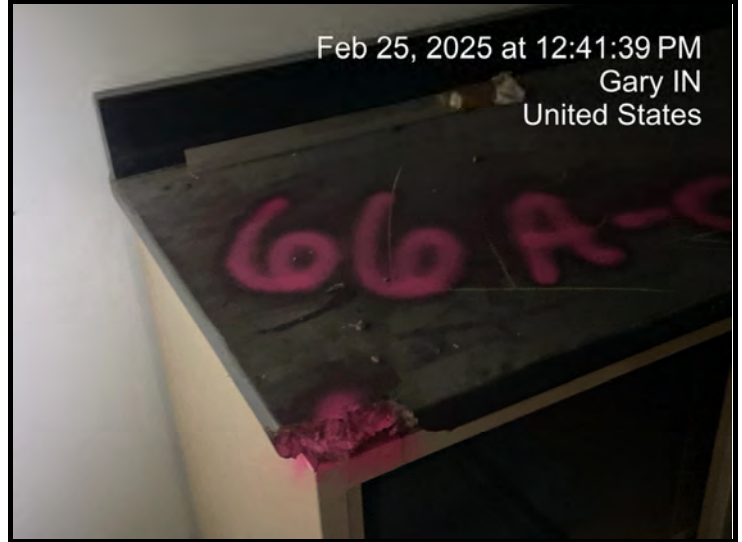


Sample
C-2-66

Transite - Transite Table

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C

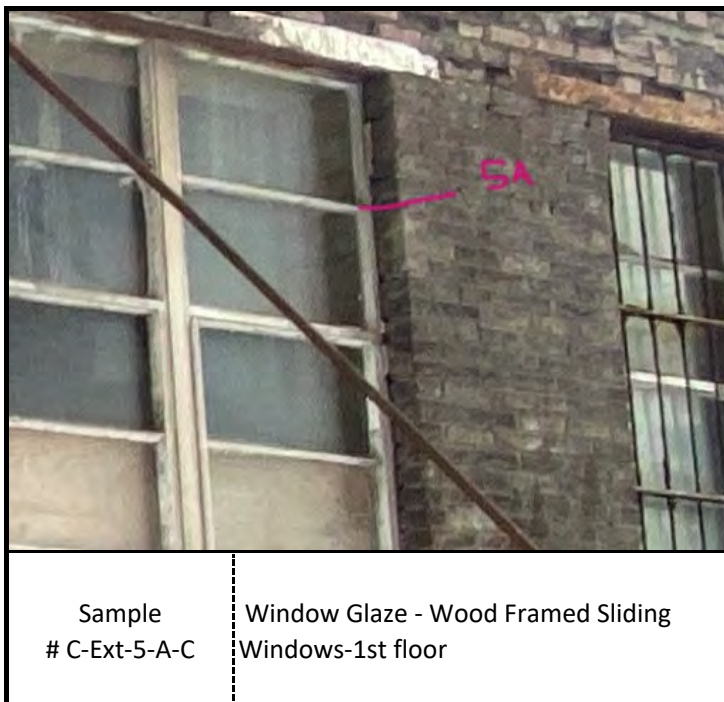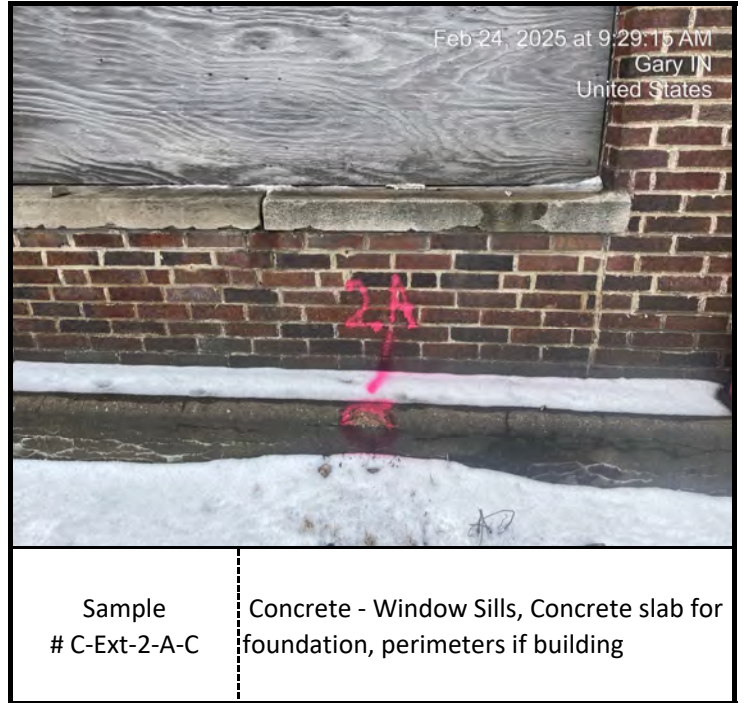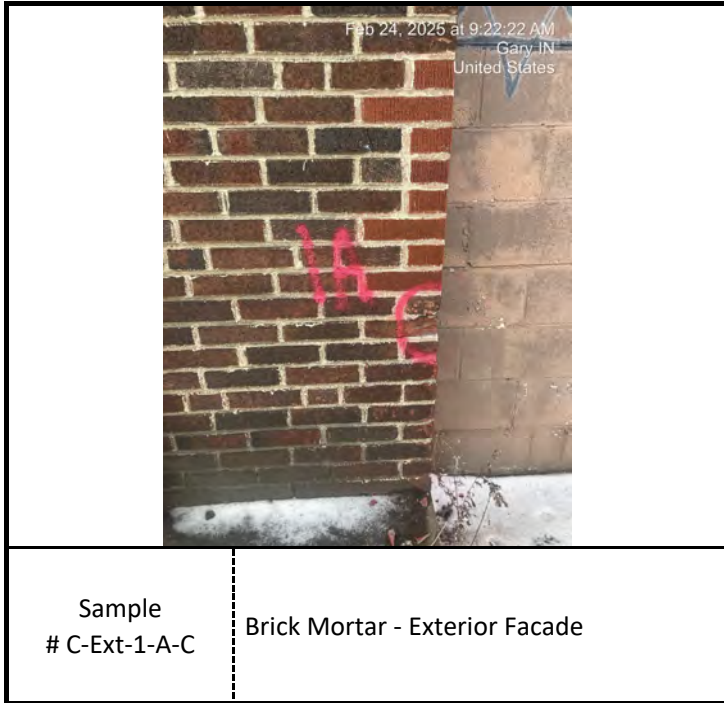

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C



Sample
C-Ext-8-A-C

Concrete - Concrete Slabs



Sample
C-Ext-9-A-C

Exterior Caulk - Around former bay door



Sample
C-Ext-10-A-C

Asphalt Paving - Parking Lot, Approaches
around perimeter



Sample
C-Ext-11-A-C

Block Mortar - Foundation Block with
Mortar- Main Door

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C



Sample
C-Ext-12-A-C

Window Glaze - Wood Framed Sliding
Windows



Sample
C-Ext-13-A-C

Roofing Material - Shingled- Roof



Sample
C-B-14-A-C

Concrete - Floor- Basement



Sample
C-B-15-A-C

Block Mortar - Interior Wall Block with
Mortar

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C



Sample # C-B-16-A-C	Window Glaze - Wood Framed Sliding Windows-Interior
--------------------------------	--



Sample # C-B-17-A-E	Plaster - Plaster over Terra- Cotta Walls
--------------------------------	--




Sample # C-B-19-A-C	Tank Insulation - Fiberglass with Foil- Tank 1
--------------------------------	---



Sample # C-B-21-A-C	Tank Insulation - Fiberglass with Foil Paper- Tank 3
--------------------------------	---

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C

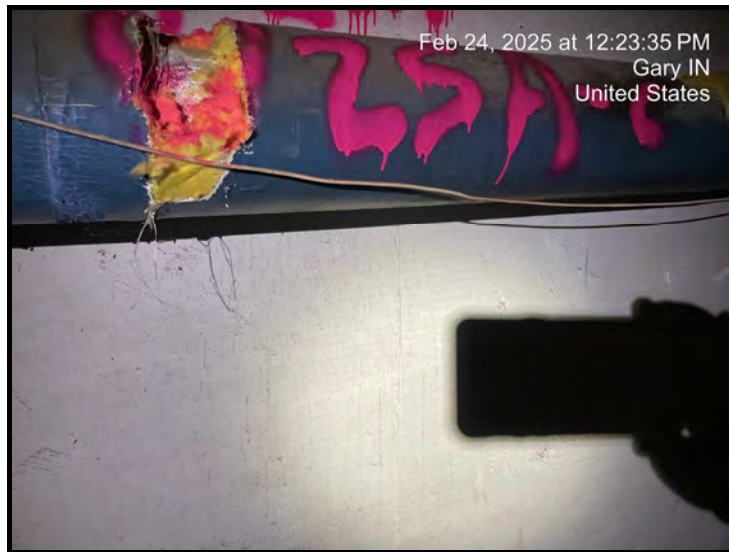

Sample
C-B-25-A-C

Pipe Insulation - 8" Fiberglass with Foil




Sample
C-B-26-A-C

Pipe Insulation - 6" Fiberglass with Paper



Sample
C-B-27-A-C

Brick Mortar - Interior Columns and walls

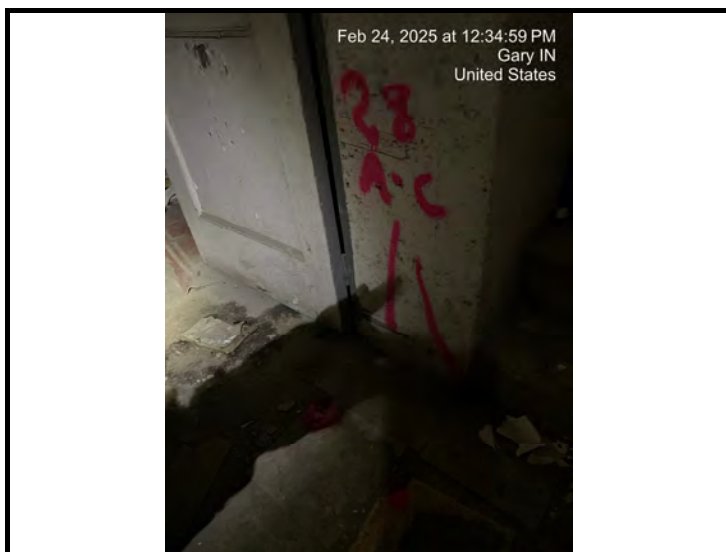

Sample
C-B-28-A-C

Flooring - 12X12 Floor Tile with Glue- Gray


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C




Sample
C-B-29-A-C

Flooring - Stair Treads & Adhesives

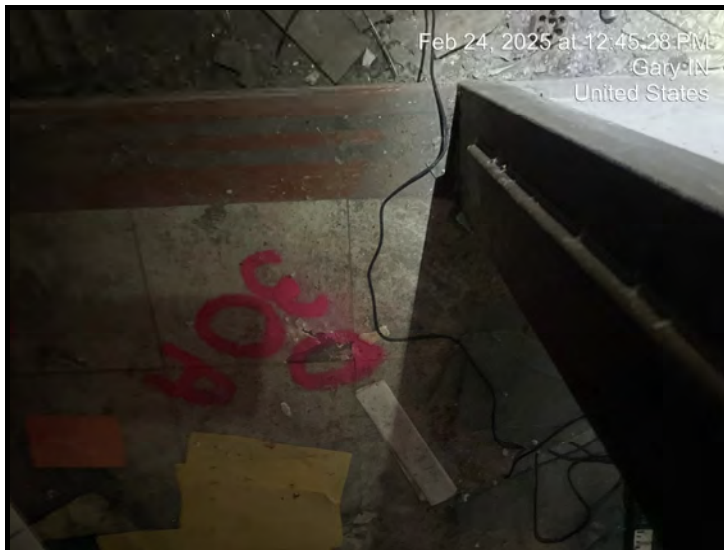

Sample
C-B-30-A-C

Flooring - 12X12 Floor Tile with Glue, Gray
with White Splotchess

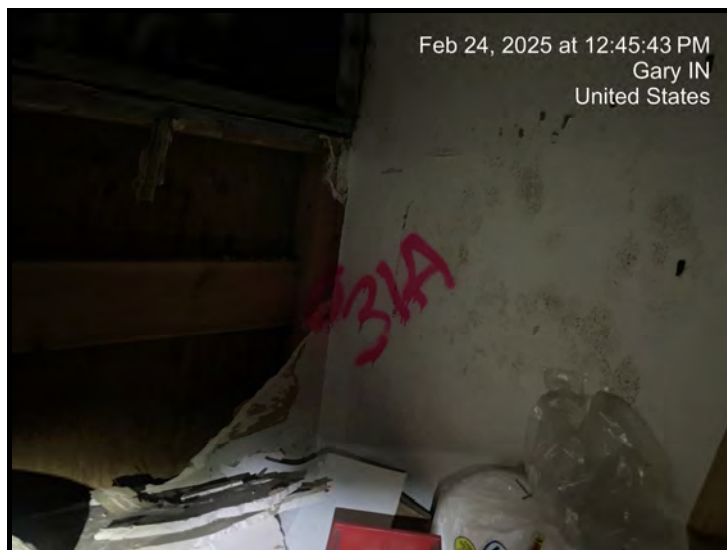

Sample
C-B-31-A-C

Wallboard - with Mud & Tape



Sample
C-B-32-A-C

Boiler Insulation - Fiberglass with Foil

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C



Sample
C-B-33 A-C

Pipe Insulation - Duplex pipe insulation
debris



Sample
C-B-34-A-C

Boiler Insulation - Boiler Interior



Sample
C-B-35-A-C

Fire Brick - Boiler Interior



Sample
C-B-36-A-C

Boiler Cap - Insulating Material


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C




Sample
C-1-41

Flooring - Carpet Glue Yellow

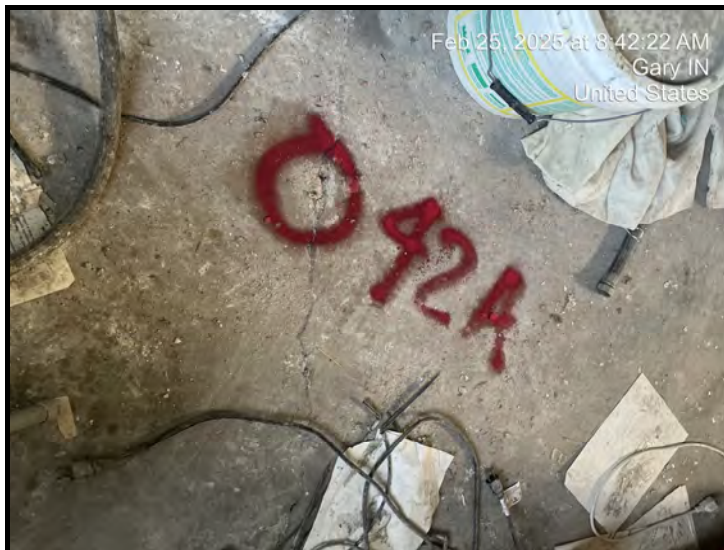

Sample
C-1-42

Concrete - Floors

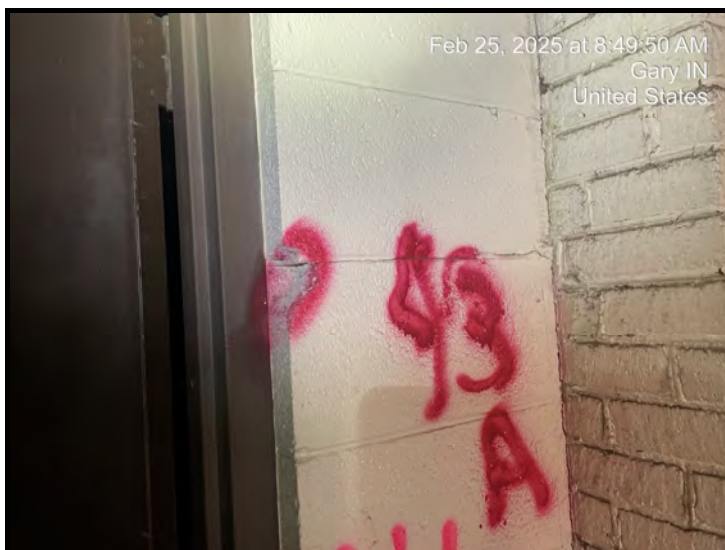

Sample
C-1-43

Block Mortar - Interior Ceiling Block with Mortar



Sample
C-1-44

Window Glaze - Wood Framed Sliding Windows- Interior Wood


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C



Sample
C-1-47

Brick Mortar - Interior Walls

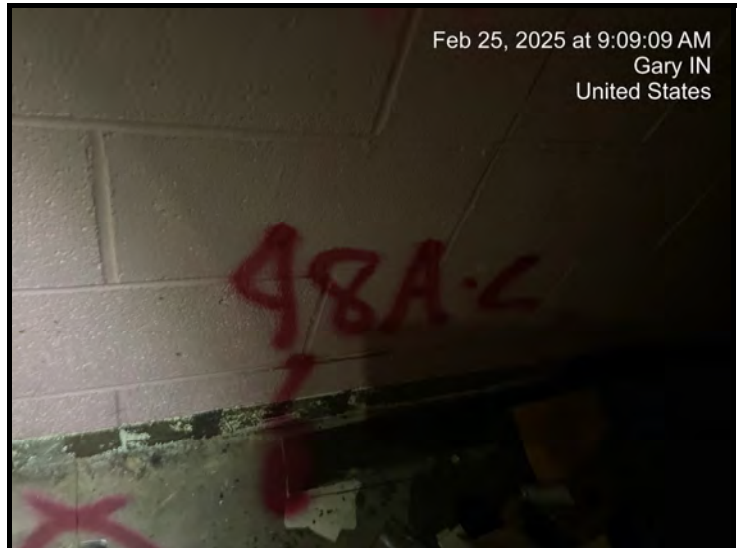

Sample
C-1-48

Cove Base - with Adhesive



Sample
C-1-49

Flooring - Linoleum with Paper Backing on
work bench



Sample
C-1-50

Ceramic Tile with Grout- Beige - Storage
Area

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C




Sample
C-1-51

Ceiling Panel - 2X4, White with
Indentations




Sample
C-1-52

Pipe Insulation - 0"-6" Fiberglass with
Cloth

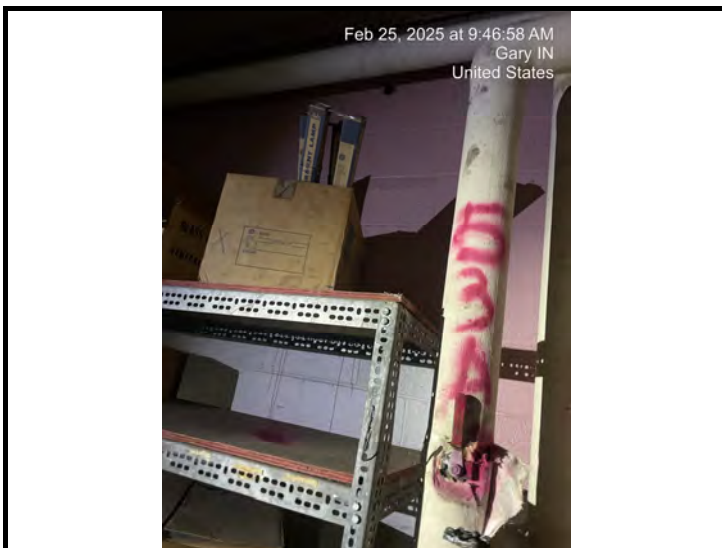

Sample
C-1-53

Pipe Fitting - 0"-6" Mudded pipe
insulation on Fiberglass with Cloth Pipe
Insulation

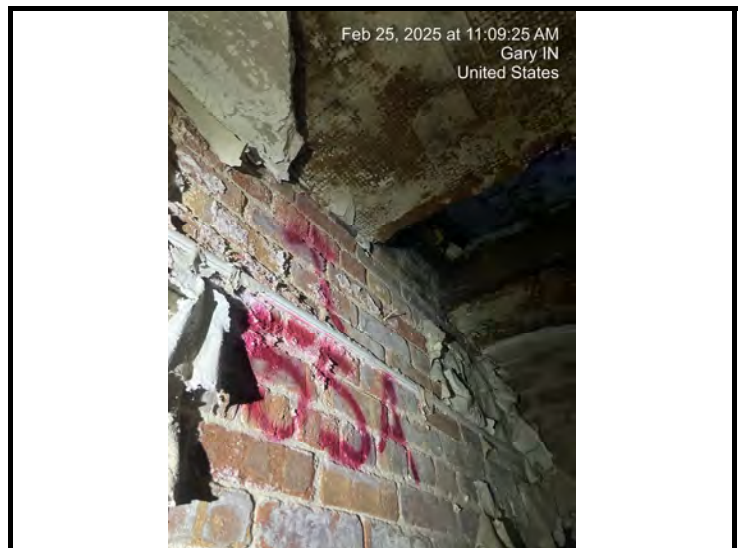


Sample
C-1-55

Plaster - Skim & Base Coat Ceilings on
Wire Mesh

Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C

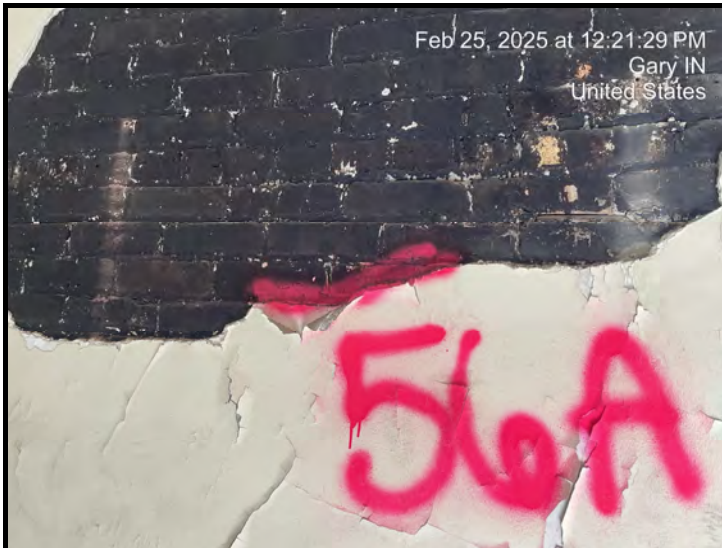

Sample
C-2-56

Plaster - Skim & Base Coat Ceilings and
Walls on Brick/Block




Sample
C-2-58

Cove Base - with Adhesive



Sample
C-2-59

Flooring - Terrazzo

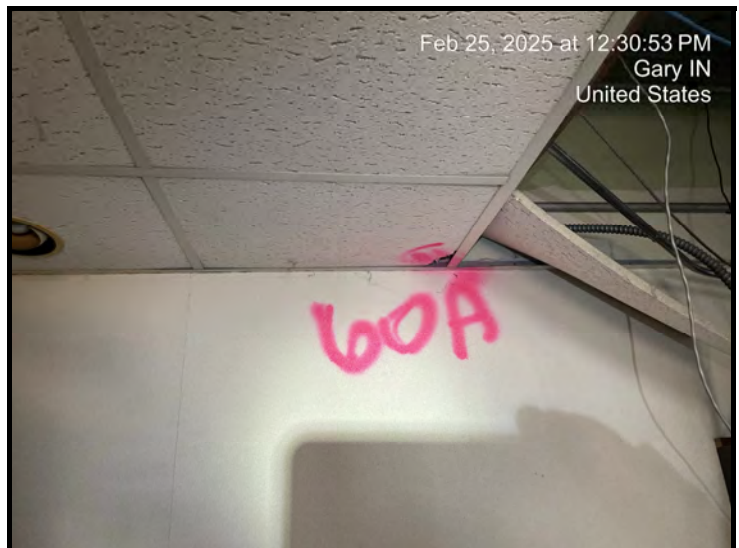

Sample
C-2-60

Ceiling Panel - 2X4, White with
Indentations


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C




Sample
C-2-61

Flooring - Linoleum with Paper Backing-
Yellow

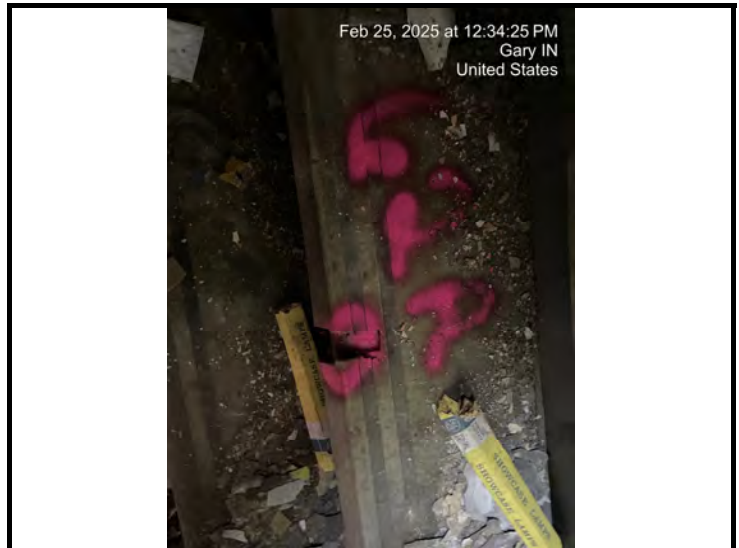


Sample
C-2-62

Flooring - Stair Treads & Adhesives

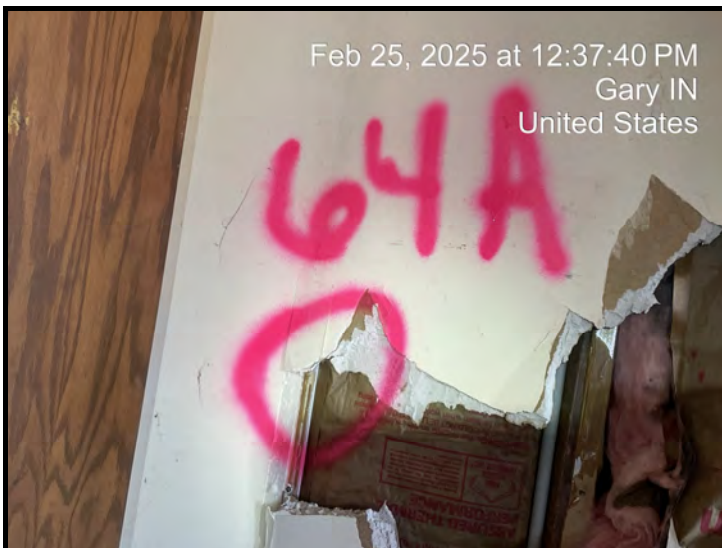

Sample
C-2-64

Wallboard - with Mud & Tape


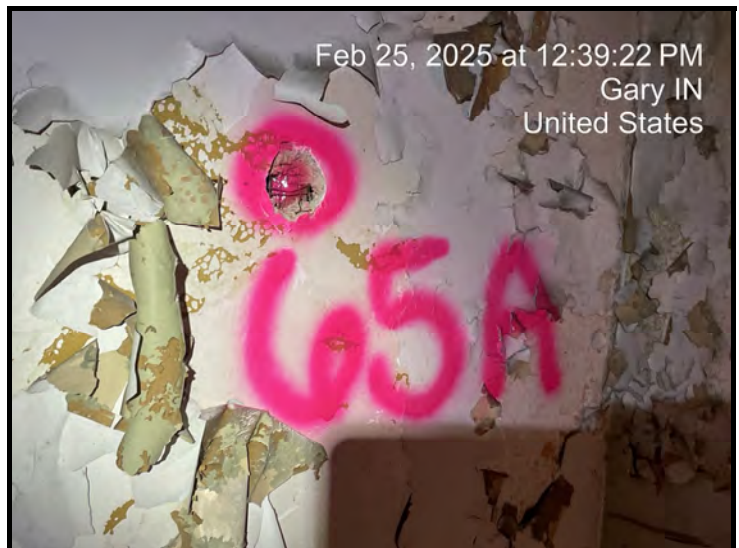


Sample
C-2-65

Plaster - Skim & Base Coat Ceilings on
Wire Mesh


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C

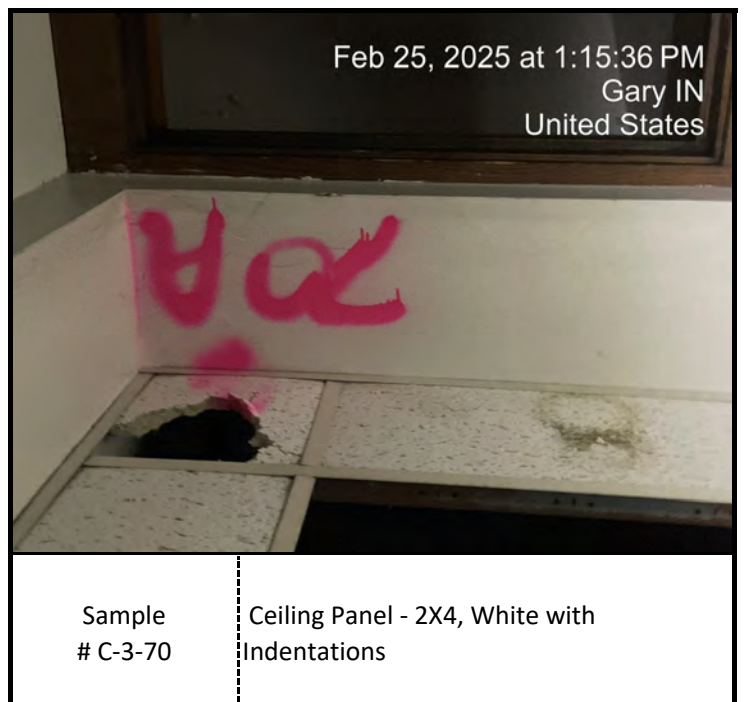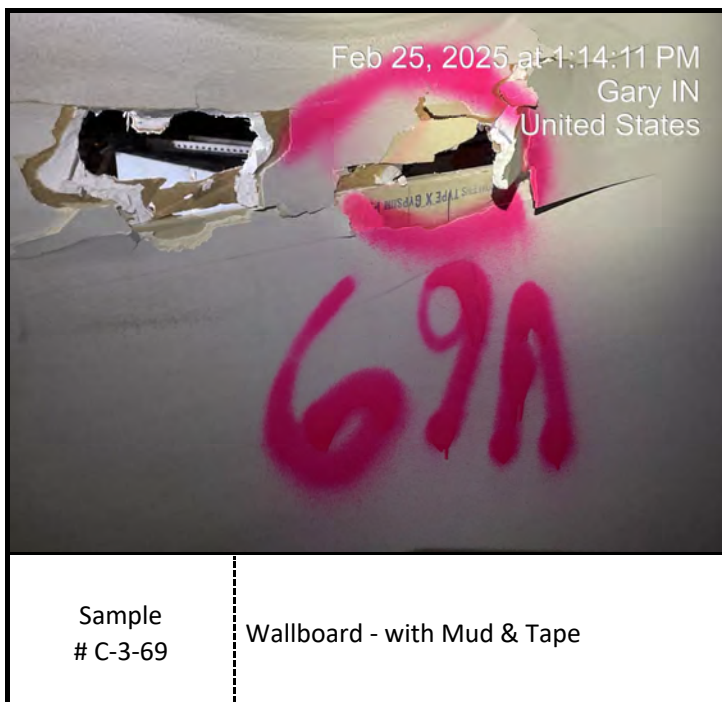


Gary Commercial Blight Elimination Program Non-Detect Samples

540 Tyler Street Gary, IN - Building C

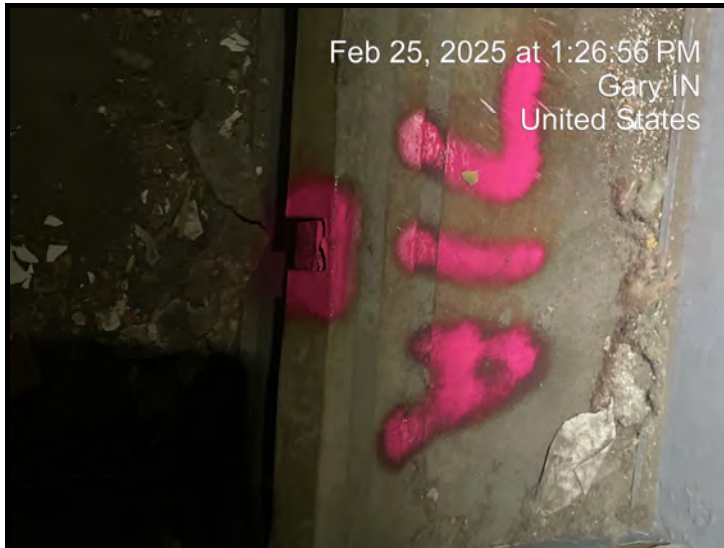

Sample
C-3-71

Flooring - Stair Treads & Adhesives

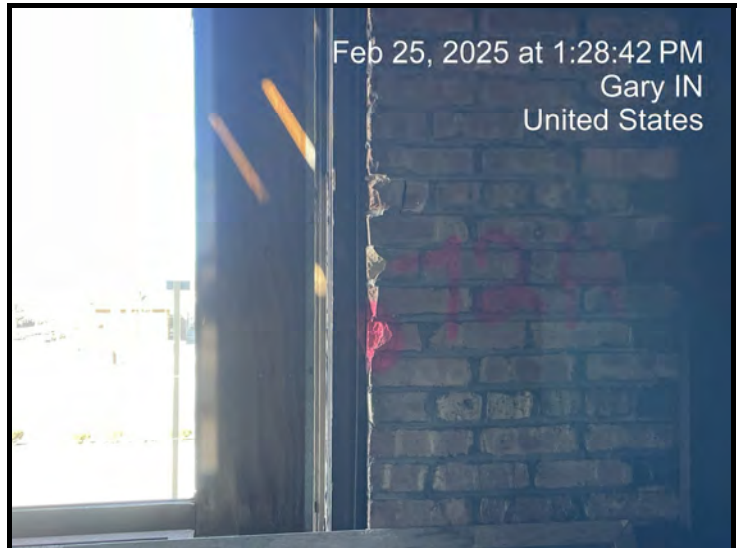


Sample
C-3-72

Brick Mortar - Interior Walls



Sample
C-3-73

Vibration Dampener - Plastic/Rubber
Coated Fabric

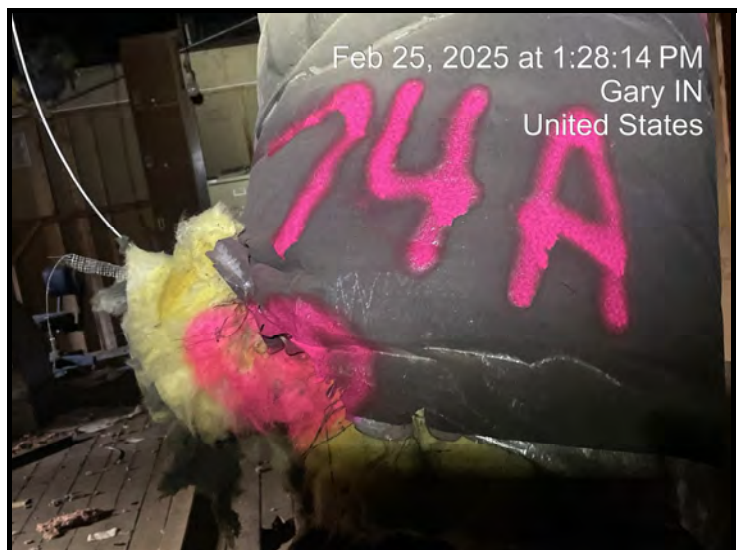

Sample
C-3-74

Duct Insulation - Fiberglass with Foil-
Yellow

**Gary Commercial Blight Elimination Program
Non-Detect Samples**

540 Tyler Street Gary, IN - Building C

	
Sample # C-3-75 Plaster - Skim & Base Coat Ceilings on Wire Mesh	